

Firmware Version: 1.09B32_WW 1.09B32_RU Published Date: Mar. 14, 2014

Copyright © 2014

Copyright Notice

This publication, including all photographs, illustrations and software, is protected under international copyright laws, with all rights reserved. Neither this manual, nor any of the material contained herein, may be reproduced without written consent of the author.

Disclaimer

D-Link

The information in this document is subject to change without notice. The manufacturer makes no representations or warranties with respect to the contents hereof and specifically disclaim any implied warranties of merchantability or fitness for any particular purpose. The manufacturer reserves the right to revise this publication and to make changes from time to time in the content hereof without obligation of the manufacturer to notify any person of such revision or changes.

Limitations of Liability

UNDER NO CIRCUMSTANCES SHALL D-LINK OR ITS SUPPLIERS BE LIABLE FOR DAMAGES OF ANY CHARACTER (E.G. DAMAGES FOR LOSS OF PROFIT, SOFTWARE RESTORATION, WORK STOPPAGE, LOSS OF SAVED DATA OR ANY OTHER COMMERCIAL DAMAGES OR LOSSES) RESULTING FROM THE APPLICATION OR IMPROPER USE OF THE D-LINK PRODUCT OR FAILURE OF THE PRODUCT, EVEN IF D-LINK IS INFORMED OF THE POSSIBILITY OF SUCH DAMAGES. FURTHERMORE, D-LINK WILL NOT BE LIABLE FOR THIRD-PARTY CLAIMS AGAINST CUSTOMER FOR LOSSES OR DAMAGES. D-LINK WILL IN NO EVENT BE LIABLE FOR ANY DAMAGES IN EXCESS OF THE AMOUNT D-LINK RECEIVED FROM THE END-USER FOR THE PRODUCT.

Content:



Notes for Configuration Auto-Backup/Restore in USB Storage	4
Upgrading Instructions:	4
Upgrading by using Web-UI	4
New Features:	5
Changes of MIB & D-View Module:	6
SSL VPN Compatibility List:	6
Problem Fixed:	. 7
Known Issues:	14
Related Documentation:	17



Revision History and System Requirement:

Firmware	Region	Date	Model	НW
Version	Region	Dute	Houer	Version
1.09B32_WW		Mar 14 2014		A1/AD
1.09B32_RU	WW/RU	Mar, 14, 2014	DSR-250, 250N	A1/A2
1.08B44_WW		0 -+ 20 2012		41/42
1.08B44_RU	WW/RU	Oct. 28, 2013	DSR-250, 250N	A1/A2
1.08B39_WW		0+ 22 2012		41/42
1.08B39_RU	WW/RU	Oct. 23, 2013	DSR-250, 250N	A1/A2
1.08B31_WW		lue 20, 2012		41/42
1.08B31_RU	WW/RU	Jun 28, 2013	DSR-250	A1/A2
1.05B53_WW	WW/RU	lue 20, 2012		A 1
1.05B53_RU		Jun 29, 2012	DSR-250, DSR-250N	A1
1.05B20_WW	WW/RU	Mar 28, 2012	DSR-250, DSR-250N	A1
1.05B20_RU		Mai 28, 2012	DSR-230, DSR-230N	AI
1.05B20_WW	WW/RU	Mar 28, 2012	DSR-250, DSR-250N	A1
1.05B20_RU	WWW/RU	Mai 28, 2012	DSR-230, DSR-230N	AI
1.05B20_WW	WW/RU	Mar 28, 2012		A1
1.05B20_RU		Mai 20, 2012	DSR-250, DSR-250N	AI
1.01B56_WW	WW	Oct. 06, 2011	DSR-250N	A1
1.01B46_WW	WW	Sep 23, 2011	DSR-250N	A1

Important Notes:

- 1. Automatic factory reset when image upgrade detects a firmware region mismatch between RU and WW images. Such as firmware upgrade from RU->WW or WW->RU image.
- 2. Russian firmware version doesn't support over 40bit encrypted algorithm according to regulatory restriction.
- 3. Microsoft Windows XP has some well-known limitation to access USB storage of DSR router, D-Link provides a Registry Script file named: WinXP.reg which can solve limitation of Windows XP environment. Without applying this script file, it cannot copy file from Windows XP to USB storage. (This issue will not happen when copy file from USB storage to Windows XP)



Notes for Configuration Auto-Backup/Restore in USB Storage

D-Link DSR router series support configuration backup or restore automatically while a USB drive is inserted. Following information instructs what condition will perform backup/restore.

- The router configuration will be automatically backed up to the USB drive as soon as the USB drive is inserted. The back name has format <Model Name>_<Serial Number>.cfg provided this USB drive doesn't have a backup configuration file from a DSR router already present.
- 2. The system LED on the router blinks 3X in amber to indicate a backup operation has started.
- 3. The configuration in the USB drive can be updated if the user manually clicks 'Save Settings' in any GUI page and provided the Model Number and the Serial Number of the router matches with the file already present in the USB drive.
- 4. In case of reboot, the router checks for the presence of configuration file (with format ModelName_SerialNumber.cfg). If found, the configuration from the USB drive is restored on the router. If a configuration file with the correct format is present in both connected USB drives, the configuration from the first USB drive will be used to restore the router.
- 5. The USB drive can have only one configuration with the above mentioned format for each model name.
- 6. If the USB drive is plugged in to the router which is in factory default state, then during reboot, no backup is taken since no custom configuration file exists in the router by that time. The custom configuration is stored on the USB drive once the user clicks Save Settings in any GUI page.

Upgrading Instructions:

Upgrading by using Web-UI

- Please use GUI upgrade feature to upgrade to this firmware version. For detailed installation and upgrade instructions, please refer to the Firmware Upgrades chapter in the Unified Services Router v1.09 User Manual.
- Please upgrade corresponding firmware based your device hardware version.



New Features:

Firmware	New Features
Version	
1.09B32	 L2TP client mode enhancements: support MPPE and demand dialing. User DB enhancements: support PPTP/L2TP tunnels external authentication though AD, LDAP and POP3.
	3. Support Selectable Outbound Interface for IGMP [HQ20121210000012]
	4. Proxy ARP: Allowing PPTP server range in range of LAN
	5. CLI enhancements: support the "space" character
	6. Web GUI enhancements: support auto parameters fill-out in the DHCP server configuration page
	 3G dongle supports: add Huawei E303, D-Link DWM-156 A7, D-Link DWM-157 B1, and D-Link DWM-158 D1.
	8. A new click button to quickly download Dbglogs.
	9. A new checkbox to enable/disable auto config backup.
	10. A new checkbox to enable/disable config file encryption.
	11. Support a Windows-based config viewer for encrypted config files.
	12. Support L2TP VPN client mode.
	13. Support 5 concurrent GRE tunnels.
	14. Lengthen IPSec Pre-shared key length to 64 characters.
	15. Simplify IGMP settings – allow all net to pass through DSR by default.
	16. Add package manager with single selectable 3G driver support
	17. Change IP address setting for inbound traffic management to configure LAN
	IP from server IP.
1.05B53	1. Support email address to be local ID in Ipsec policy.
	2. Support SHA-1 in Phase 1.
	3. Support DH group need support group 1, 2 and 5 for Phase 1.
	4. Add PFS group 1, 2 and 5 for Phase 2.
	5. Add a keyword with "." (dot) in Blocked Keywords text box.
	1. Support 3G dongle DWM-152 A1/A2/A3, DWM-156 A1/A2/A3, Huawei E1550, E173.
1.05B20	2. Pre-Share key can be configurable in wireless wizard.
	3. Change design to disable auto refresh for Traffic Monitor by default.
1.05B06	Support SSH remote management from WAN port
1.01B46	It's the first release.



Changes of MIB & D-View Module:

Firmware Version	New Features
1.05B06	Support LED and IPsec MIB.
1.01B46	It's the first release.

SSL VPN Compatibility List:

SSL-VPN SPLIT TUNNEL & SSL-VPN FULL TUNNEL		
I.E-8.0, Firefox 16.0.1, Opera 12.0.2, Google Chrome 22.0.1229.96m		
I.E-8.0, Firefox 16.0.1, Opera 12.0.2, Google Chrome 22.0.1229.96m		
I.E-9.0, I.E-10.0, Firefox 16.0.1, Opera 12.0.2, Google Chrome		
22.0.1229.96m		
I.E-9.0, I.E-10.0		
I.E-10.0		
Firefox 16.0.1, Opera 12.0.2, Google Chrome 22.0.1229.96m		
MAC Firefox 3.6.15, MAC Safari 4.1.3(45533.19.4)		
MAC Safari 5.1.7.0, MAC Firefox 16.0.1		





Problem Fixed:

Firmware	Problems Fixed
Version	
1.09B32	1. L2tp internet connection problem HQ20120810000001
	2. Device wan is unable to come up with 3G ISP with DWM-156 A5 dongle.
	3. Unable to pass Netperf traffic over IPsec tunnel.
	4. The throughput of WAN Routing mode is much lower than the WAN NAT mode.
	5. Traffic should run over the VPN client tunnel even when SPPE is in enabled state.
	6. Support NCP vpn client is able to access VLAN subnet. HQ20120827000010
	7. Support ARP from WAN HQ20120926000011.
	8. Update all pages copyright notice to 2013.
	9. Disabled firewall rule can't be deleted. HQ20130126000001
	10. SSL VPN xtunnel.cab Certificate page valid date is from 8/13/2010 to 8/13/2012. HQ20130205000011
	11. After initiating traffic from WLAN->LAN wireless client is getting disconnected and unable to reconnect.
	12. Manual time change event is not getting logged
	 Kernel panic while running traffic from WLAN/LAN hosts to internet and running traffic over IPsec tunnel when device wan is configured with L2Tp ISP. HQ20130325000004
	14. when device wan is configured in l2tp+dhcp mode, device is sending ddns membership packets to dns ip assigned by dhcp server HQ20130325000004
	15. Able to login to the portal with when configured wrong secret in the radius settings page
	16. Unable to get the IP for PPTP client in the device.
	17. Device can't detect the printer
	18. Http and FTP traffic can't be transferred over IPSEC client tunnel.
	19. Transparent mode functionality is not working.
	20. Device time will not synchronize with default NTP servers after reboot.
jreen	



HQ20130425000006
21. Not able to establish L2TP over IPsec tunnel with same user multiple time after making changes in IPsec policy.
22. Unable to find getuserDB page in RU images. HQ20130807000009
23. Unable to edit Roll-over WAN(3G) setup page.
24. Changed configuration in the configuration file is not persisting after restoring the configuration file into the device
25. User is unable to restore the encrypted configuration file into the device
26. Encrypted configuration file is not getting decrypted if we open the encrypted file from configtool.
27. Configuration is not getting saved into the USB, After enabling the 'Enable Autobackup' field.
 No option to configure VLAN port membership for Port5, Port6, Port7 and Port8 through CLI.
29. Unable to get IP address to VLAN host after reboot.
30. Device is not showing any warning when trying to add duplicate VLAN ID.
31. DMZ configuration page is not available in GUI.
32. User not able to configure DNS proxy in LAN configuration page, even after PPTP server disabled
33. Bandwidth Profile Rate Functionality is not working.
34. Kernel panic when trying to connect L2TP client over IPsec.
35. SSID can't broadcast when wireless is in open mode and radio setting is n client.
36. MAC address field is showing empty in WDS page.
37. Add Help content for DMZ pages
 DMZ related fields are not getting highlighted immediately after enabling the DMZ option.
39. Error message should be proper when user tries to check updates in manager page without internet connection.
40. Unable to enable DMZ from CLI.
41. Unable to add IPsec gw-gw policy and firewall inbound rule on rollover WAN (3G WAN).
42. Unable to establish VPN connection in phase2 with SHA-256. HQ20130204000013



43. Low InterVLAN download speed. HQ20130620000004
44. VLAN, PPTP Server, L2TP server, and SSL client ranges and DMZ in same subnet.
45. Unable to take Packet Capture on DMZ interface.
46. Port translating field doesn't update in CLI after firewall rules is changed in GUI.
47. Unable to upload .CSV file.
48. Device is displaying WLAN edit configuration page for VLAN through CLI.
49. Synchronization Select Interface options of UPNP in CLI and GUI.
50. Showing wrong firmware version in SSLVPN portal page.
51. Able to configure the DMZ configuration without enabling the DMZ.
52. User is not able to access the device CLI using SSH.
 53. Device is getting default when downgraded from 1.09b08.img to 1.08b39.img.
54. No options are available for VLAN configuration on wan page from CLI.
55. Unable to upgrade the firmware via USB.
56. Error message should be proper when we try to add DMZ reserved entry without DMZ enabled.
57. LAN host can't receive 6 to 4 prefix radvd IP from the device.
58. Device is showing '***failed to open ?directory' in CLI when log in by telnet.
59. Kernel panic while running traffic over VPN tunnel.
60. IPS signatures can't be loaded if IPS is enabled.
61. ISATAP functionality is not working.
62. PPTP client status through CLI is showing "Disconnected" even it is connected.
63. Interfaces are not displaying when user configures status route through CLI.
64. Improve PPTP performance.
65. Improve RFC 2544 UDP performance via IXIA.
66. Support DHCP option 66



٦

67. Unable to establish the IPv6 IPSec tunnel after edit the policy.	
68. GW-GW tunnel can't be established when traffic selectors "SubnetRange".	
69. Outbound traffic over IPsec tunnel is blocked when default outbound policy is configured "block always".	
70. No option for L2TP mode in CLI when IPsec policy is added.	
71. Kernel panic while executing VPN manual tunnel automation scripts.	
72. Device is showing entry for the wireless clients which are trying to authenticate in "wireless clients page".	
73. Need to regenerate selfsigned certificates.	
74. Unable to establish GRE tunnel when WAN ISP type is configured for PPTP/L2TP.	
75. DNS request timeout in LAN host by nslookup when IPS/IDS is enabled in the device.	
76. Unable to connect PPTP server using LDAP External Authentication.	
77. Unable to connect L2TP server using LDAP External Authentication.	
78. "configuration could not be saved" message when user done any configuration through CLI for the first time.	
79. Getting critical error when clicked save button in DHCP Reserved IP address page after upgrading from 1.01B46. HQ20130827000010	
80. Need username and password fields for open VPN client authentication in open VPN configure page. HQ20130724000015	
81. Custom VAP active can't be enabled or disabled for device time. HQ20130917000005	
82. SSID "DSR-250N_2" can be visible if the user configure "active time" but disabled the VAP. HQ20130902000003	
83. VLAN firewall rule is not work. HQ20130930000008	
84. Default SSIP can be visible even though WIFI disable. HQ20131108000016	
85. Need to remove the Debug log after device gets bootup in serial console. HQ20131217000002	
86. Change source IP address option for inbound traffic selector to destination IP address. HQ20140121000011	
87. LAN client page is not displaying the connected LAN clients.	



Г

٦

		88. When the GRE tunnel is established, local PC ping to peer DSR's LAN IP
		address can't get response.
		89. Usage of extended authentication when redundant gateway checkbox is enabled.
	1.08B44	1. Security Vulnerabilities Addressed: Devices respond clients some
		unnecessary information, and hence give hackers a chance to get a
		non-persistent root shell.
		Reference: (CVE-2013-5945, CVE-2013-5946)
		Solution: Remove all unnecessary root user accounts
		2. After rebooting devices, synchronization with NTP didn't works.
		(DRU20130424000003)
		3. Firewall rule with scheduling is not work. (DUSA20130125000001)
	1.08B39	1. Including 1.08B31 all fixes for DSR-250N in this version
		2. The MPPE function does not work in L2TP client mode
		3. Restore configuration file to different HW version
		4. WAN responses ARP packet
		5. Add a message to inform user, who need to change 443 port number for
		sslvpn or remote management once two features are enabled.
		6. Can't work with any AP connected with network cable
		7. Device time not synchronizing with default NTP servers after reboot.
		8. Firewall rule disable is not work unless reboot device.
		9. WIFI stability issue under heavy BT traffic
	1.08B31	1. The OpenVPN Local Network page disappear when I used IE8 or IE9 to
		manage the DSR.
		2. USB sharing could not download/upload large file
		3. DWM-156 A3, A6 compatility issue
		4. Security Vulnerabilities Addressed: Persistent root access.
		Reference:
		http://packetstormsecurity.com/files/118355/D-Link-DSR-250N-Backdoor
		<u>.html</u>
		Solution: Removed CLI commands that could allow someone to overwrite
		the super user password and gain root access to the device. Root user
		account will be completely removed in the next firmware version.
		5. Prevent to upload config file into different model
		6. Unable to change the Wireless output power
		7. Device stuck under BT download
dlinkigr	een	



		8. X.509 certificate expired issue
		 Security Vulnerabilities Addressed: uPnP vulnerabilities identified in the audit of libupnp code base.
		Reference: CVE-2012-5958, CVE-2012-5959, CVE-2012-5961,
		CVE-2012-5962, CVE-2012-5963, CVE-2012-5964, CVE-2012-5965
		Solution: Patched Intel SDK libupnp v1.3.1 to add the following; 1) use
		'snprintf' and 'strncpy' instead of 'sprintf' and 'strcpy', 2) While doing a
		'strncpy', check if we are copying more bytes than the destination string
		size.
		10. DNS query issue for L2TP WAN type
	1.05B53	1. DSR-250 and 250N don't show Logs for tunnel disconnect and Logout for
		SSL VPN & port forwarding.
		2. "LAN clients" page is not displaying the connected information.
		3. CLI wan1 status does not show wan1 physical interface information when
		device is in RU firmware dual PPPoE mode.
		4. When server IP is configured with FQDN, Wan L2TP over DHCP connection
		does not reconnect after device reboot.
		5. Default VLAN is associated with all the wireless SSID after reboot.
		6. "Block ICMP" is not work for a SSL VPN policy with permit permissions.
		7. Traffic is not going from PPTP/L2TP client to device's LAN after changing
		WAN ISP until disable and enable PPTP server again.
		8. When the user login SSL portal with wrong credentials domain name in IE
		browser address bar, the browser will not refresh back to 'SSL portal login' page.
		9. Dyndns name provided in the SSL portal page will be changed into the
		device WAN IP, if the user try to login SSL portal page with wrong credentials in Firefox browsers.
		10. Device's MAC address field in WDS page is blank in RU image.
		11. Device is taking 40-50 seconds to apply the configuration in VLAN page of
		RU image.
		12. Wireless client status page is showing wrong Authentication and
		Encryption types.
		13. Device GUI is getting stuck after running bulk traffic over PPTP/L2TP
		tunnel.
		14. "Connect" button is not working for IPv6 gw-gw policy in Active VPNs page
		when IPv6 WAN is radvd IP.
1111 A.		
dlinkigreer	ſ	



15. No information on WLAN Domain when country code is set to Japa		
	16. Firewall rule with schedule is working correctly only for GMT time zone.	
	17. Device displaying critical error message when trying to upload certificates	
	to activate OpenVPN server/client.	
	18. Unable to access GUI after factory reset and power OFF/ON the device.	
	19. Wireless clients are not getting updated in Wireless Clients status page.	
	20. UPnP process is not running in Dual Stack IPv4/IPV6 mode.	
	1. IPv6 to IPv4 tunneling is not work.	
	2. Internet web surfing is very slow for WLAN client if SPPE enabled.	
	3. Remove CLI command which is not supported in DSR-250/250N.	
	4. PPTP client is getting disconnected while uploading and downloading files	
	using windows sharing.	
1.05B20	5. Device shell is getting stuck after running bulk traffic over PPTP/L2TP	
	tunnel.	
	6. Bandwidth Usage and Used applications are not displayed in dashboard.	
	7. Default VLAN will be associated with all the wireless AP after reboot.	
	8. Fixing L2TP doesn't reconnects to L2TP server after reboot.	
	9. Fixing wireless clients is not displayed on status page.	
	1. Improving link up time of WAN interface less than 1 minute after device	
	power on.	
1.05B06	2. Fixing the printer shared port detection issue.	
	3. Fixing PPTP pass through is not working.	
	4. Fixing SSL tunnel is disconnected when user tries to download 200 MB file.	
	1. Improving link up time of WAN interface to $1 \sim 1.5$ minutes after device	
1.01B56	power on	
	2. Fixing PPPoE isn't working in custom MAC address	





Known Issues:

Firmware Version	Known Issues
1.09B32	1. PPTP passthorugh is the highest priority than PPTP firewall service.
	2. IPsec passthorugh is the highest priority than IKE out-boundfirewall service.
	3. User is unable to add DHCP reserved for wired/wireless VLAN.
	4. With 'Dlink DWA-160 Xtream N Dual Band USB adapter' the WPS status displays 'Failed' in the device WPS page, even though client is connected successfully.
	5. Bandwidth rules over IPsec VPN tunnel are not being followed. HQ20120112000014
	6. UPnp process is not running when wan link is down.
	7. User is unable to print the file from wan host with inbound firewall rule.
	8. Streaming/movie play is not perfect, when we try listen from LAN and VLAN hosts simultaneously.
	9. Wireless VLAN in general mode is not working for tagged interfaces
	10. Device should allow the user to configure UPNP on multiple VLAN subnets.
	11. SIP ALG disable state User able to establish multiple calls from WAN->LAN and LAN->WAN.
	12. Device nating the packet with WAN IP in Transparent mode.
	13. Unable to drop tunnel by clicking 'Drop' button in active VPNs page after IPSEC VPN roll-over.
	14. No option for SHA2-224 algorithm as 'Integrity Algorithm' while configuring IPSec phase-2 policy through CLI.
	15. WPS Session status is not displaying the current status
	16. Maximum static routes are not appearing in IPv4 Routing table and shell.
	17. Unable to see logs when ips/ids are enabled.
	18. Active VPN's page is displaying "IPsec SA established " even after clicking drop button when the device in behind NAT.
	19. Client is not disconnecting after user time out exceeds in PPTP/L2TP server.





	20. Device is not able to establish OpenVpn tunnel using IPalias.
	21. VLAN host can't get IPV6 address.
	22. Client tunnel is not establishing with remote as single/range/subnet.
	 User is unable to establish IPV6 ipsec gwgw/ manual tunnel using both local & remote traffic selectors as any.
	24. Upload speed for http traffic is fluctuating in the 500-1200 KBps over SSLVPN tunnel. HQ20120628000015
	25. When traffic is sent from WLAN to LAN or WLAN to WLAN, then data trasnfer rate is varying drastically. HQ20120820000010
	26. CLI can't support for L2TP client configuration.
	 Device is accepting the SMTP mails when Default Outbound Policy configured as "Block Always" without configuring the SMTP Rules (Approved Mail, Blocked Mail, Subject List).
	28. VPN Tunnel is not re-establishing if we initiate traffic from client.
	29. No GRE Tunnels status page in GUI.
	30. Traffic selector rule for inbound bandwidth profile with match type as MAC address is not working.
	31. Unable to add bandwidth profiles from CLI.
	32. Unable to establish L2TP client tunnel when ISP is connected as L2TP.
	 Unable to establish L2TP tunnel with android phone when secret key is configured.
	34. Idle time-out functionality is not working for PPTP users.
	35. Multicast packets is sent to other LAN hosts when multicast traffic running from one LAN host
	36. Specific Service support for inbound traffic management is not work.
1.08B39	1. PowerMode is not completely functional.
	2. Wan is not getting IP from IPv6 DHCP server in stateful mode.
	3. Netperf is unable to pass traffic over IPsec tunnel.
	4. PPPoE performance worst if user changes the WAN MAC address.
1.08B31	1. PowerMode is not completely functional.
	2. Wan is not getting IP from IPv6 DHCP server in stateful mode.
	3. Netperf is unable to pass traffic over IPsec tunnel.
een	
	1.08B31





	4. PPPoE performance worst if user changes the WAN MAC address.
	5. Device got defaulted after upgrade from 1.05B73_WW to 1.08B31_WW
	6. Not able to establish L2TP over IPsec tunnel with same user multiple time after change IPsec policy.
	7. The GRE function does not work
	8. The MPPE function does not work in L2TP client mode.
1.05B53	1. Bandwidth Limit not functioning when port name is used in Traffic selector
	2. PowerMode is not completely functional.
	3. Wan is not getting IP from IPv6 DHCP server in stateful mode.
	4. Netperf is unable to pass traffic over IPsec tunnel.
	5. Transparent Mode is not supported.
	6. Observed ping loss from WLAN clients to internet.
1.05B20	1. Bandwidth Limit not functioning when port name is used in Traffic selector
	2. PowerMode is not completely functional.
	3. Wan is not getting IP from IPv6 DHCP server in stateful mode.
	4. Netperf is unable to pass traffic over IPsec tunnel.
	5. Transparent Mode is not supported.
	Traffic is not going to device's LAN from PPTP/L2TP client after changing WAN ISP, unless PPTP server disables and then enables again.
	7. Observed ping loss from WLAN clients to internet.
	8. USB file sharing transmission will be disconnected if file size is over 600MB.
1.05B06	1. Bandwidth Limit not functioning when port name is used in Traffic selector
	2. PowerMode is not completely functional.
	3. Wan is not getting IP from IPv6 DHCP server in stateful mode.
	4. Netperf is unable to pass traffic over IPsec tunnel.
	5. Transparent Mode is not supported.
1.01B56	1. WAN interface need to take $1 \sim 1.5$ minutes for link up after device power on.
	2. Bandwidth Limit not functioning when port name is used in Traffic selector



Г

T

	3. SSL tunnel is being disconnected when user tries to download 200 MB file		
	4. Admin user is not able to SSH to device		
	5. Device is not detecting the printer shared port		
	6. Wan is not getting IP from IPv6 DHCP server in stateful mode.		
	7. Host MAC clone is not work.		
	8. Transparent Mode is not supported.		
1.01B46	1. WAN interface need to take $2 \sim 3$ minutes for link up after device power on.		
	2. Bandwidth Limit not functioning when port name is used in Traffic selector		
	3. SSL tunnel is being disconnected when user tries to download 200 MB file		
	4. Admin user not able to SSH to device		
	5. Device is not detecting the printer shared port		
	6. Wan is not getting IP from IPv6 DHCP server in stateful mode.		
	7. Host MAC clone is not work.		
	8. PPPoE isn't working in custom MAC address		
	9. Transparent Mode is not supported.		

Related Documentation:

- Unified Services Router User Manual v1.09
- Unified Services Router CLI Reference Guide v1.05

