


* Please understand key indicators & functions at the first operation.

FRONT PANEL & KEY FUNCTIONS

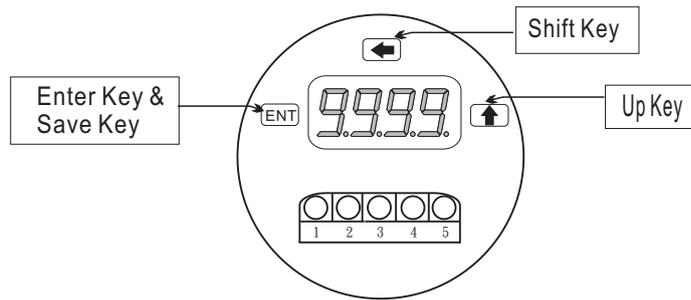

Key Name	Symbol	Descriptions
Enter Key & Save Key	ENT	1. In the measuring status, press this key can enter to parameter pages. 2. In the parameter setting, press this key can save the value & go to next parameter.
Shift Key	←	1. In the parameter setting, press this key can move the cursor left.
Up Key	↑	1. In the parameter group, press this key can enter to the setting. 2. In the parameter setting, press this key can increase the digits.

GENERAL MODE OPERATING PROCEDURES

Block Charts	Display	Descriptions	Default
System Setting Group Procedures			
Power On	10000	Measuring Status Present value for measurement.	
Press: ENT	PCod	Pass Code (P.Cod) Press ← ↑ to enter pass code.	00000
Press: ENT	P.Code Correct	Pass code is correct that will enter to parameter groups. Pass code is wrong that will back to measuring status.	
NO			
YES	TYPE	Sensor Type Setting (tYPE) Press ↑ to select sensor type (PT100 / B / E / J / K / R / S / T)	Customers specify
Press: ENT	dP	Decimal Point Setting (dP) Press ↑ to select decimal point (0, 1).	Customers specify
Press: ENT	unit	Temperature Unit Setting (unit) Press ↑ to select the units (°C or °F).	Customers specify
Press: ENT	AnLo	A/O Low Scale Setting (AnLo) Press ← ↑ to adjust A/O low scale to correspond to the display value (programmable). EX : A/O is 0~10V, the display is 10.0 to output 0V, this value must be set for 10.0.	00000
Press: ENT	AnHi	A/O Hi Scale Setting (AnHi) Press ← ↑ to adjust A/O hi scale to correspond to the display value (programmable). EX : A/O is 0~10V, the display is 90.0 to output 1 0V, this value must be set for 90.0.	99999
Press: ENT	APeRo	A/O Zero Adjustment (AZeRo) Press ← to select adjusting speed rate, press ↑ to modify the A/O zero. PS: To use this function to adjust the real A/O zero.	00000
Press: ENT	ASpAn	A/O Span Adjustment (ASpAn) Press ← to select adjusting speed rate, press ↑ to modify the A/O span. PS: To use this function to adjust the real A/O span.	00000
Press: ENT	dPEro	Display Zero Adjustment (dZEro) Press ← to select adjusting speed rate, press ↑ to modify the zero value. PS: To use this function to adjust the real zero value.	00000
Press: ENT	dSPAn	Display Span Adjustment (dSPAn) Press ← to select adjusting speed rate, press ↑ to modify the span value. PS: To use this function to adjust the real span value.	00000
Press: ENT	CodE	Pass Code Setting (CodE) Press ← ↑ to modify pass code (0~9999). PS: Please don't forget the new pass code after modification.	00000