# **User's Manual**

For



Attention: Please read this manual carefully before using the driver!







# Page | 2 Product Number Code For Micro step drive



- 1:DC power input :12V~36VDC
- 2.Output current:0.25A-2A
- 3. Microstepping: 1, 2, 4, 8, 16, 32, 64, 128
- 4. Protect From: Overvoltage, under voltage, over current , phase short circuit
- 5.Dimension: 96mmx60mmx24.5mm
- 6.Weight:180g.
- 7.Working environment: Temperature -15~80°C

# **Table of Contents**

	1. Introduction, Features and Applications4
	Introduction4
	Features
Page   3	Applications4
	2. Specifications
	Electrical Specifications
	Model no:-BH-MSD-2A4
	Drive prevention
	Operating Environment4
	Elimination of Heat5
	3. Pin Assignment and Description
	Connector P1 Configurations5
	Connector P2 Configurations
	External Limiting Resistance
	Full current And Half current5
	Wiring Notes
	Switch Choices
	4. Connecting the Motor
	Connections to 4-lead Motors
	Connections to 6-lead Motors
	Half Coil Configurations7
	Full Coil Configurations7
	Connections to 8-lead Motors7
	Series Connections7
	Parallel Connections7
	5. Power Supply Selection
	Regulated or Unregulated Power Supply8
	Multiple Drivers
	6. Troubleshooting
	7. Dimensions 10
	8. Circuit connections
	9. Frequently Asked Questions 11
	10. Contact Us

### 1. Introduction, Features and Applications

#### Introduction

Micro stepping driver is particularly suitable for the applications desired with extremely low noise and low temperature rise technology which significantly improve the performance of the stepper

Page | 4 motor that leads to low temperature rise, low vibration. With the adjustment technology (step/rev and current) according to different motors, the driven motors automatically generate optimal parameters for different motors, and achieve the best performance at higher speed. It is suitable for driving 2-phase and 4-phase hybrid stepping motors.

#### Features

- High performance, cost-effective
- Suitable for 2-phase and 4-phase motors
- Support PUL/DIR and CW/CCW modes
- Short-voltage, over-voltage, over-current and short-circuit protection
- Low temperature rise, smooth motion

### Applications

Suitable for a wide range of stepping motors, for NEMA size 17. It can be used in various kinds of machines, such as X-Y tables. And a variety of automation equipments and instruments. It always performs well when applied for equipment which requires for low-vibration, low-noise, high-precision and high-velocity.

#### 2. Specifications

### **Electrical Specifications**

WIOUEI NO:-DH-WISD-ZA								
Parameter	Min	Typical	Max	Unit				
Input								
Voltage(DC)	12	-	36	VDC				
Input								
Voltage(AC)	-	-	-	VAC				
Output current	0.25	-	2	А				
			•					

# Model No:-BH-MSD-2A

DRIVE PREVENTION :-

NOTE:-THE ABOVE VOLTAGE MAY DIFFER ACCORDING TO THE POWER SUPPLY IT IS RECOMMENDED THEORITICALLY TO USE ABOVE VOLTAGE AS IT WILL PREVENT DRIVE FROM DAMAGE.

#### **Operating Environment**

Cooling	Natural cooling or Forced cooling
Operating Environment	Environment-Avoid dust, oil fog, corrosive gases Temperature- $-15^{\circ}$ — $80^{\circ}$ Humidity-Not Condensation, No Water Droplets Operating Temperature- $-10^{\circ}$ – $45^{\circ}$
Storage Temperature	$-20^{\circ}\text{C} - 65^{\circ}\text{C}$

### **Elimination of Heat**

- Driver's reliable working temperature should be <70°C, and motor working temperature should be <80°C;</p>
- It is recommended to use automatic idle-current mode, namely current automatically reduce to 60% when motor stops, so as to reduce driver heating and motor heating;

Page | 5

5 > It is recommended to mount the driver vertically to maximize heat sink area. Use forced cooling method to cool the system if necessary.

### 3. Pin Assignment and Description

The driver has two connectors namely P1 & P2, Connector P1 for control signals connection, Connector P2 for power and motor connections. The following tables are brief descriptions of the two connectors.

#### **Connector P1 Configurations**

Pin Function	Details	
PUL	PULSE SIGNAL NEGATIVE	
DIR	DIRECTION SIGNAL NEGATIVE	
EN	ENABLE SIGNAL NEGATIVE	
VCC	SIGNAL VOLTAGE	
Connector P2 Configurations		
Pin Function	Details	
VDC+	DC POWER SUPPLY	
GND	GROUND	
A+,A-	MOTOR PHASE A	
B+,B-	MOTOR PHASE B	

**EXTERNAL CURRENT LIMITING RESISTANCE:** Signal current in both the"+" "-"ports, can't be too big and not too weak. It is necessary to connect current-limiting resistor in external, refer to following table

VOLTAGE	LIMITING RESISTANCE(R)
5 V	R=0
12 V	R=1KΩ
24 V	R=2.2 KΩ

#### NOTE: FULL CURRENT AND HALF CURRENT CHOICE: (PORT SW 4)

# <u>FULL CURRENT:-</u>IF THE DRIVER IS IN FULL CURRENT MODE THIS WILL LEAD TO MOTOR HEAT AND IT WILL ALSO DAMAGE THE DRIVER.

HALF CURRENT:-THE DRIVER SHOULD ALWAYS BE IN HALF CURRENT MODE AS THIS WILL REDUCE THE HEAT OF MOTOR AND DRIVER.

# Wiring Notes

- To prevent noise incurred in PUL/DIR signal, pulse/direction signal wires and motor wires should not be tied up together. It is better to separate them by at least 10 cm, otherwise the disturbing signals generated by motor will easily disturb pulse direction signals, causing motor position error, system instability and other failures.
- If a power supply serves several drivers, separately connecting the drivers is recommended instead of daisy-chaining.
- It is prohibited to pull and plug connector P2 while the driver is powered ON, because there is high current flowing through motor coils (even when motor is at standstill). Pulling or plugging connector P2 with power on will cause extremely high back-EMF voltage surge, which may damage the driver.

#### Switch Choice:

**1.Microstepping choice:** 

<b>SW 5</b>	ON	OFF	ON	OFF	ON	OFF	ON	OFF
<b>SW 6</b>	ON	ON	OFF	OFF	ON	ON	OFF	OFF
<b>SW 7</b>	ON	ON	ON	ON	OFF	OFF	OFF	OFF
Micro	1	2	4	8	16	32	64	128

2.Current choice:

SW 1	OFF	ON	OFF	ON	OFF	ON	OFF	ON
SW 2	OFF	OFF	ON	ON	OFF	OFF	ON	ON
SW 3	OFF	OFF	OFF	OFF	ON	ON	ON	ON
Current	0.25	0.5	0.75	1	1.25	1.5	1.75	2
(A)								

4. Connecting the Motor

# **Connections to 4-lead Motors**

4 lead motors are the least flexible but easiest to wire. Speed and torque will depend on winding inductance.



# **Connections to 6-lead Motors**

Like 8 lead stepping motors, 6 lead motors have two configurations available for high speed or high torque operation. The higher speed configuration, or half coil, is so described because it uses one half of the motor's inductor windings. The higher torque configuration, or full coil, uses the full windings of the phases.

BHOLANATH PRECISION ENGINEERING PVT. LTD.

Page | 6

# Half Coil Configurations

As previously stated, the half coil configuration uses 50% of the motor phase windings. This gives lower inductance, hence, lower torque output. Like the parallel connection of 8 lead motor, the torque output will be more stable at higher speeds. This configuration is also referred to as half chopper.

Page | 7



FOR HALF COIL CONNECTION CONNECT (A+)-A Com & (B+)-B Com/ A Com-(A-) & B Com-(B-)

6-lead motor half coil (higher speed) connections

# **Full Coil Configurations**

Lower speed is desired. This configuration is also referred to as full chopper. In full coil mode, the motors should be run at only 70% of their rated current to prevent overheating.



6-lead motor full coil (higher torque) connections

### **NOTE:**THE ABOVE CONFIGURATIONS IS FOR CONNECTING IN A BIPOLAR MICROSTEP DRIVE AS PER APPLICATION/NON-AVAILABILITY OF A UNIPOLAR MICROSTEP DRIVE.

# **Connections to 8-lead Motors**

8 lead motors offer a high degree of flexibility to the system designer in that they may be connected in series or parallel, thus satisfying a wide range of applications.

# **Series Connections**

A series motor configuration would typically be used in applications where a higher torque at lower speeds is required. Because this configuration has the most inductance, the performance will start to degrade at higher speeds. In series mode, the motors should also be run at only 70% of their rated current to prevent overheating.



8-lead motor series connections

# **Parallel Connections**

An 8 lead motor in a parallel configuration offers a more stable, but lower torque at lower speeds. But because of the lower inductance, there will be higher torque at higher speeds.



8-lead motor parallel connections

### 5. Power Supply Selection

The Microstep Driver can match small size stepping motors (for Nema size 17). To achieve good driving performances, it is important to select supply voltage and output current properly. Supply voltage determines the high speed performance of the motor, while output current determines the output torque of the driven motor (particularly at lower speed). Higher supply voltage will allow higher motor speed to be achieved, at the price of more noise and heating. If the motion speed requirement is low, it's better to use lower supply voltage to decrease noise, heating and improve reliability.

# **Regulated or Unregulated Power Supply**

Both regulated and unregulated power supplies can be used to supply the driver. However, unregulated power supplies are preferred due to their ability to withstand current surge. If regulated power supplies (such as most switching supplies.) are indeed used, it is important to have large current output rating to avoid problems like current clamp. On the other hand, if unregulated supply is used, one may use a power supply of lower current rating than that of motor (typically 50%  $\sim$ 70% of motor current). The reason is that the driver draws current from the power supply capacitor of the unregulated supply only during the ON duration, but not during the OFF duration. Therefore, the average current withdrawn from power supply is considerably less than motor current

#### **Multiple Drivers**

It is recommended to have multiple drivers to share one power supply to reduce cost, if the supply has enough capacity. To avoid cross interference, **DO NOT** daisy-chain the power supply input pins of the drivers. (Instead, please connect them to power supply separately).

#### 6. Troubleshooting

#### 1. The status on light's indication

POWER: normal work light.

#### NOTE:

TO CHECK IF DRIVE IS OK/NOT OK, CONNECT ONLY SUPPLY (DC) VOLTAGE AND GROUND TO THE MICROSTEP DRIVE AND CHECK THE LED INDICATOR IF IT GLOWS THEN DRIVE IS OK IF NOT THEN DRIVE IS NOT OK.

# 2. Troubles

	Problems	Possible cause	Solutions	
		No power supply	Check the power supply	
Page   9	Motor is not	No control signal	Check the control signal	
	rotating	The driver is disabled	Don't connected the enable signal or enable the driver	
		Supply voltage is too high or too low	Check the supply voltage	
	ALM lights	Motor line short-circuit	Check motor lines eliminate the short-circuit	
		Motor line wrong connect	Check the motor wiring	
		Motor or drive failure	Replace the motor or drive	
	Motor rotates in the wrong	Motor phases connected in reverse	Reverse the phases line	
	the wrong	Wrong I/p direction signal	Change direction setting	
	direction	Motor line break	Change the phases are connected	
		The Micro steps set incorrectly.	Set the correct segments	
	Inaccurate	The motor load is too heavy.	Increasing the current	
	Position	Control signal is interfered	Eliminate interference	
		Power supply voltage too low	Increasing the supply voltage	
		Accelerating time is too short.	Extend the acceleration time	
	Motor Stalled	Current setting is too small	Increasing the current	
		Motor torque is too small	Replace the motor	

BHOLANATH PRECISION ENGINEERING PVT. LTD.

	Problems	Possible cause	Solutions
		Wrong connection for power	Check wiring of power
Page   10	LED off turn	Low-voltages for power	Enlarge voltage of power
	Motor doesn't run,	Wrong connection of stepper motor	Correct its wiring
	without holding torque	RESET signal is effective	when offline Make RESET Ineffective
	Motor doesn't run, but maintains holding torque	Without input pulse signal	Adjust PMW & signal level
		Too small relative to current setting	Correct rated current setting
	Motor's holding torque is	Acceleration is too fast	Reduce the acceleration
	too small	Motor stalls	Rule out mechanical failure
		Driver does not match with The motor	Change a suitable driver





# 8. Circuit connections



Page | 11

# 9. Frequently Asked Questions

In the event that your driver doesn't operate properly, the first step is to identify whether the problem is electrical or mechanical in nature. The next step is to isolate the system component that is causing the problem. As part of this process you may have to disconnect the individual components that make up your system and verify that they operate independently. It is important to document each step in the troubleshooting process. You may need this documentation to refer back to at a later date, and these details will greatly assist our Technical Support staff in determining the problem should you need assistance.

Many of the problems that affect motion control systems can be traced to electrical noise, controller software errors, or mistake in wiring.

The content in this manual has been carefully prepared and is believed to be accurate, but no responsibility is assumed for inaccuracies

We manufacture 1.8° HYBRID STEPPER MOTORS of size NEMA17, NEMA23, NEMA24, and NEMA34 in square frame and Nema 23 in Round frame and available in our product range are Linear Actuator Page | 12 Stepper Motors, Planetary Geared Stepper Motors, Stepper motors with Brakes and Customized Stepper Motors.



# Office Address

# Contact Us

# Bholanath Precision Engineering Pvt.Ltd.

11,Kembros Industrial Estate,Near Asian Paint Company, Sonapur Lane,Bhandup (West),Mumbai - 400078,India.

# Phone No : -

+91 - 9920903825 / 9930514603 / 9821671733 / 9323166582 91 - 22 - 25664338 / 25662856 / 67993260