

LOTOS MIG175 with Spool Gun Assembly and Operating Instructions

For parts, please visit www.uwelding.com or call 4087392329 to order

Carefully read this operation manual prior to using, installing and maintaining your welder to prevent damage such as fire and electric shock from occurring. Please keep this manual for your future reference!

SPECIFICATIONS

Rated Electrical Input 210-240 VAC; 50-60Hz; 22AMP
Max Voltage at No Load 20 V DC
Rated Duty Cycle..... 130A@30% duty cycle
Wire Feed Rate 4.9 Ft/min – 39.3 Ft/min
Wire Sizes 0.025”(0.6mm) – 0.030”(0.8mm)
mig wire 0.030”(0.8mm) – 0.035” Flux core wire Welding Wire Spool 4”
and 8” spool Weight 62.0Lbs (24.5kg) Overall
Dimensions..... 24.4 (620mm) x 12.6” (320mm)x 16.9 (430mm)

SAFETY INFORMATION

▲WARNING

ARC WELDING CAN BE DANGEROUS.

THIS WELDING MACHINE MUST BE CONNECTED TO POWER SOURCE IN ACCORDANCE WITH APPLIANCE ELECTRICAL CODES.

The plug is a NEMA 6-50P plug rated at 220VAC 50amp

Wire selection:

Use E70S for mild steel

Use E316 for stainless steel

Use E4043 for aluminum

DISCONNECT FROM POWER SOURCE BEFORE ASSEMBLING, DISASSEMBLY OR MAINTENANCE OF THE TORCH, CONTACT TIP OR CHANGING WIRE SPOOLS.

▲ NOTICE

FOR SAFETY TURN OFF AND UNPLUG MACHINE WHEN INSTALLING NEW WIRE SPOOL, ADJUSTING WIRE TENSION ROLLER OR REPLACING CONTACT TIP.

▲ WARNING

THE GAS NOZZLE MUST ALWAYS BE INSTALLED WHEN WELDING-DO NOT WELD WITHOUT THE GAS NOZZLE IN PLACE. THE CONTACT TIP IS ELECTRICALLY “HOT” AND IF IT CONTACTS THE GROUNDED WORK PIECE IT WILL CAUSE DAMAGE.

ALL INSTALLATION, MAINTENANCE, REPAIR OPERATION OF THIS EQUIPMENT SHOULD BE PRE-FORMED BY QUALIFIED INDIVIDUALS IN ACCORDANCE WITH NATIONAL, STATE AND LOCAL CODES.

1

▲ DANGER

ELECTRIC SHOCK CAN KILL! Improper use of an electric welder can cause electric shock, injury and death! Read all precautions described in this manual to reduce the possibility of electric shock.

The MIG175 power switch is to be in the OFF (“0”) position when installing the work cable and gun and while plugging in the power cord.

Always wear dry, protective clothing and leather welding gloves and insulated footwear. Always operate the welder in a clean, dry, well ventilated area. Do not operate the welder in humid, wet, rainy or poorly ventilated areas.

Be sure that the work piece is properly supported and grounded prior to beginning an electric welding operation.

The electrode and work (or ground) circuits are electrically “hot” when the welder is on. Do not touch these “hot” parts with your bare skin or clothing.

▲ NOTICE

DO NOT TOUCH THE CONTACT TIP WITH THE UNIT TURNED “ON”. Turn the unit off before changing tips or cleaning the nozzle.

Always attach the ground clamp to the piece to be welded and as close to the weld area as possible. This will give the least resistance and best weld.

SAFETY INFORMATION

⚠ DANGER

FUMES AND WELDING GASES CAN BE DANGEROUS. Do not breathe fumes that are produced by the welding operation. These fumes are dangerous. Keep your head and face out of welding fumes. Shielding gases used for welding can displace air and cause injury or death. Always work in a properly ventilated area.

WELDING SPARKS CAN CAUSE FIRE OR EXPLOSION. Do not operate electric arc welder in areas where flammable or explosive vapors are present. Always keep a fire extinguisher nearby while welding. Use welding blankets to protect painted surfaces, dash boards engines, etc.

ARC RAYS CAN BURN. Use a shield with the proper filter (a minimum of #11) to protect your eyes from sparks and the rays of the arc when welding or when observing open arc welding. Use suitable clothing made from durable flame-re-sistant leather material to protect your skin. Protect nearby individuals with a non-flammable barrier.

HOT METAL WILL BURN. Electric welding operations cause sparks and heats metal to temperatures that will cause severe burns! Use protective gloves and clothing when performing any welding operations.

2

Always wear long pants, long-sleeved shirts and leather welding gloves. Make sure that all persons in the welding area are protected from heat, sparks and ultraviolet rays. Use additional face shields and flame resistant barriers as needed. Never touch work piece until it has completely cooled.

ELECTROMAGNETIC FIELDS MAY BE DANGEROUS. The electromagnetic field that is generated during arc welding may interfere with various electrical and electronic devices such as cardiac pacemakers. Anyone using such devices should consult with their physician prior to performing any electric welding operations. Exposure to electromagnetic fields while welding may have other health effects which are not known.

WIRE FEEDER INSTALLATION

The wire feed drive roller attached to MIG175 has two wire grooves, one for 0.023" (0.6 mm) welding wire and another for 0.030 (0.8 mm) welding wire or 0.035" (0.9 mm) flux-cored wire. The factory de-fault is the 0.023" (0.6 mm) wire groove. In the event that 0.030" or 0.035" welding wire is to be used, the wire feed roller should be switched around .

1. Ensure that the MIG175 welding machine is powered "OFF" and the power cord is unplugged.
2. Unlock the tension bar (1) and lift up the rocker arm (2) of the wire feeder.
3. Unscrew the Allen set screws (3) holding the wire Feed roller with inner Allen wrench. NOTE: turn feed roller with pliers to access allen bolt.
4. Take out wire feed roller (4) and flip the wire feed roller so that the 0.8mm mark is towards you.

5. Reinstall by putting back the wire feed roller and tightening the Allen set screw.

WELDING WIRE INSTALLATION

The MIG175 welding machine can be used with wire spools of either 8" (200 mm) in diameter or 4"(100mm) in diameter. The depth of either spool should not exceed 2.2" (56 mm). There is a 50mm plastic barrel attached to the welding machine. The swing screw can adjust the resistance of the welding wire spool to keep the wire from loosening.

For installing (See Figure D-2) a wire spool 8"(200 mm) in diameter, attach the spool (1) to the plastic barrel (2).The position fixing pole of the plastic barrel should be aligned with the locating hole of the welding wire spool.

(NOTE: the wire spool will rotate clockwise when wire is in use.)

To install the welding wire spool 4"(100 mm) in diameter, remove "plastic barrel" and install wire spool with stop block and wing screw. Loosen the wing screw (5) and remove the rotation-stop block (6). Then remove the plastic barrel (2).Install the welding wire spool onto the metal shaft (7).

(NOTE: the wire spool will rotate clockwise when wire is in use). Finally, reinstall the rotation-stop block and the wing screw.

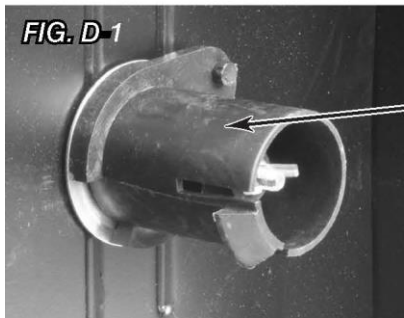


Figure D-1
Use the welder wire board
with 8" (200 mm) in dia.

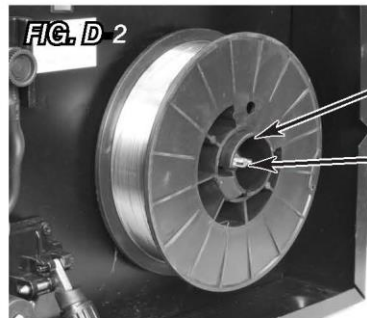



Figure D-2
Use the welder wire board
with 4" (100 mm) in dia.

HOW TO THREAD WELDING WIRE THROUGH THE WIRE FEEDER

1. Unlock the tension bar (1) on the wire tensioner and lift up the rocker arm (2). Insure that the wire drive wheel is appropriate to the welding wire size, see above describing the installation to wire feed roller installation.
2. Pull out the welding wire (3) from the welding wire spool carefully.

NOTE: Do not let go of the wire prior to step 5 or the entire spool will unravel and be useless.

3. Cut off the small piece of the curved segment at the front of welding wire and straighten the welding wire approximately 3.0" long.
 4. Thread the welding wire through the guide pipe (4) and over the wire feed roller (5) and into the torch hole (6).
 5. Reattach the rocker arm (2) and reset the presser bar (1) of the wire feeder (now the welding wire can be fed smoothly).
 6. Remove the contact tip and nozzle from the mig gun.
 7. Turn on the machine and set the wire speed about 1/2 on the scale.
 8. With the gun pointed away from you and others, depress the trigger to begin feeding wire.
- NOTE:** Watch the drive roller to see if any slipping is occurring between the roller and the wire- if so **turn the machine off** and tighten the tension wing nut 1/4 turn and test again.
9. You do not want too much tension on the tension roller as it will tend to deform the wire. Just enough to feed the wire without slipping
 10. Once wire the wire has emerged from the tip of the gun, turn the machine OFF and replace the tip and nozzle.

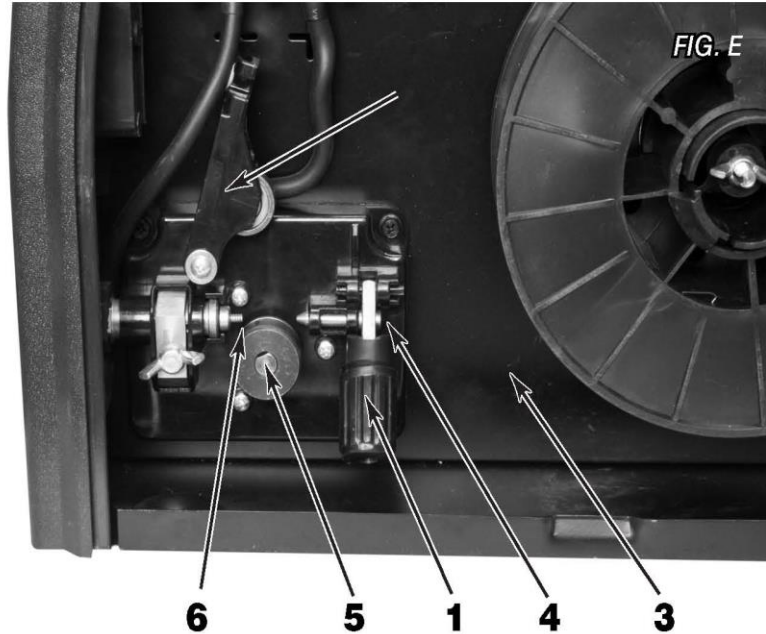


4

SHIELDING GAS INSTALLATION

A compressed gas cylinder containing 75% Argon and 25% CO₂ should be used when using the MIG (GMAW - GAS Metal Arc Welding) on steel. Use pure argon when welding aluminum. The flow regulator and supply hose is included with your welder. Compressed gas can be obtained from your local welding supplier.

1. Attach the compressed gas cylinder with a chain to a wall or other secure object, to prevent the cylinder from falling.
2. After securing the tank, remove the cylinder cap if your cylinder has one.
3. Install flow regulator to the supply valve on the cylinder and tighten it with a wrench.
4. Install one end of the gas supply hose into the outlet of the flow regulator and tighten. Connect the other end of the hose to the gas inlet located at the rear of the MIG175 welding machine (The connector nipple 5/8-18 adapts to CGA-032). Ensure that the hose is not twisted or knotted.

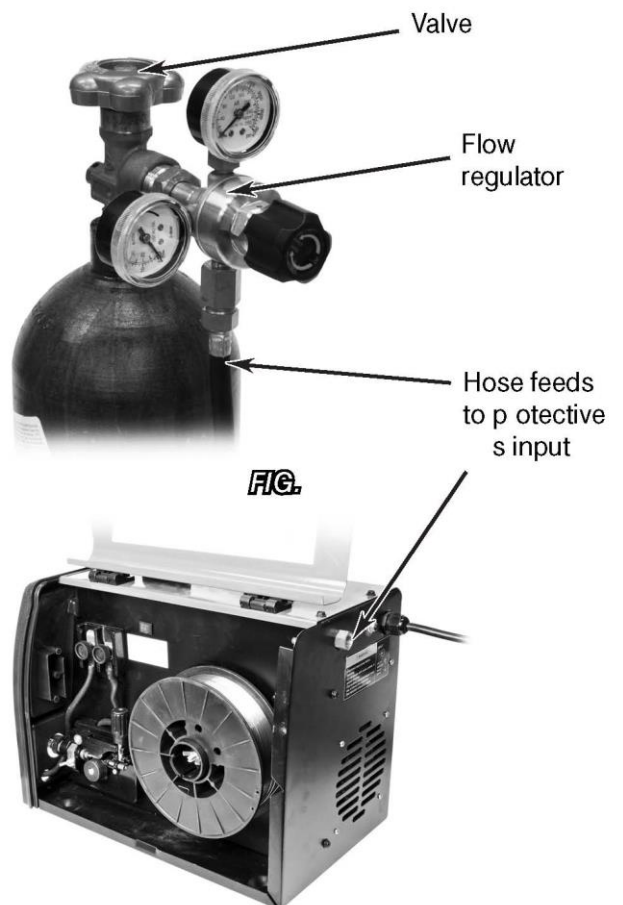

5. Slowly turn on the gas cylinder valve.
6. Depress gun trigger switch and adjust the flow regulator to 25-30 cubic ft per hour (CFH), (12-14 l/min).
7. Shut off the bottle valve when not in use. Power off your unit when you are done welding. NOTE: Always keep the valve of the gas cylinder closed when it is not in use.

WELDING OPERATIONS

1. Plug in the MIG175 Welding Machine.
2. Straighten out the welding torch.
3. Turn ON the unit and depress the gun trigger. Feed wire and cut 1/4" from the end of the nozzle.
4. Place the ground clamp as close to the welding zone as possible and remove any paint corrosion, grease and oils before welding.

WELDING PROCESS

1. Please refer to "Welding Label" in the unit and select proper setting based on the variety of metals and their thickness.
2. Adjust output polarity according to the welding wire and to ensure whether or not the protective gases are needed.
3. Connect the ground clamp to work pieces that are to be welded. This connection should be good and secure.
4. Your welding torch should have clear access to the work piece.
5. Wearing your welding helmet, gloves and long sleeve shirt and pants, press the trigger of the welding gun and begin to weld. Keep the nozzle of the welding torch approximately 1/4" away from the work piece.

5

6. Use a "Push" technique which means you will be holding the gun in your right hand with the nozzle and gun tilted back about 10-20 degrees and pushing the gun or moving from right to left.
7. Once you depress the trigger the wire will arc and you will notice a molten puddle form. You want to "move" this puddle to the left following the seam or areas to be welded.
8. If you "burn through" the material you are moving too slowly or your heat setting is too high.
9. The sound of bacon frying is what you are after. Start with the initial setting on the chart and increase or decrease wire speed to obtain the best weld.
10. Release the trigger of the welding torch to stop welding.
11. After welding, close valve of the gas bottle (if gas is used) and then press trigger of the welding torch to release any gasses left in the hose. Finally, power off the welding machine.
12. If you're welding patch panels or quarter panels on use the "stitch" type method. Depress the trigger momentarily to form a small puddle or single bead. Then depress again to form another bead aside of the first. Continue until you have 4 or 5 small beads connected about 1/2-3/4" in length.
13. Move to the other end of the panel and repeat the process. Now go to the middle and repeat. Continue this process moving to different areas of the panel to eliminate heat warping the material.

SPOOL GUN OPERATION

Your MIG175 can operate a hand-held spool gun. This will allow you weld both Aluminum and Steel. NOTE: for use on steel 18ga - 1/4"; aluminum 1/8" plate or thicker.

1. Turn the power off and remove plug from AC outlet.

2. Change the internal switch from MIG to Spool Gun.
3. Plug spool gun into outlet on the front panel of the unit.
4. Install 4" roll of steel or aluminum (4043) wire NOTE: Spool gun with Mig will only weld aluminum plate 1/8" and thicker.
5. Use 100% pure Argon shielding gas.
6. Clean the aluminum and weld area with a new stainless steel brush to remove all oxides from surface.
7. Use a "push" gun movement technique.
8. Keep the contact tip 3/4" from work piece.
9. Set voltage setting to E/F and wire speed to 5 for 1/8" thick material.
10. Set voltage setting to H/I and wire speed to 8/9 for materials over 1/8" NOTE: these are initial start settings you will have to fine tune to meet materials thicknesses and weld-ing techniques.

OVERLOAD PROTECTION FOR POWER SUPPLY TO WELDING

Your MIG175 is equipped with a temperature controller as well as an overload breaker. These two protection devices will protect the welding machine whenever the output exceeds the maximum out-put. If the output is exceeded, the unit will not supply voltage and the wire feeder will shut down (the fan will continue to run to cool the unit).

If the shut-down resulted from output overload, the circuit breaker button will extend out if it has been tripped. The circuit breaker must be reset manually. Before resetting the circuit breaker button, wait several minutes to allow the welding machine to cool down.

If there is no voltage and circuit breaker was not tripped, the internal thermal protector may have shut off the machine until it cools to a reasonable operating temperature. This is an automatic func-tion and does not require the user to manually reset anything. The fan will continue to run while the unit is cooling.

6

If the unit is still "ON" but neither the output nor fan is working, either an overload fuse or a power supply circuit fuse has been blown.

OVERLOAD PROTECTION TO WIRE FEEDER

The MIG175 model has two automatic circuits to protect motor of the wire feeder, if there is fault occurred to the motor, the circuit will power off wire feeder as well as the output.

When the trigger is released again, the circuit will be automatically reset.


Suggested Settings for Welding

MIG 175


Process	Shielding Gas	Wire Type	Wire Size (Diameter)	Thickness					
				24ga .030in .80mm	20ga .040in 1.0mm	16ga .060in 1.6mm	1/8in 3.2mm	3/16in 4.8mm	1/4in 6.4mm
MIG (DCEP)	C25 (75% Ar / 25% CO2)	Solid Wire ER70S-6	0.25in (0.6mm)	B-4	E-5	D-7	E-8	F-10	J-10
			0.30in (0.8mm)	B-3	B-4	C-5	E-6	F-7	J-8
			0.35in (0.9mm)	---	B-3	C-4	E-5	F-6	J-7
	100% CO2	Solid Wire ER70S-6	0.25in (0.6mm)	---	C-3	D-4	G-7	J-7	---
			0.30in (0.8mm)	---	C-3	D-4	F-5	H-6	J-6
			0.35in (0.9mm)	---	C-2	D-3	F-4	H-5	J-5
100% Ar	Aluminum Welding Wire	0.35in (0.9mm)	C-5	D-7	E-8	G-10	J-10	---	
Gasless Flux-Cored (DCEN)	None	Flux Core E71T-11	0.25in (0.6mm)	---	---	A-5	C-6	D-7	F-8
			0.30in (0.8mm)	---	---	A-4	C-5	D-6	F-7
			0.35in (0.9mm)	---	---	---	C-4	F-4	G-4

OUTPUT POLARITY

MIG (DCEP)

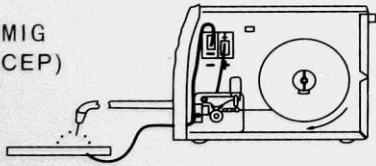

GASLESS FLUX-CORED (DCEN)

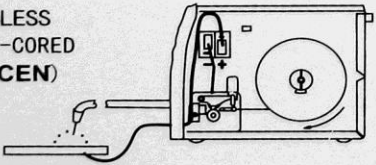

DRIVE ROLL ORIENTATION

INSTALL DRIVE ROLL WITH THE REQUIRED STENCILED SIZE FACING OUT

MIG (DCEP)

GASLESS FLUX-CORED (DCEN)

0.6mm (.025in) DIA.
SOLID STEEL WIRE

0.8mm (.030in) or
0.9mm (.035in) DIA.
SOLID STEEL WIRE

0.8mm (.030in) or 0.9mm (0.035in)
DIA Flux Cored

1.2mm (.045in) DIA
Flux Cored

