

ORION



O
R
I
O
N

Orion 150s Quick Start User Manual

See inside or go to
<http://www.OrionWelders.com/150s-tutorials>
for full video tutorials.

www.OrionWelders.com - 1-877-786-9353

Table of Contents

Foreword	4
Manufacturer's Contact Information	4
Welding Safety Precautions	4
Chapter 1: Setup & Assembly	10
• Welder	10
• Scope	12
• Argon Gas	15
• Electrodes	16
Chapter 2: Welder Overview	18
Chapter 3: Pulse Arc Welding	23
Chapter 4: Tack/Resistance Welding	30
Chapter 5: Tungsten Electrodes	36
Chapter 6: Metals	45
Chapter 7: Orion Techniques, Tips & Tricks	57
Chapter 8: Maintenance	68
Chapter 9: Technical Specifications	70
Chapter 10: Troubleshooting/FAQ	71
Warranty Contact Information	81

FOREWORD:

Thank You for Choosing Orion Jewelry Welders.

You are now the proud owner of an Orion 150s Welder. The Orion has pulse-arc, fine spot resistance, and tack welding capabilities. This manual was designed to have you welding safely within minutes of unpacking your new welder. Please read and follow all safety precautions before proceeding with the welding process.


Sunstone Engineering is the parent company of Orion Jewelry Welders. At Sunstone we are committed to producing quality products and ensuring complete owner satisfaction. If you require assistance after reading this manual please contact us with the information provided below.

Orion Jewelry Welders, a Subsidiary of
Sunstone Engineering R&D Corp.
1693 American Way Suite #5
Payson, UT 84651
Voice: 801-658-0015
Fax: 866-701-1209

Welding Safety Precautions

READ BEFORE WELDING

The following safety advice is generalized advice for the arc-welding industry. These safety precautions are not all inclusive. All users should exercise reasonable caution while using this device. The following group of symbols are warning symbols:

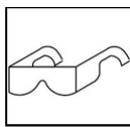

CAUTION, ELECTRIC SHOCK HAZARD, EYE PROTECTION REQUIRED.

Consult these symbols and the related instructions listed next to the symbols for proper action when dealing with these hazards.

READ INSTRUCTIONS



- Read the owner's manual before using the Orion.
- Only personnel trained and certified by the manufacturer should service the unit.
- Use only genuine replacement parts from the manufacturer.

SAFETY PRECAUTIONS FOR FIRE OR EXPLOSION



Sparks can fly off from the welding arc. The flying sparks, hot work piece, and hot equipment can cause fires and burns. Ensure that your work area is clean and safe for welding before starting any weld job.



- Do not install or operate unit near combustible surfaces.
- Do not install or operate unit near flammables.
- Do not overload your building's electrical wiring – be sure the power distribution system is properly sized, rated, and protected to handle this unit.
- Remove all flammable materials from the welding area. If this is not possible, tightly cover them with approved covers.
- Do not weld where flying sparks can strike flammable material.
- Protect yourself and others from flying sparks and hot metal.
- Watch for fire and keep a fire extinguisher nearby.
- Do not weld where the atmosphere may contain flammable dust, gas, or liquid vapors.
- Remove any combustibles, such as butane lighters or matches, from your person before doing any welding.
- Do not exceed the equipment's rated capacity.
- Use only correct fuses or circuit breakers. Do not oversize or bypass them.

SAFETY PRECAUTIONS FOR ELECTRICAL SHOCK



Touching live electrical parts can cause fatal shocks or severe burns. The input power circuit and the Orion's internal circuits are live when the power is on. Additionally the internal capacitors remain charged for a period of time after the Orion is turned off or power is disconnected. Incorrectly installed or improperly grounded equipment is a hazard. This device was designed to operate indoors only. Do not operate welder in a wet/damp environment. *Holding the hand pieces connected to the front of the welder is okay and will not generate an electrical shock.

 
- Remove personal jewelry before welding (i.e. rings, watches, bracelets, etc).
- Do not touch live electrical parts.
- Wear dry, hole-free insulating gloves and body protection.
- Properly install and ground this equipment according to this manual and national, state, and local codes.
- Do not weld with wet hands or wet clothing.
- Always verify the supply ground – check and be sure that the input power cord ground wire is properly connected to a ground terminal in the disconnect box or that the input power cord plug is connected to a properly grounded receptacle outlet. Do not remove or bypass the ground prong.
- Keep cords dry, free of oil and grease, and protected from hot metal and sparks.
- Frequently inspect the input power cord and ground conductor for damage or bare wiring – replace immediately if damaged – bare wiring can kill. Check ground conductor for continuity.
- Turn off all equipment when not in use.
- Use only well-maintained equipment and repair or replace damaged parts at once.

PERSONAL PROTECTIVE EQUIPMENT RECOMMENDATIONS FOR FLYING SPARKS AND ARC RAYS

It is essential for every person in the immediate work area to wear/ utilize proper Personal Protection Equipment. Arc welding gives off infrared and UV rays that can burn the retinal tissues within the eyes



and cause surface burns to exposed skin, similar to a sun burn. Very often sparks fly off from the weld joint area; therefore, take the necessary precautions to avoid trapping a spark within your own clothing.



- The stereo microscope provides proper eye protection when pulse-arc welding. No additional protection is necessary.
- Wear protective garments such as oil-free, flame-resistant leather gloves, heavy shirt, cuff-less trousers, high shoes, and a cap. Avoid synthetic fibers as they melt easily.
- Use an approved face shield or safety goggles with side shields when tack welding or when observing others performing pulse-arc and tack welds.

SAFETY PRECAUTIONS FOR HOT METAL



- Welding material that has a high thermal conductivity will cause metal to heat rapidly.
- Repetitive welds in the same location can cause metal to become hot.
- Do not touch hot weld areas bare-handed.
- Allow sufficient cooling time before handling welded pieces.

SAFETY PRECAUTIONS FOR FUMES AND GASES



Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health. The Orion produces minimal fumes and gases when compared to large-scale arc welders. Though not required, some form of ventilation is recommended.

- Keep your head out of the fumes. Do not breathe the fumes.
- Ventilate the area and/or use local forced ventilation at the arc to remove welding fumes and gases.
- If ventilation is poor, wear an approved air-supplied respirator.
- Read and understand the Material Safety Data Sheets (MSDSs) and the manufacturer's instructions for metals, consumables,

coatings, cleaners, and degreasers.

- Welding in confined spaces requires good ventilation or an air-supplied respirator. Always have a trained watch person nearby. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.
- Do not weld in locations near degreasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapors to form highly toxic and irritating gases.
- Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.

SAFETY PRECAUTIONS FOR FALLING EQUIPMENT



- Use a working surface of adequate physical strength to support the welding unit during operation or storage.
- Secure welding unit during transport so that it cannot tip or fall.

SAFETY PRECAUTIONS FOR HIGH FREQUENCY PITCH AND VOLUME

 
- Welding with high frequency pulse agitation can produce loud, high pitched sounds. It is recommended to use hearing protection when welding with agitation turned on.

MAGNETIC FIELDS CAN AFFECT IMPLANTED MEDICAL DEVICES



- Wearers of pacemakers and other implanted medical devices should keep away.
- Implanted medical device wearers should consult their doctor and the device manufacturer before going near arc welding, spot welding, gouging, plasma arc cutting, or induction heating operations.

OVERUSE CAN CAUSE OVERHEATING



- Allow a cooling period between strenuous welding schedules; follow rated duty cycle.
- If overheating occurs often, reduce duty cycle before starting to weld again.

OBSERVE ALL NECESSARY PRECAUTIONS ASSOCIATED WITH COMPRESSED GASES



- Use only compressed gas cylinders containing the correct shielding gas for the process used.
- Always keep cylinders in an upright position and secured to a fixed support.
- Cylinders should be located:
 - Away from areas where they may be struck or subjected to physical damage.
 - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.

Principal Safety Standards

Safety in Welding, Cutting, and Allied Processes, ANSI Standard Z49.1, from Global Engineering Documents (phone: 1-877-413-5184, website: www.global.ihs.com).

OSHA, Occupational Safety and Health Standards for General Industry, Title 29, Code of Federal Regulations (CFR), Part 1910, Subpart Q, and Part 1926, Subpart J, from U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250-7954

(phone: 1-866-512-1800) (there are 10 Regional Offices—phone for Region 5, Chicago, is 312-353-2220, website: www.osha.gov).

National Electrical Code, NFPA Standard 70, from National Fire Protection Association, P.O. Box 9101, Quincy, MA 02269-9101 (phone: 617-770-3000, website: www.nfpa.org and www.sparky.org).

Canadian Electrical Code Part 1, CSA Standard C22.1, from Canadian Standards Association, Standards Sales, 5060 Mississauga, Ontario, Canada L4W 5N5 (phone: 800-463-6727 or in Toronto 416-747-4044, website: www.csa-international.org).

Safe Practice For Occupational And Educational Eye And Face Protection, ANSI Standard Z87.1, from American National Standards Institute, 25 West 43rd Street, New York, NY 10036-8002 (phone: 212-642-4900, website: www.ansi.org).

Orion 150s

Chapter 1: Welder Setup & Assembly


The Orion 150s is a powerful addition to the Orion line of pulse-arc welding technology. Like all Orion welders, the 150s features a large touch screen interface that streamlines and simplifies the welding process – allowing users to do more and to work more efficiently. Users have many features available to them including high-frequency agitation for added penetration and weld strength, adaptive weld ignition for longer electrode life, customizable save settings for fast and easy switching between weld settings, fully updateable and upgradeable software options, and so much more. The Orion 150s continues the Orion legacy by providing the most high-tech, versatile, and affordable welding solution on the market today.

As with other Orion welders, the Orion 150s utilizes two different welding technologies – Pulse Arc and Tack. The Tack Mode uses resistance welding technology with up to 150 watt-seconds of energy. The Tack Mode is perfect for temporary placement or permanent fusion welding. The Pulse Arc Mode uses pulse-arc welding technology and consists of two distinct energy ranges – Micro and Ultra. The Ultra energy range uses up to 150 joules of energy for projects that require deeper penetration or a larger spot size. The Micro energy range uses up to 30 joules of energy and is perfect for smaller and more delicate pieces. The Orion 150s offers a versatile, compact, and affordable welding system in an easy-to-use package.

Initial Assembly

The Orion has an internal switching power supply that can accept both 120 and 240VAC - simply plug the power cable into the back of the unit and connect the other end into the wall outlet. Next, plug your 1/4" gas tube firmly into the back of the welder until it stops fully. It may wiggle when connected, but should not come out when pulled. The stereo microscope shutter should be plugged into one of the HDMI ports, and if desired, the foot pedal can be plugged into the other HDMI port.

The pulse arc welding stylus requires the most attention during setup. Since the argon gas will flow through the hand piece, a tight fit between the power supply and the hand piece is necessary. To accomplish this, push the connector onto the Orion's front panel and screw it down. Next, push in the connector again and continue to screw it down. Finally, push in the connector unit you feel it bottom out then screw the connector in unit it is firmly seated. Other welding attachments are quickly attached 'positive' and 'negative'. connections.

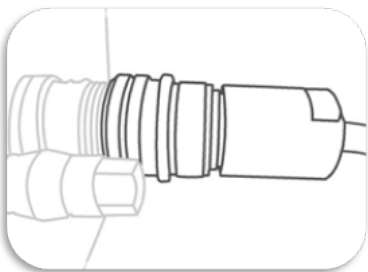

Simple Setup:

1. Push the power cord firmly into the power receptacle.
2. Push the argon gas tube (1/4") firmly into the tube receptacle until it seats firmly into the connector.
3. Connect the microscope connector by pushing it into the "Optical Unit" receptacle firmly and then tightening the threads.
4. Connect the foot switch by pushing it into the receptacle firmly and then tightening the threads.
5. The Pulse Arc welding stylus must be screwed in securely to insure no oxygen is entrained into the weld. This may require pushing in and screwing down the connector several times (pushing it in further each time) until feeling the rubber o-ring seal against the Orion connector.
6. Place a welding attachment into the positive front panel receptacle (e.g. the pulse arc alligator clip)

HANDS ON: Please set up your Orion welder as described above.

How to Setup and Use the Microscope


The Shutter System

The Orion's microscope shutter system is an advancement over other welding systems. The shutter allows an unobstructed working view before welding and completely protects the user's eyes during the welding process. The Orion will not allow a weld to take place if the shutter does not completely shut. If you ever experience a shutter malfunction, try moving the shutter in and out several times to clear any obstructions. If sticking continues, a silicon based lubricant can be used to prevent future sticking. By hand, close the shutter and while the shutter is closed, spray a small amount of the lubricant into the hole on the back of the shutter solenoid. Closing the shutter during the lubrication process is very important to prevent contamination on the microscope optics.



The Orion Microscope has been designed to provide maximum visual clarity, eye protection and ease of use.

The Orion microscope shutter system provides an unobstructed working view before welding. During the welding process the shutter closes to completely protect the user's eyes. The Orion's internal computer verifies the shutter has been closed before allowing the weld to take place. If the Orion shutter system experiences excessive sticking, use a silicon based lubricant. Close the shutter with one hand. While the shutter is closed, spray a small amount of the lubricant into the hole on the back of the shutter solenoid.

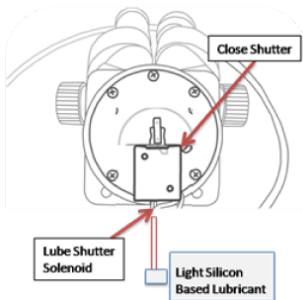




Please ensure the microscope is plugged into the welder's "Optical Unit" port. The welder will display a simple microscope symbol when the microscope is plugged in. If the microscope symbol is not displayed, the microscope will not function and the user's eyes will not

be protected from the welding flash.



When adjusting the microscope focus, use a finger on the welding electrode to help judge the correct focus location. Focus the microscope till the texture on the skin of the finger is clearly visible.

a.) Adjust the magnification between 5x and 10x. b.) Adjust the focus. c.) Adjust the height of the microscope head.

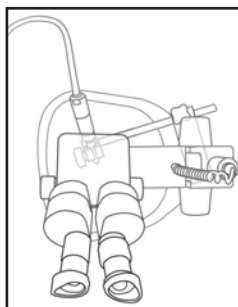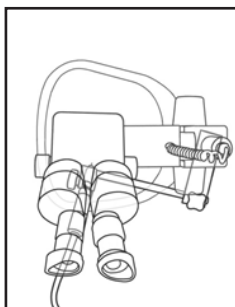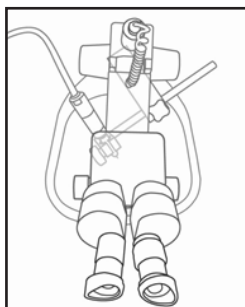

The microscope and welding stylus can be configured to meet the user's work preference. 1.) Microscope facing forward work brought to stylus from front. 2.) Microscope head rotated 90deg from body work, piece drawn toward user to touch the stylus. 3.) Microscope head rotated 90deg from body work piece lifted away from the user toward the back touch the stylus.

Adjusting the Microscope Configuration

The microscope can be configured in many different ways to suit your individual preference. Orion highly recommends configuration # 3 as the simplest to use and implement. In this configuration the user has an unobstructed space for hand and part placement. This configuration also allows the welding stylus to easily be adjusted to different angles.

HANDS ON: Please: take a moment to configure the Orion to one of the three configurations shown.

It is helpful to practice using the microscope before welding. One challenge that is easy to overcome is the eye-hand coordination of bringing the work piece to the welding electrode while looking through the microscope. Practice your eye-hand coordination while the welder is in stop mode and until you feel confident in your electrode-to-part placement.

When the welder is in stop mode an audible beep will sound every time the work piece is touched to the electrode tip. As will be discussed, the angle of the electrode tip relative to the work piece surface is very important and will take practice. Practice placing the work piece such that it is always perpendicular to the point of electrode contact.



It is helpful to practice using the microscope and welding stylus with the welder turned off or placed in stop mode.

To Help You Become Familiar with the Microscope:

1. Rest your hands on the microscope table and position the work piece close to the welding electrode before looking into the microscope.
2. Make sure your focus is at the tip of the electrode.
3. Use slow, controlled movements.
4. It is helpful to have your hands resting and to only use your fingers to move the work piece.
5. Place the work piece surface perpendicular to the point to make electrode contact.

HANDS ON: Practice setting up your hands close to the welding electrode and then looking into the scope. Practice placing the work piece perpendicular to the point of electrode contact.

Argon Gas Setup

During the pulse-arc welding process high temperature plasma quickly melts metal into a molten pool at the weld location. If room air is allowed to come into contact with the molten metal, oxygen from the air will quickly react with the hot metal. The result is a metal oxide that is brittle, porous and burnt looking.

If a protective welding gas is used, such as 99.996% pure Argon (Argon 4.6) or higher, we can prevent these effects. The argon is used to displace any oxygen at the weld location. As the arc is performed, the protective gas acts as a barrier to prevent oxygen from entering the weld zone. After the weld has cooled the protective gas is turned off.

Argon is necessary to produce clean and repeatable pulse-arc welds. In Tack Mode, however, protective argon is not necessary. Other protective gases can also be used, such as pure nitrogen. However, Orion Welders recommends high purity argon. This can be purchased at your local welding supply shop.

Argon Safety

There are several important rules that should be followed when using a compressed shielding gas such as argon.

1. Always secure the argon tank to a fixed location (such as a sturdy table leg). If the argon cylinder were to tip and become damaged there is possibility that the tank could become a rocket, expelling the high pressure argon as propellant.
2. If you experience a large argon leak, open all of the doors and windows in the room. Remember that argon is heavier than regular air and will sink to the floor of the room.
3. **ALWAYS TURN OFF THE ARGON GAS AT THE MAIN VALVE AND THE REGULATOR WHEN FINISHED.**

This will help your argon supply last longer if there is a small leak in the tubing, and is also a good safety practice. If the tube becomes dislodged, argon gas could fill the room displacing needed breathing oxygen. Argon is heavier than air and will fill the room from the bottom upward.

Setup Instructions

1. Ensure that your argon (or other inert gas) tank is securely fastened to a stationary point near the welding area.
2. Install the gas regulator onto the argon tank.
3. Adjust the regulator fully **COUNTER CLOCKWISE** (closed) to prevent over-pressurization of the line.
4. Connect one end of the gas tubing to the argon regulator. Insert the other end of the gas tube about ½ inch (12mm) into the Orion's argon connector on the rear panel. It will stop when it is fully connected. Tug gently on the tube to verify a tight fit.
5. Open the argon tank slowly to pressurize the regulator. The dial on the right should pressurize and the dial on the left should remain at zero in the 'closed' position.
6. Set the regulator to between 5-10 cubic feet per hour by slowly turning the regulator knob **CLOCKWISE**. (This will adjust the dial on the left of the regulator. Listen for any gas leaks in the line.



Electrodes

THE SINGLE MOST IMPORTANT VARIABLE IN THE WELDING PROCESS IS THE ELECTRODE. The Orion welder comes standard with (5) 0.5mm and (5) 1.0mm electrodes. The 1.0mm electrodes are a good all around electrode while the 0.5mm electrode is excellent for very small projects.


It is recommended that the user pay close attention to the electrode condition (see Chapter 4 and Chapter 6 for more info). A contaminated electrode can lead to inconsistent welds and poor arc starting. Only light pressure is needed to start the welding process, too much pressure will interfere with the welding process, lead to electrode

metal contamination and will shorten the amount of time you can weld before re-sharpening or replacing the electrode.

Before welding for the first time, follow these steps to get your electrode properly installed and setup:

1. Remove the stylus hull by gently pulling it away from the stylus.
2. Loosen the collet cap by twisting it counter-clockwise.
3. Verify that the collet has a small hole in the center to allow for the 1mm electrodes.
4. Insert the electrode into the collet. Leave between 0.5 - 0.75 inches of the electrode protruding from the stylus shaft. This will allow the electrode enough room to stick out from the stylus once the stylus hull is in place.
5. Lock the electrode into place by hand tightening the collet cap in a clockwise direction.
6. Replace the stylus hull by pushing it snugly back into place.

Exploded view of the stylus components:

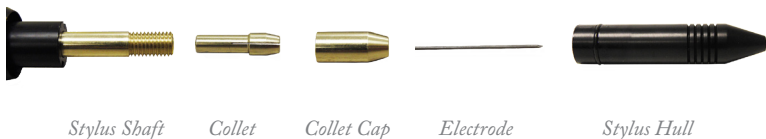


See Chapter 4 and Chapter 6 for additional details about the Tungsten Electrodes.

Chapter 2: Welder Overview

User Interface:

The Orion Pulse offers a simplified and streamlined interface for ease of use and one touch access to every welding parameter. To help get started and familiarized with the new interface, here is a brief explanation of all the various buttons and options found on the screens.

Arc Screen

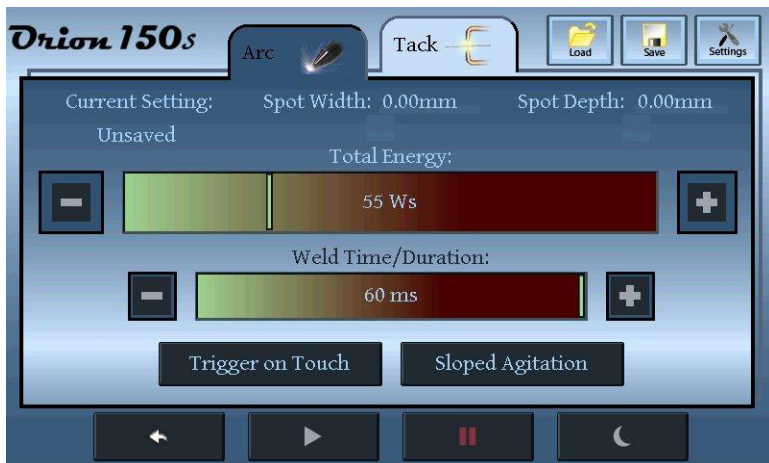

Energy Selection

Selecting the weld energy is accomplished using the “Total Energy” selection bar. This bar ranges from 2 Joules (Watt-Seconds) to 150 Joules. A second option for energy selection is to use the power up and down buttons to the right and left of the bar. This will jump the energy up or down.

Weld Time/Duration

This adjusts the amount of time that the energy is discharged from the welder. A longer discharge time will lead to smoother weld surfaces and less internal stresses within the weld spot.

Weld Initiation

Directly under the “Weld Time/Duration” bar are two buttons. The left button controls the trigger options: “Trigger on Touch” and “Trigger on Pedal.” When using “Trigger on Touch” the unit will automatically fire once the work piece is touched to the electrode tip. With “Trigger on Pedal”, initiation occurs only when the pedal is pressed.

Agitation Options

High Frequency Pulse Agitation can be an extremely valuable option- especially when welding the more difficult to weld metals. The agitation can improve weld formation and strength. The various agitation options will be discussed here. *Note: Agitation can produce loud, high-pitched sounds. It is recommended to use hearing protection when welding with agitation turned on.

None:

This is the standard weld discharge curve with a smooth slope. This good is for most simple, less-conductive metals (stainless steel) and will give maximum control over spot size formation.

Sloped:

The Sloped agitation offers low levels of agitation and has a minimal impact on spot size formation and accuracy, while still offering additional penetration and enhanced weld strength.

Sustained:

This offers high levels of agitation for improved weld spot strength. However, the high levels of agitation energy will also affect the spot size due to the added extra energy. It is recommended to lower the overall weld energy slightly to compensate for the additional agitation energy.

Undo/Play/Pause/Sleep

The four buttons displayed at the very bottom of the screen are undo, play, pause, and sleep. In order to weld, the play button must be pushed. When the welder will not be in use for a short period of time the pause button can be pushed. This will keep the unit powered on, but welding functions will be disabled. The sleep button is a power saving option that will power down the unit. To awake from sleep mode, simply

touch the screen twice. The undo button will step backwards, allowing users to 'undo' the recent adjustments they may have performed - whether intentional or unintentional.

Save/Load Settings

Once a particular metal and energy setting is found, to save this setting for future use, click on the save disc icon and enter a name and notes for this setting. To recall or load a previously save setting, click the load icon and select your setting.

Options and Preferences

The left button in the upper right corner will give access to adjust the User Options and Preferences. Available options include Audio Visual (A/V), Gas, Timing, and System parameters.

Tack Screen

The Tack Screen controls the resistance welding aspect of the welder.



Energy Bar

This controls the overall energy that will be discharged during the welding process.

Length Bar

This controls the total time that the weld energy is discharged during the welding process.

Weld Initiation


Directly under the “Weld Time/Duration” bar is a button that controls the trigger options: “Trigger on Touch” and “Trigger on Pedal.” When using “Trigger on Touch” the unit will automatically fire once the work pieces make contact with each other. With “Trigger on Pedal”, initiation occurs only when the pedal is pressed. When welding in the Tack Mode, “Trigger on Pedal” is recommended.

*Please note that tack/resistance welding requires two individual pieces—one connected with a ‘positive’ lead and one with a ‘negative’ lead. Some conductive metals (such as silver, copper, and 24k gold) will not tack weld very well.


Options and Preferences Screen

Available options include Audio/Visual (A/V), Gas, Timing, and System parameters.

Audio Video Options:

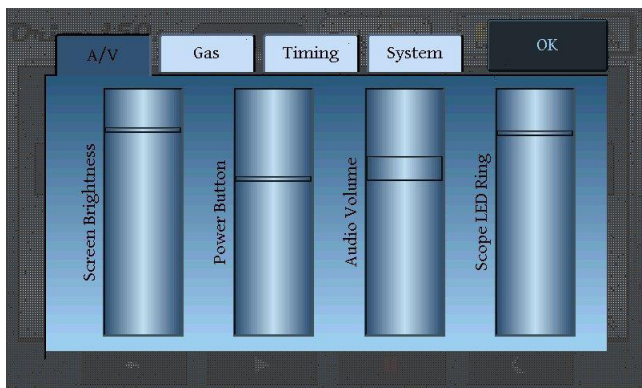


Gas Options:

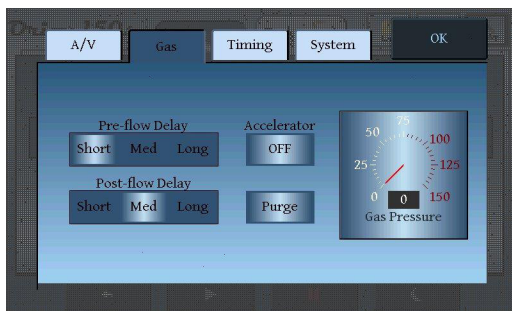

Timing Options



System Options:

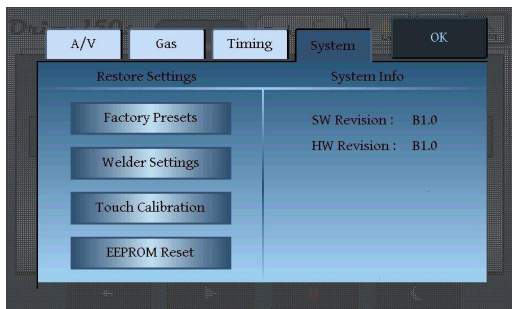

Chapter 3: Pulse Arc Welding

Welding Basics

The Orion is a pulse-arc welder and a capacitive discharge resistance welder in one. This combination of abilities allows for infinite creative possibilities. The Orion can be used as a tack welder to temporarily position parts before welding or soldering. By increasing the power output it can also be used as a permanent fusion welder (resistance welder, spot welder). In its Pulse Arc Mode, the Orion can be used to perform permanent welds, add metal, and do a variety of other amazing and time saving applications.

What is a Pulse-Arc Welder?


A pulse-arc welder is a special case of a Tungsten Inert Gas (TIG) welder. In TIG welding, a sharpened tungsten electrode is used in combination with electrical power to start and sustain an high temperature plasma stream - an arc. This plasma arc is used as a heat source to melt the work piece metal. Filler metal can also be added to build up joints and create strong and reliable weld “beads”, or weld seams.

TIG welders can use AC (alternating current) or DC (direct current) energy to initiate the plasma arc. Orion Welders has chosen to build on our extensive experience with DC welding technology. The Orion uses industrial capacitive discharge technology to produce the pulse-arc weld. AC wall voltage can vary up to 20% during the day. Capacitive welders have the advantage, over AC technologies, of precisely storing energy before the welding process. This means that the Orion will produce a repeatable weld independent of AC power fluctuations.

The Orion pulse-arc welder is a micro TIG welder and allows extremely fine control over all welding parameters.

Pulse Arc Welding Fundamentals

Pulse Arc welding uses electrical energy to create a plasma discharge. The high temperature plasma in turn melts metal in a small spot. This process takes place very quickly – within 10's of milliseconds. The process is clean, and very controllable – perfect for intricate and minute welding applications. Plasma is a gas that has been electrically ionized. Both a positive atom and a free electron are produced as a high temperature gas mixture. Because the Orion is applying a voltage between the electrode and the work piece, the atoms are accelerated toward the electrode and the electrons are accelerated toward the work piece.

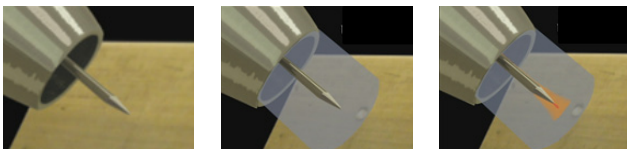


The Orion's welding process. 1.) The user touches the electrode to the surface with very light pressure. 2.) The Orion turns on the shielding gas (argon). 3.) The Orion retracts the electrode and sends a burst of electrical energy – forming a plasma arc. Please note that the weld is only made after the electrode lifts from the work piece surface – therefore it is important to use very light pressure.

The penetration of your weld spot depends on many different factors. However, as a rule of thumb you can expect the penetration of the weld spot to be approximately $\frac{1}{4}$ of the diameter of the weld spot. Factors like electrode shape and condition also effect the weld penetration and will be discussed in more detail later.




As a rule of thumb you can expect the weld spot penetration to be approximately $\frac{1}{4}$ that of the weld spot diameter.

To ensure the Orion is most effectively used the user simply needs to follow one basic rule –touch the electrode to the work piece with very light pressure. The Orion will then send out shielding gas, retract the welding tip and send the electrical energy needed to create the weld. REMEMBER THAT THE WELD IS CREATED ONLY WHEN THE ELECTRODE LIFTS FROM THE WORK PIECE SURFACE. This means that using too much pressure will prevent a weld from taking place and will also damage your electrode.

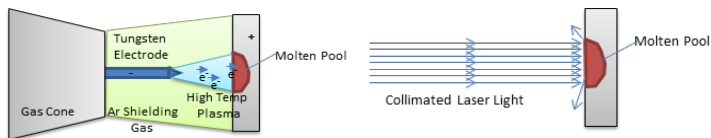

Pulse arc welding and Laser welding are different processes but provide the same end result – a high quality weld in almost any metal.

Laser welding and pulse arc welding technologies are designed to create high quality welds in precious and non precious metals. Laser welding uses collimated or focused light to add energy to the metal and melt it at a single location. Pulse Arc welding uses electricity (specifically electrons) to add energy to the work piece and melt the metal in a spot. Although laser welding devices are good welding tools, the Orion can perform many of the same functions of a laser and in some cases can even perform actions that lasers cannot. For example, welding silver is difficult for laser light because of silver's highly reflective properties. However, the Orion does not have this limitation because electrons are electrically attracted to the surface of silver.. The Orion also has the advantage of only welding on metal. Lasers can strike precious stones or other nonmetals and can even crack or evaporate the target. Because the Orion is electrically driven it requires a conductor, such as a metal, to allow the welding process to take place.

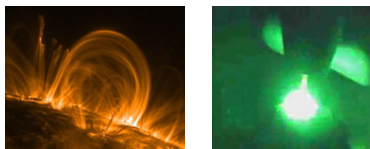


The Orion's Pulse Arc plasma is as hot or hotter than the surface of the sun.

The Orion welder uses the same high temperature plasma that can be found on the surface of the sun. The sun creates this plasma via internal fusion reactions and the plasma temperature measures about 5,500 deg C at the sun's surface. The Orion creates its plasma via electrical discharge and can generate temperatures of 5,500 – 8,000 deg C in very controlled, small bursts.

Start Welding

To become an expert and to really learn how to maximize the Orion we recommend that you dedicate time for real hands on experience. We recommend that you read and complete the following sections while you are in front of the Orion. The Orion is very easy-to-use and many users will be making quality welds within minutes. The purpose of this section is to help the user to better understand some of the fundamental welding principles, to utilize all of the functions of the Orion, and to adapt this knowledge to specific applications.

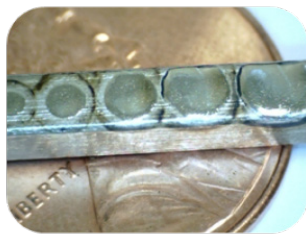


As you can see from this example the Orion's Pulse Arc Weld Mode offers a lot of power. At higher powers, this mode is perfect for larger/thicker pieces, deeper weld penetration and for welding highly conductive metals like silver.

High energy Pulse Arc welds at 30, 50, 75, and 100 Joules of energy in a titanium bar stock.

Hands on: Try welding in Pulse Arc Mode on a flat plate with 30, 50, 75, and 100 Joules of energy. Stay at 100% length, and make sure you have a sharp welding electrode. **Note that the work piece may get hot.

The Orion's Pulse Arc Mode can also be very refined and controlled. Lower energy settings allow for welds on small parts and delicate features. Having both power and precision allow users to have maximum versatility, and making adjustments fast and easy. Selecting the proper weld setting is a matter of user preference and application necessity.

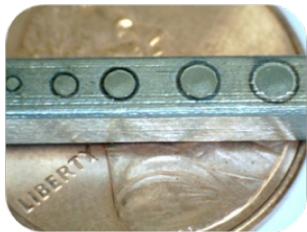

Low energy, high accuracy Micro Pulse Arc welds at 1, 3, 10, 25 Joules of energy in a titanium bar stock.

Hands On: Try welding in micro mode at 1, 3, 10, 25 Joules of energy. Stay at 100% length, and make sure you have


a sharp welding electrode. **Note that the work piece can be held in your hands at lower pulse arc energy settings).

Power vs. Time

What happens if the time or the length of the weld pulse is adjusted? As can be seen in the figures below, the pulse width (length) controls the size of the pulse to a smaller extent than the power. It also controls the smoothness of the weld puddle. Because the smoothness of the weld spot is also related to the internal stress of the weld joint – a smoother weld will have less stress. It is recommended that the user keep the pulse length at full (100%) for most applications.



25 Joules with 0, 2, 4, 8ms weld length.

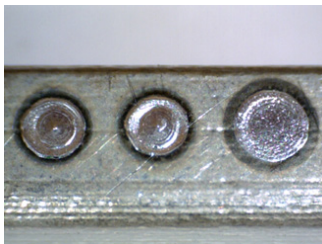


75 Joules with 10, 20, 50ms weld length.

The two weld parameters power and length can be understood with the following analogies. Consider the Orion welder to be like a water tower. The amount of water in the tower is like the power level of the welder – or the energy stored in the welder. Firing the welder is like opening a large valve to let water out. The length parameter in the welder can be thought of as how long the valve is left open. You can


discharge a very small amount of water by only having the valve open a short time, or you can allow all of the water out of the tower by leaving the valve open for a longer period of time.

The actual weld puddle can be understood better using the following analogy. Think of the metal surface as a pool of water in its frozen state. The welder's arc discharge impacts the "water" causing it to melt. The arc discharge also causes the now liquid "water" to ripple – similar to when a stone has been thrown into a body of tranquil water. If the arc energy is removed quickly the "water" freezes instantly and the ripples remain frozen into the water's surface. If the arc heat is removed more slowly, the ripples have a chance to dissipate and go away completely before the water's surface refreezes. This is why short pulse lengths cause the weld spot to look rippled. Keeping the pulse length at 100% will leave the weld looking smooth and clean.

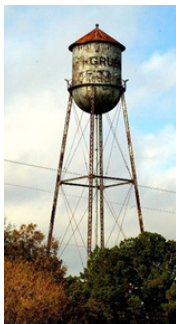

The Orion welder stores energy much like a water tower stores water. The weld spot is very similar to a frozen body of water. Ripples in the water can be frozen into the surface if the heat is removed too quickly with short pulse lengths.

Using a more technical description – during the welding process the weld spot becomes a liquid pool of metal. The impact of the welding plasma causes vibrations on the molten pool's surface, much like a stone causes ripples on the surface of a still body of water. The Orion welder's energy discharge has been designed to ramp down the weld energy for longer pulse lengths. This gives the molten metal vibrations time to smooth out before the metal re-solidifies. It is recommended that the user keep the welder at 100% length for most welding applications.

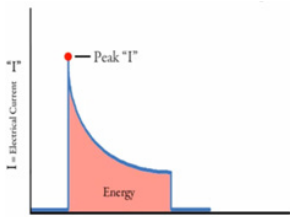


Orion welders have an energy discharge curve that helps smooth the molten weld puddle before re-solidification.

In addition to the benefits listed above, a longer weld time will also help prevent cracking in some metals as the extended time and longer discharge

curve allows the molten pool to cool more slowly. When the energy is cut off suddenly (by shortening the length setting) the liquid metal “freezes” in place. This rapid freezing can cause micro stresses in the weld spot and may make the metal more prone to cracks under additional stress (like hammering).

In most cases it is recommended to leave the weld length at 100% with one important exception. If welding a very small part in micro mode at less than 20% power it is very helpful to turn up the power to 30%+ and turn down the length. The higher the power setting is set the easier it is to ignite the arc. By turning down the length and keeping the power setting at around 30% the arc will still ignite easily but the energy that the welder allows out during the weld is limited by the shorter amount of time.

When welding very small parts it is helpful to leave the weld power at ~30% and reduce the pulse length to decrease the size of the weld spot. Note the difference – weld 1) micro weld 1: 100% length 30% power Weld 2) 0% length 30% power.

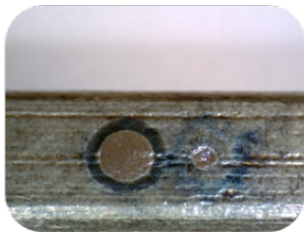

Alternatively, the user can sharpen the welding tip to a very fine point to help ignite the welding arc at very low power levels.

HANDS ON: Try making a small weld spot using 5 Joules of energy and maximum length, and then 5 Joules of energy and minimum length. Now, with a very sharp electrode, try making a weld spot at 1-3 Joules of energy and maximum length.


Chapter 4: Resistance Welding

What is Resistance Welding (Tack Welding)?

Resistance welding, often called tack or fusion welding in the jewelry industry, takes place using a very different process from that of TIG welding. In resistance welding a large electrical current is passed through two work pieces to join them. At the contact point between the two materials there is a resistance to the flow of the electrical current. As electrical current is passed through this contact point resistive heating takes place. When enough current passes through the work pieces the temperature (especially at the interface between the two pieces) can become hot enough to melt the metal in a spot. The terms resistance welder and spot welder are descriptive of this process.


If you limit the amount of power and electrical current going into the weld you can create a temporary or weak weld called a “tack” weld. Tack welding is very useful in jewelry making. It provides the ability to temporarily position a part before permanent welding. This ability opens a multitude of creative possibilities. It also helps eliminate the need for complicated binding or clamping of parts before permanent welding or soldering.

Permanent resistance welding is also useful in jewelry making. The Orion can weld ear posts and wires, tie tacks, catches, domed or dapped parts, joints pins, bolo backs and much more. Because the heart of the Orion is an industrial capacitive resistance welder, everything from one time custom pieces to production welding is possible.



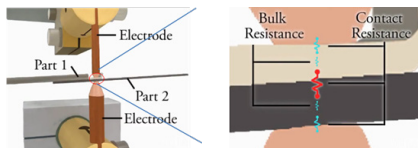


“Tack” or resistance spot welding is a fundamentally different welding process from pulse arc welding. Resistance welding uses the electrical resistance to heat to fuse the work piece parts together in a “spot”. Left: A typical (industrial) welding configuration. Right: A close-up zoom of the weld showing the electrical resistances that are used to create the weld spot.

As shown in the figure above, a typical weld configuration requires a positive and negative electrode with pressure applied to the work piece parts. As we zoom in on a cross sectional view of the work piece parts, we can identify the electrical resistance locations where heat is generated. For fine spot, or small scale resistance welding, most of the heat is generated at the contact point between the two work pieces. This has been identified on the figure as the largest resistance point. During the weld a large pulse of electrical current is dumped quickly through the work piece causing rapid heating and melting at the electrode location.

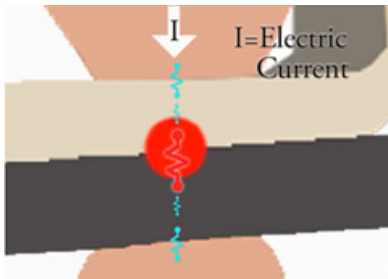

During the weld a large pulse of electrical current is dumped quickly through the work piece causing rapid heating and melting at the electrode location.

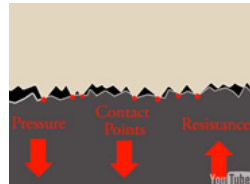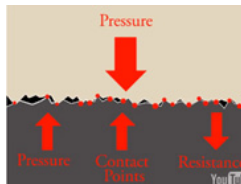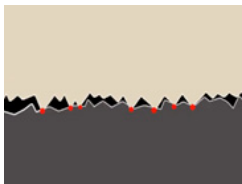


Left: On the micro scale all surfaces have a degree of surface roughness. This roughness causes the work pieces to only contact in a limited number of locations. Middle: Applying more pressure will cause more surface contact, less resistance and less resistive heating. Right: Applying less pressure will cause less surface contact, more resistance and more resistive heating.


During a resistance weld the surface between the two parts being welded is not truly flat. On the micro scale these surfaces are rough and only contact in a limited number of locations and the limited contact translates to an increased electrical resistance at the contact between the two parts. A resistance welder uses the resistance to the flow of electricity to heat and melt the part via a large electrical current. This contact point is where the highest heat is generated. Light pressure

between the parts means less contact between the two surfaces, more resistance, and hence more heating and melting. Heavy pressure between the parts translates to more contact between the two surfaces, less resistance, and less heating.

For small scale welding the melting processes typically will start at the interface between the two parts due to this high contact resistance. The exception to this rule is when resistance welding conductive materials (copper, silver, gold, brass) that require a tungsten or molybdenum electrode. When welding with a resistive electrode (tungsten) the heating actually takes place at the interface between the electrode and the part.

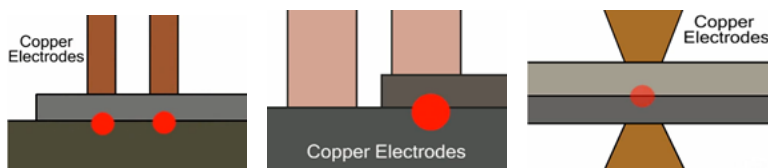

Left: Resistance welding using a series electrode configuration. Middle: Resistance welding using a step electrode configuration. Right: Resistance welding using an opposed or direct electrode configuration.

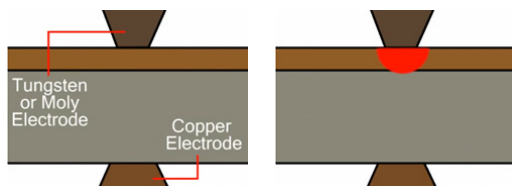


When resistance welding conductive materials like copper, gold and silver, the electrode in contact with the conductive material must be Tungsten or Moly. The melting then takes place from the electrode and works toward the part interface.



Left: Weldments (weld protrusions or bumps) can be used to focus the weld energy when resistance welding difficult materials or larger parts. Right: Weldments force the current to travel through a smaller area create more heat at that location.

Sometimes it can be helpful to focus the energy of a resistance weld for larger parts. This can be done by using a weldment, or bump between the parts to be welded. This bump forces the electrical current to pass through a concentrated point (especially important for thicker parts). The smaller the bump tip diameter the more heat that can be generated at that point. This technique is also very helpful for welding dissimilar, conductive metals. For example, resistance welding silver to gold can be difficult, however, if I place a gold weldment on the silver part the gold to gold resistance weld become very simple.

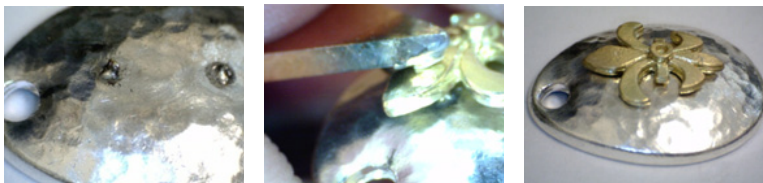

To aid in resistance welding difficult thicknesses or material combinations. 1.) Place a weldment or bump on one side to focus the energy. 2.) Use an electrode configuration that is simple and have as much contact area as possible on the outside of the parts. 3.) The weldment or bump will fuse into the other part making a resistance weld that cannot be seen on an edge.

Tips When Resistance Welding

With the above in mind there are several different helpful recommendations to use when resistance welding.

1. The pressure between the two parts is the most important variable in resistance welding; even the amount of power being used for the weld plays (to a degree) a lesser role.

2. High pressure will create a cool weld.
3. Light pressure will create a hot weld.
4. No pressure will produce an arc!!
5. Placing a small bump or weldment between difficult to weld parts can simplify the welding process.

If using tools to hold the work pieces remember that firm pressure between the tool and the work piece is important to prevent welding the tool to the work piece (e.g. brass lined pliers). Then apply the correct pressure between the work pieces to achieve your weld.

HANDS ON: Try turning the Tack Mode power to 50 watt-seconds and make a weld:

1. **First weld with very firm pressure between the parts. The result may be little or no weld.**
2. **Next clamp the parts firmly in the tool but apply virtually no pressure between the parts (make sure these are parts you no longer need). The result will be a very large spark, or at least a much better weld.**
3. **Practice at different energies and pressures until you feel comfortable with the process and results.**

The pressure between the tool holding the part is also very important. If insufficient pressure is applied between the tool and the part the weld may take place between the tool and the part. Always grip the part firmly in the tool to reduce the contact resistance between the tool and work piece. Doing this will reduce the amount of heat created where the tool and part meet.



Resistance Welding Tools

It is always a good idea to have the resistance welding tool made from a material like copper (when welding more resistive parts such as steels). If using a tool to hold the work piece together remember that firm

pressure between the tool and the work piece is important to prevent welding the tool to the work piece (e.g. brass lined pliers). Then apply the correct pressure between the work pieces to achieve your weld.

This will help to ensure the resistance between the tool and the part is very low and no weld is made at this location. Typically, it is not good practice to use a set of steel pliers to hold a steel part (for example) during resistance welding. The tool can easily fuse to the work piece.

Typically, steel is not used for resistance welding because of steel's high internal resistance. This high resistance means that a great deal of power is dropped in the tool before even making it to the weld location. The exception to making a resistance welding tool from steel is when only a small amount of power is needed. This may happen when only a light tack weld is needed before pulse arc welding.

Cables for Resistance Welding

A true resistance welding hand piece should transfer as much power to the weld location as possible. The Orion is capable of transferring over 3000 amperes to the weld location.

To enable this full power transfer:

1. The welding attachment should use 3.5ft (~1m) of 10AWG cable.
2. **IMPORTANT** the cable should be no larger than 10 AWG or damage to the welder may occur (e.g. 8AWG is a larger cable).

Not all tack welds require this amount of energy. Smaller cabled pulse arc attachments can be used for simple tack welds that require lower power.

Custom Resistance Welding Tools

It may be helpful to shape the tool for the application. Tools that clamp the parts (e.g. brass lined pliers) should have as much surface as possible in contact with the part to allow more power to transfer to the weld location. Remember that the area between the work pieces should be small to focus the energy if a strong weld is desired. A weldment or bump can be used to help focus the energy if desired.

If you are shaping an electrode to actually perform the weld then the tip should be as small as is reasonable for the desired weld size (e.g. 1mm spot size or less is typical). Remember that when using an electrode to perform the welding process, the pressure applied by the electrode tip determines the weld pressure and the heat generated. A weldment or bump between the two parts to be welded can still be used to focus the energy. Place the electrode directly over the weldment location (remember the weldment is actually between the two sheets etc, not on the electrode).

Chapter 5: Tungsten Electrodes

THE SINGLE MOST IMPORTANT VARIABLE IN THE WELDING PROCESS IS THE ELECTRODE. The Orion welder comes standard with (5) 0.5mm and (5) 1.0mm electrodes. The 1.0mm electrodes are a good all around electrode while the 0.5mm electrode is excellent for very small projects. The larger 1mm electrode allows more energy to come out at one time. The smaller 0.5mm electrode may be better for cases when less energy is desired.

HANDS ON: Make a weld using pulse arc-mode at 15 Joules and 8ms using a sharp 1.0mm electrode. Now make a weld using the same settings using a sharp 0.5mm tip.

In the 'HANDS ON' examples above, more power was transferred from the Orion into the piece for the same setting using the 1mm electrode. For very small parts using the small electrode is sufficient. This option reduces the peak weld current versus using the large electrode and can also allow for a smaller weld spot. For larger parts use the 1mm electrode. The 1mm electrode is used when needing additional weld current (more melting for same energy). The larger electrode is recommended for metals such as silver, due to higher welding energy requirements of such metals.

Please note that the 1mm electrode should be used for the normal pulse arc welding mode and the 0.5mm small electrode will "burn" or oxidize at higher power settings. As a general suggestion, the 1mm electrode is a good choice for most applications, even very small ones.



Left: Using too much power with the 0.5mm electrode will cause it to overheat and reduce its life. Right: A 1.0mm electrode can weld at a variety of powers without overheating.

Why Use Tungsten Electrodes?

1. Hardness – tungsten is extremely hard and is therefore able to hold its shape during the welding process.
2. Tungsten's melting temperature is much higher than most other metals. This means the metals being welded will melt before the tungsten.

Melting temperatures of selected metals:

Material	Melting Point (deg C)
Zinc	420
Aluminum	660
Silver	962
Gold	1064
Copper	1083
Stainless 304	1450
Carbon Steel	1500
Titanium	1660
Platinum	1772
Niobium	2468
Tungsten	3410

The table shows a variety of metals and their corresponding melting temperatures. Note that tungsten has a significantly higher melting temperature than the other metals. This is an important attribute of tungsten that aids the welding process. While welding, electrons from the weld plasma impact the work piece and form a weld spot. At the same time, positively charged gas atoms impact the electrode. Both of these processes create heat. However, more heat is generated by the electrons impacting the work piece than the atoms striking the electrode.

Electrode Shape

The electrode shape is a very important aspect to consider and has a significant impact when welding various metals. The shape of the electrode will greatly affect the welding plasma created during the arc. Poor electrode shape will lead to plasma arcs that are not repeatable while good electrode shape will help the plasma arc to discharge smoothly from the welding tip.

The grinding direction to sharpen the electrode is very important. When grinding, make sure that grind marks run parallel to the electrode shaft. Parallel grind marks will allow the plasma to discharge uniformly and smoothly from the electrode. Grinding the electrode such that circular rings or marks show up will lead to a poor plasma arc, affecting weld quality. The plasma will discharge inconsistently from the electrode ridges and may become unstable, oscillating in time. The weld spot will not be repeatable.




Grind marks on the electrode should always run parallel to the length of the electrode.



The arc will be unstable in time and the weld spot will not be repeatable if grind marks are circular.

As a rule of thumb the electrode should be ground so that the taper is approximately 2.5x the diameter. The resulting electrode shape is a good general shape for easy arc ignition and excellent weld spots.

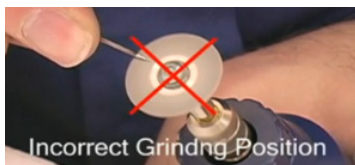

Always grind the welding electrode so that grind marks run parallel to the electrode shaft. Placing the electrode incorrectly on the diamond wheel will produce circular grind marks and poor weld results.

HANDS ON: Grind your electrode so that grind marks run parallel to the electrode shaft. Verify by looking under the microscope. Try to produce a taper that is approximately 2.5x the electrode diameter.


Electrode Shaping Effects

There are two main electrode shape configurations that Orion users should consider when preparing for a new project. The first is the sharp electrode, which is the best for most applications and metals. A sharp electrode is also the easiest to ignite and typically produces a good weld spot. A sharp electrode is especially important for small parts where fine control is essential.


The second electrode shape is a flat ended tip. This tip helps spread the energy more uniformly and is better suited for difficult metals like silver. A combination of a pointed electrode with a small flat tip can also be useful for a variety of metals. This configuration will help

improve arc properties for silver (and like metals) while still allowing smaller parts to be welded.

As a general rule of thumb you can think of a sharp tip as a weld focuser while a blunted or truncated tip is a weld un-focuser.

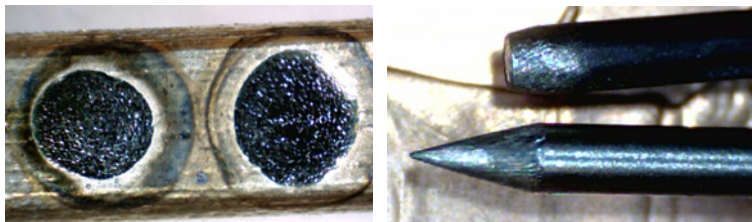

The tip shape changes the energy focus and weld penetration. The weld spot on the left was formed with a blunt electrode, while the spot on the right was made using a sharp electrode.

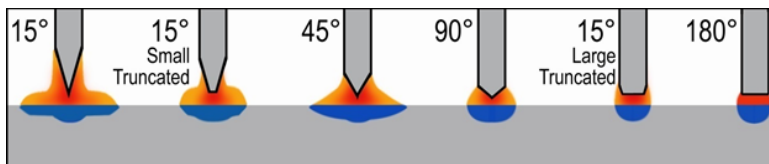

The shape of the electrode will influence the shape and penetration of the weld spot. There are advantages and disadvantages to each electrode shape.

As shown in the illustration above, the electrode shape greatly influences the weld spot's shape and penetration. By looking at the figure, one might assume that the 180 degree shape is the best electrode configuration to achieve an optimal weld spot. However, the 15 degree electrode shape has the advantage of easy weld ignition at lower power levels. In some situations it is advantageous to place a small flat on the end of the sharper tip – or truncate the weld tip. This has a stabilizing effect on the arc and also allows deeper weld penetration. Even a small flat on an otherwise sharp electrode can be helpful in making repeatable welds while still allowing easy arc ignition. For the smaller energy settings an extremely sharp electrode is essential. Remember the size of the truncation flat is related to the power setting. Use smaller flats for lower energy – larger flats for high energy.

There are several considerations that can be helpful when selecting electrode shape (e.g. sharp, blunt, or a sharp tip with a small flattened end). The most helpful of these is to spend time with the Orion and get to know how it responds to different electrode shapes and metals.

Considerations for Electrode Shape:

1. When welding very small features, under about 1mm, the electrode should be sharp to help focus the weld energy.
2. When welding in with less than 20-30 Joules the electrode will typically be sharp.
3. Some materials weld better with a sharp electrode (e.g. Stainless Steel).
4. When welding at very low power settings a sharp electrode will help ignite the arc more easily.
5. Flattened tips provides arc stability at higher energies
6. At high energies a sharp tip may melt off during the welding process and contaminate the work piece.
7. A large flat or completely blunt electrode tip for some metals is desirable (e.g. silver, aluminum).
8. A large flat can be helpful on all metals depending on the desired weld puddle and the work piece geometry.
9. Truncating the electrode helps to un-focus the weld energy and prevents “burrowing” in mobile metals like silver.
10. How large you make the tip flat (e.g. a very small flat vs. a completely blunt electrode) is determined by the amount of power the Orion will deliver. At low energies no flat is needed, where at maximum energy the tip can (if desired) be completely blunt. Remember, the smaller the flat the easier the weld ignition.



A blunt electrode tip can be helpful when making more powerful welds in silver to help overcome silver's high liquid mobility by "un-focusing" the plasma over the entire flattened area.



A sharp electrode will help place the weld into tight geometries (left), a blunt electrode can spread the energy and prevent weld formation (right).

As discussed above, silver is really the major exception to having a sharp tip. Because of silver's high liquid mobility, a sharp electrode with a focused arc (at the very tip) will actually burrow a hole in the center of the weld spot at higher energies. However, for small spots a sharp tip is still recommended in silver. When welding with higher energy settings the users will find that a sharp tip will actually dig a hole in a large piece of silver or for thinner silver, create a hole. By using a blunted or truncated tip the energy is effectively spread over the weld area and both the burrowing hole and the thin silver blow-through can be largely avoided.

Troubleshooting the Electrode

Poor weld results are most often traced back to electrode condition and shape. Because the electrode condition is very important, the following table will help troubleshoot problems quickly.

	Symptom	Possible Problem	Possible Solution
1	Trouble igniting the arc	Contaminated electrode	Re-grind the electrode to remove contamination
2		Electrode shape not conducive to ignition at low energy	Shape the electrode to a very sharp tip
3		Broken electrode, jagged edges	Re-grind electrode to desired shape
4	Cratering of the weld spot	Electrode contamination leading to a metal bridge explosion (see discussion)	Re-grind the electrode

	Symptom	Possible Problem	Possible Solution
5		Sharp electrode in a mobile metal such as silver	Truncate the end of the electrode to help “un-focus” the weld energy*
6	Weld spot not symmetric	Damaged or jagged electrode	Re-grind electrode
7	Porosity in the work piece	Damaged electrode with jagged tips	Re-grind electrode
8		Metal may contain zinc and “boil” during the welding process. (e.g. white gold)	Often welding over the same location two or three times will smooth the weld spot
9		Sharp electrode in a mobile metal such as silver	Truncate the end of the electrode to help “un-focus” the weld energy

In the table above we see that trouble igniting the arc can be caused by several different reasons. The most common is a contaminated electrode. If the work piece metal contaminates the welding electrode the following may occur:

1. During the ignition process the electrode is touching the work piece surface when the weld current begins to flow. The metal contaminant may form a liquid metal electrical conduction bridge. During the weld ignition process the electrode will retract and this may lead to the vaporization of the liquid metal bridge as it is necked down during the electrode retraction process. This vaporization process can be explosive (on a very small scale) and leaves a crater in the metal's surface. The result will be a small “pock” mark in the metal's surface. The electrode must be reground before reliable welding can continue at this setting. At lower energies (e.g. micro mode at 20% power) this resurfacing/re-tipping may be very important to get the welder to ignite reliably. At higher energies the welding process may proceed virtually unhindered even with a metal contaminated electrode. To remove the small crater, weld over the crater with a newly ground electrode.
2. The electrode may stick to the metal's surface. This happens as the liquid metal bridge cools before the electrode tip has

retracted sufficiently to leave the surface of the work piece. A now solid metal to metal weld has taken place at the electrode tip preventing retraction and arc ignition. This is often referred to as electrode “sticking”.

3. What can be done if the weld spot doesn't look good, asymmetric for example? This may mean the electrode may be damaged (sharp tips or jagged edges or strange shape due to contamination). Poor tip condition can also lead to porosity (small holes in the work piece).



Electrode condition greatly affects power transfer and also weld properties (see above discussions). Left: A perfect electrode. Right: An electrode in poor condition with metal contamination.



Electrode contamination can lead to small “explosions” that create craters in the work piece. All four welds were made at the same setting. Metal contamination on the electrode caused one weld to create a crater.

It is recommended that the user pay close attention to the electrode condition (see additional discussion). A contaminated electrode can lead to inconsistent welds and poor arc starting. Only light pressure is needed to start the welding process, too much pressure will interfere with the welding process, lead to electrode metal contamination and will shorten the amount of time you can weld before re-sharpening or replacing the electrode.

Chapter 6: Metals

Weldability of Common Metals

One very important aspect of Pulse Arc welding is a working knowledge of material properties. This knowledge will help you understand why various metals will react differently during the welding process. Shown below is a table of properties of some common metals. These metals have been arranged by melting temperature for convenience. Each of the properties listed below will have an effect of the weldability of the metals.

	Zinc	Aluminum	Silver	Gold	Copper	Palladium*	Cobalt Chrome*	Stainless 304*	Carbon Steel	Titanium	Platinum	Niobium	Tungsten
Melting Point	420	660	962	1064	1083	1200	1300	1450	1500	1660	1772	2468	3410
Boiling Point	607	2467	2212	3080	2567	3100	2800	3000	3000	3287	3827	4742	5660
Specific Heat	388	900	237	129	385	244	10	500	500	523	129	268	133
Electrical Resistivity	6	2.7	1.6	2.2	10.6	10.8	475	70	60	54	10.6	16	5.4
Density	7.1	2.7	10.5	19.3	9	11	8.3	7.9	7.8	4.5	21.5	8.6	19.3
Thermal Expansion	31	23.5	19.1	14.1	17	11	10	18	12	8.9	9	7.2	4.5
Thermal Conductivity	116	237	429	318	401	71	100	16.3	50	22	71.6	54	173

*Some Values may be approximate

Melting Point: The temperature at which the metal will begin to melt. The molten metal of the weld pool will be at this temperature during the welding process.

Boiling Point: If enough energy is added to the weld joint (and heat is removed slowly by the surrounding solid metal) the weld puddle can begin to boil. Liquid metal will be turned into gaseous metal.


Specific Heat: The energy required to raise the temperature of the metal (per unit mass). Think of this number as how much metal will melt for a given weld energy (melting point also is important). A larger specific heat means more energy is required to melt the metal.

Electrical Resistivity: This number represents the resistance to the flow of electrons in a metal. This property is especially important during a resistance or “tack” weld. The more resistive the metal is the more easily it will resistance weld (e.g. stainless steels), the smaller this number is the more difficult it will be to weld the material (e.g. silver), especially in “tack” mode.

Density: how much of the metal (atoms / mass) is in a given volume of space. This property will also influence how large the weld spot is for a given metal. All other things being equal, a lower density metal will have a larger weld spot than a higher density metal for the same weld energy.

Thermal Expansion: When a metal is heated it will expand, or elongate slightly. In some situations, especially during resistance welding, metal can expand quickly and spill out of the weld joint.

Thermal Conductivity: This is a measure of how fast the metal conducts heat. Metals that are good conductors of heat (e.g. copper) will dispel the heat away from the weld location quickly during the welding process. This action reduces the size of the weld spot. Metals that are poor conductors of heat (e.g. titanium) are slow to conduct heat away from the weld location and the weld energy has a greater affect on the weld size, etc.

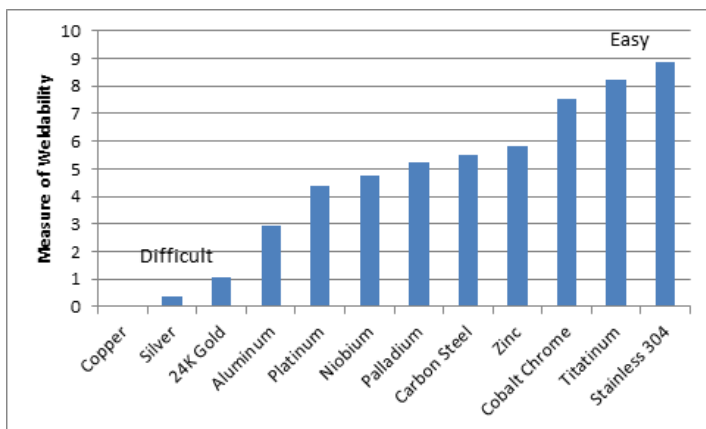

This measure of weldability comes from properties of the metal like melting point, thermal conductivity, density etc., and is intended as a relative reference between the different metals. It can be thought of as how much spot size and penetration between a given amount of weld power will have on the metal. Please note that some metals may have properties not accounted for in this chart that may make welding more difficult than indicated (e.g. palladium).


Titanium and Niobium

Some metals may react easily with oxygen and even other gases like nitrogen. Titanium (Ti) reacts with both oxygen and nitrogen at elevated temperatures. (Ti) burns to form (TiO₂) in air at 1200deg C. (Ti) will also burn in pure (N₂) gas at 800deg C to form (TiN). Titanium nitride (TiN) is inherently brittle, which will result in a weak weld joint. Very light reaction (mostly shielded) may just include slight discoloration. However, a heavy reaction will cause absorption of gas and will cause a dark gray and porous result. If the reaction is too heavy the weld location will become very weak and porous.

Niobium (Nb) reacts with both oxygen (O₂) and nitrogen (N₂) gas. The reaction with (N₂) starts at 400deg C. Niobium will oxidize (react with oxygen) at 200deg C. As you can see, niobium is even more reactive than titanium. This means that greater care must be taken when welding (Nb) to ensure proper gas shielding and clean welds. For thin parts this is particularly difficult as heat is easily conducted to

the opposite weld side (the underside of the sheet for example). This heat on the underside causes the (Nb) to absorb (O₂) and (N₂) gases resulting in brittle welds.

For both (Ti) and (Nb) the level of oxidation can be observed visually. Heavy oxidation will cause a gray porous surface, however, oxidation (or nitrogen absorption) in smaller degrees will cause the surface of the metal to color. This principle can be used to actually “paint” on oxide in different colors on (Ti) and (Nb) parts.

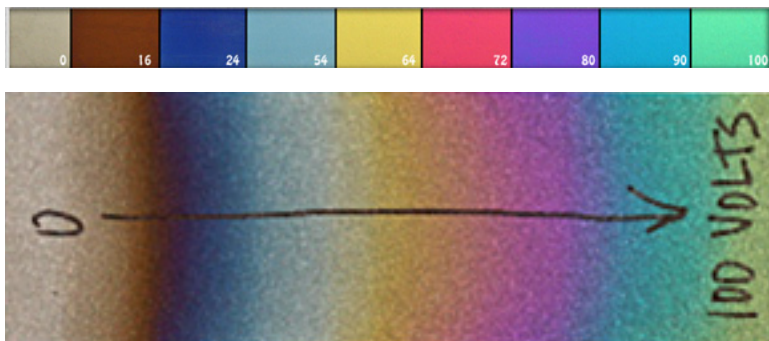

Titanium and Niobium metals will oxidize readily at elevated temperatures and voltages. The charts show (Ti) and (Nb) “painting” with electricity (showing the voltage at which the color will appear). However, similar colors will appear due to heat if welding without sufficient shield gas. These colors during welding need to be avoided. (Picture courtesy of Reactive Metals)

How to avoid oxide and nitride formation (these will work for other metals as well): In many situations this is not an issue because the argon (Ar) coming from the welding stylus completely covers the molten weld pool. However, in some situations this is not the case. For example, welding on a thin material, the back of the material is unshielded from oxygen and the exposed metal will react with oxygen.

Using the following can help reduce oxide formation on the back of the work piece:

1. Argon flood on both sides of the work piece during the welding process. This is the best method but can use a lot of gas and requires additional setup.
2. Solder flux: A thick layer of solder flux can help reduce oxide formation. Place the flux on the back side of the work piece. The flux should be as viscous and thick as possible. Some fluxes may work better than others.

After saying all of the above, it should be noted that titanium is very simple to weld. With proper gas shielding, the weld looks bright and clean. Titanium to titanium welds are simple to perform and are strong. Titanium welded to other metals can have a variety of results. For example (Ti) to Gold (Au) results in a clean looking but brittle weld. Copper to (Ti) has similar results. Silver to (Ti) is relatively strong. When welding (Ti) to other materials remember to test the weld strength with scrap pieces before welding the final work piece.

One important consideration when welding (Nb) is it's high boiling temperature (4742 deg C) relative to tungsten's melting temperature (3410 deg C). What this means: if the tungsten electrode is contaminated with (Nb) metal the (Nb) metal may superheat and start to boil right on the electrode. This boiling of the (Nb) will in turn melt the tungsten electrode causing it to lose its sharp shape.

Yellow / White Gold (Au)

Yellow gold is a relatively simple material to weld. Typically, it will produce a strong and symmetric weld spot and resulting welds are smooth and require little cleanup. This is true for even lower Karat golds; however, please note that weld results will improve with higher gold content. Typically, the different metals added to gold are used to change its wear characteristics and color. The more additional metal added (not gold) the lower the karat value. Lower karat golds that contain copper and silver, etc. can produce a black coating around the weld's surface. This can easily be steam cleaned, wiped off with a clean rag, or taken off with a glass brush.

Please also note that sometimes during the welding process a small amount of the welded metal will evaporate. Different metals will evaporate at different rates from the weld pool. The evaporated metal deposits around the weld location in a very thin layer that can look black. This type of deposit can typically be removed by steam cleaning, wiping with a clean rag or with a glass brush.

Please also note that some gold alloys can contain small amounts of zinc (0.5-1.0%). This zinc addition is used as a deoxidizer during casting, and can improve the fluidity of the molten metal. As discussed above, zinc can cause porosity and will contribute to a black film that must be removed via glass brush or clean rag.

Yellow gold physical properties and composition (one possible):
58-75% gold, 12-27% silver, 9-15% copper and some zinc

White Gold: White gold is also a relatively simple metal to work with. There are two main types of white golds – palladium-white gold and nickel-white gold.

Palladium – white gold composition (one possible):
58.5% gold, 10% palladium, 28.5% silver, 2.5% (copper, nickel, zinc)

Nickel – white gold composition 14k (one possible):
58.5% gold, 25.8 % copper, 15.3% nickel, 0.4% zinc
Gold color can be changed with the following alloying (show alloy chart by composition and color)

Note the zinc content of white gold. High zinc content can lead to weld defects like porosity, etc. as the zinc boils out of the weld joint. Please see the previous discussion on overcoming porosity. In short, welding over the location with porosity again will help remove the porosity. A fresh, sharp electrode will help with this process. Sometimes adding pure laser wire will also help in removing porosity.

In general, gold welds easily. Here are some tips when working with gold:

1. Typically a sharp electrode is preferred when welding gold.
2. Gold can easily accept small or large weld spots
3. It is often typical that gold will look black surrounding the weld location. This black layer is easily removed with steam cleaning, clean rag, or a small glass brush.
4. Gold can easily be added to almost any other metal.
5. Very interesting welding combinations are possible.

Platinum (Pt)

Platinum (Pt) has a melting temperature that is similar to stainless steel, but a density that is 3 times higher. In addition, the specific heat of (Pt) is lower by a factor of 4 than stainless steel. This means that it takes less energy to raise the temperature of (Pt) to its melting temperature. The end result is that (Pt) is a little more difficult than stainless steel to weld but very similar in overall behavior.

One important consideration when welding (Pt) is it's high boiling temperature (3827 deg C) relative to tungsten's melting temperature (3410 deg C). What this means: if the tungsten electrode is contaminated with (Pt) metal the (Pt) metal may superheat and start to boil right on the electrode. This boiling of the (Pt) will in turn melt the tungsten electrode causing it to lose its sharp shape.

Palladium (Pd)

Palladium (Pd) is a white lustrous metal that is typically a much lower cost than platinum. Palladium is also much lighter, having a density $\frac{1}{2}$ that of platinum. It would seem that (Pd) is the perfect metal. Unfortunately, (Pd) is generally difficult to work with and is somewhat difficult to weld in a jewelry setting. This is mainly due to palladium cracking during the welding process.

Palladium can be welded using the Orion welder, however, cracking can occur.

Palladium cracking is an especially difficult phenomenon to overcome with laser or pulse arc welding. If only one weld spot is made, cracking will typically not occur unless the weld joint is stressed by hammering, etc. This means that welding over porosity in a (Pd) piece can be accomplished with the Orion to help clean up the metal during the finishing process. However, welding more than one overlapping weld will inevitably lead to cracking (laser or pulse arc welder). Palladium cracking can be thought of as a combination of hot cracking and new weld puddle crystal structure problems. After a weld, the molten (Pd) re-crystallizes, typically forming a large and weak metal grain structure. When welds overlap, the new crystal structure in the last weld puddle is weak compared to the original metal. The result, a crack will start at the edge of the new weld where it overlaps with the old weld joint as the new weld cools and is stressed. The crack will then run along the middle of the weld puddle in the direction of the overlapping joints. This cracking is due to the stresses created during the weld puddle cooling process as described above with hot cracking. However, this time instead of geometry causing the cracking, a rip starts in the old crystal structure and propagates during the cooling process, much like ripping a piece of paper. The result – (Pd) is difficult to weld successfully without breakage. Typically, single spots of porosity can be welded and fixed but overlapping welds will crack.

There is a welding solution that can stop this cracking process. The addition of gold fill wire to the weld joint creates a new alloy and stronger crystal structure. The gold can discolor the weld joint. However, by welding over the joint several times the gold will diffuse into the (Pd). Another possible solution is to use a high gold content white-gold (Pd) alloy laser wire.

Silver (Ag)

Silver is an interesting metal with several properties that must be considered during the welding process. First, silver is highly reflective over a large range of light wavelengths. This metal characteristic makes welding silver difficult for a laser, but poses no problems for a Pulse Arc welder. Second, silver is a very mobile metal when in a liquid state and has low surface tension when compared to other metals. Because of these properties, how the weld energy is applied to silver is important.

When welding silver it is important to understand the concentration of your weld energy relative to the size of the silver being welded. For very small welds, a sharp electrode poses no problem. This means that in the Orion's micro mode, silver will typically behave well even with a concentrated, focused beam of energy (i.e. a very sharp electrode tip point). However, as the desired spot size gets larger (bigger micro mode welds and almost all pulse arc mode welds) the liquid silver is easily pushed around by the welding pulse. This will lead to large blobs of material being displaced from the weld site resulting in a noticeable hole. To avoid this problem, simply un-focus the weld energy by creating a truncated electrode tip flat. The size of the flat depends on the size of the weld. For relatively small welds a small flat is all that is required. For very high energy welds the electrode may be completely flat (1mm diameter).

Resistance welding silver in tack mode is very difficult because of silver's high electrical conductivity. Sterling silver has a high electrical conductivity very similar to that of copper. However, Argentium silver is approximately 30% less conductive. This means that more heat can be generated during the spot welding process due to the additional material resistance. Use Argentium silver if your application requires spot welding as opposed to pulse arc welding. Even while pulse arc welding it may be desirable to use Argentium silver because of its superior tarnish resistance. Thin Argentium silver parts can be welded directly using copper electrodes. Thicker silver parts may require a weld projection or "bump" to focus the weld current. This welding strategy is discussed in detail in Chapter 4 - Tack Welding.

Aluminum (Al)

Aluminum behaves very much like silver during the pulse arc welding process. Aluminum has a very low melting temperature (660 deg C) and is very mobile when in a liquid phase. This means that the same principles that apply to welding silver also apply to Aluminum. Aluminum also has one additional complication that may make it difficult to work with in some situations. This metal is very susceptible to hot cracking. On occasion the weld parameters or geometry may be such that a crack may appear in the weld. Always perform test welds for strength verification. In general, pulse arc welding in aluminum will

produce a weaker weld than with other metals.

Stainless Steel

Stainless steels are relatively simple to weld. The weld puddle looks smooth and joins easily and the resulting weld joint is strong. Because of the low thermal conductivity of stainless steel, it is easy to hold the work piece in hand while welding without weld heat immediately making the work piece too hot to hold. Use only stainless steel fill wire when welding. If regular low carbon steel is used, the weld joint will eventually rust over time.

Austenitic stainless steels, (304 for example) weld easily. However, hot cracking is a possibility with this material. To help avoid any cracking it is helpful to weld using an alloy that will produce a small amount of ferritic crystal structure in the weld joint. The addition of the ferritic crystal structure will help suppress cracking. For example, when welding 304 stainless a 308 stainless fill wire can be used. Not all situations will require crack suppression techniques. Smaller parts, like those typically welded using the Orion, do not require these procedures. (201, 202, 205, 216, 301, 302, 303, 304, 305, 308, 309, 310, 312, 314, 316, 317, 321, 329, 330, 332, 347, 348, 384, 385 stainless steels).

Martensitic stainless steels (410 for example) have a high carbon content. This high carbon content increases the risk of cracking. To decrease the risk of cracking it may be helpful to increase the work piece temperature to between 200 – 300 deg C. Often material thinner than 3mm can be welded successfully without heat treatment provided that pure argon is used during the welding process. (403, 410, 414, 416, 418, 420, 422, 431, 440, 501, 502, 503, 504 stainless steels).

Low Carbon Steels (Mild Steel)

Low carbon steels typically weld easily with no major cautions. Please be advised that low carbon steel will rust and will often come with a coating of zinc. The zinc coating will cause the metal to appear more white or lustrous than typical steel. As discussed above, welding on zinc will cause many issues to consider. The zinc will evaporate quickly from

the weld area causing a black coat to spread to the surrounding metal (including the welding stylus). The zinc evaporation may also cause strange weld behavior, etc.

For best results select a low carbon steel without a zinc coating. Make sure the steel is free from other contaminants such as rust or oil. Remember that if using the Orion to produce welds in very thick pieces the weld joint may need to be prepared as discussed previously.

High Carbon Steels (Spring Steel / Tool Steel)

High carbon steel welds easily but may become brittle after the welding process. To avoid weld failure the part must be heat treated after the welding process.

Cobalt Chrome Alloys

Cobalt Chrome is very sensitive to oxygen contamination. If there is insufficient argon coverage or oxygen present in the argon gas this alloy will crack. Once oxygen embrittlement has occurred the weld area must be removed (via grinding etc) to prevent future cracking over the same area.

Copper

Copper is one of the more difficult alloys to weld because of its high heat capacity and high thermal conductivity. These factors make it even more difficult to weld than silver. Copper also requires more energy than silver for the weld to take place (about 30% more). Thin copper, however, welds very easily and micro mode is typically sufficient to produce very strong welds. For thicker copper similar techniques as those employed to weld silver must be used.

Brass

Brass is a material that contains a large amount of zinc - 30 -37% zinc by composition. The remaining material is copper.

As discussed previously, zinc is a hard metal to pulse arc weld or resistance weld because of its low melting and boiling temperature (420 deg C, 907 deg C).

During the melting process the low temperature zinc evaporates/boils out of the brass alloy.

For low energies this simply coats the surrounding material in a black zinc film that can easily be removed with a glass brush.


For larger pulse arc weld energies the black coat can cover larger areas and porosity can develop at the weld location as zinc boils from the weld.

Joining Different Metals

Welding different metals together will produce a new alloy at the weld location. The new alloy will have different properties (although in many cases similar properties) to the base metals. Some metals combine well, forming a strong and useful new alloy. Other metal combinations are weak and brittle.

Helpful Hints for Combining Different Metals

1. Check the new alloy strength with scrap material to ensure the joint will turn out as expected.
2. You may need to weld over the joint location several times to get complete mixing of the weld pool and a uniform new alloy. In most cases this is not necessary for a strong joint and the first weld will be sufficient.
3. Some material combinations may benefit from a third metal at the joint which forms a better/stronger alloy with the two primary metals.

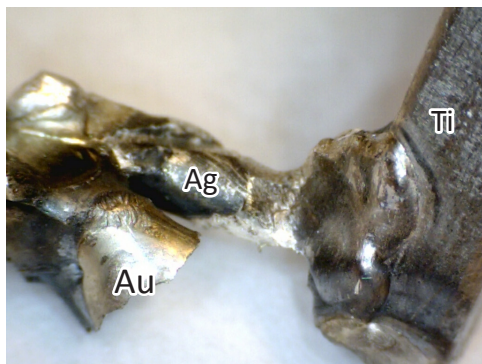

An example of titanium welded to gold and silver. The gold to titanium weld looks clean but is brittle. The silver to titanium weld also looks good and is strong. The Silver to gold weld looks good and is strong.


Chapter 7: Techniques, Tips, & Tricks

Pulse Arc Welding: Adding Material


Typically material is added with a small “laser” wire, one weld at a time. However, there are many additional options to add material. For example, two parts can be “tack” welded in place and then pulse arc welded for additional stability, or instead of using small “laser wire” the Orion can weld a much larger wire or rod to fill in more metal in a single weld. There are several methods to aid in the addition of fill wire, which are mentioned below. The placement of the electrode relative to the wire is very important and will influence how the material behaves during the addition process.

SIDE PLACEMENT: Placing the electrode on the side of the wire is generally the best method of adding fill wire. As show in figure 51 below, place the electrode at an approximate 45 degree angle and at the contact between the wire and the base material. As the electrode pulls away from the base material and the arc ignition happens, the base material will melt first and then the wire will be melted and pushed or pulled (by surface tension) into the base material. This is an excellent method to produce a uniform molten pool of metal and ensure the proper mixing of the base material and the fill wire.


The electrode may also be placed at a 45degree angle in front of the wire. However, less material will be added with every weld, and a portion of the wire will typically ball-up in the process.

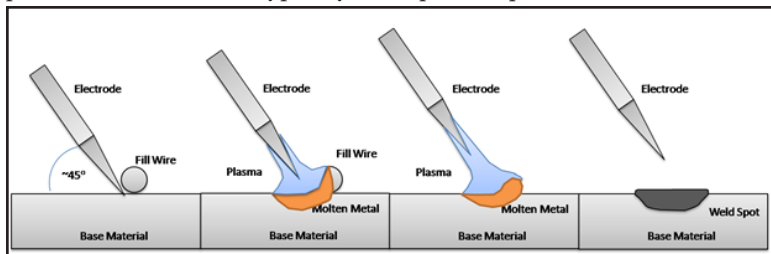

The most effective way to add fill wire to a base material is to place the welding electrode at a 45deg angle from the base surface as shown. Small fill wire will quickly melt into the base material.

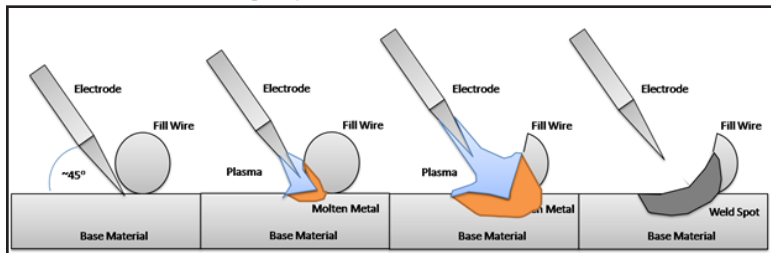


Remember that for a larger fill wire the energy must be increased to completely melt the wire. If there is insufficient energy there may only be partial melting of the wire. However, in some situations this may be advantageous.

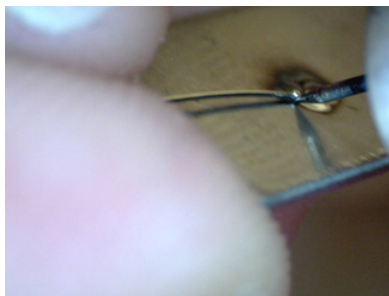


To assist in the welding process, place the electrode tip at a 45deg angle to the wire and part surface. This will allow melting to start at the base and melt the wire into the base as the tip retracts.

HANDS ON: Try adding fill wire using the side placement method. Build up a small mound or material.

TOP PLACEMENT: Placing the welding electrode on the top of the wire will have a much different effect than placement on the base material. With top placement the material addition process will depend a great deal on the wire size and the weld energy. If the wire is very small, the results will be similar to the side placement discussed above. For a small wire welded with high weld energy (relative to the wire size) the weld plasma powers through the wire. This technique melts the base metal and joints the melted wire to the base plane. However, if the wire is larger or the energy is set to produce only a small spot size, the wire will typically fail to be added to the base material. Instead the wire will ball and some melting of the base material will occur, which is insufficient to add the wire.


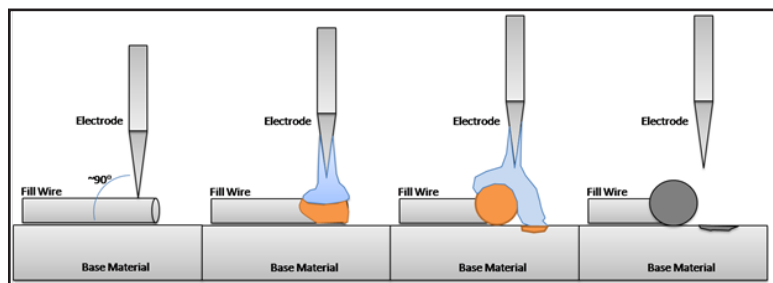


Placing the weld electrode on top of the fill wire at a 90deg angle from the base material surface is typically not the preferred method of adding material. If the wire is large compared to the energy setting, the wire will ball due to surface tension and will not be added to the base material.

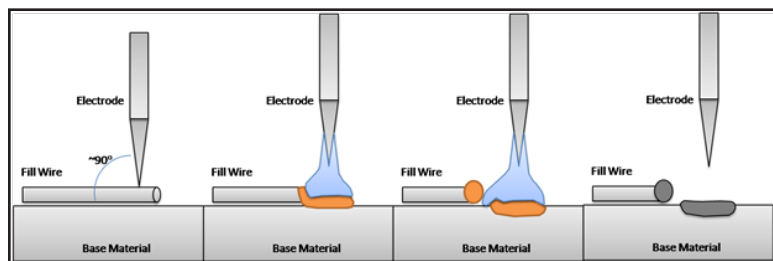

A top electrode placement can work if the wire diameter is small compared to the power setting. In this case there is enough plasma pressure to force the molten wire down onto the base material.

A final scenario can occur when the electrode is placed on top of a large wire being welded to a base material at a high weld energy setting. In this case the plasma can push the wire metal down to the base metal surface but there may be no penetration into the base material.

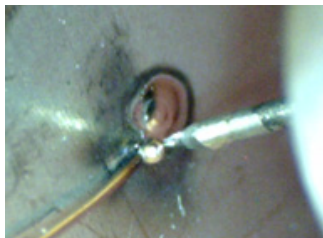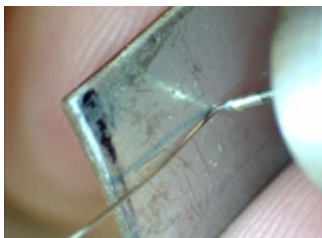

Placement of the electrode directly on top of the fill wire can melt the wire into the base if the power is sufficient, or the wire is very small. Alternatively it may also only melt the wire causing it to ball as shown for larger wire size or insufficient power settings.

HANDS ON: Try adding fill wire using the top placement method. Build up a small mound of material.

As a rule of thumb it is always best to use the side electrode placement. This is especially true of larger fill wire diameters. If it is essential for a top placement weld the process will be improved by using very fine laser wire to ensure full wire melting.



It is important to choose the correct wire size for your application. Extremely small wires may be required for tiny applications; larger wires can be used for things like filling a large joint. The correct wire size will save you time and prevent frustration.

Choosing the correct wire gauge for your application is very important. For example, micro-scale applications, it is important to select the smallest fill wire available. If a wire is selected that is similar in size to

the base metal, there is a good chance that the power setting required to melt the wire will also melt the base metal. Alternatively, if the wire is small relative to the base metal, the wire can be melted adding material to the base metal without any damage or warping to the base metal. For larger features, select a wire size that will allow you to perform your task efficiently. For example, filling a large pore should not be done with ultra-fine wire, but instead with wire of approximately the same diameter as the pore. In this case the repair can be accomplished in literally one weld. In comparison, with the ultra-fine wire, the repair would take many welds.

Pulse Arc Welding: Pushing Metal


There are two competing forces at work during the pulse arc welding process. The first is the surface tension of the molten metal. Surface tension is a force between the metal atoms themselves that is pulling the molten pool of metal flat during the metal's liquid phase. Metal surface tension (when molten) is many times stronger than water surface tension. The second force as work happens when the weld plasma exerts a force on the molten metal as the plasma's electrons bombard the weld surface. Electrons from the plasma will attempt to push the molten metal in the direction the electrode tip points. Surface tension and plasma electron pushing are generally competing forces. The plasma tries to push the molten metal, while the surface tension tries to keep it in place.

This means:


1. Some metals with lower surface tension (e.g. silver) are easier to “push” around than metals with high surface tension (e.g. Stainless).
2. Surface tension itself can be used to move metals around. By placing the electrode between a high and low spot, the melting process will try and “flatten” the two –stealing material from the high and moving it toward the low.

The surface tension smoothing is accomplished by placing the electrode at a 90 deg angle from the work piece surface with the electrode tip on the edge or slightly interior to the edge of the metal mound. The welding process will then take material from the mound and spread it

into the surrounding material. One should repeat this process until the proper spread of material is achieved.

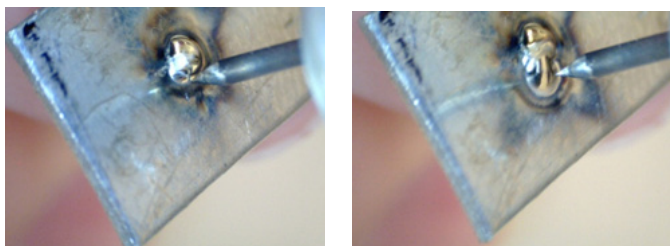


By placing the electrode between a high and low spot, the melting process will try and “flatten” the two –taking material from the high area and moving it toward the low area.

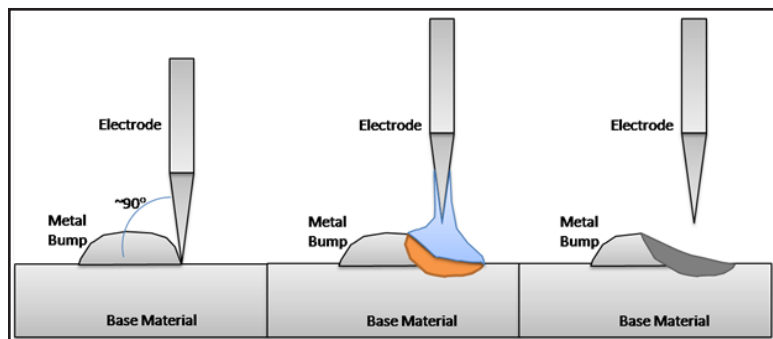


Placing the weld electrode on the edge of a bump will smooth away the bump as surface tension spreads the metal over the molten base material.

HANDS ON: Use your electrode with several different materials to push metal around, or to use surface tension to smooth a metal mound out.

Please note that various metals will react differently to pushing and surface tension smoothing. For example, silver has a relatively low surface tension while in a liquid state. This means that the plasma push method may be more successful than it would be with stainless steel (with a much higher surface tension). On the other hand, because of the high surface tension of stainless steel, the surface tension smoothing method will proceed quickly.

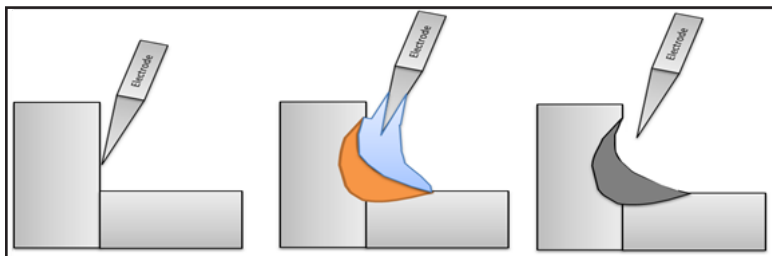

The Orion can be used to push metal around. This is especially helpful if one of the parts to be joined is heat sensitive. In this example the horizontal member is more heat sensitive or is thinner than the vertical member. Material is pushed from the vertical member onto the horizontal member to prevent part damage.

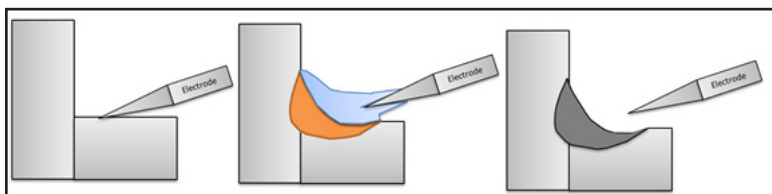

The Orion can be used to push metal around. This is especially helpful if one of the parts to be joined is heat sensitive. In this example the vertical member is more heat sensitive or is thinner than the horizontal member. Material is pushed from the horizontal member onto the vertical member to prevent part damage.

Pulse Arc Welding: Weld Cracking


Some materials are prone to crack because of their metal properties. For example, High Carbon steel, Palladium (Pd), and some silver alloys. Why does the cracking take place? With some metals it is the new crystal structure created during the welding process e.g. palladium and high carbon steel. However, another cracking process often called “hot cracking” can occur when the cooling process and the resulting thermal shrinkage create high stresses in the work piece. For example, some silvers when first welded may crack due to the thermal conduction out of the weld puddle. Hot cracking is very geometry dependent and can be avoided by carefully considering the weld joint before welding.

Questions to consider to prevent hot cracking:


1. How fast can the heat escape and the molten pool cool.
2. Does the heat escape in a preferential direction that may lead to uneven stresses in the cooling weld puddle.

Ideas to overcome hot cracking:

1. Keep joint gaps as small as possible.
2. Keep the pulse length at 100% to help ramp down the heat more gradually.
3. Pulse Arc Mode has a much longer pulse duration and time that can improve heat ramp down.

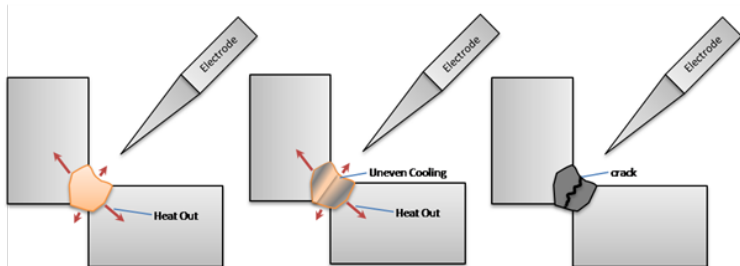

Improper joint preparation or geometry can lead to uneven weld puddle cooling. If the puddle cools in such a way to create a hot center section the hot section will be pulled apart by the stresses from the cooling out metal.

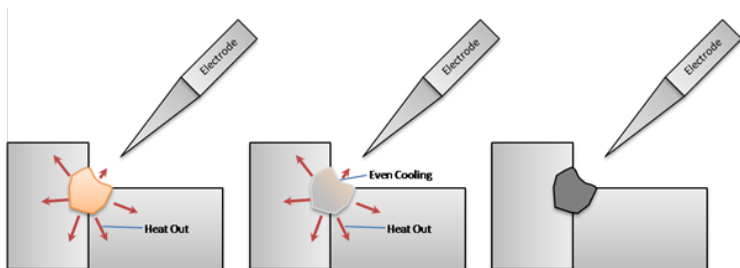

A proper weld joint will help the weld puddle cool uniformly. This will allow even stresses within the weld puddle and prevent weld cracking.

Palladium and high carbon steel cracking is a special case and is difficult to overcome when laser or Pulse Arc welding. If only one weld spot is made, cracking will typically not occur unless the weld joint is stressed by hammering etc. This means that welding over porosity in a Pd piece can be accomplished with the Orion (or laser) to help clean up a ring during the finishing process. However, welding more than one overlapping weld will inevitably lead to cracking (laser or Pulse Arc welder).


Palladium cracking can be thought of as a combination of hot cracking and a new weld puddle crystal structure problem. After a weld the molten Pd re-crystallizes, typically forming a large and weak metal grain structure. When welds overlap the new crystal structure in the previous weld, the new puddle will be weak compared to the original metal. The result is a crack will start at the edge of the new weld where it overlaps with the old weld joint. The crack will then run along the middle of the weld puddle in the direction of the overlapping joints. This is due to the stresses created during the weld puddle cooling process as described above with hot cracking. However, this time, instead of geometry causing cracking, a rip starts in the old crystal structure and propagates during the cooling process, much like ripping a piece of paper. The result – Pd is difficult to weld successfully without breakage. Typically, with Pd, single spots of porosity can be welded and fixed but overlapping welds will crack.

Heating a difficult silver part can help reduce cracking by reducing the temperature difference during the weld cooling process. Part heating will change the spot size for a given amount of weld power. As the part gets hot, less energy is needed to produce the same spot size. Hence, without adjusting the energy down, the spot size will increase. This is very noticeable in silver. Heating will also reduce the hot cracking a part can potentially undergo. The heating process reduces the difference in temperature between the metal's liquid state and solid state (at the heated temperature). This means the stress and shrinkage created during the cooling of the weld puddle will be significantly less.


Pulse Arc Welding: Joint Preparation

The Orion can be adjusted to a weld penetration of up to approximately 1mm in depth (depending on the material). However, deeper penetration usually also means large spot size around 3 to 4 mm. When deep penetration is desired but the weld spot size needs to remain small or the work piece thickness is very thick, additional weld joint preparation may be necessary.

The Y joint is the simplest joint to prepare. Use fill wire of an appropriate diameter to build up material in the joint. Weld with no fill material for the first pass to increase the weld penetration into the joint. Then add fill wire to build up material in the top of the Y until the material is flush with the top surface. Other joint preparations like X, V, etc. are possible and the welding procedure is similar.

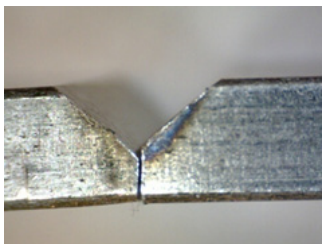

The Y joint is the simplest joint to prepare. First, weld the bottom and top of the work piece without fill wire to help strengthen the joint. Next, use fill wire of an appropriate diameter to build up material in the joint until the top of the Y is filled.

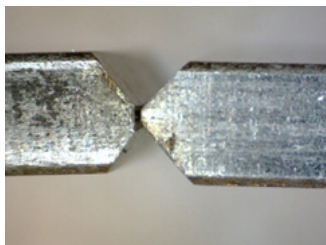

Other joint preparations, such as X and V, are possible. However, if the materials are thin and butt evenly no joint preparation may be needed.

Pulse Arc Welding: Warping

In some specialized applications, precise positioning of the work piece relative to a model is very important. However, during the melting process the weld pool will expand and shrink asymmetrically, meaning that the expansion during melting is less than the shrinkage during cooling. This asymmetric expansion can warp the work piece.

The warping can be used to one's advantage if done correctly. Often the user can simply observe the natural warp in the work piece and place welds to warp the part back into proper alignment. Even if warping is not desired there are steps to avoid this problem.

To do this, start with very small pulse arc weld energies in micro mode. This will minimize the initial warping as you stabilize the work piece. Always alternate sides during the welding process – several welds in a row on one side can exaggerate the warping, while alternating welds will pull the part back and forth eliminating most warping. After the smaller stabilizing welds have been placed you can turn up the power and make the larger welds. It is still a good idea to alternate weld sides during the process.

Pulse Arc Welding: Weld Cleaning

For many applications the weld joint will require very little preparation. Keep the weld area clean and free from debris. Remember that finger oils, etc. will cause blackening around the weld spot. This blackening can easily be wiped away with a clean rag or taken off with a glass brush (one is included with your Orion system), sand blaster or steam cleaner.

During the welding process small amounts of metal will be vaporized from the weld joint and can be deposited elsewhere on the work piece. Typically, this thin film of metal will look black and can easily be cleaned off with a glass brush, ultrasonic cleaner, etc.

What if the welds themselves look black or discolored? This may be an indication of oxidation and can come as a result of too little or too much argon gas flow. If the part is too hot, some metals will readily react with oxygen to form oxide layers. If gas flow is insufficient the

weld spot may be poorly covered and oxygen may be present during the weld. On the other hand, if the protective gas flow is too high, the gas may exit the stylus nozzle in a turbulent state. When the gas flow is turbulent it will “grab” oxygen and other atmospheric gases and bring them inside the protective argon gas shield. This will also lead to the molten weld puddle being exposed to oxygen.

Protective gas rules of thumb

1. 4 – 10 CuFt/Hr is a good argon shield gas rate
2. The shorter the electrode is, the less gas flow is necessary
3. Gas flow may need to be increased if the electrode is lengthened.

However, be aware of possible turbulent gas flow if increased too much. Any discolorations that shows in titanium is an indication of poor shield gas coverage. For this reason it may be helpful to practice on titanium to make sure your gas flow is correct. Adjust your gas to ensure no discoloration in a small titanium weld spot. This will give you confidence of proper argon shielding for other materials.

Chapter 8: Maintenance

Changing and Sharpening Electrodes


As electrodes wear, they will become dull and result in lower quality and less attractive welds. Sharpening or changing them out periodically is important to maintain weld consistency.

The Orion's electrodes are made of lanthanated tungsten. The small amounts of lanthanum found in the electrodes help the tips stay sharp and help improve weld performance. The electrodes are also double ended, meaning that either end can be used for welding. The 1mm electrodes require the included collet with the small hole in the center. This collet is pre-installed in the stylus when shipped. The 1mm electrodes cannot be used with the other zero clearance collet, and similarly the 0.5mm electrodes cannot be used in the collet designed for the 1mm electrodes. Inserting and tightening electrodes into the wrong collet can damage the stylus.

When swapping electrodes, use caution when touching any part internal to the stylus. With extensive use, the internal parts and especially the electrode **WILL BE HOT**. Allow them to cool before attempting to change electrodes. As an added safety precaution, it is recommended to put the Orion in Stop Mode.

To change the electrode, first remove the stylus hull by gently pulling on it. Then loosen the collet cap by twisting it counter-clockwise. Grasp the electrode and push it into the collet to free it, and then pull it out to remove it.

If changing electrode sizes, the collet must also be swapped out. To do this, remove the collet cap by continuing to twist it counter-clockwise. The collet should be loose and will remain in the stylus shaft. If it is not loose, gently tap it out with a screwdriver or other small tool. Replace the collet with the desired one. Replace the collet cap, but do not tighten yet. Insert the fresh electrode into the collet and lock it into place by hand tightening the collet cap in a clockwise direction. Finally, replace the stylus hull by pushing it snugly back into place. See below for an exploded view of the stylus.

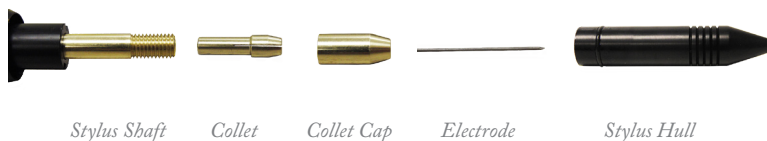

When sharpening electrodes, be sure to remove them from the stylus first. Use the included diamond wheel in a rotary tool to reshape the tips. Be sure to follow all safety instructions provided by the rotary tool manufacturer. When grinding down the tips, attempt to create a 15° angle to the tip as shown below. A sharp tip welds better in much the same way that a sharp pencil writes better. However, grinding a very small flat surface on the tip of the electrode tip will improve the number of welds between tip sharpening.

Cleaning Guidelines

Work pieces: The included fiberglass brush can be used to clean off weld debris and discoloration from weld areas. The bristles are extended and retracted by twisting the top.

General Cleaning Guidelines: Be sure to only perform cleaning on the Orion when it is switched off and unplugged. Never use abrasive cleaning implements on any part of the Orion. Do not blow compressed air into any part of the Orion as this may damage the internal components. Never use any chemicals besides mild detergents on any part of the Orion. Always clean the Orion's parts indirectly by moistening or spraying a soft cloth first, and then use only the cloth to perform the cleaning.

Stylus and Hand Attachments: If discoloration appears at the end of the stylus or hand attachment, it can be wiped off using a moistened cloth.

Cables and Cords: Detach cables and cords from the Orion and wipe them off using a moistened cloth.

Orion's Case and LCD Screen: Wipe gently with a moistened cloth being careful not to let any moisture into the air vents.

Chapter 9: Technical Specifications

Orion 150s Pulse Arc Welder	
Welder Type	Pulse-Arc and Resistance
Weld Modes	3
Pre-Programmed Metal Settings	10
Customizable Save Settings	20
Languages	Multiple
Display	7" Touch Screen
Energy (ws)	2-150 ws
Switching Power Supply	110/240VAC (Auto Detected)
Weld Spot Diameter	0.1 - 3.5mm
Footprint	11.8" x 8.5" x 8.6" (30 x 22 x 22cm)
Weight	15 lbs (6.8 kg)
Stereo Microscope Magnification	5x - 10x
Shutter/Auto Darkening	Shutter System

Chapter 10: FAQ / Troubleshooting / Glossary

Frequently Asked Questions

Can I use any attachment while in Tack Mode?

NO. The pulse-arc welding stylus should never be used while the Orion is in Tack Mode. However, any other attachment can be used. Attachments sold as “tack” welding attachments have been designed to transfer more power to the weld. These attachments help the Orion work as not only a tack welder, but as a permanent fusion resistance welder.

Can attachments labeled “tack” be used with the pulse-arc welding stylus?

Yes*. The pulse-arc welding stylus requires an electrical contact to the workpiece. Tack welding attachments can be used for this purpose.

*Please note that tack welding attachments will also transfer more power to the arc when used for Pulse Arc Mode. This means that you should use lower power settings than you would need with pulse-arc attachments.

I want to get the most power possible out of the Orion. What can I do?

The Orion is designed to deliver a tremendous amount of power in Tack Mode. You can use up to 10AWG cabling to deliver more power to the work area. NOTE: Using larger cabling (ex. 8 AWG or larger) may damage the welder and will void your warranty.

Can I make my own welding attachments?

Yes, the Orion welder is very versatile. You are welcome to make your own pulse-arc and tack / fusion welding attachments.

NOTE: 10 AWG is the largest cable that should be used with your Orion welder. The 10 AWG cable should not be shorter than 3.5 feet (1m).

Can I make permanent welds in Tack Mode?

Yes, the Orion has been designed with Sunstone Engineering's industrial spot welding (resistance welding) technology. By turning up the power and using tack welding attachments the Orion is a fully fledged resistance welder, often called a fusion welder. Alternatively, by using low energy or small cabling, the Orion will act as a temporary tack welder. This temporary tacking allows positioning of a weld piece before permanent welding in Pulse Arc Mode.

What materials can you weld with the Orion?

Orion Jewelry Welders has designed the Orion to weld a wide variety of materials. Some examples include gold, silver, platinum, steel, stainless steel, titanium and virtually all other precious metals. In addition, cobalt alloys, aluminum, tin, brass, and EVEN copper can be welded with the Orion. Even with an ideal welder, some materials and alloys will be difficult to weld. Furthermore, some materials such as zinc should not be welded because they may produce fumes that will make the welding technician sick. Pulse-arc welding of solder is also not advised because of its low melting temperature. Solder will vaporize easily and leave your workpiece looking blackened or burnt.

Can I build-up or add material to a weld location?

Yes, the Orion is very versatile. In Pulse Arc Mode, filler wire can be used to add metal to a weld location. In Tack Mode, filler wire or sheet filler can be permanently affixed to a location. Wire sizes up to and greater than 1mm in diameter can be added. However, the user should select wire diameters that match the size of the feature being welded. Users should also select wire with similar material to that of their workpiece. For example: when re-tipping a gold ring, 0.25mm gold filler wire is an excellent choice. If filling a large gap in a steel workpiece, 1mm steel wire may be more suitable. The Orion has the power and versatility to do weld both of these, and many more applications with ease.

Can the Orion weld silver?

Yes, the Orion has been specifically designed with the more difficult-to-weld materials in mind. Silver requires appreciable power for a sustained period of time. The Orion has enough power and capacity to make quick work of your silver applications.

Can I weld different (dissimilar) metals together?

Yes, in many instances different metals can be welded easily together with the Orion. In pulse-arc welding the weld spot location becomes a new alloy of the two primary metals (this new alloy will adopt new properties that may be better or worse than the primary materials).

Dissimilar metals can also be joined in Tack / Fusion Mode. Again, weld strength and properties will depend on alloy properties.

How do I determine the best power settings for my particular weld application?

In Pulse Arc Mode metals will weld according to thermal conductivity and melting point. For example, a metal with lower thermal conductivity (e.g. stainless steel, titanium, cobalt alloys) will weld easily because the weld heat stays concentrated in the spot. Therefore, less power is required to weld one of these metals than other metals of the same thickness that have a higher thermal conductivity.

Metals with higher thermal conductivity (e.g. copper, silver, gold) will require more power to create the same spot because much of the heat is conducted away quickly.

The melting temperature of the metal is also very important when determining the necessary power setting for a weld. Knowing the approximate or relative melting temperature of your working metal will enable you to estimate the amount of energy required to create a spot. High melting temperature translates to a large amount of energy required. Low melting temperature translates into a smaller amount of energy required to make the weld.

In Tack Mode, power is important but there are two other important factors that need to be remembered. These factors are electrical

conductivity and contact pressure. In Tack Mode the Orion is a full-fledged resistance welder. This means that the Orion uses a metal's electrical resistance to create the weld heat. Metals that conduct electricity well (e.g. copper) are more difficult to weld in Tack Mode and require special Tack attachments to obtain a proper weld. The second important factor when in Tack Mode is the weld contact pressure. The weld contact pressure can be controlled by how much force you apply to the two pieces that are being welded together. The harder you push the pieces together the lower you make the electrical contact resistance between them and the lower the created heat. Conversely, light pressure will result in high contact resistance and high heat.

For all welds, the size and thickness of the metal will play a significant role in the power settings that you choose. Orion Jewelry Welders recommends that users start at a low power and work upwards until an appropriate power setting is found. Please check the Orion Jewelry Welders forum for job specific power setting information and please post your preferred settings as well.

Will I contaminate my base material with the tungsten electrode?

There is a possibility of tungsten contamination when the Orion user forces the welding electrode into the weld material. However, with proper practice using the pulse-arc welding stylus contamination is very unlikely.

Do I need to use Argon to weld?

Argon is necessary to produce a clean and repeatable pulse-arc weld. Without protective argon, oxygen may combine with the weld metal to produce brittle and porous welds. In Tack Mode, however, protective argon is not necessary. Other protective gases can also be used, such as pure nitrogen. However Orion Jewelry Welders recommends high purity argon. This can be purchased at your local welding supply shop.

How do I control weld spot size and weld depth?

The simplified answer: Your weld power adjusts your spot size while your weld time controls penetration. In reality both of these factors (power and time) influence both welding characteristics (spot size and weld depth). However, the above rule-of-thumb will allow good and intuitive control of your welding parameters. It is also important to keep your tungsten electrode sharp to maintain precise control over the characteristics of the weld spot size and weld depth.

How much heat is added to my workpiece?

The Orion is capable of extremely fine welds in Micro Mode. In Micro Mode and low power settings in Pulse Arc Mode, small amounts of energy are added and cause virtually no heat to be added to the workpiece. During small welds involving little energy it is possible to hold the work-piece in hand. For applications that require higher power, the Orion is capable of adding up to 150 Joules of energy to a weld. In Pulse Arc Mode this can be a significant amount of heat and small parts may become extremely hot! Until the user is familiar with the welding characteristics of the Orion, we recommend holding all parts with the pulse-arc attachments (e.g. alligator clip) and not with your fingers.

What is the smallest and largest spot size achievable?

The answer to this question depends greatly on the material being welded. However, spot sizes of down to 0.1 mm and up to 4.0 mm are typical and simple to implement.

How deep can my pulse-arc weld penetrate?

As stated above the answer to this question depends greatly on the material being welded. However, spot depth of down to 1 mm can be achieved.

How long will electrodes last?

Under normal use electrodes will last for approximately 2,000 welds. To ensure that you get the most life out of your electrodes use argon gas for pulse-arc welding and maintain a sharpened electrode tip during the welding process.

Are there special joint preparations needed when pulse-arc welding?

Pulse-arc joint preparation is very similar to that of general “tungsten inert gas” – TIG welding. Some different types of weld preparation include the simple “I” seam (but joint), X, Y and V joints (named for the way they look). The “I” seam may require no filler material, while the X, Y and V require filler material and may require successive layers of material to be added to the joint. For joints where the Orion can penetrate approximately $\frac{1}{2}$ to $\frac{3}{4}$ of the way through the material an “I” seam may be appropriate. The weld location should be cleared of solder as this will reduce weld quality.

Are there special joint preparations needed with tack/fusion welding?

Just as in pulse-arc welding all solder should be removed if a strong metal to metal tack/fusion weld is desired. Tacking can be used to weld solder in place or to temporarily tack a work-piece to a solder layer.

Can I use Tack Mode to place solder granules or pieces before a soldering torch is used?

Yes, this is a very simple process. A variety of hand pieces are available.

Problems

Problem	Solution(s)
My welder won't turn on.	• Verify that the power cord is plugged into the rear panel of the Orion and also into a power outlet. • Verify that the Voltage Selector Switch is correctly set for your region's operating voltage (115VAC/230VAC). • Push the Power Button ALL the way in. • Do NOT use an extension cord with the Orion. • Check the circuit breaker for that particular power receptacle. • Check and replace any blown fuses in the Orion's Fuse Bay. (2 X 10 Amp)
I'm set to Auto Trigger (Touch Detect) but nothing ever happens when I touch the electrode to my work-piece.	• Verify that the work-piece is clipped to or touching an attachment that is securely plugged into one of the + terminals. • Verify that the LCD has the word "Run" and not "Stop" displayed in the upper left corner, and that no menus are displayed. Press the Run/Stop Button to do this. • Verify that the stylus connector is completely inserted into the stylus receiver on the front panel. Disconnect and reconnect it following the procedure given in the Setup Instructions. • The work-piece is not conductive and cannot be arc-welded with the Orion.

Problem	Solution(s)
I can trigger a weld, but it always aborts and does nothing.	• Hold the stylus steady so that the electrode continuously contacts the work-piece. If contact is lost at the end of the third beep, even for an instant, the weld will abort. • Verify that the attachment plugged into the + terminal is making constant contact with the work-piece. • Clean the surface of the work-piece at the weld site. Oil, carbon deposits, and other residue can cause continuity to be lost. • Change the tip retraction to “Feather” in the Advanced Settings Menu. • Verify that the electrode is sharp and not deformed at its tip. Replace or sharpen the electrode as necessary.
My electrode keeps sticking when I weld.	• Verify that the current mode is not Tack Mode. • Hold the stylus so that there is less pressure on the electrode. Very low power settings in Micro Mode will require extremely little pressure on the electrode. • Change the tip retraction to “Moderate” in the Advanced Settings Menu. • Increase the power slightly to add more energy to the arc.
My electrode keeps sticking before I even weld.	• Clean the work-piece at the weld site. • Clean or sharpen the electrode. • Increase the power slightly to add more energy to the arc.
My welds look dirty or blackened.	• Change the flow rate of the shielding gas. 5-20 lpm, as read on the Run Screen, is recommended. • Decrease the length of exposed electrode to bring the work-piece closer to the stylus nozzle. • Verify that there are no gas leaks at the gas receiver on the rear panel of the Orion and also at the stylus connector on the front panel. Note: Gas cannot leak from the stylus connector except during a weld.

Problem	Solution(s)
The Orion still shows that I have gas connected even after I've turned my tank off.	•Even though the tank's valve has been shut, there may still be residual pressure in the gas tube. After the pressure is released, the Orion will display the gas connectivity status correctly.

Glossary

Capacitive Discharge (CD): Refers to the capacitor technology that the Orion uses to produce clean and smooth weld surfaces. See page 16 for a visual aid.

Custom Setting: Refers to the fifteen available “slots” for settings that a user may customize and then save with any ten character name.

Factory Preset Setting: Refers to the fifteen settings that have been preprogrammed into the Orion Master Jeweler Plus.

Hand Attachment: The Orion comes with a variety of hand attachments that can serve as a positive or negative electrode depending on the circumstances.

Joule: See **Watt Second**.

Liters Per Minute (lpm): Used to reference a gas flow rate for shielding gas (argon) as shown on the Run Screen of the Orion Master Jeweler Plus.

Millisecond (Ms): One thousandth of a second (.001). Used to reference the Weld Time or length of a weld pulse.

Plasma: Plasma is an ionized, high temperature gas, in which a certain proportion of electrons are free rather than being bound to an atom or molecule. The ability of the positive and negative charges to move somewhat independently makes the plasma electrically conductive. The Orion's pulsed arc uses this high temperature plasma to create a weld.

Pulse-Arc Welder: Arc Welding uses a welding power supply to create an electric arc between an electrode and the base material to melt the metals at the welding point; Pulse refers to the intermittent nature of the weld arc produced.

Resistance Welding: A process that uses the electrical resistance properties of a metal as a source of heat for welding.

Shielding Gas: Argon, or other inert gas, is used while welding to displace the regular atmosphere from the weld location. This drastically reduces oxidation and carbonization of the metals increasing the weld quality.

Stylus: On the Orion, the stylus is the main hand piece used for arc welding. It safely encloses the electrode and directs the shielding gas to the weld area.

Tack / Fusion Welding: Tack welding can refer to a semi-permanent weld to place parts prior to permanent pulse arc welding. Fusion welding can refer to a permanent resistance weld. See Resistance Welding.

TIG Welding: Also known as Tungsten Inert Gas Welding, is an arc welding process that uses a non consumable tungsten electrode to produce a weld. The weld area is protected from atmospheric contamination by an inert gas such as argon.

Trigger: When using the Orion welder the term trigger is used to denote what method the operator is using to initiate the welding cycle. When the trigger is set to “Automatic” the Orion will automatically detect the contact between the tungsten electrode and the workpiece. Once contact is made the weld sequence will initiate automatically. When the trigger is set to “Foot Switch” the Orion will not initiate the weld sequence until the foot pedal is depressed and there is contact between the tungsten electrode and the workpiece.

Watt Second (Ws): Used to reference weld energy as shown on the Run Screen of the Orion. A Watt second is the same as a Joule. $1 \text{ Ws} = 1 \text{ J}$.

Workpiece: In this manual, workpiece refers to anything being welded or worked on.

Warranty and Contact Information

All Orion products come with a 2-year limited repair warranty. Orion Jewelry Welders will repair all defects in craftsmanship without charge during this time period (excluding the cost of shipping). This warranty does not cover damage caused by improper use of Orion Jewelry Welder products. This warranty does not include consumable items, such as welding electrodes or hand piece attachments. Orion Jewelry Welders is dedicated to keeping our products operating at peak performance for years to come. Any repairs needed after the 2-year warranty period are performed at cost, typically costing \$50-100 USD.

Orion Jewelry Welders offers a 30-day money-back guarantee on all of our products. Before sending a product back please contact Orion Jewelry Welders to receive an RMA number. The RMA number should appear clearly on the outside of the package. Customer refunds are accomplished via check. Please note that a 3% restocking fee will apply to all returns. Equipment damaged by improper use or insufficient shipping precautions will be charged additional fees.

Orion Jewelry Welders is dedicated to providing quality products and support. Please feel free to call with any questions before or after purchasing our products.

Phone: 1-801-658-0015

Toll free: 1-877-786-9353

Fax: 1-866-701-1209

E-mail:

Sales sales@OrionJewelryWelders.com

Tech Support tech@OrionJewelryWelder.com

Web: www.OrionJewelryWelders.com

Mail: Orion Jewelry Welders, a Subsidiary of
Sunstone Engineering R&D Corporation
1693 American Way, Unit 5
Payson, UT 84651 USA