

# **IMC17 / IMCE17** INTEGRATED STEP MOTOR, DRIVER, AND CONTROLLER





USER MANUAL Version 1.06 Thank you for purchasing the IMC17 or IMCE17 integrated motor and controller with microstepping driver. This product is warranted to be free of manufacturing defects for one year from the date of purchase.

# PLEASE READ BEFORE USING

Before you begin, ensure there is a suitable DC Power Supply. **Do not disconnect the DB-9 cable while power is still being applied to the controller.** This will damage the board. Under any circumstances, do not exceed +40 VDC.

# DISCLAIMER

The information provided in this document is believed to be reliable. However, no responsibility is assumed for any possible inaccuracies or omissions. Specifications are subject to change without notice.

RMS Technologies reserves the right to make changes without further notice to any products herein to improve reliability, function, or design. RMS Technologies does not assume any liability arising out of the application or use of any product or circuit described herein; neither does it convey any license under its patent rights, nor the rights of others.

Special Symbols



Indicates a <u>WARNING</u> and that this information could prevent injury, loss of property, or even death (in extreme cases).

# IMC17/IMCE17 User Manual

Product:	IMC17/IMCE17
Version:	1.06
Date:	4/3/2009

Version History			
Version	Date	Description of Changes	
1.00	04/10/2006	New User Manual	
1.01	08/07/2006	Updated specs	
1.02	08/18/2006	Updated specs	
1.03	02/01/2007	Standardization of all user manuals	
1.04	11/02/2007	Updated description of RMS vs Amp Peak current, and explanation of I/O's	
1.05	12/14/2007	Updated designer kits, connections & HyperTerminal instructions	
1.06	4/3/2009	Added new RoHS RS485- 232 card info	

## **TABLE OF CONTENTS**

#### **<u>1. FEATURES</u>** Error: Reference source not found

Designer's Kit with RS232 communication Error: Reference source not found Designer's Kit with USB communication Error: Reference source not found Default Settings Error: Reference source not found

- 2. ELECTRICAL SPECIFICATIONS Error: Reference source not found Digital I/O Specifications Error: Reference source not found Motor Specifications Error: Reference source not found
- 3. OPERATING SPECIFICATIONS Error: Reference source not found Communication Specifications Error: Reference source not found

# 4. MECHANICAL SPECIFICATIONS Error: Reference source not found Dimensions Error: Reference source not found IMCE17 Encoder Pinouts Error: Reference source not found

5. PIN ASSIGNMENTS Error: Reference source not found Connecting to the RS232 card Error: Reference source not found Connecting to the USB card Error: Reference source not found

## **6. CONNECTION SPECIFICATIONS** Error: Reference source not found

Quick Start Error: Reference source not found RS232-485 converter card Error: Reference source not found USB-485 converter card Error: Reference source not found Mating Connectors Error: Reference source not found

## 7. CONFIGURING AND CONTROLLING THE IMC17 Error: Reference source not found

HyperTerminal Setup Error: Reference source not found Setting the Current Error: Reference source not found Connecting Multiple IMC17's Error: Reference source not found Changing the Address of the Controller Error: Reference source not found Connecting Accessories Error: Reference source not found

**Connecting Accessories** Error: Reference source not found **Push Button** Error: Reference source not found **LED or other output** Error: Reference source not found **Optical Sensor** Error: Reference source not found

<u>9. Appendix</u> Error: Reference source not found Connecting to the old non-RoHS RS232 card Error: Reference source not found

# **1. FEATURES**

- NEMA 17, 1.8° step motor integrated with R256 controller/driver
- Operates from +12V to 40V
- Single 2 wire bus linking up to 16 stepper motors via RS485
- 2.0 Amp Chopper (PWM) Driver
- 1/2, 1/4, 1/8, 1/16, 1/32, 1/64, 1/128, 1/256 step resolution
- Stand alone operation with no connection to a PC
- Execution Halt pending switch push button
- Internally Pre-wired for Opto Switch inputs
- Homes to an Opto or Switch closure with a single command
- Fully programmable ramps and speeds
- Two digital I/O and two fixed input channels
- Switch selectable address
- Software selectable "Move" and "Hold" currents
- Hold Current automatically selected upon move completion
- Simple DB9 connection

# Designer's Kit with RS232 communication

Here is the list of components if you have purchased the optional Designer's Kit:

- RS485 to RS232 converter card
- A switch push button
- Opto Sensor

RMS part number: RS232KIT



# Designer's Kit with USB communication

Here is the list of components if you have purchased the optional Designer's Kit:

- USB to RS232 converter card
- A switch push button
- Opto Sensor
- A USB 6 foot long cable

RMS part number: USBKIT



#### **Default Settings**

Function (command)	Description			
Running Current (m)	30% of 2.0 Amps			
Holding Current (h)	10% of max current of 2 Amps			
Step Resolution (j)	256x			
Top Velocity (V)	305175 pps (microsteps/sec)			
Acceleration (L)	L=1000, 6103500 µsteps/sec <sup>2</sup>			
Microstep smoothness (o)	1500			
Outputs (J)	Both are turned off, J0			
Baud Rate	9600 bps			
Table 1: Default Settings				

# **2. ELECTRICAL SPECIFICATIONS**

Supply Voltage:	+12 to +40 VDC
Peak Current:	0.1 to 2.0 Amps

#### Digital I/O Specifications

N	umber of I/O	2
N	umber of Inputs	2
Ir	nput Voltage	+0 VDC to +5 VDC (0 to 24V tolerant, but 5V recommended)
Ir	nput Current	700 mA
P	ull-up Resistors	10k Ω
P	rotection	Static Protection to the microprocessor
LI	ED output	(Pin 9) max of 20mAmps, with 200 ohm internal resistor

#### **Motor Specifications**

Any 4118 series step motor that is rated at 2.0 Amps/Phase or less can be combined into a IMC17 product. General torque specifications are listed below:

Holding Torque (max of 1.0 Amp Holding Current, winding specific)IMC17-S20 to 45 oz-inIMC17-M30 to 63 oz-inIMC17-L40 to 80 oz-in

Steps per Revolution: 400, 800, 1600, 3200, 6400, 12800, 25600, 51200

# **3. OPERATING SPECIFICATIONS**

Maximum Step Frequency	2^24 (pps) or 16.7MHz
Operating Temperature Range	0° to 50° C
Storage Temperature Range	-20° to 70° C

## **Communication Specifications**

IMC17/IMCE17 User Manual

Interface Type	RS485 (RS232 or USB with a converter	card)	
Baud Rate	9600, 19200, or 38400 bps		
# Bits per character	8 Data		
Parity	None		
Stop Bit	1		
RMS Technologies	Page 6	4/	

# **4. MECHANICAL SPECIFICATIONS**

## Dimensions

- **A.** DB-9 connector for I/O, Power and Communication
- **B.** Motor Shaft Length: standard length is 0.94". Customized length is available.
- C. Motor Shaft Diameter: standard shaft diameter is 0.1968". Customized diameter length available.
- D. Overall Body Length: Motor body length is available in various lengths Model IMC17-S (2.69")





\*Index is optional and must be specified during ordering

# **IMCE17 Encoder Pinouts**

<u>NOTE: This is not a closed loop system.</u> The encoder does not feedback to the controller. A separate PLC or controller must be used to communicate between this controller and this encoder.

- A choice of 32 to 1250 cycles per revolution (CPR)
- 2 Channel Quadrature
- TTL Squarewave Outputs
- Optional index (3<sup>rd</sup> Channel)
- E2 US Digital Encoder

Pin Number Function



Table 2:

## Encoder Pinouts 5. PIN ASSIGNMENTS

A DB-9 female connector cable receives power and provides the control connections for the IMC17. The DB-9 cable has a 3 pin connector provided for the converter card in order for the controller to communicate with the PC via an RS232 converter card or USB card. Other wires allow the user to solder and program the switch push button and the Opto Sensor, enabling several options. The I/O's will allow for options such as solenoids, relays, opto isolators, LED's and many other input and output connections. See *Table3* below for details.

Pin #	Color	Function	Input*
1	Red	+V (Main Power In)	
2	Black	I/O	1
3	Brown	RS485B (-)	
4	Black/Whit	RS485A (+)	
	е		
5	Orange	Switch Closure to GND (IN)	4
6	Green	GND (-V of main power in)	
7	White	Opto Sensor Phototransistor (IN)	3
8	Blue	I/O	2
9	Yellow	Opto Sensor LED (Power Out)	
Table 3: Pin Assignments			

Table 3: Pin Assignments

\*Inputs are labeled 1, 2, 3 and 4 for programming the 'Halt' and 'Skip' Commands.



### Connecting to the RS232 card

SP17C pin#	SP17C color	*USB pin#
4	Black/white	1 (RS485A)
6	Green	2 (GND connect to Power Supply Ground)
3	Brown	3 (RS485B)



Figure 2 The RS232 card requires power (7-40VDC)

#### Connecting to the USB card

SP17C pin#	SP17C color	*USB pin#
4	Black/white	1 (RS485A)
6	Green	2 (GND connect to Power Supply Ground)
3	Brown	3 (RS485B)

Table 5





#### RS485 Connection View Figure 3

The USB converter card does not require power (it receives power from the PC). Power is still needed for the IMC17 controller/driver.

# **<u>6. CONNECTION SPECIFICATIONS</u>**

Quick Start DO NOT PLUG IN POWER UNTIL EVERYTHING IS CONNECTED.

RMS Technologies IMC17/IMCE17 User Manual





- 1. The RS232 converter card connects to the IMC17 using the DB-9 cable that is provided to you. Opposite the DB-9 cable is a 3-Pin connector which is placed onto the converter card.
- 2. Your power supply will be connected to the RS232 card where the green header is located. + is for +12-40VDC, - is for the Power Supply Ground. The IMC17 must also be powered via Pin 1 (red wire for Power) and Pin 6 (Green for Ground).
- 3. Connect the RS232 card to your PC with a male to female DB-9 cable.
- 4. Turn your power supply on and follow instructions for using HyperTerminal.

#### **USB-485** converter card



#### (Figure 5)

- 1. The USB converter card connects to the IMC17 using the DB-9 cable that is provided to you. The 3-Pin connector is placed onto the converter card.
- Your power supply will be connected to the IMC17 directly. The USB card is powered via the PC. IMC17's pin1, Red wire is +12-40VDC, pin 6, Green wire is Ground.
- 3. Connect the USB card to your PC using the USB cable provided to you. You will need to download driver files (2 of them). You can find them at: <a href="http://www.rmsmotion.com">http://www.rmsmotion.com</a>
- 4. Turn your power supply on and follow instructions for using HyperTerminal.

## Mating Connectors

ADB-9 cable is provided with every motor. The opposite end has flying leads and a 3-pin connector for RS485 communication.



# 7. CONFIGURING AND CONTROLLING THE IMC17

## HyperTerminal Setup

Please follow these steps in order to properly set up HyperTerminal:

- 1. Open a terminal from your PC by following these steps: Start Menu  $\rightarrow$  Programs  $\rightarrow$  Accessories  $\rightarrow$  Communications  $\rightarrow$  HyperTerminal
- 2. Assign a name for your New Connection
- Determine the correct COM port # by right clicking on "My Computer" and selecting "Properties". Select the "Hardware Tab" and click on "Device Manager".

Note: if you are using the USB485 converter card, first download driver files (found online: <u>www.rmsmotion.com</u>).

You should then see the RMS USB 485 converter card in the "Ports (COM & LPT)" area.

If you are connecting via RS232, most likely it is COM1, "Communications Port".



COM1 Properties			? 🗵
Port Settings			
<u>B</u> its per second:	9600	*	
<u>D</u> ata bits:	8	~	
<u>P</u> arity:	None	*	
<u>S</u> top bits:	1	*	
Elow control:	None	*	
		<u>R</u> estore Defaul	ts
0	K C	Cancel A	pply

- Under 'Connect using', select the COM connection that corresponds to your PC serial port (i.e. COM 1, COM 2, etc.) then click 'OK'
- 5. Set your Port Settings to default (i.e. 9600 baud, 8 data, no parity, 1 stop bit, no flow control)

6. Turn on local echo by going to:

File  $\rightarrow$  Properties  $\rightarrow$  Settings tab  $\rightarrow$  ASCII Setup: Click on the box for "Echo Typed Characters Locally" and click on the box for "Send Line ends with line feeds". Click "OK".

7. Now you can type your commands

ASCII Setup 🛛 🛛 💽			
ASCII Sending			
Send line ends with line feeds			
Echo typed characters locally			
Line delay: 0 milliseconds.			
Character delay: 0 milliseconds.			
ASCII Receiving   Append line feeds to incoming line ends   Eorce incoming data to 7-bit ASCII   Y   Wrap lines that exceed terminal width			
OK Cancel			

Example command: /1A10000R

- This will run unit #1 to the Absolute position 10000
- You can check the address of your driver by checking the dial at the top of the driver. (See the following page for Changing the Address)
- A full list of commands is available in the IMC17 Command List
- Hint: Most common commands to change are:
  - Step resolution (/1j2R sets it to half stepping)
    - Velocity in pulses/sec (/1V1000R sets the speed to 1000 pps)
    - Run current (/1m50R sets the run current to 50%)
    - $\circ$   $\,$  Hold current (/1h20R sets the hold current to 20%)  $\,$
    - Move the motor (/1P800R moves the motor 2 revs if half stepping)

## Setting the Current



# CAUTION! DO NOT SET THE CURRENT ABOVE THE MOTOR'S RATED CURRENT.

In order to set the correct current for your motor, you must program the specified amount in HyperTerminal

Current is set based on the Maximum amount of current the controller board can output, which is 2.0 Amps Peak. Below is a table of how much current will be applied to your motor for each setting.

Percent		Motor's Current Rating (Amps)	Driver's Equivalent Current (Amps)
10%	=	0.14	0.20
20%	I	0.28	0.40
30%	Π	0.42	0.60
40%	=	0.57	0.80
50%	Π	0.70	1.00
60%	=	0.85	1.20
70%	Π	0.99	1.40
80%	=	1.13	1.60
90%	=	1.27	1.80
100%	Π	1.41	2.00

Table 6: Desired Current

# To achieve the equivalent Driver Current (Amps), multiply your motor's rated current by 1.4. Follow these examples:

#### Example One:

You have a motor that is rated at **0.85** Amps, 0.85 Amps x  $1.4 = \sim 1.2$  Amps. Using *Table 3* we would see that 1.2 Amps is 60% of the driver's maximum output current.

Assuming the IMC17 is addressed to Number 1, this is what you'd program: /1m60R

## Example Two:

You have a motor that is rated at **1.0** Amps, and your Controller is addressed to Number 1, this is what you'd program: **/1m70R** 

This will set the controller to 1.4 Amps Peak. How did we get 1.4 Amps?  $\rightarrow$  1.0 Amps x 1.4 = 1.4 A

# **WARNING!:** Setting the Current to a value greater than the Motor's rated current will damage your motor, and may overheat the controller.

# **Connecting Multiple IMC17's**

If using the RS232-to-RS485 converter card, daisy chain all four wires: power, ground, RS485+ and RS485- prior to plugging into the converter card.



Figure 6: Connection using RS232 Converter Card

If using the USB485 converter card, connect all the power and ground lines on the units to the main power supply. Then daisy chain the RS485+ and RS485- lines prior to plugging into the USB485 card. Be sure to also ground the USB485 card with Pin 2, ground.



Figure 7: Connection using USB485Converter Card

# Changing the Address of the Controller

Use a screwdriver to turn the dial so the arrow points to the desired Address. Use this number when programming commands. For example, /1P1000R



*Figure 8: Address Dial Note: New RoHS compliant boards have a* **Black** *dial instead of a Red one.* 

#### **Connecting Accessories**

If you have purchased the Designer's Kit, there is a Red Push Button and an Optical Sensor included. Follow the schematics below in order to properly assemble accessory pieces.

#### **Push Button**



Figure 9: Push Button Schematic

It is best to solder the Push Button to Pin 5 which corresponds to Input 4, then solder Pin 6 (Power Ground) to the other side of the push button.

Input 1	Pin 2		
Input 2	Pin 8		
Input 3	Pin 7		
Input 4	Pin 5		
Table 7			

Any of the four inputs can be connected to a push button. In our example above, pin 5 corresponds to input #4, therefore, if you want to program the motor to wait until this button is pressed in order to begin movement, your program would look something like this:

## /1H04P50000R

**H04** means to Halt until it sees a low, or 0, on input #4 **P5000** move the motor in the positive direction by 5000 steps **R** is to run this string of commands

The motor should send the command P5000 once the button has been pressed, otherwise, it will continue to wait at "H04"  $\,$ 

#### LED or other output

The two I/O lines, pins 2 & 8, can drive an external device such as solenoids, LED's, or switches. The bidirectional I/O's are switches to ground internally, and therefore need to be connected to the +V of the power supply. Below is a recommended connection for lighting an LED with 20 mAmps:



Upon entering command /1J0R, both pins 2 & 8 will output 1 Amps. The 1.2k ohm resistor will limit the current to 20 mAmps into the LED. Select any ohm value to limit your current based on the device that is connected to the output.

I/O's are 24VDC tolerant.

# **Optical Sensor**



Figure 10: Opto Sensor Connection Schematic

The Opto Sensor uses Pins 6, 7, and 9. Use the following table to solder the corresponding wires.

<b>Optical Sensor</b>	DB9 Cable		
Green →	Green		
Black →	Green		
Red →	Yellow		
White →	White		
Table 8			

Use the Z command and state the max number of steps you want it to search for home. The unit will either stop at the opto sensor or when it finishes moving your designated number of steps. For example:

## /1Z500000R

Motor will take 500,000 steps and stop OR Motor will stop once the optical sensor has been interrupted. Only input #3 can work with the optical sensor. The LED output on pin 9 can output a max of 20mAmps (200 ohms internal resistor and 5VDC output)

#### Encoder Usage

The IMCE17 **is not a closed loop system**. The encoder does not connect to the controller/driver. A separate PLC or controller system that can talk to the R256 board and understand the E2 encoder can create a closed loop system.

The IMCE17 can also be used as reference to home by connecting to an US Digital E2 Encoder. The pinouts are as follows:

Pin Number	Function		
1	Ground		
2	Index		
3	Channel A		
4	+ 5 VDC		
5	Channel B		
Table 9			

The E2 encoder requires a separate +5 Volt power supply, as the IMCE17 cannot provide a strong enough source of power.

In order to use the Indexer as a reference to home, connect Pin 2 from the encoder to one of the inputs on the controller. From the controller's side, for best results use Pin 5, the switch closure to ground.

In addition, use a pull-down resistor (10k  $\Omega$ ) to ensure that the controller will recognize the difference between high and low (4.85V and 0.5V).



Figure 11: Encoder Pin Connection Schematic

After successfully connecting the encoder to the controller, now you can program the controller to run continuously. The motor will stop movement when the indexer goes high. This will send the high signal to Pin 5 on the controller.

If using channel 1, use this command to start the homing routine:

## /1P0R

# 8. Troubleshooting & FAQ

## Cannot Type anything in HyperTerminal:

Is the correct COM Port selected? Are you using Windows 95? Windows 95 has had problems with its HyperTerminal. Use an operating system of Windows 98 or higher. Are you working on a Laptop? Sometimes there is a shift in Ground on Laptop Serial Ports. Pin 5 on the Serial Port is Ground. Make sure that this is connected to a true ground.

Did you check the Properties in HyperTerminal? Check the box in Properties  $\rightarrow$  ASCII Settings  $\rightarrow$  ASCII setup  $\rightarrow$  'Echo Typed Characters Locally'.

Is the LED flashing on the bottom of the IMC17? A flashing light indicates it is waiting for Commands and power is OK. Motor shaft should be difficult to rotate.

Check the Converter Card. Use a voltmeter to measure if Power is coming into the card correctly and if power is being supplied to the Controller properly.

#### Can Type in HyperTerminal, but nothing is happening:

Check the LED on the back of the IMC17. If there is no LED lit, the problem may be the Power Supply, check the connections. If you see one LED that flashes on and off about 5 seconds at a time, then power is OK.

Is the IMC17 set to the correct Address? Check the Red Dial (new RoHS compliant boards have a black dial) on the bottom of the unit. The white arrow should be pointing to the corresponding Address. Make sure that the arrow is not between 2 Addresses. Use a small screw to verify that it clicks in place.

Check the Converter Card. Use a voltmeter to measure if Power is coming into the card correctly and if power is being supplied to the Controller.

Assuming the Properties of HyperTerminal are set as described in the Manual (HyperTerminal Setup), does HyperTerminal respond with a string of characters? /0' indicates that the command is terminated

- /0 indicates that the command and that it was reserved
- /0@ indicates good command and that it was received correctly
- /0C indicates that the command is out of range
- /0b indicates bad command

The unit is by default, set to 256 microsteps. Therefore, by typing in a position move of /1P200R, you will not see anything. It takes 51,200 steps to make one revolution, so try a large value, like /1P100000R

# Windows Application: When pressing 'Run' it gives the error - File Already Open:

Another program could also be running at the same time. Click End, and then try again. Sometimes if you are connected through a Network, there are problems with permissions in running programs. Check with your Administrator.

If HyperTerminal is open concurrently, you will receive an error. Only one program can be running at one time.

#### IMC17 will accept commands, but the Motor will stall in the middle of a command:

This means there is not enough current being supplied to the Motor. Use the m command to change the current, or run the Motor at a Lower Speed (V command). Or, make the motor accelerate slower using the L command.

# Halt Command (H01) Issues

There are known issues involving the Halt command (i.e., H01) when stored in memory location zero. Upon power up, the remaining command string after the Halt command might be executed if the user types in a new command. If memory location zero is not being used, the user is advised to always clear everything in memory by typing /1?9. Otherwise, the user may terminate the remaining command string in the buffer by issuing a /1T.

#### I want to use one of the I/Os to turn on a LED to confirm that the motor has finished moving or moved to a certain position. How do I do it?

To turn on a LED to confirm that the motor finished moving you must use the "J" command in the command list section On/Off Drivers. We are assuming the unit executes the command sent. We cannot detect skipping because the set up is open loop. Example: /1P200J10R, is a position move 200 steps, then turn on driver 2.

#### What's the minimum and maximum voltage the RS485 to RS 232 Converter Card can handle?

Min and Max voltage levels: 7 to 40 VDC

#### Using a PLC to communicate with board

After the command, you need to issue a carriage return and linefeed. Example: /1A1000R (absolute position move 1000). After the R, send a 0x0d in hex.

#### **USB** Converter card setup

The USB converter card requires you to install the unit as a hardware. Two files should be downloaded, and they can be found online at www.rmsmtion.com.

You should be able to view the converter card if you go to Properties of "My Computer"  $\rightarrow$  Hardware  $\rightarrow$  Device Manager  $\rightarrow$  Ports.

🗄 🚽 Ports (COM & LPT)

- 🧷 Communications Port (COM1) ECP Printer Port (LPT1)

  - 📝 RMS Motion USB485 (COM9)

The LED's on the USB485 converter card only light up during sending and receiving of a command.

#### **Technical Support for RMS Technologies** By Telephone: 877-301-3609 (Mon.-Fri., 8:00 a.m.-5:00 p.m.) On the Web: www.rmsmotion.com

Our technical support group is glad to work with you in answering your questions. If you cannot find the solution to your particular application, or, if for any reason you need additional technical assistance, please call technical support at **877-301-3609**.

# 9. Appendix

SP17C pin#	SP17C color	RS232 card pin#
4	Black/white	A (RS485A)
3	Brown	B (RS485B)
6	Green	- (GND)
1	Red	+ (PWR)

## Connecting to the old non-RoHS RS232 card



Table 4

Figure 2 The RS232 card requires power (7-40VDC). Power is then sent to the motor via the Red 4-Pin connector.



Figure 5: Connection using RS232

- 5. The RS232 converter card connects to the IMC17 using the DB-9 cable that is provided to you. The red 4-Pin connector is placed onto the converter card.
- 6. Your power supply will be connected to the RS232 card where the green header is located. + is for +12-40VDC, is for the Power Supply Ground.
- 7. Connect the RS232 card to your PC with a male to female DB-9 cable.
- 8. Turn your power supply on and follow instructions for using HyperTerminal.

#### How to connect with old cable:

If you have a cable with a Red 4-Pin connector, simply cut off this connector,strip the wires and reconnect to a 3-Pin connector in the following manner:RMS TechnologiesPage 21IMC17/IMCE17 User ManualRev 1.06

Old 4-Pin cable		Connect	New 3-Pin cable	
<u>Pin #</u>	<u>Color/function</u>	to	<u>Color/function</u>	<u>Pin #</u>
Pin 1	Red (PWR)	$\rightarrow$	No connection	
Pin 2	Green (GND)	$\rightarrow$	Green (GND)	Pin 2
Pin 3	Brown RS485 B (+)	$\rightarrow$	Brown RS485 B (+)	Pin 3
Pin 4	Black/white RS485 A (-)	$\rightarrow$	Black/white RS485 A (-)	Pin 1

#### Peak current versus Amps/Phase

Where does the 1.4 times come from? Current is continuously changing when a motor steps. If the motor is rated for 1.0 A/Ph, it may receive 0 Amps, 1 Amp, 1.4 Amps, or anything in between if you are microstepping. For ease of explanation, we will look at the current waveform when we half step, or set the driver/controller to 2x microstepping.

If we take a look at both the A and B phases, and plot on an X-Y chart of when each phase receives current, and how much it receives, it will look like the chart below. Beginning at position 1, Phase A receives negative current, and Phase B receives positive current. Let's assume it is at coordinate (-1, 1).



The position versus time graph just above, plots only the A Phase, following the eight different steps the motor will make. Current is changing with each position. Recall that a negative in electronics simply means reverse direction of current flow.



Motors have a rated current, or average RMS value since in operation, the current is continuously changing. The most logical way to describe a rating is to take an average, or RMS (root means squared) value. But drivers understand current in terms of peak current, therefore the conversion is: **Amps/Phase x 1.4 = Amps Peak**