



INSTRUCTION MANUAL

3522-50 LCR HITESTER

HIOKI E.E. CORPORATION

Contents

Introduction)	i
Shipping C	heck	ii
Safety		- iii
Points for A	Attention During Use	V
	his Manual	
Chapter 1	Overview	1
1.1	Product Overview	
	Product Features	
	Names and Functions of Parts	
Chapter 2	Before Starting Measurement	7
	Connecting the Power Cord	
	Connecting the Test Leads	
	2.2.1 Establishing the Connections	8
2.3	Turning the Power On and Off	
Chapter 3	Outline of Operation	11
3.1		
3.2	About the Screen	12
	3.2.1 Control Screen Sequence	14
3.3	Basic Measurement	15
	3.3.1 Basic Flow up to Testing of the Sample	15
	3.3.2 Setting the Test Parameters to be Displayed (Cs, D)	
	3.3.3 Setting the Test Frequency	18
	3.3.4 Setting the Constant Voltage Level	
	3.3.5 Setting Open Circuit Compensation	
	3.3.6 Setting Short Circuit Compensation	
	3.3.7 Starting Testing	28
Chapter 4	Detailed Description of Functions	29
4.1	Description of the Screens	29
	4.1.1 The Initial Screen	30
	4.1.2 The Menu Screen and Application Menu Screen	31
4.2	Setting the Parameters to be Displayed	32
	4.2.1 Control Screen Sequence	32
	4.2.2 Details of the Setting Process	32
	4.2.3 Series Equivalent Circuit Mode and Parallel Equivalent Circuit Mode	34

4.3	Setting the Test Frequency	35
	4.3.1 Control Screen Sequence	35
	4.3.2 Selecting the Input Method	36
	4.3.3 Input Using the Ten Key Screen	37
	4.3.4 Input Using the Digit Screen	
4.4	Setting the Test Signal Level	- 39
	4.4.1 Control Screen Sequence	
	4.4.2 Selecting the Level Type	40
	4.4.3 Setting the Open Circuit Voltage (V) Level	42
	4.4.4 Setting the Constant Voltage (CV) Level	
	4.4.5 Setting the Constant Current (CC) Level	44
4.5	Setting the Voltage/Current Limit	
	4.5.1 Control Screen Sequence	
	4.5.2 Details of the Setting Process	46
4.6	Setting the Ranging	- 48
	4.6.1 Control Screen Sequence	48
	4.6.2 Setting the Ranging	49
	4.6.3 Setting AUTO Ranging	49
	4.6.4 Setting the Ranging to HOLD	
4.7	Open Circuit Compensation	
	4.7.1 Control Screen Sequence	52
	4.7.2 Setting the Compensation Method	
	4.7.3 ALL Compensation	
	4.7.4 Spot Compensation	56
	4.7.5 When an Error Message Appears and Compensation Has Stopped	59
	4.7.6 Clearing Compensation Data	59
4.8	Short Circuit Compensation	60
	4.8.1 Control Screen Sequence	
	4.8.2 Setting the Compensation Method	
	4.8.3 ALL Compensation	
	4.8.4 Spot Compensation	65
	4.8.5 When an Error Message Appears and Compensation Has Stopped	68
	4.8.6 Clearing Compensation Data	
4.9	Open Circuit Compensation and Short Circuit Compensation	
41	0 Setting the Trigger	
T. 1	4.10.1 Control Screen Sequence	
	4.10.2 Details of the Setting Process	
		. 2

4.11	Setting the Trigger Delay	74
	4.11.1 Control Screen Sequence	
	4.11.2 Details of the Setting Process	75
4.12	Setting Averaging	77
	4.12.1 Control Screen Sequence	77
	4.12.2 Details of the Setting Process	78
4.13	Setting the Testing Speed	80
	4.13.1 Control Screen Sequence	
	4.13.2 Details of the Setting Process	81
4.14	Setting and Activating the Comparator	
	4.14.1 Control Screen Sequence	
	4.14.2 Setting the Comparator	83
	4.14.3 Returning from Comparator Operation to Normal Testing	86
	4.14.4 Choosing How to Set the Upper and Lower Limit Values	86
	4.14.5 Setting the Upper or Lower Limit Value as an Absolute Value (ABS)	88
	4.14.6 Setting the Upper or Lower Limit Value as a Percentage (%) Relative to a Standard Value	90
	4.14.7 Displaying Measurement Values as Deviations from the Reference value (Δ %)	om 93
4.15	Setting and Activating the Scaling	
	4.15.1 Control Screen Sequence	95
	4.15.2 Setting Scaling	96
	4.15.3 Canceling the Scaling Function	97
	4.15.4 Setting the Compensation Coefficient (a, b)	98
4.16	Panel Save Function	- 100
	4.16.1 Control Screen Sequence	100
	4.16.2 Details of the Setting Process	101
4.17	Panel Load Function	104
	4.17.1 Control Screen Sequence	
	4.17.2 Details of the Setting Process	
4.18	Setting the Beep Sound	
	4.18.1 Control Screen Sequence	
	4.18.2 Details of the Setting Process	
4.19	Enlarged Display of Measurement Values	109
	4.19.1 Control Screen Sequence	
	4.19.2 Details of the Setting Process	
4.20	System Reset	
	4.20.1 Control Screen Sequence	
	4.20.2 Details of the Setting Process	112

4.2	1 Continuous Test Function	114
	4.21.1 Control Screen Sequence	114
	4.21.2 Details of the Setting Process	115
4.22	2 External DC Bias Setting	118
	4.22.1 Control Screen Sequence	118
	4.22.2 Details of the Setting Process	
4.23	3 Setting the Number of Displayed Digits	
	4.23.1 Control Screen Sequence	120
	4.23.2 Details of the Setting Process	121
4.24	4 Setting for Display	
	4.24.1 Control Screen Sequence	
	4.24.2 Details of the Setting Process	
4.25	5 Key Lock Function	124
	4.25.1 Turning the Key Lock On and Off	124
Chapter 5	Applications	125
5.1	Example of Comparator Application	125
	Testing High Impedance Elements	
	Testing an Element in a Circuit	
5.4	External Interference	129
	5.4.1 Countermeasures Against Interference from the Power Supply Line	129
	5.4.2 Countermeasures Against Noise from the Test Cables	
1.5	The EXT I/O Connector	132
	5.5.1 Pinouts for the EXT I/O Connector	
	5.5.2 Signal Lines for the EXT I/O Connector	134
	5.5.3 Circuit Construction and Connections for the EXT Connector	
	5.5.4 Electrical Characteristics of the Output Signals	
5.6	Testing Using EXT I/O	
	5.6.1 Normal Testing	
	5.6.2 Continuous Testing From EXT I/O	
5.7	Supplying DC Bias	
	5.7.1 How to Supply a DC Bias Voltage	145
	5.7.2 How to Supply a DC Bias Current	
5.8	The Residual Charge Protection Function	148
	9442 PRINTER (option)	
	5.9.1 Preparation	
	5.9.2 Connection Method	151
	5.9.3 Control Screen Sequence	152

	5.9.4 Returning from Comparator Operation to Norma Testing	ıl 153
	5.9.5 Screen Copy Mode	154
	5.9.6 Auto Print Mode	155
	5.9.7 Manual Print Mode	155
Chapter 6	Maintenance, Adjustment, and Disposal	157
6.1	Maintenance and Servicing	157
	How to Change the Power Supply Fuse and Chan the Power Supply Voltage	159
6.3	Shipping the Unit	161
6.4	Troubleshooting Checklist	
6.5	Disposing of the Unit	
Chapter 7	Specification and Options	165
7.1	General Specification	165
7.2	Testing Parameters and Calculation Equations	170
7.3	Time Taken for Testing	172
7.4	Options	176
7.5	Test Accuracy	179
Index	I	NDEX 1

Introduction

Thank you for purchasing the HIOKI "3522-50 LCR HITESTER." To obtain maximum performance from the product, please read this manual first, and keep it handy for future reference.

This manual contains information and points for attention which are necessary for safe operation of the unit and for storing it safely in proper operational condition.

Shipping Check

When you receive the product, inspect it carefully to ensure that no damage occurred during shipping. In particular, check the accessories, panel switches, and connectors. If damage is evident, or if it fails to operate according to the specifications, contact your dealer or Hioki representative.

Check the 3522-50 unit and the supplied accessories

Main unit

3522-50 LCR HiTESTER

Supplied accessories

- (1) User manual ... 1
- (2) Grounded power cord ... 1
- (3) Spare fuse for power supply (according to voltage specification) ... 1 100 V, 120 V setting: 250 V F1.0AL 20 mm × 5 mm dia.
 220 V, 240 V setting: 250 V F0.5AL 20 mm × 5 mm dia.



No interface boards and no test cables are supplied with the unit as standard equipment. You should order them separately, according to requirements.

Safety

This manual contains information and warnings essential for safe operation of the product and for maintaining it in safe operating condition. Before using the product, be sure to carefully read the following safety notes.

This product is designed to comply with IEC 61010 Safety Standards, and has been thoroughly tested for safety prior to shipment. However, mishandling during use could result in injury or death, as well as damage to the product. Be certain that you understand the instructions and precautions in the manual before use. We disclaim any responsibility for accidents or injuries not resulting directly from product defects.

The following symbols in this manual indicate the relative importance of cautions and warnings.

Safety symbols

	 The A symbol printed on the product indicates that the user should refer to a corresponding topic in the manual (marked with the A symbol) before using the relevant function. In the manual, the A symbol indicates particularly important information that the user should read before using the product. 	
<u> </u>	Indicates a grounding terminal.	
\sim	Indicates AC (Alternating Current).	
	Indicates a fuse.	
	Indicates the ON side of the power switch.	
0	Indicates the OFF side of the power switch.	
	Indicates that incorrect operation presents a significant hazard that	

	could result in serious injury or death to the user.
	Indicates that incorrect operation presents a possibility of injury to the user or damage to the product.
NOTE	Advisory items related to performance or correct operation of the product.

Measurement categories (Overvoltage categories)

This instrument complies with CAT I safety requirements. To ensure safe operation of measurement instruments, IEC 61010 establishes safety standards for various electrical environments, categorized as CAT I to CAT IV, and called measurement categories. These are defined as follows.

- CAT I Secondary electrical circuits connected to an AC electrical outlet through a transformer or similar device.
- CAT II Primary electrical circuits in equipment connected to an AC electrical outlet by a power cord (portable tools, household appliances, etc.)
- CAT III Primary electrical circuits of heavy equipment (fixed installations) connected directly to the distribution panel, and feeders from the distribution panel to outlets.
- CAT IV The circuit from the service drop to the service entrance, and to the power meter and primary overcurrent protection device (distribution panel).

Higher-numbered categories correspond to electrical environments with greater momentary energy. So a measurement device designed for CAT III environments can endure greater momentary energy than a device designed for CAT II.

Using a measurement instrument in an environment designated with a higher-numbered category than that for which the instrument is rated could result in a severe accident, and must be carefully avoided.

Never use a CAT I measuring instrument in CAT II, III, or IV environments. The measurement categories comply with the Overvoltage Categories of the IEC60664 Standards.



Points for Attention During Use

Follow these precautions to ensure safe operation and to obtain the full benefits of the various functions.

Before turning the product on, make sure the source voltage matches that indicated on the product's power connector. Connection to an improper supply voltage may damage the product and present an electrical hazard. • To avoid electric shock and ensure safe operation, connect the power cable to a grounded (3-contact) outlet. • The 3522-50 contains certain interior components which are at very high voltages. Never remove the cover of the unit, because to do so is very dangerous. • Various connectors are present on the outside of the 3522-50. Never connect any cable to any of these connectors without first turning off the power supply and removing the power cord. Moreover, check the connections carefully in order to avoid any chance of setting up a short circuit etc.. • If anything unusual happens during operation of the unit, turn off the power switch immediately and contact any HIOKI service facility for help, advice and service. • This product should be installed and operated between 0° C and 40° C and 80% RH or less, and less than 2000 m height. • The unit should always be stored in a range of temperature and humidity from -10° C to 55° C, 80% RH or less. • Do not store or use the product where it could be exposed to direct sunlight, high temperature or humidity, or condensation. Under such conditions, the product may be damaged and insulation may deteriorate so that it no longer meets specifications. • To avoid damage to the product, protect it from vibration or shock during transport and handling, and be especially careful to avoid dropping. • Do not use excessive force on the touch panel, and do not use sharp objects that could damage the touch screen. • Before using the product, make sure that the insulation on the probes is undamaged and that no bare conductors are improperly exposed. Using the product in such conditions could cause an electric shock. Replace the test leads and probes specified by Hioki. • Ventilation holes for heat radiation are provided on the side panels of the product. Leave sufficient space around the ventilation holes and install the product with the holes unobstructed. Installation of the product with the ventilation holes obstructed may cause a malfunction or fire. About the guarantee You should be aware that HIOKI cannot accept any responsibility directly or

You should be aware that HIOKI cannot accept any responsibility directly or indirectly if the unit has been incorporated in some other system, or if it is resold to a third party.

Layout of This Manual

Chapter 1	Overview Describes the product generally, and lists the parts and functions.	
Chapter 2	Before Starting Measurement How to connect the power cord etc., and important precautions before operation.	
Chapter 3	Outline of Operation Explains the touch panel and basic testing.	
Chapter 4	Detailed Description of Functions Detailed explanation of the functions.	
Chapter 5	Detailed Description of Applications Various testing applications.	
Chapter 6	Maintenance, Adjustment, and Disposal	
Chapter 7	Specification and Options	
Index		

Chapter 1 Overview

1.1 Product Overview

The HIOKI 3522-50 LCR HiTESTER is an impedance meter which uses a touch panel as the user interface. This interactive touch panel enables extremely easy operation. The test frequency can be set DC and from 1 mHz to 100 kHz at high resolution.

The values of a maximum of any four of the fourteen test parameters, including not only impedance |Z| and phase angle θ , but also L, C, and *R* etc., can be simultaneously displayed upon the screen.

Moreover, this widely applicable impedance meter can be set, not only to a floating voltage setting, but also to a constant voltage setting or a constant current setting.

1

1.2 Product Features

Wide range of test frequencies

The test frequency can be selected from a wide range - DC, 1 mHz to 100 kHz - at high resolution. Frequency dependent assessment of electronic components and materials, etc., is possible.

Constant voltage and constant current testing

Assessment of dependence upon voltage or current is possible.

Outstanding operability

All control operations are initiated via a touch panel on the display. All the keys currently available for use are shown on the display, and can be operated interactively.

Simultaneous display of four parameters

Up to four of the test parameters (such as L,C,R, etc.) can be displayed simultaneously.

Interface

Using a computer, any required parameters can be captured

Changing settings without stopping measurement

Various background settings can be changed without stopping measurement (when an internal trigger is set).

1.3 Names and Functions of Parts





Liquid crystal display

This is a 5-inch liquid crystal display fitted with a touch panel. It also serves to provide input keys.

Power switch

Turns the power for the unit on and off.

Contrast adjustment knob

This knob adjusts the screen contrast. Turning it clockwise decreases the contrast, and vice versa.

Test terminals

There are five test terminals:

H_{CUR} The test signal is supplied to this terminal.

H_{POT} Detected voltage high terminal

L_{POT} Detected voltage low terminal

L_{CUR} Test current detected terminal

GUARD Guard terminal

These test terminals are designed according to the safety standard; Pollution Degree 2, Measurement category I.



Rear View

Power input socket (internally fused type) with voltage selector

Connect the supplied power cord here.

Optional equipment interface

Optional interface boards are connected here.

EXT I/O connector

For input of an external trigger signal and output of comparator results. Compatible with sequencer connection.

Key lock switch

Puts the touch panel keys into the input-not-accepted state.



Left View

Stand

Can be opened to tilt the unit upwards.

Do not apply strong downward pressure with the stand extended. Damage to the stand will result.

Handle

Used when carrying the unit.

Chapter 2²

Before Starting Measurement



2.1 Connecting the Power Cord

🕂 WARNING

- When a 3522-50 unit is ordered, the supply voltage is set in the factory to the value specified, which can be 100 V, 120 V, 220 V, or 240 V. The maximum rated power (with all options fitted) is 40 VA.
- Before turning the product on, make sure the source voltage matches that indicated on the product's power connector.
 Connection to an improper supply voltage may damage the product and present an electrical hazard.
- The power supply voltage for this product is switchable. To avoid electrical accidents, check that the voltage selector is set correctly for the supply voltage you are using. (For details, refer to Section 6.2)
- To avoid electric shock and ensure safe operation, connect the power cable to a grounded (3-contact) outlet.



- 1. Check that the main power switch of the unit is off.
- **2.** Check that the power supply voltage is correct, and connect the proper end of the power cord to the power input socket (with voltage selector) at the rear of the unit.
- **3.** Plug the other end of the power cord into the power supply socket.

Grounding

Use the grounding type (three-wire) power cord supplied. The unit will be grounded automatically.





8

2.2 Connecting the Test Leads

The 3522-50 has five test terminals: H_{CUR} terminal (to which the test signal is supplied); H_{POT} terminal (detected voltage high terminal); L_{POT} terminal (detected voltage low terminal); L_{CUR} terminal (test current detected terminal), and GUARD terminal (connected to the chassis of the unit).



2.2.1 Establishing the Connections

- The maximum voltage which can be applied to the test terminals of the 3522-50 unit is 10 V DC (when the 9268 or 9269 is used, 40 V DC). If a DC voltage greater than this is applied continuously, the unit may be damaged. (For how to apply a DC bias voltage, refer to Section 5.7, "Supplying DC Bias")
- Using a low frequency to measure capacitors with a particular polarity (for example, electrolytic capacitors) results in a reverse bias being applied. In some cases this could damage or destroy the capacitor, and therefore a DC bias should always be applied while making the measurements. Also be sure that the positive terminal of the capacitor is connected to the H_{CUR} terminal on this unit.

If using a test lead set supplied by HIOKI, connect the red leads to the H_{CUR} terminal and to the H_{POT} terminal, and connect the black leads to the L_{CUR} terminal and to the L_{POT} terminal.



The unit is designed and adjusted for 75 Ω coaxial cable test leads. It is best to use HIOKI test leads.



• The connections to the article to be tested are as shown in the following figure.



- No test cables are included with the 3522-50 unit. They must be purchased separately. (For details, refer to Section 7.4, "Options")
- If all four terminals are left floating, the numbers which appear on the display are completely meaningless.

2.3 Turning the Power On and Off

How to turn the power on

1. Turn on the power switch on the front panel. The Initial screen will be displayed on the liquid crystal display.



The test conditions will start off the same as they were when last the power was turned off.

2. Adjust the contrast knob so as to make the display as easy to see as possible.



3. Wait for 60 minutes after turning on the power before starting testing, so as to allow the unit to warm up fully.

How to turn the power off

Turn off the power switch on the front panel. The test conditions will be preserved.

NOTE

Even if the power supply is interrupted because of a power failure or the like, the test conditions (settings) will not be lost; when the power is turned on again, the unit will return to its state just before the interruption.

Chapter 3 Outline of Operation

3.1 About the Touch Panel

Do not use excessive force on the touch panel, and do not use sharp objects that could damage the touch screen.

The 3522-50 uses a touch panel for setting and changing all of the test conditions. Simply by touching the LCD screen at certain areas - termed soft keys - which appear in reverse video, the items associated with these soft keys, and numerical values, can be selected.

In this manual, lightly touching a soft key area on the screen is termed "pressing" a key.



Initial Screen

3

3.2 About the Screen

(1) The Initial screen

- When the power is first turned on, the basic screen for controlling the 3522-50 immediately appears, called the "Initial screen". A maximum of four of the test parameters (L, C, R, etc.) can be set for display, and all of the test conditions can be checked, on this Initial screen.
- The Menu screen can be displayed by pressing the MENU key.
- The Parameter setting screen can be displayed by pressing a parameter key.



Initial Screen

For details, refer to Section 4.1.1, "The Initial Screen."

(2) The Menu screen

The Menu screen is used for selecting whichever of the test conditions you want to change. Pressing one of the keys on this screen changes over the display to the appropriate test condition setting screen.





(3) The Parameter setting screen

- Pressing a parameter key on the Initial screen causes the Parameter setting screen to be displayed, using which the test parameters to be displayed (up to a maximum of four) are selected.
- By pressing a key for any test parameter, that parameter is set to be displayed, and the unit automatically returns to displaying the Initial screen again.



Parameter Setting Screen

(4) The Test condition setting screen

- This screen is for changing a test condition (for example, the test frequency).
- When you have finished setting the test condition, press the **EXII** key, and the unit will return to displaying the Initial screen again.



Test Condition Setting Screen (Test frequency setting screen)

3.2.1 Control Screen Sequence

- The basic flow for the change of screens as control operation is performed is as follows.
- The measurement values can be checked in real time on all of the screens.



Initial Screen

The measured values of any of the test parameters can be displayed for checking (up to a maximum of four) and all of the test conditions can be checked on the Initial screen.

To make a change to the test conditions: Press the **NEWD** soft key, and the Menu screen will be displayed.

Select the test condition to alter on the Menu screen (for example, when changing the test frequency).

Press the **FRO** soft key, and the Frequency setting screen will be displayed.

Set or change that test condition on the appropriate Test condition setting screen.

When the test condition setting is complete, press the **EXIT** soft key, and the display will return to displaying the Initial screen.

3.3 Basic Measurement

In order to explain the basic operation of the 3522-50 unit, as an example, the procedure will be shown for establishing the following settings:

Example	Sample to be tested Capacitor	85 µF
	Test conditions	
	Test frequency	120 Hz
	Constant voltage level	0.4 V
	Open circuit compensation setup	ALL compensation
	Short circuit compensation setup	ALL compensation
	Parameters to be displayed	
	Capacitance Cs, Loss coefficient	D

The trigger is internal. The 3522-50 unit, when it is dispatched from the factory, is in the internal trigger state.

3.3.1 Basic Flow up to Testing of the Sample

The basic flow up to starting testing of the sample is as shown in the following chart in correspondence to the applicable reference sections:



NOTE

Reference sections

3.3.2, "Setting the Test Parameters to be Displayed (Cs, D)"

- 3.3.3, "Setting the Test Frequency"
- 3.3.4, "Setting the Constant Voltage Level"
- 3.3.5, "Setting Open Circuit Compensation"
- 3.3.6, "Setting Short Circuit Compensation"

3.3.2 Setting the Test Parameters to be Displayed (Cs, D)

Here the first (i.e., the uppermost) parameter key will be set to capacitance Cs, and the third parameter key will be set to loss coefficient D.



Before Setting

Setting procedure







Parameter Setting Screen

1. In order to change the first parameter displayed on the Initial screen, press the first (uppermost) parameter key.

2. The Parameter setting screen is displayed. (The test parameter (currently Z) to which the pressed parameter key currently corresponds is shown in black characters on a white ground, i.e. in nonreversed video).

Press **Cs** on this screen, and the display will automatically return to displaying the Initial screen, with capacitance Cs being displayed as the first parameter.

If you press the **EXIT** key on this screen without pressing **Ls**, no new setting is performed, and the display just returns to displaying the Initial screen.

NOTE

Any of the test parameters (Z, L, C, R, etc.) (up to a maximum of four) can be set to correspond to any of the four parameter keys.



Initial Screen



Parameter Setting Screen



Initial Screen

4. The Parameter setting screen is displayed. Press D on this screen, and the display will automatically return to displaying the Initial screen, with the loss coefficient D being displayed as the third parameter.

NOTE

If you press the **OFF** key, instead of pressing a soft key corresponding to any one of the test parameters, then the display of the test parameter to which the third parameter key currently corresponds will be canceled.

5. Now the Initial screen is displaying the values of the parameters Cs and D.

For details, refer to Section 4.2, "Setting the Parameters to be Displayed".

3.3.3 Setting the Test Frequency

The following explanation shows how to set the test frequency to 120 Hz, as an example.



Setting procedure



 Cs 10.209µF
 FRE0
 LEVEL
 LIMIT

 OFF
 OFF
 SHORT
 SHORT

 D 0.11660
 FRIG
 DELAV
 AVE

 OFF
 APPLI MENU
 * SELECT MENU *
 EXIT

Menu Screen

1. On the Initial screen, press the **MENU** key, and the Menu screen will be displayed.

2. Press the **FRED** key on the Menu screen, and one of the frequency setting screens will be displayed.

There are actually two frequency setting screens. The display can be switched over between these two screens just by pressing a particular soft key.

The Digit screen

The Ten key screen



Digit Screen

The test frequency is input using the **1** and digit keys.

A numerical value for the test frequency is input directly.



Ten Key Screen

• In this case, because it is desired to input the

value 120 Hz for the test frequency directly as

a numerical value, the Ten key screen is used.



Ten Key Screen



• When the Digit screen is being displayed, pressing the **E** soft key causes the display to switch over to the Ten key screen.



3.3 Basic Measurement



3. Press the keys 1, 2, and 0 in succession on the ten key pad.
If you make a mistake, press the C key to clear the value entered so far, and start again.
Then press the 2 key, and check that the test frequency value input is indeed 120 Hz.

NOTE

The numerical value input for the test frequency cannot be checked until one of the keys <u>kHz</u>, <u>Hz</u>, and <u>Hz</u> has been pressed. If you press the <u>EXIT</u> key before pressing the <u>Hz</u> key, the display will return to displaying the Initial screen with the previously set value for the test frequency still current.

4. When the setting has been established as above, press the **EXIT** key, and the display will return to the Initial screen.





For details, refer to Section 4.3, "Setting the Test Frequency".

3.3.4 Setting the Constant Voltage Level

The following explanation shows, as an example, how to set the value for the constant voltage level to 0.4 V.



Before Setting

Setting procedure



Св85.072µF	RANGE
D0.11660 #F	TRIG DELAY AVE
* SELECT MENU *	APPLI MENU EXIT

Menu Screen

1. On the Initial screen, press the **MENU** key, and the Menu screen will be displayed.

2. Press the *LEVEL* key on the Menu screen, and the Level setting screen will be displayed.



Level Setting Screen







Initial Screen

- 3. Because you for example want to set the value for the constant voltage (CV), press the **CV** key. Then check that the **CV** key changes to black figures on a white ground (i.e., in non-reversed video), which confirms that constant voltage has been properly selected.
- 4. Using the and the keys, set the displayed constant voltage value to 0.400.
 - The corresponding digit is incremented. (If you hold this key down continuously, the corresponding digit increments continuously.)
 - The corresponding digit is decremented. (If you hold this key down continuously, the corresponding digit decrements continuously.)
- 5. When the setting has been established as above, press the **EXII** key.

NOTE

- With this constant voltage (CV) setting, the testing will be performed with the voltage between the terminals of the sample being tested being kept constant at 0.400 V.
- The accuracy of this constant voltage is $\pm 10\% \pm 10$ mV.

For details, refer to Section 4.4, "Setting the Test Signal Level"
3.3.5 Setting Open Circuit Compensation

The following explanation shows, as an example, how to set up ALL open circuit compensation, with which open circuit compensation values for all of the test frequencies are determined and adjusted.













1. Arrange the test leads as closely as possible to their configuration in which measurement will be performed, and make sure that the HIGH and LOW leads are not contacted together.

For details, refer to Section 4.7.2, "Setting the Compensation Method".

- 2. On the Initial screen, press the **MENU** key, and the Menu screen will be displayed.
- **3.** Press the **OPEN** key on the Menu screen, and the Open circuit compensation screen will be displayed.



4. Press the **ALL** key so as to select ALL compensation, with which open circuit compensation values for all the test frequencies will be determined and adjusted.

Open Circuit Compensation Screen



Confirmation Screen



5. A Confirmation screen will be displayed for

Check again - are the test leads definitely out of mutual contact ?

confirmation of ALL open circuit compensation.

NOW ADJUSTING	
20%	
STOP	
* OPEN ADJUST *	

Data Determination Screen

6. When you press the RUN key, the ALL open circuit compensation process starts.

After about 2 minutes, the determination and adjustment of the open circuit compensation values is complete.

If an error message appears, refer to Section 4.7.5.



Confirmation Screen



Initial Screen

7. If the compensation process has terminated satisfactorily, a Confirmation screen as shown to the left is displayed.

The residual component at the frequency of 100 kHz with the test cables separated (open circuited), and its phase angle, are shown on the screen. These values are required for use with the test range on HOLD. (For details, refer to Section 4.9, "Open Circuit Compensation and Short Circuit

Compensation".)

8. After checking the open circuit residual component and its phase angle, press the key, and the display will return to the Initial screen.

For details, refer to Section 4.7, "Open Circuit Compensation".

3.3.6 Setting Short Circuit Compensation

The following explanation shows, as an example, how to set up ALL short circuit compensation, with which short circuit compensation values for all of the test frequencies are determined and adjusted.





Setting procedure



Menu Screen

- 1. Arrange the test leads as closely as possible to their configuration in which measurement will be performed, and short circuit together the HIGH and LOW leads using a shorting bar. (Refer to Section 4.8.2 for information about the shorting bar.)
- 2. On the Initial screen, press the **MENU** key, and the Menu screen will be displayed.
- **3.** Press the **SHORT** key on the Menu screen, and the Short circuit compensation screen will be displayed.



Short Circuit Compensation Screen



Confirmation Screen

4. Press the ALL key so as for example to select ALL compensation, with which short circuit compensation values for all the test frequencies will be determined and adjusted.

5. A Confirmation screen will be displayed for confirmation of ALL short circuit compensation. If it is OK to proceed, press the RUN key.

NOTE

Check again - are the test leads properly short circuited together by the shorting bar?

	NOW ADJUSTING	
	20%	
	STOP	
* SHOR	RT ADJUST *	

Data Determination Screen

6. When you press the RUN key, the ALL short circuit compensation process starts.

After about 2 minutes, the determination and adjustment of the short circuit compensation values is complete.

If an error message appears, refer to Section 4.8.5.



Confirmation Screen



Initial Screen

7. If the compensation process has terminated satisfactorily, a Confirmation screen as shown to the left is displayed.

The residual component at the frequency of 100 kHz with the test cables connected together (short circuited), and its phase angle, are shown on the screen.

These values are required for use with the test range on HOLD. (For details, refer to Section 4.9, "Open Circuit Compensation and Short Circuit Compensation".)

8. After checking the short circuit residual component and its phase angle, press the key, and the display will return to the Initial screen.

For details, refer to Section 4.8, "Short Circuit Compensation"

3.3.7 Starting Testing

When the operations described above have been completed, the test conditions have been for example set as follows:

Test conditionsFrequency120 HzConstant voltage level0.4 VOpen circuit compensationALL compensationShort circuit compensationALL compensation

Parameters displayed Capacitance Cs, Loss coefficient D

Connect the actual sample to be tested to the test cables, to start testing.

Chapter 4 Detailed Description of Functions

4.1 Description of the Screens

The Initial screen, Menu screen, Application menu screen will be explained.

4

4.1.1 The Initial Screen

The Initial screen is the screen which is initially displayed when the power to the 3522-50 unit is turned on.

The monitor display on this screen enables the user to perform testing while checking the values of all the test conditions. (The monitor display varies according to the test signal level setting.)



- 1. Measured values
- 2. Parameter keys (The parameters displayed can be selected using these keys.)
- 3. FREQ Test frequency
- 4. V Test signal control level
- 5. Vmoni Voltage value between the terminals of the test sample
- 6. I-LIM Measurement current limit value
- 7. Imoni Current value flowing through the test sample
- 8. RANGE Test range
- 9. OPEN Open circuit compensation setup
- 10. SHORT Short circuit compensation setup
- 11. TRIG Trigger mode
- 12. DELAY Set value for the trigger delay
- 13. AVE Number of times for averaging
- 14. SPEEDTesting speed

MENL



Even if the 3522-50 unit is being used outside the limits of its specification, test values are sometimes displayed. In this case, the following type of indication appears on the display.



This means that the 3522-50 is operating outside the range for which the accuracy of the measured values can be assured.

- In this case, you should consider the following possible causes, and you should either change the test conditions while checking the accuracy assured ranges (with reference to Section 7.5, "Test Accuracy"), or you should consider the measured values as values for reference only, because their validity is somewhat doubtful.
- Perhaps the test signal controlled level is too low. Increase the test signal level.
- Perhaps the present test range (if ranging is set to HOLD) is not suitable. Either set the test range to the most suitable one by using AUTO ranging, or change the test range manually.
- When powering on again, the screen when the power has been turned off on the following screens is displayed.

Initial screen, Comparator screen, Scaling screen, Magnification screen, Continuous test screen

4.1.2 The Menu Screen and Application Menu Screen



To display the Menu screen

Press this MENU key on the Initial screen.

It is possible to access various setting screens for changing the various test conditions from this screen.

To display the Application screen



Press the **APPLI MENU** key on the Menu screen. It is possible to access the various application function setting screens from this screen.



	1. Measured values		
	2. Parameters displayed		
	3. FREQ	Test frequency setting	
	4. LEVEL	Test signal level setting	
0	5. LIMIT	Limit setting	
U	6. RANGE	Range setting	
1	7. OPEN	Open circuit compensation setting	
_	8. SHORT	Short circuit compensation setting	
2	9. TRIG	Trigger setting	
	10. DELAY	Trigger delay function	
	11. AVE	Averaging setting	
	12. SPEED	Test speed setting	



13. COMP ON	Comparator function
14. SCALE ON	Scaling function
15. CONT MEAS	S Continuous test function
16. LOAD	Panel load function
17. SAVE	Panel save function
18.	Beep sound setting
19. RESET	System reset
20. EXT DC BIA	AS External DC bias setting
21. A	Magnification display function
22. DISP	Display setting
23. DIGIT	Display digits setting

4

4.2 Setting the Parameters to be Displayed

From among the total of 14 different test parameters a maximum of four can be selected for their values to be simultaneously displayed on the screen, arranged in any desired order.

4.2.1 Control Screen Sequence



4.2.2 Details of the Setting Process

- 1. Ensure that the Initial screen is being displayed.
- **2.** Decide in which of the four positions on this Initial screen you wish to change the parameter which is being displayed, and then press the parameter key in the corresponding position.

The Parameter setting screen will be displayed, as follows:

The position in which you wish to change the parameter displayed

The parameter currently being displayed in this position appears in black letters on white (non-reversed video).



The parameters set to be displayed can only be changed by starting from the Initial screen.

- **3.** The parameter which you wish to display in the chosen position can be chosen from the following list by pressing the corresponding key. The screen will then automatically revert to the Initial screen, with the desired new parameter being displayed in the appropriate position.
 - Z impedance (Ω)
 - *Y* admittance (S)
 - θ impedance phase angle (°) *1
 - Cs static capacitance in series equivalent circuit mode (F)
 - Cp static capacitance in parallel equivalent circuit mode (F)
 - D loss coefficient=tan δ
 - Ls inductance in series equivalent circuit mode (H)
 - Lp inductance in parallel equivalent circuit mode (H)
 - Q Q factor
 - Rs effective resistance in series equivalent circuit mode (Ω)=ESR *2
 - *R*p effective resistance in parallel equivalent circuit mode (Ω) *2
 - *G* conductance (S)
 - *X* reactance (Ω)
 - B susceptance (S)

OFF display no test parameter in the chosen position

- *1 The phase angle θ is shown based on the impedance Z. When measuring based on the admittance, the sign of the phase angle θ must be reversed.
- *2 When measuring direct resistance (DC measurement), if *Rs* or *Rp* is selected the direct resistance (DCR) is displayed. However for others parameter measurement, it is not displayed.
- NOTE

All parameters excluding the impedance phase angle θ is displayed as absolute value. To check the polarity, confirm the impedance phase angle θ . For details, see Section 7.2, "Testing Parameters and Calculation Equations".

Press the **EXIT** key in order to cancel this setting process and return to the Initial screen with the original parameter still displayed as before.

4.2.3 Series Equivalent Circuit Mode and Parallel Equivalent Circuit Mode

The 3522-50 unit analyses the test sample in terms of a pure inductive component (L), an equivalent circuit construction composed of a pure capacitive component (C), and a pure resistive component (R), and calculates as though these components were connected in series, or alternatively connected in parallel. Therefore, it is possible for the user to select either a series equivalent circuit mode or a parallel equivalent circuit mode for this conceptual connection together of these L, C, and *R* components.

When the impedance of the sample being tested is relatively high, Lp, Cp, and *R*p for the parallel equivalent circuit mode should be selected manually, and when the impedance of the sample being tested is relatively low, Ls, Cs, and *R*s for the series equivalent circuit mode should be selected manually. Generally, for a device such as an electrolytic capacitor or the like with a high D value (i.e., a low Q value), the test values obtained when testing using series equivalent circuit mode. The greater the resistance component in the sample being tested, the more this difference in the test values appears.

For example, the test values for capacitors of the same capacitance which have different values of D in series equivalent circuit mode and in parallel equivalent circuit mode may be as follows:

	Series equivalent circuit mode	Parallel equivalent circuit mode
D = 0	C	C
D = 0.1	1.005C	0.995C
D = 0.5	1.118C	0.8944C

(Where C is the static capacitance)

Therefore it is necessary for the user clearly to understand the setting of this test mode, in order properly to assess test samples.

In general, parallel equivalent circuit mode should be used for elements which have relatively low capacitance and high impedance such as film capacitors and ceramic capacitors, since parallel resistance can cause great loss in this case; while series equivalent circuit mode should be used for elements which have relatively high capacitance and low impedance such as electrolytic capacitors, since series resistance can cause great loss in this case.

V L



Series equivalent circuit

Parallel equivalent circuit

4.3 Setting the Test Frequency

Sometimes the value for the test frequency should be changed according to the type of sample being tested.

There are two types of method for inputting the frequency for testing. Either of two different screens can be selected, according to which of these two input methods is to be used. These two screens are called the Ten key screen and the Digit screen.

The Ten key screen The Digit screen

The numerical value for the test frequency is directly input using the numeric keypad (on the touch panel). Each digit of the test frequency can be varied by using the appropriate up and down keys.

4.3.1 Control Screen Sequence



4.3.2 Selecting the Input Method

- 1. On the Initial screen, press the **MENU** key, and the Menu screen will be displayed.
- 2. Press the **FREO** key on the Menu screen, and the display will change over to the one of the Frequency setting screens which was previously used.
- **3.** The display can be switched over between these two Frequency setting screens just by pressing the soft keys shown in the figure.



4.3.3 Input Using the Ten Key Screen

1. Access to the following Ten key screen.



- **2.** Input the new test frequency directly using the numeric keypad. Frequency range which can be set: 0.000 Hz (DC) to 100.0 kHz
- (NOTE)

If you attempt to set a test frequency greater than 100 kHz, it will automatically be reduced to 100 kHz.

If you attempt to set a test frequency lower than 1 mHz, it will automatically be increased to 0 Hz (DC).

When measuring at 0 Hz (DC), and if the display parameter is set to Rs or Rp, the direct resistance (DCR) is displayed. The measured values for other parameters are not displayed.

When the **DC** key is pressed, the frequency is immediately changed to 0 (DC).

If you make a mistake during input, press the **C** key to cancel the input so far, and start again.

- 3. When you have completed inputting the numerical value for the frequency, press the appropriate units key to confirm the displayed frequency. If you change screens before confirming the frequency you have set, the frequency will not be changed.Until the numerical value for the frequency has been input, the units keys cannot be used.
- 4. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

4.3.4 Input Using the Digit Screen

1. Access to the following Digit screen.



The digit keys (If held down continuously, the corresponding digit increments or decrements continuously.) (If the limit for the corresponding digit is reached, these keys change to non-reversed video and become inactive.)

The current situation can be checked using the monitor display.

2. Change the test frequency using the digit keys. Frequency range which can be set: 0.000 Hz (DC) to 100.0 kHz If you try to go out of this range, the relevant digit key goes into nonreversed video and becomes inactive.

When measuring at 0 Hz (DC), and if the display parameter is set to Rs or Rp, the direct resistance (DCR) is displayed. The measured values for other parameters are not displayed.

3. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

NOTE

4.4 Setting the Test Signal Level

The value of the test signal level may change according to the sample which is being tested. With the 3522-50, it is possible to vary the level of the test signal applied to the object under test over a wide range using the following three methods:

Set open circuit voltage (V) Set constant voltage (CV)

Set constant current (CC)

The value of the open circuit voltage is set. The value of the voltage between the terminals of the object under test is set. The value of the current flowing through the object under test is set.

4.4.1 Control Screen Sequence



4.4.2 Selecting the Level Type

Be absolutely sure not to change over between constant current (CC) level and constant voltage (CV) level with the test terminals still connected to the sample to be tested. Doing so may damage the test sample.



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **LEVEL** key on the Menu screen to display the Test signal level setting screen.



test signal level is shown in non-reversed video.

The digit keys (If held down continuously, the corresponding digit increments or decrements continuously.) (If the limit for the corresponding digit is reached, these keys change to non-reversed video and become inactive.)

The current situation can be checked using the monitor display.

- **3.** The method of control for the test signal level can be selected from the following three:
 - Set open circuit voltage (V) The value of the open circuit voltage is set.
 - Set constant voltage (CV) The value of the voltage between the terminals of the object under test is set.
- Set constant current (CC) The value of the current flowing through the object under test is set.

NOTE

The accuracy of testing varies according to the test signal level. Check the accuracy table in Section 7.5.



• Even if the 3522-50 unit is being used outside the limits of its specification, test values are sometimes displayed.

In this case, the following type of indication appears on the display, indicating a value which is not guaranteed.



In this case, you should consider the following possible causes, and you should either change the test conditions while checking the accuracy assured ranges (with reference to Section 7.5, "Test Accuracy"), or you should consider the measured values as values for reference only, because their validity is somewhat doubtful.

- Perhaps the test signal level is too low, increase the test signal level.
- If the current measurement range (during HOLD setting) is not appropriate, set again in the AUTO range, or change the range by manual.

About the test signal level

The relationship between the test signal level for the 3522-50 and the object to be tested is as follows:



Open circuit voltage level (V)

This voltage value is the value which is applied across the two terminals of the series combination of the object which is being tested and the output impedance. As for the voltage which is applied across the terminals of the object which is being tested (by itself), if required, you should either check the monitor voltage value, or select constant voltage (CV) and set a voltage value across these terminals.

Constant voltage level (CV)

You should select this if you wish to set the voltage across the terminals of the object to be tested to a constant value.

Constant current level (CC)

You should select this if you wish to set the current passing through the object to be tested to a constant value.

4.4.3 Setting the Open Circuit Voltage (V) Level



1. Press this key to set open circuit voltage (V), and the monitor display will change immediately.



The digit keys (If held down continuously, the corresponding digit increments or decrements continuously.) (If the limit for the corresponding digit is reached, these keys change to non-reversed video and become inactive.)

- 2. Change the set voltage value using the digit keys.
- 3. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

4.4.4 Setting the Constant Voltage (CV) Level



1. Press this key to set constant voltage (CV), and the monitor display will change immediately.



The digit keys (If held down continuously, the corresponding digit increments or decrements continuously.) (If the limit for the corresponding digit is reached, these keys change to non-reversed video and become inactive.)

- 2. Change the set constant voltage value using the digit keys.
- **3.** When the setting has been established, press the **EXIT** key to return to the Initial screen.

NOTE

Testing some types of sample is not possible using constant voltage. In this case, the following symbol appears on the display:



In such a case, constant voltage testing is not performed. Change the constant voltage level to a value not more than the value being shown as Vmoni.

Reference When a 1 μ F capacitance is measured at 10 kHz, the CV operation range can be obtained as follows. Sample impedance Zm becomes as follows:

 $Zm = Rm + jXm = 0\Omega - j15.9\Omega$ Xm=-1/(2 fC)

The impedance Zm' observed from the generator is as follows:

 $Zm' = Ro + Zm = 50\Omega - j15.9\Omega$ Ro: Output resistance (50 Ω)

Accordingly, the voltage Vm across both leads of the sample is as follows:

 $Vm = |Zm| \times Vo/|Zm'|$ Vo: generator output

 $= 15.9\Omega \times \text{Vo}/52.5\Omega$

Because the generator output voltage range is 10 mV to 5 V for 10 kHz, the CV operation range per the above expression is Vm = 3.03 mV to 1.51 V

4.4.5 Setting the Constant Current (CC) Level



1. Press this key to set constant current (CC), and the monitor display will change immediately.



The digit keys (If held down continuously, the corresponding digit increments or decrements continuously.) (If the limit for the corresponding digit is reached, these keys change to non-reversed video and become inactive.)

- 2. Change the set constant current value using the digit keys.
- **3.** When the setting has been established, press the **EXIT** key to return to the Initial screen.

NOTE

Testing some types of sample is not possible using constant current. In this case, the following symbol appears on the display:



In such a case, constant current testing is not performed. Change the constant current level to a value not more than the value being shown as Imoni.

Reference When a 10 mH impedance is measured at 1 kHz, the CC operation range can be obtained as follows. Sample impedance Zm becomes as follows:

 $Zm = Rm + jXm = 0\Omega + j62.8\Omega$ Xm: 2 fL

The impedance Zm' observed from the generator is as follows:

 $Zm' = Ro + Zm = 50\Omega + j62.8\Omega$ Ro: output resistance (50 Ω) Accordingly, the voltage Im across both leads of the sample is as follows:

Im = $Vo/|Zm'| = Vo/80.3\Omega$ Vo: generator output

Because the generator output voltage range is 10 mV to 5 V for 1 kHz, the CC operation range per the above expression is $Im = 125 \ \mu A$ to 62.3 mA.

4.5 Setting the Voltage/Current Limit

Depending on the test signal level, in some cases it is possible to damage the sample which is being tested by applying to it a voltage or a current greater than its rated value. Using the voltage/current limit function, it is possible to set a limit value which the voltage applied to the sample under test, or alternatively the current flowing through it, should not exceed; and thereafter the 3522-50 unit will limit the voltage, or current, so as keep it below this specified limit value.

When open circuit voltage (V) or constant voltage (CV) is set: A current limit can be set. When constant current (CC) is set :

A voltage limit can be set.

4.5.1 Control Screen Sequence



4.5.2 Details of the Setting Process



1. Press the MENU key on the Initial screen to display the Menu screen.

2. Press the **LIMIT** key on the Menu screen to display the one of the Limit setting screens.



The present situation can be checked using the monitor display. The monitor display is different for V, CV, and CC.

NOTE

The setting for voltage or current limit changes automatically to current or voltage limit, according to the present Test signal level setting. Therefore, first set the test signal level, and thereafter set the voltage or current limit. For details of the Test signal level setting, refer to Section 4.4.

3. Input the limit value using the digit keys. The ranges within which the limit values can be set are as follows.

Test signal control level	Limit set	Setting range
V, CV	Current limit	0.01 mA to 99.99 mA
CC	Voltage limit	0.010 V to 5 V

When any digit key would take the limit value outside these ranges, it changes to non-reversed video (black characters upon a white ground).



The limit value is not made effective just by setting it, if the limit function is turned off.

4. The limit function can be turned on and off by pressing the appropriate one of the following keys (The key which has been pressed changes to non-reversed video).

: The limit function is turned on.

: The limit function is turned off.

Whether the limit function is on or off can be checked from the change on the monitor display.

NOTE

When the limit function is on in the following cases, " \bigcirc " or " \bigcirc " are displayed.

" 🕑 " display

If the voltage or current which is applied to the sample under test exceeds the limit value (the current exceeding the limit value flows through the sample even when the open-circuit voltage is set to minimum value.)



" (init) " display

If the test signal level which is being applied to the sample under test exceeds the limit value. Then the test signal level is stopped changing .



At this time, the voltage or current which exceeds the limit value is not being applied to the sample under test. You should change the test signal level so that it does not exceed the limit value.

5. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

4.6 Setting the Ranging

Using AUTO, the 3522-50 unit can automatically select the most appropriate test range. This is useful when testing a sample whose impedance varies greatly with frequency, or whose nature is unknown. The test range can also be fixed using HOLD, which provides the quickest testing. AUTO : The most suitable test range is set automatically. HOLD : The test range is fixed, and may only be altered manually.



The ranges are all defined in terms of impedance. Therefore, for a parameter other than impedance, the value is obtained by calculating from the measured values of |Z| and θ .

4.6.1 Control Screen Sequence



49

4.6.2 Setting the Ranging



- **1.** Press the MENU key on the Initial screen. The Menu screen will be displayed.
- 2. Press the RANGE key on the Menu screen. The Ranging setting screen will be displayed.



Ranging Setting Screen

3. The ranging setting can be either of the following:

AUTO : The most suitable test range is set automatically.

HOLD : The test range is fixed, and may only be altered manually.

4.6.3 Setting AUTO Ranging



- **1.** Press this key, and the 3522-50 will automatically be set to the most suitable test range. At this time, the AUTO key and the key corresponding to the current test range will be shown in non-reverse video.
 - 2. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

4.6.4 Setting the Ranging to HOLD



- **1.** There are two ways of setting the ranging to HOLD:
- 1) While AUTO ranging is set, press the HOLD key, and then this key will go into non-reverse video, and the currently most suitable range will be held fixed.
- 2) To select a desired test range directly, just press the key corresponding to that range. Then the **HOLD** key and also this range key will both go into non-reverse video.

Set the test range according to the combined impedance value of the sample to be tested and the test cables.

Test range [Ω]	Range of impedance which can be measured within the accuracy guaranteed $[\Omega]$
0.1	10.00 m to 99.99 m
1	80.00 m to 999.99 m
10	0.8000 to 9.9999
100	8.000 to 99.999
1 k	80.00 to 999.99
10 k	0.8000 k to 9.9999 k
100 k	8.000 k to 99.999 k
1 M	80.00 k to 999.99 k
10 M	0.8000 M to 9.9999 M
100 M	8.0000 M to 200.00M

NOTE

The measurement range is determined according to the test range setting. If the display for the measured value shows "OVER FLOW" or "UNDER FLOW", that means that measurement cannot be performed using the currently set test range. Either you should set AUTO ranging so as to select the most suitable test range automatically, or you should set a more suitable test range manually. 2. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

NOTE

• In the case of a test sample whose impedance changes according to the frequency, when testing is being performed with HOLD set, it may happen, when the frequency is changed over, that measurement cannot be continued to be performed upon the same test range. You should change the test range if this happens.

- The test range setting is made according to the combination of the impedances of the sample being tested and the test cables. Therefore it can happen that testing is not possible, if the test range is held with HOLD only upon the basis of the impedance of the sample under test. If this happens, you should change the test range, making reference to Section 4.9, "Open Circuit Compensation and Short Circuit Compensation".
- Even if the 3522-50 unit is being used outside the limits of its specification, test values are sometimes displayed.

In this case, the following type of indication "reference value" appears on the display, indicating a value which is not guaranteed.



In this case, you should consider the following possible cause, and you should either change the test conditions while checking the accuracy assured ranges (with reference to Section 7.5, "Test Accuracy"), or you should consider the measured values as values for reference only, because their validity is somewhat doubtful.

• When the present test range (when HOLD is set) is not suitable: Either you should set AUTO ranging so as to select the most suitable test range automatically, or you should set a more suitable test range manually.

4.7 Open Circuit Compensation

With open circuit compensation, it is possible to reduce the influence of the floating impedance of the test cables and thereby to enhance the accuracy of measurement. It is effective for test samples whose impedance is relatively high.

Open circuit compensation may be performed according to either of two methods:

ALL compensation

Compensation is performed at all the test frequencies.

SPOT compensation

Compensation is performed for one specified test frequency only.



- The testing accuracy specified in the specification of the 3522-50 unit assumes that open circuit compensation and short circuit compensation is being performed, as appropriate.
- When you have changed the test cables, be sure to perform compensation again. Correct test values will not be obtained if you go on testing using the same old compensation values which were obtained before the cable change.
- During DC measurement, it is not necessary to perform open circuit compensation.

4.7.1 Control Screen Sequence



4.7.2 Setting the Compensation Method

- **1.** Arrange the test leads as closely as possible to their configuration in which measurement will be performed, and make sure that the HIGH and LOW leads are not contacted together.
- **2.** When the open circuit compensation is performed, execute the guarding process. (For the guarding process, refer to Section 5.2.)



- **3.** On the Initial screen, press the **MENU** key, and the Menu screen will be displayed.
- 4. Press the **OPEN** key on the Menu screen, and the Open circuit compensation screen will be displayed.



- 5. The OPEN circuit compensation method can be set to:
 - **ALL** : The compensation values are obtained for all test frequencies.
 - **SPOT**: The compensation values are obtained at the set test frequency only.
 - **OFF**: The open circuit compensation data are cleared.



1. To select ALL compensation, press this key with the Open circuit compensation screen displayed.

SELECT MODE	
ALL SPOT OFF	
* OPEN ADJUST *	EXIT

Open Circuit Compensation Screen

2. A Confirmation screen will appear for confirmation. If it is OK to proceed, press the **RUN** key; if not, press the **BAX** key to return to the Open circuit compensation screen.

YOU SELECTED ALL MODE OK ?	
RUN <u>Cêl</u>	
* OPEN ADJUST *	EXIT

NOTE

Check again - are the test leads definitely out of mutual contact?

3. When the **RUN** key is pressed, the ALL open circuit compensation process starts. After about 2 minutes, the determination and adjustment of the open circuit compensation values is complete.



Interrupting the ALL compensation process:

To interrupt the ALL compensation process, press the **STOP** key on this screen. The compensation process will stop and the display will revert to the Initial screen. At this time, the compensation values obtained in the previous episode of open circuit compensation will remain valid.

4. If the compensation process has terminated satisfactorily, the following Confirmation screen will be displayed.

The open circuit residual component for the test cables at the frequency of 100 kHz and its phase angle are shown on the screen. (If an error message appears, refer to Section 4.7.5.)



These values are required for use with the test range on HOLD. (For details, refer to Section 4.9, "Open Circuit Compensation and Short Circuit Compensation".)

After checking the open circuit residual component and its phase angle, press the key, and the display will return to the Initial screen.



Compensation can be performed for impedances of at least 1 k Ω .



1. To select SPOT compensation, press this key with the Open circuit compensation screen displayed.

SELECT MODE	
ALL SPOT OFF	
* OPEN ADJUST *	EXIT

Open Circuit Compensation Screen

2. A numeric keypad is displayed for input of the frequency. Until one of these keys is pressed for input of a numerical value, the previous frequency for which SPOT compensation was performed is displayed.



Units keys (shown in non-reversed video, until a numerical value for the frequency has been input)

SPOT compensation for the same frequency as previously

Just press the **RUN** key. SPOT compensation will be started using the same frequency which was used for the last episode of SPOT compensation.

SPOT compensation for some new frequency

Input the frequency for compensation using the numeric keypad. Frequency range which can be set : 1 mHz to 100.0 kHz



If you attempt to set a test frequency greater than 100 kHz, it will automatically be reduced to 100 kHz.

- If you make a mistake during input of the numerical value, press the **C** key to cancel the input so far, and start again.
- When you have completed inputting the numerical value for the frequency, press the appropriate units key <u>KHz</u>, <u>Hz</u>, or <u>mHz</u> so as to confirm the displayed frequency for compensation.
- Until the numerical value for the frequency has been input, the units keys cannot be used.
- **3.** After the frequency for SPOT compensation has been input as above, press the **RUN** key.





Check again - are the test leads definitely out of mutual contact?

The time taken for the SPOT compensation varies depending on the frequency for compensation, but it takes about 15 minutes maximum at 1 mHz compensation.

- NOW ADJUSTING 20% Stop * Open Adjust *
- **4.** When you press the **RUN** key, the SPOT open circuit compensation process starts.

Interrupting the SPOT compensation process:

To interrupt the SPOT compensation process, press the **STOP** key on this screen. The compensation process will stop and the display will revert to the Initial screen. At this time, the compensation values obtained in the previous episode of open circuit compensation will remain valid.

5. If the compensation process has terminated satisfactorily, the following Confirmation screen will be displayed.

The open circuit residual component for the test cables at the set frequency, and its phase angle, are shown on the screen. (If an error message appears, refer to Section 4.7.5.)



These values are required for use with the test range on HOLD. (For details, refer to Section 4.9, "Open Circuit Compensation and Short Circuit Compensation".)

After checking the open circuit residual component and its phase angle, press the **O**K key, and the display will return to the Initial screen.



Compensation can be performed for impedances of at least 1 k Ω .
4.7.5 When an Error Message Appears and Compensation Has Stopped



When an error message appears and compensation has stopped, open circuit compensation is turned OFF.

The open circuit compensation process is quite sensitive to noise - both noise originating externally and induced noise. Therefore, if open circuit compensation has been interrupted with a fault, you should check the following points before starting the compensation process again:

- Check that the test cables are properly connected.
- Check that nothing is connected to the test cables. (Open circuit compensation cannot be performed while any test sample is connected to the test cables.)
- Check that the test leads are arranged as closely as possible to their configuration in which measurement will be performed.
- During the compensation process, be sure not to disturb the test cables or to move your hand near them.
- Execute the guarding process. (For details, refer to Section 5.2, "Testing High Impedance Elements".)

4.7.6 Clearing Compensation Data

From the Open circuit compensation screen, press the **OFF** key, and the display will revert to the Initial screen with the compensation data cleared.

4.8 Short Circuit Compensation

With short circuit compensation, it is possible to reduce the influence of the residual impedance of the test cables and thereby to enhance the accuracy of measurement. It is effective for test samples whose impedance is relatively low.

Short circuit compensation may be performed according to either of two methods:

ALL compensation

Compensation is performed at all the test frequencies.

SPOT compensation

Compensation is performed for one specified test frequency only.



- The testing accuracy specified in the specification of the 3522-50 unit assumes that open circuit compensation and short circuit compensation is being performed, as appropriate.
 - When you have changed the test cables, be sure to perform compensation again. Correct test values will not be obtained if you go on testing using the same old compensation values which were obtained before the cable change.

4.8.1 Control Screen Sequence



4.8.2 Setting the Compensation Method

1. A shorting bar is used. This shorting bar is for short circuiting together the ends of the test leads. Use an object whose impedance is as low as possible.





If you use a metallic wire or the like as a shorting bar, try to ensure that it is as thick and short as possible.

2. Arrange the test leads as closely as possible to their configuration in which measurement will be performed, and short circuit together the HIGH and LOW leads. In order to keep external influences as low as possible, be sure to thrust the shorting bar in all the way.





If you intend to short circuit between the clamps at the ends of the test leads, clip both clamps onto a short piece of metallic wire as shown. If you clip the two clamps together directly, they will not be properly short circuited together.

- 3. On the Initial screen, press the MENU key, and the Menu screen will be displayed.
- **4.** Press the **SHORT** key on the Menu screen, and the Short circuit compensation screen will be displayed.



- 5. The SHORT circuit compensation method can be set to:
 - **<u>ALL</u>** : Compensation values are obtained for all test frequencies.
 - **SPOT** : Compensation values are obtained at the set test frequency only.
 - **OFF** : The short circuit compensation data are cleared.

4.8.3 ALL Compensation



1. To select ALL compensation, press this key with the Short circuit compensation screen displayed.



Short Circuit Compensation Screen

2. A Confirmation screen will appear for confirmation. To proceed, press the RUN key; if not, press the RUN key to return to the Short circuit compensation screen.

YOU SELECTED OK ?	ALL MODE
RUN	CAN
* SHORT ADJUST *	EXIT



Check again - are the test leads properly shorted together with the shorting bar?

3. When you press the **RUN** key, the ALL short circuit compensation process starts. After about 2 minutes, the determination and adjustment of the short circuit compensation values is complete.



Interrupting the ALL compensation process:

To interrupt the ALL compensation process, press the **STOP** key on this screen. The compensation process will stop and the display will revert to the Initial screen. At this time, the compensation values obtained in the previous episode of short circuit compensation will remain valid.

4. If the compensation process has terminated satisfactorily, the following Confirmation screen will be displayed.

The short circuit residual component for the test cables at the frequency of 100 kHz and its phase angle are shown on the screen. (If an error message appears, refer to Section 4.8.5.)



These values are required for use with the test range on HOLD. (For details, refer to Section 4.9, "Open Circuit Compensation and Short Circuit Compensation".)

After checking the short circuit residual component and its phase angle, press the key, and the display will return to the Initial screen.



Compensation can be performed for impedances less than 1 k Ω , and for frequency 1 mHz to 100 kHz.

4.8.4 Spot Compensation



1. To select SPOT compensation, press this key with the Short circuit compensation screen displayed.



Short Circuit Compensation Screen

2. A numeric keypad is displayed for input of the frequency. Until one of these keys is pressed for input of a numerical value, the previous frequency for which SPOT compensation was performed is displayed.



Units keys (shown in non-reversed video, until a numerical value for the frequency has been input)

SPOT compensation for the same frequency as previously:

Just press the **RUN** key. SPOT compensation will be started using the same frequency which was used for the last episode of SPOT compensation.



3. After the frequency for SPOT compensation has been input as above, press the **RUN** key.



NOTE

Check again - are the test leads properly shorted together with the shorting bar?

The time taken for the SPOT compensation varies depending on the frequency for compensation, but it takes about 15 minutes maximum at 1 mHz compensation.



4. When you press the **RUN** key, the SPOT short circuit compensation process starts.

Interrupting the SPOT compensation process:

To interrupt the SPOT compensation process, press the **STOP** key on this screen. The compensation process will stop and the display will revert to the Initial screen. At this time, the compensation values obtained in the previous episode of short circuit compensation will remain valid.

5. If the compensation process has terminated satisfactorily, the following Confirmation screen will be displayed.

The short circuit residual component for the test cables at the set frequency, and its phase angle, are shown on the screen. (If an error message appears, refer to Section 4.8.5.)



These values are required for use with the test range on HOLD. (For details, refer to Section 4.9, "Open Circuit Compensation and Short Circuit Compensation".)

After checking the short circuit residual component and its phase angle, press the **O**K key, and the display will return to the Initial screen.

4.8.5 When an Error Message Appears and Compensation Has Stopped

ZERO ADJUSTMENT FAILURE	
ОК	
* SHORT ADJUST *	

When an error message appears and compensation has stopped, short circuit compensation is turned off.

Check the following points before starting the short circuit compensation process again:

- Check that the test cables are properly connected.
- Check that the test cables are properly shorted together with the shorting bar. (Short circuit compensation cannot be performed while any test sample is connected to the test cables.)
- Check that the test leads are arranged as closely as possible to their configuration in which measurement will be performed.
- During the compensation process, be sure not to disturb the test cables or to move your hand near them.

4.8.6 Clearing Compensation Data

From the Short circuit compensation screen, press the **OFF** key, and the display will revert to the Initial screen with the compensation data cleared.

4.9 Open Circuit Compensation and Short Circuit Compensation

The residual impedance component of the test fixture can be considered in terms of an equivalent circuit as shown in the figure. Further, because the measured value Zm for impedance includes this residual component, therefore, in order to obtain the genuine impedance value, it is necessary to compensate the measured value in terms of the open circuit impedance residual component and the short circuit residual component, which accordingly must be obtained.



In this case, for the measured value Zm: Zm = Zs + 1/(Yo + 1/Zx)

The residual components can be determined in the following manner:

Open circuit compensation

The terminals of the test fixture are left separated (open circuited). Because the short circuit residual component Zs is now zero, therefore the open circuit residual component Yo can be determined.

Short circuit compensation

The terminals of the test fixture are connected together (short circuited). Because the open circuit residual component Yo is now zero, therefore the short circuit residual component Zs can be determined.

These residual components thus obtained are recorded as compensation values, and the compensation process may then be performed by substituting them into the above equation.



NOTE

The determination of test range is performed according to the measured value Zm for impedance. Therefore it may happen that testing cannot be performed, when HOLD is on, if the test range is determined merely according to the value of impedance of the sample under test. In this case, you should set the test range in consideration both of the impedance of the test sample and also of the residual impedance components of the test fixture.

Deviations in the measured values can become comparatively large in the following cases:

• If only short circuit compensation has been performed. With short circuit compensation only having been performed, since no compensation can be performed in terms of the open circuit residual component Yo (which is not available), thereby deviation in the resultant values will become large if the value of that open circuit residual component Yo is relatively large.

• If only open circuit compensation has been performed. With open circuit compensation only having been performed, since no compensation can be performed in terms of the short circuit residual component Zs (which is not available), thereby deviation in the resultant values will become large if the value of that short circuit residual component Zs is relatively large.

In order to avoid this sort of thing, be sure always to perform both short circuit compensation and also open circuit compensation.

NOTE

During DC measurement, it is not possible to perform open circuit compensation because the open circuit residual component Yo can be ignored.

4.10 Setting the Trigger

The trigger can either be set to internal trigger, when continuous testing is performed while automatically generating an internal trigger signal, or external trigger, when a trigger signal is input from the outside either manually or automatically.

4.10.1 Control Screen Sequence



4.10.2 Details of the Setting Process



1. Press the MENU key on the Initial screen to display the Menu screen.

2. Press the **TRIG** key on the Menu screen to display the Trigger setting screen.



Trigger Setting Screen

INT (internal trigger)

Testing is performed continuously.

EXT (external trigger)

The trigger is input manually, via EXT I/O, or via interface.

The external trigger can be input manually, via the EXT I/O connector, or via interface.

When external trigger is selected, MANU TRIG appears on the following screens as shown in the next figure, and a manual trigger signal can be input by pressing this key.



Press this key to perform testing once.

When inputting the trigger signal through the EXT I/O connector:

Testing is performed once, each time a negative sense pulse signal is supplied to the EXT I/O connector on the rear panel of the 3522-50. (For details, refer to Section 5.5, "The EXT I/O Connector")

When inputting the trigger signal through the interface:

Testing is performed once, when the "*TRG" command is transferred from the interface. (For details, see the "Command Reference" of the Instruction Manuals for the interface.

3. When the setting has been established as above, press the **EXII** key to return to the Initial screen.

4.11 Setting the Trigger Delay

The delay time period from input of the trigger signal to reading of the test data can be set. The value of the trigger delay period can be set from 10 ms to 9.99 s, with a resolution of 10 ms. With this function it is possible to ensure that testing is started after the connection condition of the object being tested and the test cables has stabilized.

4.11.1 Control Screen Sequence



4.11.2 Details of the Setting Process



- **1.** Press the **MENU** key on the Initial screen. The Menu screen will be displayed.
- 2. Press the **DELAY** key on the Menu screen. The Trigger delay setting screen will be displayed.



Press this key when setting is completed to return to the Initial screen.

The digit keys (If held down continuously, the corresponding digit increments or decrements continuously.) (If the limit for the corresponding digit is reached, these keys change to non-reversed video and become inactive.)

 Set the desired value for the delay time period using the digit keys. The range over which the delay time period can be set : 10 ms to 9.99 s, with a resolution of 10 ms

The other keys, which cannot be used, are shown in non-reversed video.

4. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

Canceling the trigger delay function

Press the **C** key to set the trigger delay period to 0.00 s. This will cancel the trigger delay function.



4.12 Setting Averaging

With the averaging function, the measured values can be averaged. Using this function, it is possible to reduce fluctuations in the measured value display.

The averaging can be performed over 2, 4, 8, 16, 32, or 64 times that measurement is performed.

4.12.1 Control Screen Sequence



4.12.2 Details of the Setting Process



1. Press the MENU key on the Initial screen to display the Menu screen.

2. Press the Averaging setting screen.

The selected number is displayed, and averaging is set.



When the setting is completed, press this key to return to the Initial screen.

Averaging Setting Screen

3. Press the key corresponding to the desired number of times for averaging. The number of times for averaging which can be selected : 2, 4, 8, 16, 32, or 64.

The key which is pressed goes into non-reversed video, and this number is set as the number of times for averaging.

NOTE

The way in which averaging is performed varies, depending upon the trigger setting.

With internal trigger:

A rolling average of the tested values over the set number of times for averaging is always calculated backwards from the present. When the sample to be tested is changed over, it takes a little time for a certain stabilization time period until the results is reliable.

With external trigger:

An average of the test values is calculated over the set number of times for averaging forwards from when the trigger is input.

4. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

Stopping the averaging function

On the Averaging setting screen, press the **OFF** key. This key will go into non-reversed video, and the averaging function will be terminated.



4.13 Setting the Testing Speed

The testing speed can be set. The slower the testing speed is, the more accurate are the results.

The testing speed can be set to one of three values:

FAST low accuracy testing is performed at high speed

NORM the speed used for normal testing

SLOW high accuracy testing is performed slowly

SLOW2 high accuracy testing is performed slowly

The number of displaying digit of the test values for parameter excluding D, Q, and θ varies depending on the setting of test speed.

Test speed setting	Maximum display digits
FAST	4
NORM, SLOW, SLOW2	5

4.13.1 Control Screen Sequence



4.13.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **SPHD** key on the Menu screen to display the Test speed setting screen.



Test Speed Setting Screen

3. Select the desired new speed for testing from among the following options. The key corresponding to the currently selected testing speed appears in non-reversed video (black letters upon a white ground).

Testing	speeds	(typical)
---------	--------	-----------

FAST	5 ms \pm 2 ms	Low accuracy testing at high speed
NORM	16 ms \pm 2 ms	This speed used for normal testing
SLOW	88 ms ±2 ms	High accuracy slow testing
SLOW2	828 ms ±2 ms	High accuracy slow testing

The testing speed varies according to the number of parameters being displayed, and according to their type. The speeds given in the table relate to the case of |Z| only being displayed. For details, refer to Section 7.3, "Time Taken for Testing."

4. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

4.14 Setting and Activating the Comparator

Using the comparator function an upper limit value and a lower limit value can be set, and the result of measurement then can be compared with these two limit values, so as to give a result expressed as HI (greater than the upper limit value), IN (between the lower limit value and the upper limit value), or LO (less than the lower limit value). Moreover, a corresponding signal can be output via the EXT I/O connector on the rear panel of the 3522-50 unit.

The following setting methods are available on the comparator:

Absolute value setting method (ABS)

The upper limit value and the lower limit value are set as absolute numerical values. The measurement values displayed are the same as those of the measurement parameters.

Percentage setting method (%)

A reference value is input, and the upper-limit and lower-limit values are set as percentages relative to the reference value. The measurement values displayed are the same as those of the measurement parameters.

Setting of the deviation percentage (Δ %)

A reference value is input, and the upper-limit and lower-limit values are set as percentages relative to the reference value. The measurement values are displayed in deviations (Δ %) from the reference value.

The comparator can deal with two test values at the most. "ABS", "%", and " Δ %" can be selected for each of these values individually.

After powering off on the Comparator setting screen, the screen is displayed when the power is turned on again.

4.14.1 Control Screen Sequence



4.14.2 Setting the Comparator



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **Comparator** key on the Application menu screen to display the Comparator screen. At the same time, the comparator will be started.



Initial Screen

Comparator Screen

NOTE

On the Scaling screen, the Comparator scaling screen can be also accessed by same key operations. The comparator is activated for the scaling measured value.

For the scaling function, refer to Section 4.15.



Scaling Screen

Comparator Scaling Screen

4. Set the first and third parameters to be the two parameters which you wish to measure. (Refer to the section on display parameter setting for details upon how to make the setting.)



The Conditions setting screen is accessed by pressing the **W** key.

- 5. The Menu screen can be displayed from the Comparator screen display by pressing the **MENU** key, in the same manner as from the Initial screen, and then the values for the various test conditions can be changed. (For details, refer to the explanation of setting the appropriate test condition.)
- NOTE
- When the trigger is internal, testing starts at the time point at which the comparator mode is started, and the results of the decisions will be output through the EXT I/O terminal.
- The test conditions during comparator operation and normal operation are compatible.

4.14.3 Returning from Comparator Operation to Normal Testing



- **1.** Press the MENU key on the Comparator screen or the Comparator scaling screen to display the Menu screen.
- **2.** Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **Series** key on the Application menu screen to return the Initial screen or the Scaling screen.
 - The test conditions during comparator operation and normal operation are compatible.
 - On the Initial screen, the second and fourth display parameter positions will revert to displaying the parameters which they were displaying before the comparator mode was started. On the Scaling screen, they will revert to displaying ab.

NOTE

The comparator is active until the display returns to showing the Initial screen or Scaling screen.

4.14.4 Choosing How to Set the Upper and Lower Limit Values

lmt Comparator screen

- 1. Access the Comparator screen.
- 2. On this screen, press the we key which corresponds to the upper or lower limit value to set or change. The Conditions setting screen is displayed.
- 3. Select the method for setting the limit value and press the following corresponding key **ABS** or **%**:
 - Absolute value setting method (ABS)

The upper limit value and the lower limit value for the test parameter are set as absolute numerical values. The measurement values displayed are the same as those of the measurement parameters.

- Percentage setting method (%) A reference value is input, and the upper-limit and lower-limit values are set as percentages relative to the reference value. The measurement values displayed are the same as those of the measurement parameters.
- Setting of the deviation percentage (Δ%)
 A reference value is input, and the upper-limit and lower-limit values are set
 as percentages relative to the reference value. The measurement values are
 displayed in deviations (Δ%) from the reference value.



Deviation Percentage (Δ %) Setting Screen

4.14.5 Setting the Upper or Lower Limit Value as an Absolute Value (ABS)

ABS Condition setting screen

1. Press this key on the Conditions setting screen displayed to select the absolute value setting mode.

At this time the ABS key will go into non-reversed video, and simultaneously H I and L O keys will appear for setting the upper and lower limit values.



Absolute Value Setting Mode

2. To set the upper limit value (for example), press the **H** key, and a screen will appear for upper limit value setting. Use the numeric keypad to input the desired value for the upper limit.

In order to set no upper limit value, press the **OFF** key.



The setting can be made in the range : -200.00M to +200.00M To return to the previous screen without making any change to the set value, press the **INTER** key when the screen is in the state with nothing being displayed (the state after pressing the **C** key). **1**/10³ : step the units down p -- n -- μ -- m -- (none) -- k -- M <= Units down Units up => Pressing the **ENTER** key causes the upper limit

Pressing the **EXITER** key causes the upper limit value to be set and the screen display to return to the Conditions setting screen.

4. The lower limit value is set in a manner identical to the upper limit value, mutatis mutandis.



The setting can be made in the range : -200.00M to +200.00M

5. When the setting for the upper or lower limit value has been established as above, press the **EXII** key on the Condition setting screen to return to the Comparator screen.

NOTE

The comparator decisions are made in the following order:

- 1) If the measured value is "OVER FLOW", HI is displayed, and the value is "UNDER FLOW", LO is displayed.
- 2) Is the measured value greater than the lower limit value or not? If not (NG decision result), then LO is displayed.
- 3) Is the measured value lower than the upper limit value or not? If not (NG decision result), then HI is displayed.

4) If both 2) and 3) give an affirmative result, then IN is displayed. No test is performed in order to ensure that the upper limit value is greater than the lower limit value. Therefore no error message will be displayed even if you mistakenly interchange the settings for the desired upper limit value and the desired lower limit value. However, be careful that the decision process will not operate properly.

4.14.6 Setting the Upper or Lower Limit Value as a Percentage (%) Relative to a Standard Value



1. Press this key on the Conditions setting screen to select the percentage value setting mode.

At this time the *key* will go into non-reversed video, and simultaneously a *key* will appear for inputting the reference value, and *key* will appear for the upper and lower limit values.



The settings of the reference value and the upper- and lower-limit values are common to both the percentage mode and deviation percentage mode.



Percentage Value Setting Mode

2. Press the **REF** key, and a screen will appear for setting the reference value. This reference value is necessary for setting the limit values in terms of percentages.



The setting can be made in the range : -200.00M to +200.00M To return to the previous screen without making any change to the set reference value, press the **ENTER** key when the screen is in the state with nothing being displayed (the state after pressing the **C** key). **3.** Select the units using one of the units keys:

10 : step the units up **17** : step the units down p -- n -- μ -- m -- (none) -- k -- M <= Units down Units up => Pressing the **CUER** key causes the upper 1

Pressing the **EXITE** key causes the upper limit value to be set and the screen display to return to the Conditions setting screen.

4. When the **1** key is pressed, a screen for setting the upper limit value will appear. Use the numeric keypad to input the upper limit value as a percentage relative to the reference value.

In order to set no upper limit value, press the **OFF** key.



The setting can be made in the range : -999.99% to +999.99%

NOTE

The actual internal operation consists of calculating the upper-limit value of comparison using the equation given below, and comparing it to the measurement value to enable a decision to be made.

```
Upper-limit
comparison value = Reference value + |Reference value| x \frac{Percentage set value}{100}
```

| |: Denotes an absolute value

When the setting has been established as above, press the **ENTER** key to return to the Conditions setting screen with the upper limit value set.

5. The lower limit value is set in a manner identical to the upper limit value, mutatis mutandis.



The setting can be made in the range : -999.99% to +999.99%

The actual internal operation consists of calculating the lower-limit value of comparison using the equation given below, and comparing it to the measurement value to enable a decision to be made.

If a value smaller than the reference value is to be set, the percentage set value must be an absolute value.

Lower-limit		Percentage set value
comparison value	= Reference value + Refe	rence value x
•		100

| |: Denotes an absolute value

If the value is lower than the reference value, a minus sign is necessary.

6. When the setting for the upper or lower limit value has been established as above, press the **EXII** key on the Condition setting screen to return to the Comparator screen.

NOTE

NOTE

The comparator decisions are made in the following order:

- 1) If the measured value is "OVER FLOW", HI is displayed, and the value is "UNDER FLOW", LO is displayed.
- 2) Is the measured value greater than the lower limit value or not? If not (NG decision result), then LO is displayed.
- 3) Is the measured value lower than the upper limit value or not? If not (NG decision result), then HI is displayed.

4) If both 2) and 3) give an affirmative result, then IN is displayed. No test is performed in order to ensure that the upper limit value is greater than the lower limit value. Therefore no error message will be displayed even if you mistakenly interchange the settings for the desired upper limit value and the desired lower limit value. However, be careful that the decision process will not operate properly.

4.14.7 Displaying Measurement Values as Deviations from the Reference Value (Δ %)



1. Press this key on the Conditions setting screen to select the deviation percentage mode.

At this time the Δ % key will go into non-reversed video, and simultaneously a **REF** key will appear for inputting the reference value, and **REF** keys will appear for the upper and lower limit values.



Deviation Percentage Mode

The setting can be made in the range : -999.99% to +999.99% In the deviation percentage mode, the measurement value is displayed as a deviation (Δ %) from the reference value. The reference value and upperand lower-limit values are set in the same manner as in the percentage mode. For the setting method, refer to "4.15.6."

NOTE

The settings of the reference value and the upper- and lower-limit values are common to both the percentage mode and deviation percentage mode.

The Δ % value is calculated using the following equation: Δ % = $\frac{\text{Measurement value - Reference value}}{|\text{Reference value}|} \times 100$

| |: Denotes an absolute value

If the result of the calculation exceeds 999.99, "999.99" will be indicated, and if the result is less than -999.99, "-999.99" will be displayed.



NOTE

The comparator decisions are made in the following order:

- If the measured value is "OVER FLOW", HI is displayed, and the value is "UNDER FLOW", LO is displayed.
- 2) Is the measured value greater than the lower limit value or not? If not (NG decision result), then LO is displayed.
- 3) Is the measured value lower than the upper limit value or not? If not (NG decision result), then HI is displayed.

4) If both 2) and 3) give an affirmative result, then IN is displayed. No test is performed in order to ensure that the upper limit value is greater than the lower limit value. Therefore no error message will be displayed even if you mistakenly interchange the settings for the desired upper limit value and the desired lower limit value. However, be careful that the decision process will not operate properly.
4.15 Setting and Activating the Scaling

Scaling applies a correction function to the measurement value. This function can be used to provide compatibility among measurement devices. Set the compensation coefficient a and b for the measurement values of the first and third parameters to compensate by the following expression.

 $\mathbf{Y} = \mathbf{a} \mathbf{X} \mathbf{X} + \mathbf{b}$

X: the first or third parameter measurement value

Y: the last measurement value

a: integration value of the measured value X

b: the value added to measured value X

Here, when the parameter corresponding to X is either D or Q, the scaling is applied to θ as follows:

 $\theta' = a \mathbf{X} \theta + b$

This gives a new value θ , from which D or Q is obtained.

After powering off on the Scaling screen, the same screen is displayed when the power is turned on again.

4.15.1 Control Screen Sequence



4.15.2 Setting Scaling



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI NEXU** key on the Menu screen to display the Application menu screen.
- 3. Press the set is key on the Application menu screen to display the Scaling screen. At the same time, the comparator will be started.



Initial Screen

Scaling Screen

NOTE

On the Comparator screen, the Comparator scaling screen can be also accessed by the same key operations. For details on the comparator, see Section 4.14.



Comparator Screen

Comparator Scaling Screen

4. Set the first and third parameters to be the two parameters which you wish to measure. (Refer to the section on display parameter setting for details upon how to make the setting.)



The Conditions setting screen is accessed by pressing the between the setting key.

5. The Menu screen can be displayed from the Comparator screen display by pressing the **MENU** key, in the same manner as from the Initial screen, and then the values for the various test conditions can be changed. (For details, refer to the explanation of setting the appropriate test condition.)

4.15.3 Canceling the Scaling Function



- **1.** Press the MENU key on the Scaling screen or the Comparator scaling screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **Const** key on the Application menu screen to return the Initial screen or the Scaling screen.

On the Initial screen, the second and fourth display parameter positions displaying the parameters which they were displaying before the Scaling mode was started. On the Comparator screen, they will revert to displaying displaying .

4.15.4 Setting the Compensation Coefficient (a, b)

- 1. Access the Scaling screen.
- 2. On the Scaling screen, press the b key which you wish to change. The Conditions setting screen will be displayed.



3. Press the **a** key, and a screen will appear for setting the compensation coefficient a. Use the numeric keypad to input the desired value.



The setting can be made in the range : -999.99 to +999.99 To return to the previous screen without making any change to the set value, press the **EVER** key when the screen is in the state with nothing being displayed (the state after pressing the **C** key). 4. Set the compensation coefficient b as the same way.



The setting can be made in the range : -200.00M to +200.00M $\times 10^3$: step the units up $1/10^3$: step the units down p -- n -- μ -- m -- (none) -- k -- M <= Units down Units up =>

5. When the compensation coefficient setting has been established, press the **EXII** key on the Compensation coefficient setting screen to return to the Scaling screen.

NOTE

• The scaled measurement value has no effect on other measurement values. Therefore, even if the same parameter is set for the first and third parameters, the scaling is carried out with the respective compensation coefficients.

The calculation result of scaling for θ is as follows. When exceeding 180 °, "180.00 °' is displayed.
When below -180 °, "-180.00 °' is displayed.

The setting can be made in the range : -999.99% to +999.99%

4.16 Panel Save Function

All of the test conditions can be saved as a "panel", up to a maximum of 30 such stored panels (i.e., sets of stored test conditions).

The test conditions which are saved are:

- Display parameters
- Test range
- Set value for averaging
- Test frequency
- Open and short circuit compensation values
- Set value for test speed
- Test signal level
- Setting for trigger value
- Beep sound setting
- Voltage and current limit values
- Set value for trigger delay
- Comparator setting
- Scaling setting
- External DC bias setting
- Display digits setting
- Display setting

4.16.1 Control Screen Sequence



4.16.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the APPLIMENU key on the Menu screen to display the Application menu screen.
- **3.** Press the **SAVE** key on the Application menu screen to display the Panel number selection screen.



***NONE *** means that nothing is saved.

Panel Number Selection Screen



EXIT: cancel the saving, and the display reverts to the Initial screen. PAGE, BAGE : change the position of the panel number

4. When you have decided upon the panel number under which the present test conditions will be saved, press the corresponding panel number key to select it.



VES : save the current test conditions with the saving name, and the display automatically reverts to the Initial screen.

- **NO**: change the panel number, and the previous screen will be displayed again.
- 5. To change the saving name, press the **NAME** key, and the screen for name input will be displayed. Input the saving name (up to 20 characters).



EBECT : Toggles between the alphabet input screen and numerical input screen.

- **B** S: Back space
- **CLEAR** : Clears the input character.

6. After input, press the ENTER key to return the Saving confirmation screen.

7. Press the **VES** key on the Saving confirmation screen to save the test conditions. The display automatically reverts to the Initial screen.



- Under normal conditions of use, the average life of the backup battery is about 10 years.
- If the internal battery becomes exhausted, it is no longer possible to save the test conditions. You should have the battery changed by an approved HIOKI service facility (which is chargeable).

4.17 Panel Load Function

Using the panel load function, saved test conditions can be loaded. The test conditions which are saved:

- Display parameters
- Test range
- Set value for averaging
- Test frequency
- · Open and short circuit compensation values
- Set value for test speed
- Test signal level
- Setting for trigger value
- Beep sound setting
- Voltage and current limit values
- Set value for trigger delay
- Comparator setting
- Scaling setting
- External DC bias setting
- Display digits setting
- Display setting

4.17.1 Control Screen Sequence



4.17.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- **2.** Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the LOAD key on the Application menu screen to display the Panel load screen.



***NONE *** means that nothing is saved.

Panel Load Screen

4. For each panel number, some of the values currently saved are shown on the Panel load screen. Check these stored values and then select the panel number for which the stored test conditions will be loaded.



5. When you have decided upon the panel number for which the stored test conditions will be loaded, press the corresponding panel number key to select it.

To cancel the panel load process, press the **EXII** key. The present test conditions will not be altered, and the display will revert to the Initial screen.

6. A message requesting confirmation will be displayed. To continue, press the **VES** key. The test conditions saved under the panel number which was selected will be loaded in place of the present test conditions.



To change the panel number for the load, press the **NO** key, and the previous screen will be displayed again.

When the new test conditions have been loaded, the display automatically reverts to the Initial screen, on which the panel number from which the newly loaded test conditions just came is displayed.

NOTE

• For test conditions saved with the comparator mode, the following mark is displayed:



- Under normal conditions of use, the average life of the backup battery is about 10 years.
- If the internal battery becomes exhausted, it is no longer possible to save the test conditions. You should have the battery changed by an approved HIOKI service facility (which is chargeable).

4.18 Setting the Beep Sound

The beep sound which is produced each time that a soft key is pressed, and the beep sound which is produced when the comparator makes decisions, can be turned on and off individually.

4.18.1 Control Screen Sequence



4.18.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the key on the Application menu screen to display the Beep sound setting screen.



Setting the beep sound produced each time a key is pressed:

- A beep sound for key input is emitted.
- **OFF** : No beep sound for key input is emitted.

Setting the beep sound produced when the comparator makes decisions:

- When the comparator makes a single decision:
 - **I** When the comparator result is IN, a beep sound is emitted.
 - **N G** : When the comparator result is LO or HI, a beep sound is emitted.
 - **OFF** : No beep sound is emitted when the comparator operates.
- When the comparator makes two decisions:
 - **I** N: When both of these comparator results are IN, a beep sound is emitted.
 - **N** G: When either of these comparator result is LO or HI, a beep sound is emitted.

OFF : No beep sound is emitted when the comparator operates.

3. When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

4.19 Enlarged Display of Measurement Values

The measurement values and comparator decision results can be displayed in enlarged form. This function is convenient when the unit is used under constant measurement conditions.

After powering off on the Magnification display screen, the same screen is displayed when the power is turned on again.

4.19.1 Control Screen Sequence



4.19.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **ECE** key on the Application menu screen to display the Magnification display screen.





Normal Screen

Comparator Screen

EXIT : return the Initial screen

MANU TRIG (during the external trigger setting): measure once

On the Magnification display screen, only **EXIT** and **MANU TRIG** keys are displayed.

4.20 System Reset

All of the settings will revert to the factory original settings.

4.20.1 Control Screen Sequence



4.20.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLIMENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **RESET** key on the Application menu screen to display the System reset screen.





VES : reverts to the factory settings and the Initial screen is displayed. **EXIT** : halts settings and reverts to the Initial screen.

The settings established at the factory are as follows:

The settings established at the	raciony are as ronows.
Test parameters	$ Z , \ heta$
Test frequency	1 kHz
Test signal level	Open circuit voltage (V) setting
Open circuit voltage (V) set value	1.000 V
Constant voltage (CV) set value	1.000 V
Constant current (CC) set value	10.00 mA
Limit function	OFF
Voltage limit set value	5.000 V
Current limit set value	50.00 mA
Test range	AUTO range
Open circuit compensation	OFF
Short circuit compensation	OFF
Trigger setting	Internal trigger
Trigger delay setting	0 s
Averaging setting	OFF
Test speed setting	NORMAL
Beep sound setting	ON for key input, OFF for comparator
Panel save, panel load	All contents clear
Comparator	
Comparator setting	Both first and third parameters set to
	absolute value.
Absolute value set values	Upper and lower limit values for the first
	and third parameters both OFF
Percent set values	First parameter reference value: 1000
	Upper and lower limit values for first
	parameter both OFF
	Third parameter reference value: 10
	Upper and lower limit values for third
	parameter both OFF
Scaling setting value	Compensation coefficient a for the first
	and third parameters: 1.0000
	Compensation coefficient b for the first
	and third parameters: 0
External DC bias setting	OFF
Display digits setting	All five digits for first to 4th parameters
Display setting	LCD display: ON
	Voltage and Current monitor: ON

4.21 Continuous Test Function

It is possible to read in order test conditions which have been saved using the panel save function, and to perform continuous testing. Up to five panel numbers can be selected in a page for the continuous testing.

Page	Panel numbers
1	1 - 5
2	6 - 10
3	11 - 15
4	16 - 20
5	21 - 25
6	26 - 30

After powering off on the Continuous test screen, the same screen is displayed when the power is turned on again.

4.21.1 Control Screen Sequence



4.21.2 Details of the Setting Process

This section describes procedure when performing continuous testing with panel numbers 6, 8, and 10 for example.

1. Save the continuous testing conditions using the panel save function to the panel numbers 6, 8, and 10. The continuous testing is performed for the first and third parameters which have been saved.

For details on panel save function, see Section 4.16.



Test conditions for some other test sample are already saved here





- 2. Press the MENU key on the Initial screen to display the Menu screen.
- **3.** Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **4.** Press the **EESS** key on the Application menu screen to display the Continuous test screen.

5. Using the state and state keys, make a display of panel numbers which are previously saved.



Continuous Test Screen



The panel numbers which are not saved or which are invalid even if saved (when the both first and third parameters are off, or when the parameters are other than Rs and Rp during DC measurement) are not displayed.

6. Set whether testing of each panel number is executed or not.

When the saving conditions of the panel or previous test result is displayed, the testing is executed. However, when "*** NO USE ***" is displayed, the testing is not executed. In this example, make a setting not to test for the panel number 7.



NOTE

When changing a page, the all panel number displayed will be tested.

7. Press the MANU TRIG to start test. The test result is displayed when the tests of each panel numbers are terminated.



NOTE

If the displaying page is switched to other page after test completed, the displays of the test result are disappear.

8. To exit from the continuous test, press the **EXIT** key to return the Initial screen.

The continuous test can be executed from the EXT I/O connector. For details, see Section 5.6, "Testing Using EXT I/O."

4.22 External DC Bias Setting

The external DC bias function is available for test of supplying DC bias or batteries and if the test result is "OVER FLOW" or failed. Set this function to ON.

For supplying external DC bias, refer to Section 5.7, "Supplying DC Bias".

4.22.1 Control Screen Sequence



4.22.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **Biss** key on the Application menu screen to display the External DC bias setting screen.



4. To exit from this mode, press the **EXIT** key to return the Initial screen.

4.23 Setting the Number of Displayed Digits

The number of effective digits for measurement can be set on a parameterby-parameter basis.

4.23.1 Control Screen Sequence



4.23.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **DIGIT** key on the Application menu screen to display the Setting the displayed digits screen.



Press and rate for each parameter to set the number of displayed digits. While the definable set values are 3, 4, and 5, the value is actually selected according to the parameter type, as shown in the table below.

Parameter Setting value	heta, Q Comparator Δ % setting	D	Others
5	Up to the second decimal place	Up to the fifth decimal place	Up to 5 digits *1
4	Up to the first decimal place	Up to the fourth decimal place	Up to 4 digits
3	No decimal place	Up to the third decimal place	Up to 3 digits

*1 When the measurement speed is set to FAST, the setting is for 4 digits.

4. To exit from this mode, press the **EXIT** key to return the Initial screen.

4.24 Setting for Display

In some applications, such as on a production line or where EXT I/O or interfaces are used, it may not be necessary to display measurement values. This unit allows ON/OFF settings of the display and voltage/current monitors (Vmoni, Imoni) to be made.

Turning off the LCD display helps save power, as the LCD display and backlight remain off. Moreover, the measurement time is reduced due to the fact that measurement values and Vmoni and Imoni indications need not be displayed. When the voltage and current monitors are turned off, the measuring time is also reduced due to the fact that the Vmoni and Imoni indications are not required.

4.24.1 Control Screen Sequence



4.24.2 Details of the Setting Process



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the **DISP** key on the Application menu screen to display the Display Setting Screen.



Setting for LCD Display

• The LCD display and backlight remain on permanently. • The LCD display and backlight remain off permanently.

When OFF is selected, the LCD display and backlight go out approximately 10 seconds after the touch panel is last touched. When the touch panel is touched after the display and backlight have gone out, they will come on again. When the display and backlight are off, the measurement time is reduced, as Vmoni and Imoni do not display indications.

Setting for Voltage and Current Monitors (Vmoni, Imoni)

The voltage and current monitors display indications.FF :The voltage and current monitors do not display indications.

When OFF is selected, the measurement time is reduced, as Vmoni and Imoni do not display indications. For the measurement time, refer to "7.3 Time Taken for Testing."

4. To exit from this mode, press the **EXIT** key to return the Initial screen.

4.25 Key Lock Function

When the key lock function is turned on, all of the keys become inoperative, so that no control via the touch panel is possible, and the values of the settings are all frozen and preserved.

4.25.1 Turning the Key Lock On and Off

- This function is activated using the key lock switch on the rear panel of the 3522-50 unit.
- The key lock function can only be used when the screen is displaying the Initial screen, Comparator screen, Scaling screen, Magnification display screen, or Continuous test screen.



NOTE

- In the case of external triggering, the key lock does not apply to the MANU TRIG button.
 - Even if the power supply is interrupted, the key lock function is not canceled.

Chapter 5 Applications

5.1 Example of Comparator Application

Making decisions for two items simultaneously (ABS and % settings).

Example First parameter: static capacitance Cp and third parameter: phase angle θ will be set as follows:

First parameter (ABS setting)

Upper limit value110 nFLower limit value100 nF

Third parameter (% setting)	
Reference value	-85°
Upper limit value	5% (i.e., -80.75°)
Lower limit value	-5% (i.e., -89.25°)

The results of the decisions with these settings are as shown in the following table:

Comparator decisions

Third parameter		er Lower lim	Lower limit value Upper limit value	
Firstr parameter		LO	IN	HI
Upper limit value	HI	HI/LO	HI/IN	HI/HI
Lower limit value	IN	IN/LO	IN/IN	IN/HI
Lower minit value LO	LO	LO/LO	LO/IN	LO/HI

In this manner, two decisions can be made simultaneously. Further, it is possible to check the decision results for two different parameters at the same time, and thereby to determine what quality zone the object which is being tested falls into.

Sorting a single item into five bands (% setting).

Two decisions can be made relating to the same item, so as to obtain five different combinations of results.

Example First parameter and third parameter: impedance Z, will be set as follows:

First parameter	
Reference value	3.0 k
Upper limit value	10%
Lower limit value	5%
Third parameter	
Reference value	3.0 k
Upper limit value	-5%
Lower limit value	-10%

The results of the decisions with these settings are as shown in the following table:

	Comparator decisions	
	Parameter 1 result	Parameter 3 result
Band 1 First parameter upper limit value	Н	н
10% (3.3 k) Band 2	IN	Н
First parameter lower limit value 5% (3.15 k) Band 3	LO	н
Third parameter upper limit value -5% (2.85 k) Band 4	LO	IN
Third parameter lower limit value -10% (2.7 k) Band 5	LO	LO

It is possible to sort the objects under test into five bands according to the results of the decisions relating to the first and the third parameter. (This can also be done using the ABS setting.)

Various other possibilities can be used for the settings, according to requirements.

5.2 Testing High Impedance Elements

The measured value obtained when testing a high impedance element (such as, for example, a resistor with resistance higher than 100 k $\,$) is sometimes unreliable, because such an element is vulnerable to the effects of external interference and the like. In this case, reliable testing can be performed by the use of guarding, that is, connecting a metallic plate to the GUARD terminal and carrying out the measurement on the metallic plate.



When testing against a metallic plate, the surface of the plate should be covered by a film of resin or the like, in order to prevent short circuiting together the terminals.

NOTE

When the open circuit compensation is performed always execute the guarding process because of high impedance elements testing. If not, the compensation values do not stabilize. It is not possible to obtain the reliable measured value.

5.3 Testing an Element in a Circuit

Testing an element in a circuit is not possible without guarding.

• Referring to the following figure, when measuring a resistance value for the resistor R_2 , even if the tips of the two probes are contacted against the ends of the resistor R_2 , considering the sum of the current flowing through the resistor R_2 and the current flowing through the resistors R_3 and R_4 , what is obtained is the resistance value for the parallel combination:



• If as shown in the next figure a guard terminal is used, the current flowing through the resistors R_3 (not flowing through R_4) is absorbed by this guard terminal, so that the resistance value for the resistor R_2 is accurately measured.



NOTE

The accuracy of measurement will not be improved in cases where for example

 $R_2 >> R_3$ and R_3 is close to zero.

As shown in the figure below, it is not possible to use this type of separation process for testing of the impedance values of two resistors or other elements of identical types which are connected in parallel, or for testing of the impedance values of a coil and a capacitor which are connected in parallel.



Two resistors in parallel



Coil and capacitor in parallel

5.4 External Interference

The 3522-50 is designed to be resistant to errors caused by interference from the test cables or the power supply line. However, if the level of the interference is particularly large, this can cause measurement errors or faulty operation.

Refer to the examples given below for examples of countermeasures which can be taken against interference which has caused faulty operation etc.

5.4.1 Countermeasures Against Interference from the Power Supply Line

If noise is present in the power supply line, its influence can be moderated by the following countermeasures:

Grounding by using a protective ground wire

The 3522-50 unit is constructed so as to be provided with protective grounding via the ground lead in the power cord.

This protective grounding serves the important function, not only of avoiding the possibility of electric shock to the operator, but also of eliminating noise from the power supply line by the provision of an internal filter.

Be sure to connect the 3522-50 unit to a properly 3-wire power supply socket, using the grounded power cord which is supplied with the unit.

Inserting a noise filter in the power supply line

Any excessive noise present in the power supply line can be suppressed by purchasing a socket type noise filter (generally available commercially) which can be inserted into the power supply socket, with the 3522-50 unit connected to the output of the noise filter.

Various types of such socket type noise filters are readily available from specialist manufacturers.



Fitting an anti-interference ferrite core on the power cord

Pass the power cord through a commercially available anti-interference ferrite core, and fix it on the power cord as close as possible to the AC power inlet of the 3522-50 unit, so as to suppress noise from the power supply line. Further benefit can often be obtained by fitting another antiinterference ferrite core on to the power cord at its other end, as close as possible to the plug which connects to the power supply outlet. Moreover, if the internal diameter of the ferrite core allows, winding the power cord several times around the ferrite core may further reduce the amount of noise. Various types of such anti-interference ferrite cores or ferrite beads are readily available in the market from specialist manufacturers.


5.4.2 Countermeasures Against Noise from the Test Cables

If interference is producing noise in the test cables, its influence can be moderated by the following countermeasure.

Fitting an anti-interference ferrite core on the test cables

Pass the test cables through a commercially available anti-interference ferrite core, and fix it close to the test terminals, so as to suppress noise from the test cables.

Moreover, if the internal diameter of the ferrite core allows, winding the test cables several times around the ferrite core (as with the power cord as described above) may further reduce the amount of noise.





5.5 The EXT I/O Connector

This is a connector for output of comparator result signals, of a measurement finished signal (EOM), and of an analog measurement finished signal (INDEX), and for input of an external trigger signal, and a signal for performing selection of the number of the panel to be loaded.

Connector used

Honda communication Co.: ADS-B36BLFDR116

Compatible connector

Honda communication Co. : ADS-HC360001-010 Hirose: RC30-36P or equivalent



EXT I/O Connector Pin Numbering (seen from 3522-50)

5.5.1 Pinouts for the EXT I/O Connector

Pin number	Signal line name	Input/output	Pin number	Signal line name	Input/output
1	TRIG	Input	19	LD1	Input
2	LD2	Input	20	LD3	Input
3	LD4	Input	21	LD5	Input
4	PNL0	Input	22	PNL1	Input
5	PNL2	Input	23	M-HI	Output
6	M-IN	Output	24	M-LO	Output
7	S-HI	Output	25	S-IN	Output
8	S-LO	Output	26	AND	Output
9	INDEX	Output	27	EOM	Output
10	Unused		28	Unused	
11	EXT.DCV	Input	29	INT.DCV	Output
12	EXT.DCV	Input	30	INT.DCV	Output
13	EXT.DCV	Input	31	INT.DCV	Output
14	EXT.DCV	Input	32	INT.DCV	Output
15	EXT.COM	Input	33	INT.GND	Output
16	EXT.COM	Input	34	INT.GND	Output
17	EXT.COM	Input	35	INT.GND	Output
18	EXT.COM	Input	36	INT.GND	Output

5.5.2 Signal Lines for the EXT I/O Connector

NOTE

All input signals are all negative logic.

- (1) $\overline{\text{M-HI}}$, $\overline{\text{M-IN}}$, $\overline{\text{M-LO}}$ (Output signal of comparator result) These lines output the comparator result for the first parameter.
- (2) $\overline{\text{S-HI}}$, $\overline{\text{S-IN}}$, $\overline{\text{S-LO}}$ (Output signal of comparator result)

These lines output the comparator result for the third parameter.

(3) AND (Output signal of comparator result)

This signal is used to comprehensively evaluate the decision results for the first and third parameters.

This signal is output only if both the first parameter comparator result and the third parameter comparator result are IN.

(4) EOM (End of measurement signal)

This signal is continuously output during measurement. When this signal is HI, the most recent comparator result is used for the evaluation. The next trigger signal can also be input.

(5) INDEX (Signal during analog measurement)

Output during analog measurement. When this signal is HI, the object under test can be changed.

NOTE

INDEX signal is output at each time of retest. Therefore, when the object under test is changed, the settings of the test signal level, current and voltage limits, test range, and average are specified as followings.

Test signal level	Open-circuit voltage (V) setting
Current and voltage limits	OFF
Test range	HOLD range
Average	OFF

For the settings other than above, change the object under test referring to $\overline{\text{EOM}}$.

(6) EXT.DCV, EXT.COM

These are terminals for supplying a power supply voltage from an external device. This enables the 3522-50 unit to be connected to an external device while maintaining the isolation. The range of power voltage which can be connected is from +5 to +24 volts DC.

(7) INT.DCV, INT.GND

These lines output +5 VDC and COM from the 3522-50 unit.

(8) TRIG

When the external trigger is enabled for the 3522-50, measurement is begun when this signal is input.

(9) PNL0 to PNL2 (Panel page signals)

These lines inputs the page which have been saved by the panel save function.

Signal Page	PNL2	PNL1	PNL0
Invalid	HIGH	HIGH	HIGH
1	HIGH	HIGH	LOW
2	HIGH	LOW	HIGH
3	HIGH	LOW	LOW
4	LOW	HIGH	HIGH
5	LOW	HIGH	LOW
6	LOW	LOW	HIGH
Invalid	LOW	LOW	LOW

(10) $\overline{\text{LD1}}$ to $\overline{\text{LD5}}$ (Panel load signals)

Select the panel numbers stored using the panel save along with $\overline{\text{PNL0}}$ to $\overline{\text{PNL2}}$.

This signal is used to select panel numbers stored using the panel save function. When a panel number has been selected using this signal at the input of a trigger signal, the 3522-50 loads the measurement conditions for the panel number and then begins measurement. The table below shows the selectable panel numbers.

Page Signal	1	2	3	4	5	6
LD1	1	6	11	16	21	26
LD2	2	7	12	17	22	27
LD3	3	8	13	18	23	28
LD4	4	9	14	19	24	29
LD5	5	10	15	20	25	30

5.5.3 Circuit Construction and Connections for the EXT I/O Connector

The circuit construction for the EXT I/O connector is shown in the figure.

Except for the power supply lines, all of the input and output signal lines are insulated by photocouplers.



NOTE

- The internal DC power supply of 5 VDC is provided between INT DCV and INT GND. The maximum current capacity is 100 mA. Do not connect any external circuit whose current consumption is greater than 100 mA.
- INT GND is grounded to the chassis of the 3522-50 unit.
- When using the EXT I/O connector, be sure always to supply power to the external DC power supply.
- The output signal low level output current is a maximum of 60 mA. If a current greater than this is required, you should connect a transistor circuit using a current amplifier driven by an external power source or the like externally.

5.5.4 Electrical Characteristics of the Output Signals

The output signals are the collector outputs of the photocouplers, and are connected to the external DC power supply (EXT. DCV) via 4.7 k pull-up resistors provided internally to the 3522-50 unit.

The relationship between the external DC power supply voltage, the voltage of the output signals, and the current, is as shown in the following table:

ſ	External DC	Output s	signals (internal pull-up resistors 4.7 k)				
	External DC power supply voltage		Low level				
	voltage	High level	Output current 10 mA	Output current 40 mA	Output current 60 mA (max.)		
Ī	5 V	5V	0.9 V	1.1 V	1.2 V		
	12 V	12 V	0.9 V	1.1 V	1.2 V		
	24 V	24 V	0.9 V	1.1 V	1.2 V		

Direct connection of a circuit whose input voltage V_{IL} is regulated to a maximum of 0.8 V or the like is not possible.

In such a case, keep V_{IL} below 0.8 V by incorporating a transistor or a drive capable buffer circuit or the like.

5.6 Testing Using EXT I/O

5.6.1 Normal Testing

With the test conditions for testing by the comparator having been set (with the trigger setting set to external trigger), when in this state a trigger signal is input via the EXT I/O connector, or when on the screen the MANU TRIG soft key is pressed, then the decision result is output on the comparator result output signal line of the EXT I/O connector.

When a panel number has been selected using the panel load signal at the input of a trigger signal via the EXT I/O connector, the 3522-50 loads the measurement conditions for the panel number and then begins measurement. An example of testing timing is as follows:



	Meaning	Timing (approximate)
T1	Minimum time period for trigger signal recognition	100 μs
T2	Time period from trigger to circuit response	300 μ s + α (α depends on the sample under test and the trigger delay)
Т3	Analog measurement time; chucking switching on INDEX (HIGH) possible (Note 1)	1 ms (Note 2)
T4	Time period for testing	5 ms (Note 2)
Т5	Minimum time period from end of testing to next trigger	0 s
Т6	Time period from trigger input to panel load signal recognition. After this length of time has elapsed, the LD signal can be changed.	300 μs

Note1: The chuck can be switched using the INDEX signal only when the test signal level, current and voltage limits, test range, and average are set as specified below: Test signal level: Open circuit voltage (V) setting Current and voltage limits: OFF Test range: HOLD range Average: OFF

Note2: Reference value with the following conditions; test frequency:1 kHz, testing speed:FAST, averaging:OFF, and when measuring |Z|. For the test time, refer to Section 7.3, "Time Taken for Testing."

• When the selected panel number falls under either of the following conditions, the 3522-50 begins measurement without loading the measurement conditions:

- (1) When more than 2 panel numbers have been selected.
- (2) The selected panel number is not stored.
- (3) Both the first and third parameters are set to OFF.
- (4) The parameters are other than Rs or Rp during DC measurement.
- When the measurement conditions are loaded, the external trigger is always set.

5.6.2 Continuous Testing From EXT I/O

It is possible to read in from the EXT I/O connector in order test conditions which have been saved using the panel save function, and to perform as many measurements as desired one after another automatically (continuous testing).

Up to five panel numbers can be selected in a page for the continuous testing.

Page	Panel numbers
1	1 - 5
2	6 - 10
3	11 - 15
4	16 - 20
5	21 - 25
6	26 - 30

(1) Control Screen Sequence



Section 4.16, "Panel Save Function"

Section 4.21, "Continuous Test Function"

Specify the panel number for use the LD1 to LD5 and $\overline{\text{PNL0}}$ to $\overline{\text{PNL2}}$ signals of the EXT I/O connector.

Input the TRIG signal of the EXT I/O connector to start test.

(2) Details of the Setting Process

This section describes procedure when performing continuous testing with panel numbers 6, 8, and 10 for example.

1. Save the continuous testing conditions on the panel number 6, 8, and 10. The continuous testing is performed for the first and third parameters which have been saved.

For details on panel save function, see Section 4.16.



Panel Save Screen

2. Shift to the continuous test screen.

No. 6	TEST1 Cs-D	120.0 H:	z COMP	
No. 7				
No. 8 ON/	TEST3 Cs-D	1.000kH:	z COMP	PAGE
No. 9				PAGE DOWN
No.10 ON/OFF	TEST5 Cs-D	10.00kH:	z Comp	
* CONTINUOU	S MEAS	* MANU	I TRIG	EXIT

Continuous Test Screen

NOTE

- If the power is cut on the continuous test screen, the machine will shift to the continuous test screen the next time the power is turned ON.
- The panel numbers which test conditions are not saved or which are invalid even if test conditions are saved (when the first and third parameters are both off, or when the parameters are other than Rs or Rp during DC measurement), are not displayed.

3. When continuous testing is performed using panel numbers 6, 8 and 10, set the following signals via the EXT I/O connector.

Signal lines	PNL2	PNL1	PNL0	LD5	LD4	LD3	LD2	LD1
Settings	HIGH	LOW	HIGH	LOW	HIGH	LOW	HIGH	LOW

For details on each signals, panel saving pages, and panel numbers, see Section 5.5.2, "Signal Lines for the EXT I/O Connector."

4. Input a trigger signal via EXT I/O connector to start test.

When a trigger signal (TRIG) is input, the settings of LD1 to LD5 and PNL0 to PNL2 signals are read, and then the settings of panel numbers for continuous testing are updated.

The testing will be performed in ascending order from low numbers of specified panel. Each time test is completed, the test results for the panel number are displayed.

The settings for the panel numbers on the screen are invalid because of $\overline{\text{TRIG}}$ signal input.



The first and third parameters decision results

NOTE

NOTE

If the screen is switched to other pages after test completed, the displays of the test results are disappeared.

The comparator decision result for the panel numbers for continuous testing, which the comparator setting is ON, is output on the following signal line of the EXT I/O connector.

- AND If all of the decision results are IN, then LO is output.
- M-IN If all of the decision results of the first parameters are IN, then LO is output.
- S-IN If all of the decision results of the third parameters are IN, then LO is output.

M-HI, M-LO, S-HI, S-LO

Not used. HI is always output.

An example test timing in this case is shown below.



When continuous testing is performed using panel numbers 6, 8 and 10:



- *3 If all of the conditions hold (IN) then the AND line is brought LO.
- *4 M-IN is brought low when all of the decision results for the first parameter are satisfied; and S-IN is brought low when all of the decision results for the third parameter are satisfied.

5. When each trigger signal arrives and the panel number is changed, the process follows the timing shown in the next figure. (The figure shows that the panel numbers 6,8 and 10 are tested first and then the panel numbers 2 and 3 are tested.)



6. When quitting continuous testing, press the **EXIT** key to return to the initial screen.

5.7 Supplying DC Bias

The maximum voltage which can be applied to the test terminals of the 3522-50 unit is 10 V DC. If a DC voltage greater than this is applied continuously, the unit may be damaged.

Supplying DC bias means that a DC voltage is supplied as a bias to a sample for test whose characteristics are voltage dependent, such as an electrolytic capacitor or a ceramic capacitor.

Further, a DC current can be supplied as a bias to a sample for test whose characteristics are current dependent, such as a choke coil.

Since the 3522-50 unit has no DC bias input terminals, a DC bias must be supplied in the manner described in the following sections.



When the DC bias is supplied to test, and if "OVER FLOW" is displayed and test cannot be done, set the external DC bias function to ON. (See Section 4.22, "External DC Bias Setting.")

5.7.1 How to Supply a DC Bias Voltage

- In order to avoid electric shock accident, be absolutely sure not to touch the test terminals while the DC bias voltage is being supplied to them.
- If you disconnect the sample under test from the test terminals with the DC bias voltage still being supplied, then the test sample is left charged, which is very dangerous. In order to avoid electric shock accident, be absolutely sure to discharge the test sample.
- Do not short circuit between the clips of the test probes with the DC bias voltage still being supplied. Doing so may damage the probes or cause a short circuit accident.

To supply a DC bias voltage to a capacitor or the like, proceed as follows. Use the optional 9268 DC BIAS VOLTAGE UNIT.

For details on using the 9268, refer to the Instruction Manual of the 9268. (Depending on the test frequency, test signal level, and test range, the 9268 cannot be used.)



If the 9268 is not used, refer to the following.

DC Bias Voltage Circuit

- Use a resistance (R) or inductance (L) which has a large enough impedance with reference to the sample under test (Z).
- Use a capacitor (C) which has a small enough impedance (i.e., a large enough capacitance) with reference to the sample under test (Z).
- Be careful about the polarity when connecting together the probes, the sample to be tested, and the DC voltage source.
- It takes a little time for the DC voltage which is being supplied to the sample under test to reach the set voltage, so you should wait for a certain stabilization time period (which depends upon the sample) before performing testing. Be careful, because if you perform testing before this stabilization time period has elapsed, the results will not be reliable.
- After testing is completed, drop the voltage of the DC voltage source to zero, and remove the sample under test from the probes after having discharged any electric charge which may have built up.
- If you have removed the sample under test from the probes without first having discharged the accumulated electric charge, you should be careful to do so immediately.

5.7.2 How to Supply a DC Bias Current

• In order to avoid electric shock accident, be absolutely sure not to touch the test terminals while the DC bias is being supplied to them.

• Do not short circuit between the clips of the test probes with the DC bias still being supplied. Doing so may damage the probes or cause a short circuit accident.

To supply a DC bias, use the optional 9269 DC BIAS CURRENT UNIT. For details on using the 9269, refer to the Instruction Manual of the 9269. (Depending on the test frequency, test signal level, and test range, the 9269 cannot be used.)

If the 9269 is not used, refer to the followings.

To supply a DC bias current to a transformer or a choke coil or the like, construct an external bias circuit as follows.



DC Bias Current Circuit

- Connect the sample to the measuring probe and then gradually raise the voltage of the DC source to the specified DC bias level. To disconnect the sample, gradually reduce the voltage of the DC source until the DC bias supplied to the sample is decreased to zero. You may disconnect the sample after this is achieved.
- Use a choke coil (CH) which has a large enough impedance with reference to the sample under test (Z).
- Use a capacitor (C) which has a small enough impedance (i.e., a large enough capacitance) with reference to the sample under test (Z).
- Be careful about the polarity when connecting together the probes, the sample to be tested, and the DC current source.
- Be careful not to magnetically saturate the choke coil (CH) with the DC bias current.
- It takes a little time for the DC current which is being supplied to the sample under test to reach the set value, so you should wait for a certain stabilization time period (which depends upon the sample) before performing testing. Be careful, because if you perform testing before this stabilization time period has elapsed, the results will not be reliable.

5.8 The Residual Charge Protection Function

- The quoted maximum voltage from which the unit can be protected by this function is for reference purposes only, and is not a guaranteed value. There may be danger of damage to the 3522-50 unit, depending upon the operational circumstances and upon how often such charged capacitors are connected. In general, you should not rely upon this protection function; be sure to discharge charged capacitors properly before connecting them to the test terminals.
- The residual charge protection function is for protection of the 3522-50 unit against the discharge of voltage present in charged capacitors, and is not capable of protecting the unit against DC voltage which is constantly applied such as a superimposed DC voltage. (The maximum voltage for supply to the test terminals of the 3522-50 unit is 10 VDC.) If this is done, there is a danger of damage to the unit. (For how to supply a DC bias voltage, refer to Section 5.7, "Supplying DC Bias".)

The 3522-50 has been enhanced by the incorporation of a residual charge protection function. If by mistake a charged capacitor is connected to the test terminals, this function protects the internal circuitry of the unit from discharge of such residual charge.

The maximum voltage from which the unit can be protected by this function is determined from the capacitance value of the sample under test by the following equation:

$$V = \sqrt{rac{1}{C}}$$

V: voltage (volts) (maximum 400 VDC) C: capacitance (farads)

5.9 9442 PRINTER (option)

Using with the optional 9593-01 RS-232C INTERFACE, 9442 PRINTER, and 9446 CONNECTION CABLE, the test values and screen display copy can be printed out.

5.9.1 Preparation

(1) Using of the printer

Use the 9442 PRINTER, the 9443-01 AC ADAPTER, and the 1196 RECORDING PAPER.

To connect the main unit and printer, use the 9593-01 RS-232C INTERFACE and the 9446 CONNECTION CABLE. (All are options)

9442	DPU-414	Seiko Instruments Inc.
9443-01	PW-4007-J1	Seiko Instruments Inc. (for Japan)
9443-02	PW-4007-E1	Seiko Instruments Inc. (for EU)
9443-03	PW-4007-U1	Seiko Instruments Inc. (for America)

(2) Setting of the 9442 PRINTER communication condition

Change the settings of the software dip switches (DIP SW) to use the 9442 for the 3522-50.

 The 9442 is shipped with the function settings for use with the HIOKI 3166 CLAMP ON POWER HITESTER. Before using, always change the settings of the DIP switches.

- For details on the operations and handling of the printer, refer to the operation manual supplied to the printer.
- For the printer, use the 1196 RECORDING PAPER (thermal paper, 10 rolls) or an equivalent.
- 1. Turn off the power.
- 2. Turn on the power while pressing the ON LINE button. Release the button after a list of the current settings starts printing out.
- 3. The print out of the current settings is followed by the prompt: "Continue? :Push 'On-line SW'", "Write?:Push 'Paper feed SW'". Press the ON LINE button to change the settings.

	to the ne			
Software DIP SW1	Switch No.	Function	ON (ON LINE)	OFF (FEED)
Use these settings	1	Input method	Parallel	Serial
for the 3522-50	2	Printing speed	High	Low
	3	Auto loading	Enable	Off
	4	CR function	Carriage return and line feed	Carriage return
	5	DIP SW setting command	Enable	Disable
	6			OFF
	7	Printing density (set to 100%)	ON	
	8		ON	

4. "Dip SW-1" is printed to make a settings for switch number 1 to 8 of DIP SW 1. Refer to the next table.

To set to ON, press the ON LINE button once and to set to OFF, press the FEED button once.

The setting is printed out after the ON LINE or FEED button is pressed to allow to confirm the new setting. To change the settings, repeat from step 1. When the setting for switch number 8 is made, the printer once again prompts with "Continue? :Push 'On-line SW", "Write?:Push 'Paper feed SW".

5. Set the switch number 1 to 8 of DIP SW 2 and 3 in the same way from step 3 referring to the following tables.

Software DIP SW2	Switch No.	Function	ON (ON LINE)	OFF (FEED)
	1	Print mode	Normal printing (40 columns)	Condensed printing (80 columns)
	2	User-defined characters back-up	Enable	Disable
	3	Character type	Ordinary characters	Special characters
	4	Zero font	0	0
	5		ON	
	6	International	ON	
Software DIP SW3	7	character set	ON	
	8		ON	
Software DIP SW3	Switch No.	Function	ON	OFF
Software DIP SW3	Switch No. 1	Function Data bit length	ON Eight bits	OFF Seven bits
Software DIP SW3				
Software DIP SW3	1	Data bit length	Eight bits	Seven bits
Software DIP SW3	1 2	Data bit length Parity permission	Eight bits Without	Seven bits With
Software DIP SW3	1 2 3	Data bit length Parity permission Parity condition	Eight bits Without Odd	Seven bits With Even
Software DIP SW3	1 2 3 4	Data bit length Parity permission Parity condition	Eight bits Without Odd	Seven bits With Even XON/XOFF
Software DIP SW3	1 2 3 4 5	Data bit length Parity permission Parity condition Flow control	Eight bits Without Odd H/W BUSY	Seven bits With Even XON/XOFF

6. After setting for the switch number 8 of DIP SW 3 is made, press the ON LINE or FEED switch to complete settings."Dip SW setting complete!!" is printed out.

(3) Setting of the 9593-01 RS-232C INTERFACE

Set the communication setting switch on the left of the RS-232C connector to ON.

5.9.2 Connection Method

To avoid electrocution, turn off the power to all devices before plugging or unplugging any cables or peripherals.

Set the 9442 PRINTER and the 9593-01 RS-232C INTERFACE referring to Section 5.9.1.

- 1. Turn off the power of the main unit and printer.
- **2.** Install the 9593-01 RS-232C INTERFACE to the main unit. (For details on installing, see the 9593-01 Instruction Manual.)
- **3.** Connect the 9446 CONNECTION CABLE between the main unit and the printer.



5.9.3 Control Screen Sequence



When the setting has been established as above, press the **EXIT** key to return to the Initial screen.

5.9.4 Returning from Comparator Operation to Normal Testing



- **1.** Press the MENU key on the Initial screen to display the Menu screen.
- 2. Press the **APPLI MENU** key on the Menu screen to display the Application menu screen.
- **3.** Press the *E* key on the Application menu screen to display the Print mode setting screen.



Print mode setting screen

- **4.** Select the one of the following print mode. The key selected changes to non-reversed video. For details on print mode, see Section 5.9.5 to 5.9.7.
 - 1: Screen copy printing Prints out the Initial screen copy.
 - 2: Auto printing Prints out the test values after test.
 - 3: Manual printing Prints out the test values only when the **PRINT** key key on the Initial screen is pressed.
- 5. When the setting is completed, press the **EXIT** key to return the Initial screen.

5.9.5 Screen Copy Mode

Prints out the screen copy of the Initial screen.

- Pressing the **PRINT** key on the Initial screen starts printing.
- During printing, the **PRINT** key is not displayed, and all keys are invalid.
- When the printer is not operated for 10 seconds or more after pressing the key, such as case of disconnecting the printer, it stops printing after beep sounds.

Example of printing



5.9.6 Auto Print Mode

The test values are printed out when the test is completed. When the continuous test is performed, the test values are printed out when each test for the panel number is completed.

Example of printing

Normal test

Z 413.49m ohm : PH -79.68 deg Cs 391.24u F : D 0.18210

Comparator executing

Cs 391.34u F HI ! D 0.18174 HI

Continuous test

PANEL No.1: No.1 SAVE DATA 0.31376 Cs 385.12u F IN : D ΙN PANEL No.2: No.2 SAVE DATA Cs 383.24u F IN : D 0.44627 ΙN PANEL No.3: No.3 SAVE DATA Cs 383.56u F IN : D 0.57990 $\Gamma_{0,\infty}$ PANEL No.4: No.4 SAVE DATA Cs 385.70u F IN : D 0.71671 ΙN PANEL No.5: No.5 SAVE DATA Cs 389.56u F IN : D 0.85801 ΙN

5.9.7 Manual Print Mode

Regardless of the trigger settings, the test values are printed out when the **PRINT** key on the Initial screen is pressed.

- When the test value is not stabilized because of changing the range by autoranging, "OVER FLOW" may be printed out. Press the **PRINT** key after the test value is stabilized.
- The examples of the output results are same as a and b of the auto print mode.

Chapter 6 Maintenance, Adjustment, and Disposal

6.1 Maintenance and Servicing

In order to use the 3522-50 safely, the following maintenance and checking procedures should be executed at the proper intervals.

- Be sure to read assiduously the various items highlighted in this manual for attention, in order to use the unit correctly.
- If damage is suspected, check the "Troubleshooting" section before contacting your dealer or Hioki representative.
- Getting the 3522-50 unit wet or letting oil or dust enter inside its casing will certainly damage it, and is quite likely to cause an electric shock accident or a dangerous conflagration. If the unit has gotten seriously wet, oily, or dusty, stop using it and send it for service at an approved HIOKI service facility.
- Periodic calibration is necessary in order to maintain and authenticate the accuracy of this testing device. When such calibration is necessary, you should utilize the services of an approved HIOKI calibration facility.
- A lithium battery is used in the 3522-50 for powering the backup memory. When this battery becomes unfit for service, it is no longer possible to preserve the testing conditions. Therefore, when it is not possible to preserve the testing conditions, you should dispatch the unit to an approved HIOKI service facility for the lithium battery to be changed.

NOTE

HIOKI intend to maintain the supply of spare parts for maintenance and service of the 3522-50 unit for a minimum of seven years after the cessation of production.

6

Cleaning the unit

- To clean the product, wipe it gently with a soft cloth moistened with water or mild detergent. Never use solvents such as benzene, alcohol, acetone, ether, ketones, thinners or gasoline, as they can deform and discolor the case.
- Wipe the LCD gently with a soft, dry cloth.



159

6.2 How to Change the Power Supply Fuse and Change the Power Supply Voltage

The power supply fuse for the 3522-50 unit, and the power supply voltage selector, are housed in the power input socket on the rear panel.

When changing the power supply fuse or changing the power supply voltage, in order to avoid the risk of electric shock accident, be guite sure first to turn the main switch of the 3522-50 unit off, and then to remove the power cord. Moreover, after finishing any operation, before reconnecting the power cord to the unit, be sure to check that the power supply voltage value indicated on the voltage selector housed in the power input socket on the rear panel is in agreement with the actual voltage value of the power supply line to which you intend to connect the unit. • Replace the fuse only with one of the specified characteristics and voltage and current ratings. Using a non-specified fuse or shorting the fuse holder may cause a life-threatening hazard. Fuse type: 100 V, 120 V settings: 250 V F1.0 AL 20 mm x 5 mm dia. 220 V, 240 V settings: 250 V F0.5 AL 20 mm × 5 mm dia. • Before the 3522-50 is dispatched from the factory, it is set to the power supply voltage used at the destination specified for shipping, and the specified fuse for that power supply voltage is fitted, along with an identical spare fuse. If for any reason you intend to power the unit from a power supply whose voltage is different, be sure to change the fuse as well as altering the voltage selector setting. • If you intend to use a power supply of a voltage other than the specified ones for powering the unit, use a fuse and voltage selector setting as follows: Actual power supply voltage 110 V : use settings for 120 V Actual power supply voltage 200 V : use settings for 220 V Actual power supply voltage 230 V : use settings for 240 V



Changing the power supply fuse and the power supply voltage:

Display window

- **1.** Turn the power switch off, and then remove the power cord.
- 2. Using a slot head screwdriver or the like, bias sideways the catch which holds the fuse box into the power input socket as shown in the figure, and then remove the fuse box.
- 3. When changing the power supply fuse: Change the power supply fuse for a

new one of the same rating and specification.

When altering the power supply voltage setting:

- Remove the voltage selector from the fuse box, and reinsert it after having rotated it so that the desired new power supply voltage setting appears in the display window as shown in the figure. Then recheck the setting value shown in the window. (The voltage display is upside down and backwards.).
- 2) Change the power supply fuse for a new one whose rating and specification are appropriate for the new power supply setting.
- **4.** Replace the fuse box by reinserting it into the power input socket.

6

6.3 Shipping the Unit



Use the original packing materials when reshipping the product, if possible.

6.4 Troubleshooting Checklist

If the 3522-50 unit appears to be faulty, check the following possibilities before sending the unit for service:

Symptom	Cause	Treatment	
Although you have turned on the power switch, the screen display does not appear.	Is the power cord disconnected?	Reconnect the power cord.	
	Is the contrast on the LCD panel turned down to minimum?	Adjust the LCD panel contrast.	
	Has the fuse blown?	Change the fuse.	
Key input is not effective.	Is the unit in the key locked state?	Release the key lock state.	
	If both GP-IB and RS-232C are in use, has remote been externally set?	Set both GP-IB and RS-232C to local.	

If none of these is applicable, or if you have no idea of the problem, try resetting the system.

All of the settings will revert to the factory original settings. You must reset them again.

For the method of system reset, see Section 4.20 "System Reset."

If operation is interrupted in the following kinds of situation, remove the power cord and the input cables, and get into contact with an approved HIOKI service facility:

- The unit is clearly damaged.
- Even when you try, testing is not possible.
- The unit has remained subject to high temperature or high humidity conditions for a long time period.
- The unit has been subjected to stress due to rough transportation.

6

6.5 Disposing of the Unit

A lithium battery is used in the 3522-50 as a power source for recording test conditions.

- To avoid electrocution, turn off the power switch and disconnect the power cord and measurement cables before removing the lithium battery.
- When disposing of this product, remove the lithium battery and dispose of battery and product in accordance with local regulations
- If the protective functions of the product are damaged, either remove it from service or mark it clearly so that others do not use it inadvertently.

1

1

Tools required for dismantling

- Phillips screwdriver
- Pair of tweezers

How to dismantle the unit



- **1.** Turn off the power switch, and disconnect the power cord and other cables.
- **2.** Remove the eight screws at the back of the unit and the two screws which hold on the carrying handle, as shown.



3. The battery holder is located in the position illustrated on the left. Insert a pointed tool, such as the tip of a tweezers, between the battery and the battery holder, and lift the battery to remove it.

Chapter 7 Specification and Options

7.1 General Specification

	17	Impodonco			
1. Test parameters	Z Y	Impedance Admittance			
	• •	θ Phase angle			
	Cs Series-equivalent static capacitance				
	Cp Parallel-equivalent static capacitance				
	D				
	Ls				
	Lp				
	-				
	Rs	<i>R</i> s Series-equivalent resistance = ESR			
	<i>R</i> p	Parallel-equivalent r	esistance		
	G	Conductance			
	X	Reactance			
	В	Susceptance			
2. Test frequencies	DC, 1 m	Hz to 100 kHz			
(FREQ)					
(FREQ) Setting resolution		Frequency (Hz)	Step (Hz)		
· · · · · · · · · · · · · · · · · · ·		Frequency (Hz) DC to 9.999	Step (Hz) 1 m		
· · · · · · · · · · · · · · · · · · ·					
· · · · · ·		DC to 9.999	1 m		
·····		DC to 9.999 10.00 to 99.99	1 m 10 m		
· · · · · · · · · · · · · · · · · · ·		DC to 9.999 10.00 to 99.99 100.0 to 999.9	1 m 10 m 100 m		
· · · · · ·	±0.0059	DC to 9.999 10.00 to 99.99 100.0 to 999.9 1.000 k to 9.999 k 10.00 k to 100.0 k	1 m 10 m 100 m 1		

4. Test signal levels

4. Test signal levels				
Open circuit voltage (V) mode and Constant voltage (CV) mode	Range Resolution Accuracy	0.010 to 5.000 V, 100 mA max. 0.001 V steps ±10%±10 mV		
Constant current (CC) mode	Range Resolution Accuracy	0.01 to 99.99 mA, 5 V max. 0.01 mA steps ±10%±10 μA		
Monitor function Voltage monitor (Vmoni)	Range Accuracy	0.000 V to 5.000 V $\pm 10\% \pm 10 \text{ mV}$		
Current monitor (Imoni)	Range Accuracy	0.000 mA to 100.0 mA $\pm 10\% \pm 10 \ \mu A$		
Limit function Current limit (I-LIM) (V, CV mode)	Range Accuracy	0.01 mA to 99.99 mA ±10%±10 μA		
Voltage limit (V-LIM) (CC mode)	Range Accuracy	0.010 V to 5.000 V $\pm 10\% \pm 10 \text{ mV}$		
5. Residual charge protection	400 V max (for reference only) Where: $V = \sqrt{\frac{1}{C}}$ {C: capacitance of the sample under test in farads}			
6. Test ranges (RANGE)	The test range is determined according to impedance and phase angle. The values of the other test parameters are calculated from $ Z $.			
Ranges	100 m Ω , 1 Ω , 10 Ω , 100 Ω , 1 k Ω , 10 k Ω , 100 k Ω , 1 M Ω , 10 M Ω , and 100 M Ω (10 ranges, can be set either automatically or manually)			
Z display range	10.00 m Ω to 200.00 M Ω (5 digits)			
θ display range	$+180.00^{\circ}$ to -180.00° (5 digits)			
7. Display ranges	The measurement range varies according to the test frequency. (): impedance			
	Y, G, B	5.0000 nS to 99.999 S 5 digits		
	<i>R</i> , <i>X</i>	10.00 m Ω to 200.00 M Ω 5 digits		
	L	16.000 nH to 750.00 kH 5 digits		
	С	0.3200 pF to 1.0000 F 5 digits		
	D	0.00001 to 9.99999 6 digits		

Q

NOTE: The test range of L and C varies depending on the test frequency and value of θ . When the test speed is FAST, the parameters excluding D, Q, and θ are displayed up to 4 digits.

Resolution:0.01

0.01 to 999.99
8. Display	78.4 mm x 107.2 mm (3.09" x 4.22") LCD display with backlight		
9. Testing speed (SPEED)	Processing method: taken as the average of the waveform detected by the measurement circuit.		
When measuring open- circuit terminal voltage (V) (minimum times with test frequency 1 kHz, Z display, initial screen)	The values depend on the measurement frequency, display parameter types, open-circuit and short-circuit compensation, and whether or not the comparator is being used. FAST 5 ms ± 2 ms NORM 16 ms ± 2 ms SLOW 88 ms ± 2 ms SLOW2 828 ms ± 2 ms		
Constant voltage (CV) and constant current (CC) settings	Constant voltage/constant current measurement after connecting a measurement sample Maximum of 5 times measurement speed setting		
10. Averaging function (AVE)			
Setting of the number of averaging	OFF, 2, 4, 8, 16, 32, or 64		
Processing	Internal trigger moving average of setting times External trigger moving average of setting times		
11. Trigger function (TRIG)	 Manual setting of the Internal trigger (INT) or external trigger (EXT) Trigger delay function (DELAY): 0.01 s to 9.99 s, setting resolution 0.01 s 		
12. Zero compensation			
Open circuit compensation (OPEN)	Correction of residual admittance between the measurement terminal of the fixture		
	Operation is possible when, with the terminals open-circuit, the impedance is at least 1 k Ω .		
Short circuit compensation (SHORT)	Correction of residual impedance between the measurement terminals of the fixture Operation is possible when, with the terminals short-circuit, the impedance is less than 1 k Ω .		
Spot compensation (SPOT)/Continuous correction (ALL)	For both open-circuit and short-circuit correction, a selection can be made for correction either at the set frequency only, or correction to be made over the entire frequency range.		
13. Comparator function (СОМР)		
Comparator function setting and using	For the touch panel, GP-IB, and/or RS-232C, comparator settings can be made and execution carried out for two parameters.		
Upper and lower limit value settings (LIM)	For ABS (absolute values) setting Upper and lower limit values (HI, LO) are set. For % (percentages) setting Set a reference value (REF) and upper- and lower-limit values (HI, LO). For Δ % (deviation percentages) setting Set a reference value (REF) and upper- and lower-limit values (HI, LO). The measurement values are displayed as deviations from the reference value (Δ %).		
Comparator result output (HI, IN, LO)	EXT I/O connector (HI, IN LO output of two parameters, AND, INDEX, EXT TRIG, EOM, LOCK output internal 5 V, GND output, external power supply, GND input, LOAD, PANEL signal input)		

14. Scaling function	Test value con coefficients a			ble by setting the ing equation.	compensation
	[test value after compensation] = $a \times [test value] + b$ When the parameter is D or Q, calculate from compensation value				
	for θ .				
15. Magnification display function	Y The test values and comparator decision results can be displayed in enlarged form				
16. Continuous test function	Continuous testing of the conditions which have been saved				een saved
17. Display digits	The values 3, 4, and 5 can be set as the number of displayed digits. The actual number of displayed digits, however, depends on the parameter used.				
	Parameter Setting value	θ, Compara sett	ator Δ %	D	Others
	5	Up to the decimal p	second lace	Up to the fifth decimal place	Up to 5 digits *1
	4	Up to the decimal p	first lace	Up to the fourth decimal place	Up to 4 digits
	3	No decima	al place	Up to the third decimal place	Up to 3 digits
	*1 When the is for 4 di		ement sp	beed is set to FA	AST, the setting
18. Display-setting function	A setting can be made to turn on/off the indications of the LCD display and voltage/current monitors.			ns of the LCD	
19. System reset	All of the setti	ngs will r	evert to t	he factory setting	s.
20. Key lock function (KEY LOCK)	This disables the operation of keys on the panel, by means of either the special-purpose switch on the rear panel.				
21. Panel save (SAVE) and load (LOAD) function	A maximum of 30 sets of complete measurement conditions can be saved and recalled.				
22. Beep sound setting (BEEP)	There are settings corresponding to key input and to the comparator results.				
23. Interfaces	 Touch panel settings 9518-01 GP-IB INTERFACE or 9593-01 RS-232C INTERFACE options can be selected (separate package) EXT I/O connector (standard) 				
24. Temperature range for use	0 to 40° C (32°F to 104°F), up to 80% relative humidity, no condensation.				
25. Temperature range for storage	-10 to 55°C (14°F to 131°F), up to 80% relative humidity, no condensation.				
26. Operating environment	Indoors, altitude up to 2000 m (6562 feet)				
27. Power supply	Rated supply v	voltage	(Voltage	/220/240 V AC (s e fluctuations of <u>c</u> pply voltage are t	$\pm 10\%$ from the
	Rated supply f Maximum rate			z (with options inst	alled)

28. Dimensions and mass	Approx. 313W mm x 125H mm x 290D mm (12.32"W x 4.92"H x 11.42"D), Approx. 4.5 kg (158.7 oz)		
29. Accessories supplied	Instruction Manual1Power cord1(selected according to shipping destination)Spare fuse for power supply1(selected according to shipping destination)(100/120 V: 250 V F1.0 AL, 200/240 V: 250 V F1.0 AL)		
30. Component replacement	Power supply fuse (refer to above)		
31. Options	 9140 4-TERMINAL PROBE 9143 PINCHER PROBE 9261 TEST FIXTURE 9262 TEST FIXTURE (direct connection type) 9263 SMD TEST FIXTURE (direct connection type) 9268 DC BIAS VOLTAGE UNIT 9269 DC BIAS CURRENT UNIT 9165 CONNECTION CORD (for 9268, 9269/ BNC-BNC/ 1.5 m) 9166 CONNECTION CORD (for 9268, 9269/ BNC-clip/ 1.5 m) 9518-01 GP-IB INTERFACE 9593-01 RS-232C INTERFACE 9443-01 AC ADAPTER (for printer, for Japan) 9443-02 AC ADAPTER (for printer, for FU) 9443-03 AC ADAPTER (for printer, for America) 9446 CONNECTION CABLE (for printer) 1196 RECORDING PAPER (for printer) Note: Only one of the 9518-01 GP-IB INTERFACE and the 9593-01 RS-232C INTERFACE can be installed. To use the 9442 PRINTER, 9593-01 is necessary. 		
32. Applicable Standards	EMC EN61326:1997+A1:1998+A2:2001+A3:2003 EN61000-3-2:2000 EN61000-3-3:1995+A1:2001 Safety EN61010-1:2001		
	Pollution Degree 2 Measurement Category I (anticipated transient overvoltage 330 V)		
33. Withstand voltage	1.39 kV AC for 15s, between power and ground		

7.2 Testing Parameters and Calculation Equations

Normal circuit elements etc. are assessed with regard to their characteristics in terms of their impedance Z. The 3522-50 for subjects such circuit components to an alternating current signal at a certain test frequency, measures their voltage and current vectors, and from these values obtains the impedance Z and the phase angle θ . It is then possible to obtain the following quantities from the impedance Z by displaying it upon the complex plane.



Moreover, it is possible to use the admittance Y, which as a characteristic of a circuit component is the reciprocal of the impedance Z.

By displaying the admittance Y upon the complex plane (just as was done for the impedance Z) the following quantities can be obtained:



From the voltage V which is applied between the terminals of the sample under test, the current I which flows through the test sample at this time, the phase angle θ between this voltage V and this current I, and the angular velocity ω which corresponds to the test frequency, the 3522-50 can calculate the following components by using the calculation equations shown:

NOTE

The phase angle θ is shown based on the impedance Z. When measuring based on the admittance, the sign of the phase angle θ must be reversed.

Quantit	Series equivalent circuit mode	Parallel equivalent circuit mode	
Quantit	-		
Z	$ Z =rac{V}{I}\Bigl(=\sqrt{R^2+X^2}\Bigr)$		
Y	$ Y = \frac{1}{ Y }$	$rac{1}{Z } \left(=\sqrt{G^2+B^2} ight)$	
R	$Rs = ESR = Z \cos \theta$	$R\mathbf{p} = \left \frac{1}{ \mathbf{Y} \cos \phi} \right (= \frac{1}{G})^*$	
x	$X = Z \sin \theta $		
G		$G = \mathbf{Y} \mathbf{cos} \phi *$	
В		$B = \mathbf{Y} \sin \phi *$	
L	$L_s = \frac{X}{\omega}$	$L_p = \frac{1}{\omega B}$ $C_p = \frac{B}{\omega}$	
С	$C_s = rac{1}{\omega X}$	$C_p = \frac{B}{\omega}$	
D	$D = \left \frac{1}{t} \right $	$\frac{1}{\operatorname{an}\theta}$	
Q	$Q = \mathbf{t} $	$ an \theta \left \left(= \frac{1}{D} \right) \right. $	

* ϕ : phase angle of admittance $Y(\phi = -\theta)$

- Ls, Rs, Cs : The measured values of L, C, and R in series equivalent circuit mode.
- Lp, *R*p, Cp : The measured values of L, C, and *R* in parallel equivalent circuit mode.

7.3 Time Taken for Testing

The time taken for testing varies according to the test conditions. The following values may be used for reference.

NOTE

These values are all for reference only. Do not rely upon them absolutely, because the actual time taken for testing depends upon many operational conditions.

Analog testing signal (INDEX) <T3>

The output time (T3) of the analog testing signal (INDEX) taken according to the testing speed:

1. When the test frequency is DC

Measurement speed	FAST	NORM	SLOW	SLOW
Т3	1 ms	100 ms	800 ms	1600 ms

2. When the test frequency is less than 10 Hz (Tf(s) = $1 \div$ test frequency)

Measurement speed	FAST	NORM	SLOW	SLOW
Т3	Tf	Tf	Tf x 2	Tf × 3

3. When the test frequency is 10 Hz or more (Tf(s) = $1 \div$ test frequency)

Measurement speed	FAST	NORM	SLOW	SLOW
Т3	$Tf \times n_1$	$Tf \times n_2$	Tf × n_2 × 8	$Tf \times n_3 \times 16$

The value of "n" varies according to the test frequency.

Value of n ₁	Test frequency [Hz]
1	10.00 to 1.500 k
2	1.501 k to 3.000 k
10	3.001 k to 15.00 k
50	15.01 k to 75.00 k
250	75.01 k to 100.0 k

Value of n_2	Test frequency [Hz]	Value of n ₂	Test frequency [Hz]
1	10.00 to 40.00	1	10.00
2	40.01 to 750.0	2	10.01 to 187.5
10	750.1 to 3.750 k	10	187.6 to 937.5
50	3.751 k to 18.75 k	50	937.6 to 4.687 k
250	18.76 k to 93.75 k	250	4.688 k to 23.43 k
1250	93.76 k to 100.0 k	1250	23.44 k to 100.0 k

Testing finished signal (EOM) <T4>

1. When the test frequency is DC (d = 725 ms)

Measurement speed	FAST	NORM	SLOW	SLOW
T4	4.2 ms+d	105 ms+d	808 ms+d	1625 ms+d

(Allowance $\pm 2 \text{ ms}$)

"d" is the test time to detect the offset component of analog circuit. It is automatically tested when the test conditions (range and level) are changed or every five minutes approximately.

2. When the test frequency is other than DC

For the output time (T4) of the testing finished signal EOM, the following time periods A through E should be added to the output time (T3) of the analog testing signal:

$\underline{T4 = T3 + A + B + C + D + E}$

The time taken for calculation varies according to A to E.

<A>

The time taken for calculation varies according to the display parameters:

	Calculation time (Allowance ± 2 ms)			
Display parameters	FAST	NORM	SLOW	SLOW2
Ζ	4.1 ms	5.4 ms	8 ms	28 ms
<i>Ζ</i> -θ (+1.1ms)	5.2 ms	6.5 ms	9.1 ms	29.1 ms
Cp-D (*1) (+1.6ms)	5.7 ms	7.0 ms	9.6 ms	29.6 ms
<i>Ζ-θ</i> -Cp (+2.5ms)	6.6 ms	7.9 ms	10.5 ms	30.5 ms
<i>Ζ-θ</i> -Cp-D (+3.7ms)	7.8 ms	9.1 ms	11.7 ms	31.7 ms

(*1) Since calculations are based on |Z| and θ , other parameters prolong the testing time. (For details, refer to Section 7.2, "Testing Parameters and Calculation Equations")

The time taken for test varies according to the display state (display ON/OFF):

Display setting	Test time	
LCD display and backlight :OFF	-2.3 ms	
Voltage and current monitors:OFF	-1.4 ms	
LCD display and backlight :ON Voltage and current monitors:ON	0 ms	

(Allowance ± 1 ms)

<C>

The time taken for calculation varies according as to whether or not both open circuit compensation and also short circuit compensation are performed:

Open/short circuit compensation	Calculation time
Open and/or short circuit compensation performed	1.4 ms
Not performed	0 ms

(Allowance ± 1 ms)

<D>

The time taken for calculation varies according as to whether or not the comparator is operating:

Comparator operating	Calculation time
Normal testing	0 ms
When the comparator is operating	0.7 ms

(Allowance $\pm 1 \text{ ms}$)

<E>

The time taken for calculation varies according as to whether or not the comparator is operating:

Scaling execution	Calculation time
Normal testing	0 ms
When the scaling is executed	0.8 ms for a parameter

(Allowance $\pm 1 \text{ ms}$)

Wait time for changing test conditions

When the test conditions are changed, the time taken for the internal processing is necessary according to the following factors (1) to (4), before testing.

If the several factors occur the wait time, the longest time is taken among the factors.

- (1) When the test frequency is changed:
 - Changing to the frequency in another range Wait time: 300 ms
 - Changing the frequency through 100.1 Hz Wait time: 1s

Range	Frequency
1	DC
2	0.001 Hz to 0.100 Hz
3	0.101 Hz to 4.000 Hz
4	4.001 Hz to 100.0 Hz
5	100.1 Hz to 2.000 kHz
6	2.001 kHz to 10.00 kHz
7	10.01 kHz to 100.0 kHz

Example: When the test frequency is changed from 10 Hz to 1 kHz, the wait time is 1s.

(2) When the test signal level is changed:

Changing to the test signal level in another range Wait time: 300 ms

Range	Test signal level
1	0.010 V to 0.200 V
2	0.201 V to 0.500 V
3	0.501 V to 1.000 V
4	1.001 V to 2.000 V
5	2.001 V to 2.500 V
6	2.501 V to 5.000 V

- Example: When the test signal level is changed from 1 V to 1.001 V, the wait time is 300 ms.
- Note: When the test signal level setting is CV/CC or the setting of voltage and current limit is ON, the test signal level is automatically changed.
- (3) When the test range is changed: There are cases in which a 300 ms wait is entered.
- (4) When the setting for external DC bias is changed: There are cases in which a 300 ms or a 1 s wait is entered.

7.4 Options

9518-01 GP-IB INTERFACE

Compliance standard: IEEE 488.1-1987

Reference standard: IEEE 488.2-1987

For explanation of how to fit the 9518-01 GP-IB INTERFACE BOARD and for a detailed description of its commands etc., reference should be made to the user manual supplied with the 9518-01.

9593-01 RS-232C INTERFACE

Compliance standard: EIA RS-232C

For explanation of how to fit the 9593-01 RS-232C INTERFACE BOARD and for a detailed description of its commands etc., reference should be made to the user manual supplied with the 9593-01.

9140 4-TERMINAL PROBE



This is a crocodile clip type of test probe.

This type of probe is very convenient for connection to a wide range of wires, from comparatively thin wires to comparatively thick ones.

Range of frequencies which can be used is from DC to 100 kHz



This tweezer type probe is very convenient for testing samples such as chips. The impedance range which can be measured by the 3522-50 using this probe varies according to the frequencies.

The range of test frequency which can be used is from DC to 5 MHz.

NOTE

When using a probe, it may happen that the values obtained vary because the contact resistance is altering due to alterations in the pinch pressure exerted. Therefore it is necessary to keep the pinch pressure as constant as possible.



Samples to be tested can be comparatively easily loaded into and removed from this type of fixture. The range of test frequency which can be used is from DC to 5 MHz.

This is very convenient for testing samples such as chips.

The range of test frequency which can be used is from DC to 5 MHz.





Maximum input voltage: 40 VDC

9269 DC BIAS CURRENT UNIT

Maximum input current: 2 A

9442 PRINTER



The screen copy and test values can be printed out. To use the printer, the following optional unit is necessary.

9593-01 RS-232C INTERFACE

- 9443 AC ADAPTER
- 9446 CONNECTION CABLE
- 1196 RECORDING PAPER

7.5 Test Accuracy

The test accuracy is calculated from a basic accuracy, which is based on the accuracy for impedance when DC measurement is R accuracy (%), alternating current measurement is Z accuracy (%), phase angle θ (°), and the following coefficients.

Test accuracy = Basic accuracy x C x D x E x F + G

- C: Test signal level
- D: Test speed coefficient
- E: DC bias coefficient
- F: Cable length coefficient
- G: Temperature coefficient

1. Basic accuracy

The basic accuracy is calculated from a value A and B from the accuracy coefficient table, which is based on the measurement frequency, and the measurement range.

(1 k Ω range or more) Basic accuracy Z(%) or $\theta(^{\circ}) = \pm \left(A + \frac{B \times |10 \times Zx[\Omega] - Range[\Omega]|}{Range[\Omega]}\right)$ (100 Ω range max.) Basic accuracy Z(%) or $\theta(^{\circ}) = \pm \left(A + \frac{B \times |Range[\Omega] - Zx[\Omega]| \times 10}{Range[\Omega]}\right)$ Zx: sample of |Z|The impedance of the measurement sample (Zx) is taken to be either the measured value, or the value calculated from the following expressions (refer to "Conversion Table from C and L to |Z|"). $|Zx| (\Omega) \stackrel{:=}{=} \omega L (H) (\theta \stackrel{:=}{=} 90^{\circ}) \\\stackrel{:=}{=} 1/\omega C (F) (\theta \stackrel{:=}{=} -90^{\circ}) \\\stackrel{:=}{=} R (\Omega) (\theta \stackrel{:=}{=} 0^{\circ})$

Basic accuracy conditions:

- Using the 9262 TEST FIXTURE
- Test speed: SLOW2
- Cable length coefficient: 0 (m)
- Temperature and humidity: 23 ± 5 (°C), 80 (%RH) or less
- Operation 60 minutes after the power is turned on
- Open circuit compensation and short circuit compensation both being performed

If the test condition is different from above, the coefficients corresponding to the following settings are calculated from each table and must be multiplied (C, D, E, F) or added (G) to the basic accuracy.

<u>1. Impedance (Z=500 Ω) basic accuracy</u>

Measurement conditions: test frequency = 10 kHz, speed = SLOW2, range = 1 k Ω

Basic Accuracy Coefficient Table



From Basic Accuracy Coefficient Table, basic Z accuracy coefficients A=0.08, B=0.001.

Inserting these in the calculation expression yields:

Z accuracy =
$$\pm (0.08 + \frac{0.001 \times |10 \times 500 - 1 \times 10^3|}{1 \times 10^3}) = \pm 0.084\%$$

Similarly for θ basic accuracy coefficients A = 0.05, B=0.001, and thus:

 $\theta \text{ accuracy} = \pm (0.05 + \frac{0.001 \text{ x} |10 \text{ x} 500 - 1 \text{ x} 10^3|}{1 \text{ x} 10^3}) = \pm 0.054^\circ$

2. Capacitance(Cs=160 nF) basic accuracy



Inserting these in the calculation expression yields:

Z accuracy =
$$\pm (0.1 + \frac{0.002 \times |10 \times 1.0144 \times 10^3 - 10 \times 10^3|}{10 \times 10^3}) = \pm 0.1\%$$

Similarly for θ basic accuracy coefficients A = 0.05, B=0.001, and thus: θ accuracy = $\pm (0.05 + \frac{0.001 \times |10 \times 1.0144 \times 10^3 - 10 \times 10^3|}{10 \times 10^3}) = \pm 0.05^{\circ}$ From the basic accuracy, find ranges that each of Z and θ can take.

From the ranges of Z and θ , determine ranges of Cs can take.

 $\begin{array}{ll} Csmin = 1/(Zmax \ x \ \omega \ x \ sin \theta max) & 159.81 \ nF \ \dots -0.12\% \\ Csmax = 1/(Zmin \ x \ \omega \ x \ sin \theta min) & 160.19 \ nF \ \dots +0.12\% \\ \omega = 2 \ x \ \pi \ x \ f \\ f: \ frequency \ [Hz] \end{array}$

Hence the accuracy of Cs is ± 0.12

2. Test signal level (C)

	10 mV -	201 mV	501 mV -	1 V -
Coefficient	3	2	1.5	1

3. Test speed coefficient (D)

Test speed	FAST	NORMAL	SLOW	SLOW2
С	5	2	1.5	1

4. DC bias coefficient (E)

	ON	OFF
Coefficient	4	1

5. Test cable length coefficient (F)

Cable length	0 m	1 m
D	1	(100 kHz max) 1.5 + 0.015 x f [kHz]
		(100.1 kHz min) 1.5 + 0.3 x f [MHz]

6. Temperature coefficient (G)

Temperature	Operating temperature = T $^{\circ}C$
E	0.1 x basic accuracy x (T-23)

Accuracy Table

1 k
$$\Omega$$
 range or more
Basic accuracy = $\pm \left(A + \frac{B \times |10 \times Z_X[\Omega] - Range[\Omega]|}{Range[\Omega]}\right)$
100 Ω range or less
Basic accuracy = $\pm \left(A + \frac{B \times |Range[\Omega] - Z_X[\Omega]| \times 10}{Range[\Omega]}\right)$
Zx: sample of impedance
A, B: basic accuracy coefficient
Accuracy coefficient for Z (%): upper values in the following table

Accuracy coefficient for θ (°): upper values in the following table

[*1: Guaranteed accuracy period									
*1	Range						o 10kHz	10.01kHz	to 100kHz		
	100MΩ	A= 1	B= 1	A= 7	B= 5	A= 4.5	B= 1	A= 4.5	B= 1		
				A= 4	B= 3	A= 3	B= 1.5	A= 2.5	B= 1.5		
	10MΩ	A= 0.5	B= 0.3	A= 2	B= 0.5	A= 0.7	B= 0.4	A= 0.7	B= 0.4	A= 1.5	B= 0.5
			······	A= 1	B= 0.2	A= 0.7	B= 0.2	A= 0.5	B= 0.2	A= 2	B= 0.3
	1MΩ	A= 0.2	B= 0.05	A= 0.7	B= 0.03	A= 0.25	B= 0.03	A= 0.2	B= 0.03	A= 0.7	B= 0.03
				A= 0.35	B= 0.02	A= 0.15	B= 0.02	A= 0.1	B= 0.02	A= 0.5	B= 0.1
	100kΩ	A= 0.1	B= 0.01	A= 0.4	B= 0.01	A= 0.2	B= 0.002	A= 0.15	B= 0.002	A= 0.35	B= 0.01
				A= 0.28	B= 0.002	A= 0.12	B= 0.002	A= 0.08	B= 0.002	A= 0.1	B= 0.02
	10kΩ	A= 0.1	B= 0.01	A= 0.38	B= 0.002	A= 0.15	B= 0.002	A= 0.1	B= 0.002	A= 0.2	B= 0.002
6 months				A= 0.25	B= 0.001	A= 0.1	B= 0.001	A= 0.05	B= 0.001	A= 0.08	B= 0.002
	1kΩ	A= 0.1	B= 0.01	A= 0.36	B= 0.001	A= 0.12	B= 0.001	A= 0.08	B= 0.001	A= 0.15	B= 0.001
				A= 0.25	B= 0.001	A= 0.1	B= 0.001	A= 0.05	B= 0.001	A= 0.08	B= 0.002
	100Ω	A= 0.1	B= 0.02	A= 0.36	B= 0.01	A= 0.15	B= 0.01	A= 0.15	B= 0.01	A= 0.15	B= 0.02
				A= 0.25	B= 0.005	A= 0.1	B= 0.005	A= 0.05	B= 0.005	A= 0.08	B= 0.01
	10Ω	A= 0.2	B= 0.05	A= 0.5	B= 0.04	A= 0.25	B= 0.02	A= 0.25	B= 0.01	A= 0.35	B= 0.02
				A= 0.35	B= 0.02	A= 0.2	B= 0.01	A= 0.15	B= 0.01	A= 0.2	B= 0.02
	1Ω	A= 0.3	B= 0.3	A= 1	B= 0.6	A= 0.5	B= 0.3	A= 0.35	B= 0.2	A= 0.7	B= 0.3
				A= 0.6	B= 0.4	A= 0.35	B= 0.2	A= 0.3	B= 0.1	A= 0.45	B= 0.1
	100m Ω	A= 3	B= 2	A= 7	B= 4	A= 3.5	B= 1.5	A= 2.5	B= 1.5	A= 3.5	B= 1.5
				A= 5	B= 2	A= 2.5	B= 1	A= 1.5	B= 1	A= 2	B= 1
*1	Range	DC		1mHz to 99.99Hz 100Hz		100Hz t	to 999.9Hz 1kHz to 10kHz		10.01kHz to 100kHz		
	100M Ω	A= 1.5	B= 1.5	A= 10.5	B= 7.5	A= 6.75	B= 1.5	A= 6.75	B= 1.5		
	10011132			A= 6	B= 4.5	A= 4.5	B= 2.25	A= 3.75	B= 2.25		
	10MΩ	A= 0.75	B= 0.45	A= 3	B= 0.75	A= 1.05	B= 0.6	A= 1.05	B= 0.6	A= 2.25	B= 0.75
	101112			A= 1.5	B= 0.3	A= 1.05	B= 0.3	A= 0.75	B= 0.3	A= 3	B= 0.45
	1MΩ	A= 0.3	B= 0.075	A= 1.05	B= 0.045	A= 0.375	B= 0.045	A= 0.3	B= 0.045	A= 1.05	B= 0.045
				A= 0.525	B= 0.03	A= 0.225	B= 0.03	A= 0.15	B= 0.03	A= 0.75	B= 0.15
	100k Ω	A= 0.15	B= 0.015	A= 0.6	B= 0.015	A= 0.3	B= 0.003	A= 0.225	B= 0.003	A= 0.525	B= 0.015
				A= 0.42	B= 0.003	A= 0.18	B= 0.003	A= 0.12	B= 0.003	A= 0.15	B= 0.03
	10kΩ	A= 0.15	B= 0.015	A= 0.57	B= 0.003	A= 0.225	B= 0.003	A= 0.15	B= 0.003	A= 0.3	B= 0.003
1 year				A= 0.375	B= 0.0015	A= 0.15	B= 0.0015	A= 0.075	B= 0.002	A= 0.12	B= 0.003
	1kΩ	A= 0.15	B= 0.015	A= 0.54	B= 0.0015	A= 0.18	B= 0.0015	A= 0.12	B= 0.002	A= 0.225	B= 0.002
				A= 0.375	B= 0.0015	A= 0.15	B= 0.0015	A= 0.075	B= 0.002	A= 0.12	B= 0.003
	100 Ω	A= 0.15	B= 0.03	A= 0.54	B= 0.015	A= 0.225	B= 0.015	A= 0.225	B= 0.015	A= 0.225	B= 0.03
				A= 0.375	B= 0.0075	A= 0.15	B= 0.0075	A= 0.075	B= 0.008	A= 0.12	B= 0.015
	10Ω	A= 0.3	B= 0.075	A= 0.75	B= 0.06	A= 0.375	B= 0.03	A= 0.375	B= 0.015	A= 0.525	B= 0.03
				A= 0.525	B= 0.03	A= 0.3	B= 0.015	A= 0.225	B= 0.015	A= 0.3	B= 0.03
	1Ω	A= 0.45	B= 0.45	A= 1.5	B= 0.9	A= 0.75	B= 0.45	A= 0.525	B= 0.3	A= 1.05	B= 0.45
				A= 0.9	B= 0.6	A= 0.525	B= 0.3	A= 0.45	B= 0.15	A= 0.675	B= 0.15
		A= 4.5	B= 3	A= 10.5	B= 6	A= 5.25	B= 2.25	A= 3.75	B= 2.25	A= 5.25	B= 2.25
	$100 \text{m} \Omega$						in more a				

*1: Guaranteed accuracy period



11

1

10

100

100m

10mΩl

1 m

10m

100k

10 k

Frequency (Hz)

1 k

Index

- A -

Absolute value setting (ABS)	82,88
Admittance	33,170
Averaging	77
Averaging setting screen	78

- B -

Beep sound	107
Beep sound setting screen	108

- C -

Comparator screen	- 84
Condition setting screen	- 87
Conductance 33,	170
Constant current (CC)	9,44
Constant voltage (CV) 39	9,43
Continuous test 114,	140
Contrast adjustment knob	3,10
Current limit	- 45

- D -

DC Bias	145
Delay time	74
Deviation percentage (Δ %)	82,93
Display parameters	32

- E -

EXT I/O connector 4,132
Equations (for calculation)170
External trigger 72

- F -

Factory settings 113	,
Frequency setting screen 35	

- G -

GP-IB interface 17	6
Guard terminal 3,12	27
Guarding 12	27

- H -

Handle 5	
----------	--

- | -

Impedance	- 33,170
Impedance phase angle	- 33,170
Inductance	33
Interference	129-131
Internal trigger	72

- K -

Key lock	4,124
Key lock switch	4

- L -

LCD screen	11
Limit setting screen	46
Loss coefficient	33

- M -

Measurement ranges	48
Menu keys	12
Menu screen	12,31
Monitor display	12,30

- N -

Noise 129-131

- 0 -

Open circuit compensation	
Open circuit compensation screen	53
Open circuit residual components	69
Open circuit voltage (V)	39,42

- P -

- Q -

Q factor 33

- R -

RS-232C interface 176
Range setting screen — 49
Reactance 33,170
Residual charge protection ————————————————————————————————————
Residual conductance 69
Residual inductance 69
Residual resistance 69

- S -

Saved test conditions 100
Series equivalent circuit mode34
Short circuit compensation 60
Short circuit compensation screen 62
Short circuit residual component 69
Shorting bar 61
Specification 165
Stand 5
Static capacitance 33,165
Susceptance 33,170
System reset 111

- T -

Test cables ————————————————————————————————————
Test fixture 69
Test frequency 35
Test level setting screen 40
Test parameters 32
Test ranges — 48
Test signal levels 39
Test speed 80
Test speed setting screen 81
Test terminals 3,8
Trigger delay function 74
Trigger delay setting screen75
Trigger setting screen 72

- V -

Voltage	limit 45	j
Voltage	selector (power inlet) 4,160)

ΗΙΟΚΙ

DECLARATION OF CONFORMITY

Manufacturer's Name:

Manufacturer's Address:

Product Name: Model Number:

Options:

HIOKI E.E. CORPORATION 81 Koizumi, Ueda, Nagano 386-1192, Japan LCR HITESTER 3522-50 9518-01 GP-IB INTERFACE 9593-01 RS-232C INTERFACE 9261 TEST FIXTURE 9262 TEST FIXTURE 9263 SMD TEST FIXTURE 9268 DC BIAS VOLTAGE UNIT 9269 DC BIAS CURRENT UNIT 9140 4-TERMINAL PROBE 9143 PINCHER PROBE 9165 CONNECTION CORD 9166 CONNECTION CORD 9151-02 GP-IB CONNECTOR CABLE 9151-04 GP-IB CONNECTOR CABLE

The above mentioned products conform to the following product specifications:

Safety: EMC: EN61010-1:2001 EN61326:1997+A1:1998+A2:2001+A3:2003 ClassB equipment Minimum immunity test requirement EN61000-3-2:2000 EN61000-3-3:1995+A1:2001

Supplementary Information:

The products herewith comply with the requirements of the Low Voltage Directive 73/23/EEC and the EMC Directive 89/336/EEC.

HIOKI E.E. CORPORATION

T. yashuke

Tatsuyoshi Yoshiike President

3522C999-02

15 September 2006

HIOKI 3522-50 LCR HITESTER

Instruction Manual

Publication date: September 2006 Revised edition 2

Edited and published by HIOKI E.E. CORPORATION Technical Support Section

All inquiries to International Sales and Marketing Department

81 Koizumi, Ueda, Nagano, 386-1192, Japan

TEL: +81-268-28-0562 / FAX: +81-268-28-0568

E-mail: os-com@hioki.co.jp

URL http://www.hioki.co.jp/

Printed in Japan 3522C981-02

• All reasonable care has been taken in the production of this manual, but if you find any points which are unclear or in error, please contact your supplier or the International Sales and Marketing Department at HIOKI headquarters.

• In the interests of product development, the contents of this manual are subject to revision without prior notice.

• Unauthorized reproduction or copying of this manual is prohibited.



HIOKI E.E. CORPORATION

HEAD OFFICE

81 Koizumi, Ueda, Nagano 386-1192, Japan TEL +81-268-28-0562 / FAX +81-268-28-0568 E-mail: os-com@hioki.co.jp / URL http://www.hioki.co.jp/

HIOKI USA CORPORATION

6 Corporate Drive, Cranbury, NJ 08512, USA TEL +1-609-409-9109 / FAX +1-609-409-9108

3522C981-02 06-09H

Printed on recycled paper

