

User's Manual

Model MY10

Insulation Resistance Tester

Thank you for purchasing the Yokogawa Meters & Instruments MY10 Insulation Tester. To optimize all the functions of the instrument, please read this manual thoroughly before operating it.

Store this manual in a safe place for future reference.

1st Edition : Jan. 2000(YG)
All Rights Reserved, Copyright©1999, Yokogawa M&C Corporation

YOKOGAWA

Yokogawa Meters & Instruments Corporation

IM MY10-E
6th Edition: Dec. 2006 (KP)

About This Manual

The contents of this manual are subject to change without prior notice. Under absolutely no circumstances may the contents of this manual be transcribed or copied, in part or in whole, without obtaining permission. Every effort has been made to ensure accuracy in the preparation of this manual. Should any errors or omissions come to your attention however, please inform Yokogawa M&C Corporation accordingly.

1. Safety Precautions

Always observe the following instructions. Failure to do so may result in electric shock or other dangers that may lead to serious injury or the loss of life.

Yokogawa Meters & Instruments Corporation is in no way liable for any damage resulting from the user's mishandling of the tester.

For safe use of this tester, the following safety symbols are used in the user's manual:

 **WARNING**

Indicates a hazard that may result in the loss of life or serious injury of the user unless the described instruction is abided by.

 **CAUTION**

Indicates a hazard that may result in an injury to the user and/or physical damage to the product or other equipment unless the described instruction is abided by.

Note

This provides important information for handling the tester and clarifies tester functions.

The following symbols are used on the MY10 tester.

 Danger! Handle with Care.

This symbol indicates that the operator must refer to an explanation in the user's manual in order to avoid risk of injury or death of personnel or damage to the tester.

 High-voltage Terminal

This symbol indicates a dangerous voltage level (terminals with voltages exceeding 1000 volts must be so marked). Never touch the terminals.

 AC Voltage

This symbol indicates the presence of an AC voltage.

 Double Insulation

This symbol indicates double insulation.

 
 **WARNING**

Always observe the following instructions. Failure to do so may result in electric shock or other dangers that may lead to serious injury or the loss of life.

- During Measurement of Insulation Resistance
 - A high voltage is present at the probes. Do not touch the measured object or the earth or line terminal.
- Immediately After Measurement of Insulation Resistance
 - The probes or the measured object may remain highly charged. Do not touch them immediately after the completion of measurement.
- During Measurement of AC Voltages
 - Do not press the MEAS key while measuring AC voltages.
 - Voltage that exceeds the specified limit must not be applied to terminals.
- Probes
 - Use the probes supplied by Yokogawa Meters & Instruments with this tester.
 - Do not use probes that have deteriorated or are defective.
 - Remove the probes from the measured object before attaching/detaching the probes to/from the tester.
- Insulation of Casing
 - A puncture in the protective insulation may occur if there are any cracks or other damage in the casing as a result of the instrument having been dropped or knocked against another object. Do not use the instrument before taking the necessary remedial measures; ask the manufacturer to repair it.
- The Measured Object
 - Turn off the power to the measured object before you begin measuring insulation resistance.
 - Avoid touching any electrified parts while using the tester in a location with live electricity. For safety, it is recommended that you use a pair of rubber gloves or other alternative means.
- Operating Environment
 - Do not operate the tester in an atmosphere where any flammable or explosive gas is present.
 - Do not use the tester if there is condensation on it.
- Disassembly
 - No person, except personnel from Yokogawa Meters & Instruments, is authorized to disassemble this tester.

Measurement Categories

Measurement category		Description	Remarks
I	CAT. I	For measurements performed on circuits not directly connected to MAINS.	
II	CAT. II	For measurements performed on circuits directly connected to the low voltage installation.	Appliances, portable equipments, etc.
III	CAT. III	For measurements performed in the building installation.	Distribution board, circuit breaker, etc.
IV	CAT. IV	For measurements performed at the source of the low-voltage installation.	Overhead wire, cable systems, etc.



2. Measuring Functions and Additional Features


Measuring Functions

- Measuring the insulation resistance
- Measuring AC voltages (sine wave at 50/60 Hz)

Additional Features

- Discharge feature
 - The tester is designed to begin discharging when the MEAS key is turned off. The ALARM LED turns off when discharging is complete.
- Battery check
 - This function verifies if the battery voltages are within the valid ranges. (When the battely is checked, the pointer must be within the BATT mark.)
- Phosphorescent scale plate
 - The indicator window lights up according to the intensity of light.
- Locking the MEAS key
 - Pulling the MEAS key up allows for continuous measurement over a prolonged period of time.

3. Components and Their Functions

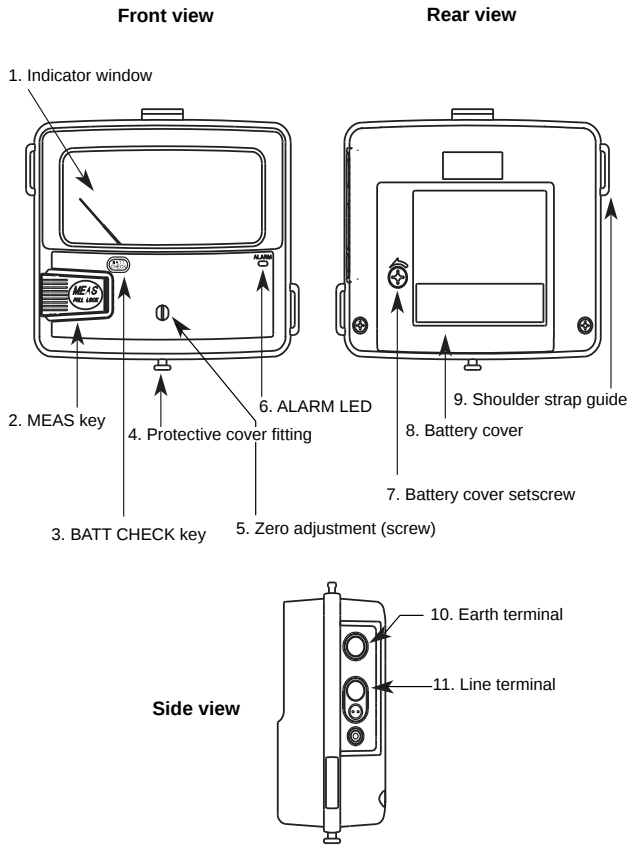

- Indicator window
- MEAS key
- BATT CHECK key
 - Verifies if the battery voltages are within the valid ranges.
- Protective cover fitting
- Zero adjustment (screw)
- ALARM LED
 - Discharge feature (On→ Off)
When lit, it indicates that a capacitive component in the measured object remains electrified and will light up even if measurement has been completed. It turns off when discharge is complete.
- Battery cover setscrew
 - Undo to replace batteries.
- Battery cover
- Shoulder strap guide
 - The shoulder strap is passed through it.
- Earth terminal
 - Connection for earth probe.
- Line terminal
 - Connection for line probe.

Note

- GUARD function is not a standard function.

4. Before Measurement

- Safety
 - Read the handling precautions in this manual carefully.
 - Make sure it is safe before starting measurement.
- How to Read the Scale
 - Read the value from the top-right of the scale.
- Zero Adjustment
 - Confirm that the pointer is at the center of the infinity sign (∞); if it is, do not press the MEAS key.
 - If it is not, adjust the pointer to indicate the center of the infinity sign (∞) with the zero adjustment screw using a slotted screwdriver.
- Battery Voltage Verification
 - Press the BATT CHECK key to make sure the battery voltages are within the valid ranges. (When the battely is checked, the pointer must be within the BATT mark.)
 - If the batteries are low, replace them as specified in the battery replacement section of this manual.
- Connecting the Probes
 - Plug the earth probe into the earth terminal.
 - Plug the line probe into the line terminal.

 **WARNING**

- Remove the probes from the measured object before attaching/detaching the probes to/from the tester.
- Make sure the MEAS key is off when attaching/detaching the probes to/from the tester.

5. Measuring the Insulation Resistance

1. Before Connecting the Probes

 **WARNING**

- Turn off the power to the measured object before connecting the probes or measuring insulation resistance.
- Electrical charges may be present in the cables attached to or metal of the electrical equipment being tested. Verify that the equipment is free from electrical charges before connecting the testing terminals.

2. Connecting the Earth Probe

- Securely connect the earth probe to the measured object's ground line (if the measured object is not grounded, this process may be omitted).

3. Connecting the Line Probe

- Bring the line probe into contact with the measured object, and then press the MEAS key. The pointer indicates the insulation resistance of the measured object.

Note

During measurement, exercise care to prevent the leadwire of the line probe from coming into contact with the ground, floor or any other object. Not observing this precaution may result in a failure to measure the correct insulation resistance.

4. After Measurement

 **WARNING**

- Immediately after measurement, electrical charges resulting from the applied testing voltage may remain present in the probes or measured object.
- The tester, therefore, is designed to automatically begin discharging electricity upon completion of measurement. Verify that the ALARM LED turns off when discharging is complete.

Locking the MEAS Key (for Continuous Measurement)

The MEAS key, when pulled up to the right, can be locked to ensure the key remains turned on. Use this mechanism when making continuous measurement over a prolonged period. Note, however, that leaving the key turned on for an unreasonably long time will accelerate the discharge of the batteries.

Battery Life (reference only)

For MY10-03 at rated 500 V/100 M Ω :
Approximately 10 hours when in continuously operation with central indication (approx. 2 M Ω ; with standard supplied batteries).

Note

The data above is typical. Nevertheless, the battery life varies depending on the operating conditions. Check the batteries before measurement.

6. Measuring AC Voltages

 **WARNING**

- Do not press the MEAS key while measuring AC voltages. Otherwise, it may result in a failure.
- Voltage that exceeds the specified limit must not be applied to terminals.

1. Connecting the Earth Probe

- Securely connect the earth probe to the measured object's ground line (if the measured object is not grounded, this process may be omitted).

2. Connecting the Line Probe

- Bring the line probe into contact with the measured object. The pointer indicates the AC voltage. Read the value on the voltage measurement scale ($\sim$ V). If the voltage of 20 V AC or more is present between the earth and line terminals, the ALARM LED turns on.

Note


When measuring insulation resistance, the tester can also be used to verify that there is no voltage present at the measured object.



7. Specifications

Model	MY10-01	MY10-02	MY10-03	MY10-04	MY10-05
Rating	125 V/20 M Ω	250 V/50 M Ω	500 V/100 M Ω	500 V/1000 M Ω	1000 V/2000 M Ω
Central Indication	0.5 M Ω	1 M Ω	2 M Ω	20 M Ω	50 M Ω
1st Effective Measuring Range	0.02 to 10 M Ω	0.05 to 20 M Ω	0.1 to 50 M Ω	1 to 500 M Ω	2 to 1000 M Ω
2nd Effective Measuring Range	0.01 to 0.02 M Ω 10 to 20 M Ω	0.01 to 0.05 M Ω 20 to 50 M Ω	0.05 to 0.1 M Ω 50 to 100 M Ω	0.5 to 1 M Ω 500 to 1000 M Ω	1 to 2 M Ω 1000 to 2000 M Ω
Lower Measuring Limit of Resistance	0.125 M Ω	0.25 M Ω	0.5 M Ω	1 M Ω	2 M Ω
Rated Current	1 to 1.2 mA	1 to 1.2 mA	1 to 1.2 mA	0.5 to 0.6 mA	0.5 to 0.6 mA
AC Voltage Measuring Range	0 to 250 V	0 to 300 V	0 to 500 V	0 to 500 V	0 to 500 V

First and second effective measuring ranges

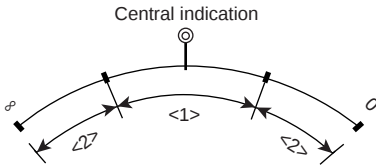

<1> 1st effective measuring range
<2> 2nd effective measuring range
The values which belong to both the first and second ranges in the table above, are included in the first range.

Tolerances under the above conditions
Resistance measurement: ±5% of reading within the 1st effective measuring range
±10% of reading within the 2nd effective measuring range
Infinity and zero indications: 0.7% or less of scale length
AC voltage: ±10% of the maximum value
No-load voltage: Within 130% of the rated voltage
Short-circuit current: 12 mA or less
Scale length: Approx. 78 mm

Standard test conditions
Ambient temperature and humidity: 23 ±5°C at 45 to 75% RH
Position: Horizontal (within 5 degrees)
Influence of external magnetic field: Earth magnetism
Battery Voltage: Within effective range for the battery (When the battery is checked, the pointer must be within the BATT mark.)

Item	Limit	Test condition
Response time	3 sec or less	From the instant the resistors whose values correspond to central indication and zero indications are abruptly connected, to when the pointer reaches a level within tolerance
Friction	No friction is recognized	
Effects of inclination	2% or less of the scale length	Deviation from the infinity indication when the tester is tilted from a horizontal position by 30 degrees
Effect of temperature	(1) 5% or less (2) 0.7% or less of scale length	(1) Deviation from central indication when ambient temperature is varied from 20°C by ±20°C (2) Deviation from infinity and zero indications when ambient temperature is varied from 20°C by ±20°C
Effect of humidity	Within tolerance	When the tester is left for 1 hour with the humidity at 90% RH
Effect of external magnetic field	3% or less of indication	The change of indication when an external field of 400 A/m DC is applied in the most affected direction
Effect of AC component of measuring terminal voltage	10% or less of indication	A change when a capacitor with 5μF ±10% is connected in parallel to a resistor corresponding to central indication connected
Insulation resistance	50MΩ or more (between electric circuits and outer case)	When tested at 500 V if the rated measuring voltage is 500 V or less or at a voltage identical to the rated voltage if the rated voltage exceeds 500 V
Dielectric withstand voltage	There must not be an abnormality. (between electric circuits and outer case)	When a sine wave, or the like, is applied between the electric circuits and the outer case at 5550 V AC and 50/60 Hz for 1 minute
Resistance to vibration	The specifications for tolerances, friction, and the effect of tilting must be met. There are no mechanical and electrical damage.	When a vibration frequency of 16.7 Hz and peak-to-peak amplitude of 4 mm is applied in the direction of the axis of the moving part for 1 hour
Resistance to shock	The specifications for tolerances, friction, and the effect of tilting must be met. There are no mechanical and electrical damage.	When shock of 1000 m/s² is applied twice in the direction of axis of the moving part and in a direction perpendicular to the axis
Endurance	The specifications for tolerances and friction must be met.	When a resistor corresponding to the central indication is connected across the measuring terminals and the power switch is repeatedly turned on and off 10 000 cycles at a rate of about 300 cycles/hour
Input over-voltage protection	There must not be an abnormality.	When an AC voltage of 50/60 Hz at 1.2 times the rated measuring voltage is applied to the measuring terminals for 10 seconds


8. General Specifications

Operation temperature and humidity	0 to 40°C at 90% RH or less (no condensation)
Storage temperature and humidity	-10 to 60°C at 70% RH or less (no condensation)
Battery	AA-size (4), [R6]
External dimensions	Approx. 125 (W) × 103 (H) × 52.5 (D) mm
Weight	Approx. 500 g (main unit and batteries only) Approx. 600 g (main unit, batteries, protective cover, earth probe and line probe)
Safety standards	EN61010-1, EN61010-2-31 Insulation class II ,Pollution degree 2 Measurement categoryⅢ (maximum input voltage: 600 V)
EMC Standard	EN55011 ClassB Group1 EN61326 ClassB
Effect of radiation immunity	At the strength of radio-frequency electromagnetic field of 3 V/m • Insulation resistance measurement 1st effective measuring range : ±10% of rdg 2nd effective measuring range : ±20% of rdg Infinity and zero indications : 1.4% or less of scale length • AC Voltage measurement : ±10% of FS

9. Using Protection Cover and Shoulder Strap


The tester comes with a protection cover and shoulder strap as standard accessories.

- The protection cover can be used as a front cover (for the indicator window) or as a bottom cover. (It is set as the front cover when delivered from the factory.)
- Using the shoulder strap allows you to position the tester in front of your chest for ease of reading. Pass the strap through the shoulder strap guide and adjust the length of the strap to allow you a good view of the tester.
- Remove the cover from the front, and attach it to the bottom using the fixing hole (B) on the surface of the cover. This is useful when the scale is too close to your body to see clearly (See the figure on the right).
- A belt on the cover which is fitted with pieces of Velcro, can be used to store the probes (Remove the probes from the tester terminals when storing them).

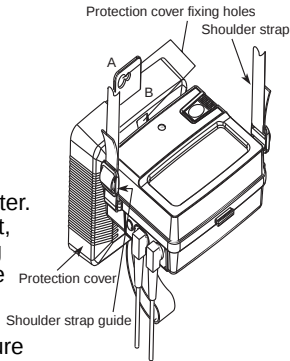


10. External Dimensions


Main unit

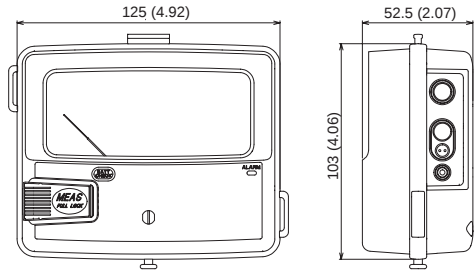

Earth probe

 

Line probe

 

11. Accessories

Name	Model No.	Quantity
Protection cover	93013	1
Shoulder strap	99005	1
Line probe	98001	1
Earth probe	98002	1
Batteries	—	4
User's manual	IM MY10-E	1

Optional Accessories

Name	Model No.	Description
1. Spare probe tip for the line probe (Model 98001)	99011	105 mm, breaker pin
2. Hard case	93015	Houses both the main unit, the line probe and the earth probe.
3. Accessory bag	B9108XA	Soft case, approx. 100 (W) × 190 (H) × 40 (D) mm
4. Replaceable-type line probe	98005	Cable length: 1000 mm
5. Spare probe tips for the line probe (Model 98005)	B9600GN	58 mm, general-purpose
6.	B9600NW	360 mm, hook-shaped
7.	B9600NX	360 mm, for extension purposes
8.	B9600NZ	108 mm, sharp-pointed
9.	B9635JK	338 mm, pickax-shaped

12. Battery Replacement

WARNING

- Remove the probes from the tester and then turn off the MEAS key before opening the casing to replace the batteries.
- Do not touch the MEAS key during replacement. Otherwise, a high voltage may be produced.

- Loosen the battery cover setscrew, and then slide the cover off of the main unit.
- Replace all of the 4 batteries at the same time and make sure the polarities of the new batteries are exactly as shown on the battery holder.
- After replacing the batteries, attach the battery cover and tighten the setscrew.

CAUTION

- Do not mix batteries of different types or new batteries with used ones.
- Always remove the batteries if the tester will not be used for a prolonged period of time. If you store the tester with the batteries left installed, fluid is likely to leak from them, resulting in a malfunctioning of the instrument.

13. Maintenance

Storage Conditions

- Temperature and humidity:-10°C to 60°C at 70% RH or less
- Remove the batteries before storing the tester.
- Avoid storing the tester in a location where there is: moisture; exposure to direct sunlight; a high-temperature heat source nearby; exposure to severe mechanical vibrations; a large amount of dust and/or salt, or a corrosive gas.

Removal of Dirt
Do not use volatile solvents (such as paint thinners or benzine) as they are likely to cause discoloration. Wipe off dirt with a cloth dampened with water or alcohol.

Calibration Cycle
It is recommended that the tester be calibrated once every year for correct operation; ask Yokogawa M&C to do the periodic calibration for you.

YOKOGAWA ◆
Yokogawa Meters & Instruments Corporation

Yokogawa Meters & Instruments Corporation
International Sales Dept.
Tachihl Bld. No.2, 6-1-3, Sakaecho, Tachikawa-shi,Tokyo 190-8586 Japan
Phone: 81-42-534-1413, Facsimile: 81-42-534-1426
YOKOGAWA CORPORATION OF AMERICA (U.S.A.)
Phone: 1-770-253-7000 Facsimile: 1-770-251-2088
YOKOGAWA EUROPE B. V. (THE NETHERLANDS)
Phone: 31-334-64-1611, Facsimile: 31-334-64-1610
YOKOGAWA ENGINEERING ASIA PTE. LTD. (SINGAPORE)
Phone: 65-6241-9933 Facsimile: 65-6241-2606
YOKOGAWA AMERICA DO SUL S. A. (BRAZIL)
Phone: 55-11-5681-2400 Facsimile: 55-11-5681-1274
YOKOGAWA MEASURING INSTRUMENTS KOREA CORPORATION (KOREA)
Phone: 82-2-551-0660 to -0664 Facsimile: 82-2-551-0665
YOKOGAWA AUSTRALIA PTY. LTD. (AUSTRALIA)
Phone: 61-2-9805-0699 Facsimile: 61-2-9888-1844
YOKOGAWA INDIA LTD. (INDIA)
Phone: 91-80-4158-6000 Facsimile: 91-80-2852-1441
YOKOGAWA SHANGHAI TRADING CO., LTD. (CHINA)
Phone: 86-21-6880-9107 Facsimile: 86-21-6880-4987
YOKOGAWA MIDDLE EAST E. C. (BAHRAIN)
Phone: 973-358100 Facsimile: 973-336100
LTD. YOKOGAWA ELECTRIC (RUSSIAN FEDERATION)
Phone: 7-095-737-7868 Facsimile: 7-095-737-7869