## **Transformation to Control Procedure for iWitness**

This tip sheet was prepared for users with a basic knowledge of the iWitness™ close-range photogrammetry software system

The purpose of this tip sheet is to provide the basic understanding of the **Transformation to Control** dialog box within iWitness. For the sake of brevity, only the "3D transformation to control" feature is discussed in this tip sheet. For 1D (block shift) and 2D (transformation within an XY plane) see the iWitness User Manual.

### **Overview:**

iWitness provides the user a method to "stitch" a series of multiple project images from different coordinate systems. This stitching capability is beneficial in order to 'break' sub-sets of images into manageable, smaller projects by keeping them all in the same coordinate reference system.

For example, if an accident reconstruction practitioner has acquired terrestrial-based images over a quarter mile in length, it is often easier to "break" the projects up into 500' to 600' length sub-projects and "stitch them together." This "stitching" is accomplished by using the *iWitness* Transformation to Control function along with measured Control Points (CP's). The CP's are simply four or more measured XYZ points that are observed in two or more iWitness networks. For our project example, we are simply using 4 traffic cones and DCS "cone-style Reference Point Markers" (RPMs) to illustrate the CP marking procedure. It should be noted the wider the CP's are separated in a 'real-world' project, the better. Further, the CP's do not have to necessarily be the cone-style RPMs as illustrated in the tip sheet, or spread coplanar, rather any natural feature in the images the user can accurately "cursor mark" in the images. An example might be a vehicle crash scene, perhaps marking the CP's on discrete features in the images, such as including the top of a streetlight standard or anything that is stationary during the picture taking process.

# **Procedure to use the iWitness Transformation to Control:**

The assumption is the user has completed two networks (we will call them **Network1.iwp** and **Network2.iwp** for this tip sheet.)

**Step 1:** Network1 has already been scaled with the 3-2-1 (model rotation) within iWitness. Network2 is also complete, but it does not require "scale" or "3-2-1" as the 3D transformation to control function will scale and rotate the Network2.iwp into the same coordinate reference system as Network1.iwp.

**Step 2:** The user **names the 4<sup>+</sup> control points from Network1**. It is best to typically use six CP's, but for this tip sheet we only use four as the minimum amount for the least squares coordinate transformation. See Figure 1 for the named control points. The named points are **CP\_9, CP\_U, CP\_V, CP\_W**.



It should be noted the 4 CP's are located into the "depth" of the image, whereas Network1 camera positions are generally observed closest, or in common to the forward side of CP\_9 & CP\_U, (reference the markers "O, B, and N") whereas Network2 is located into the depth or backside of Figure 1, (behind CP\_W and CP\_V where the police vehicle is parked in the image.)





See Figure 2, on the next page with the 3D Points dialog open.

0.000.000.000	X	Y	Z	Z-Offset	# Rays	Quality	Angle (deg)	Description	^
A	38.9811	-12.1529	-0.0	0,0000	20	0.26	76.9		
в	68.9624	-13 3813	-0.1	1067 0.0000	16	0.15	25.4		
BASE	0.9662	1 Save As	li -					? 🔰	
c c	38.9971	-2	Save in:	C Net 1		•	+ 🗈 💣 🗉	-	
CP_9	100.0124		-	backups					
CP_U	100.1271	-2 🕻							
CP_V	111.1310	-1 Red	cent						
CP_W	110.8155	-	3					-	
CSM_1	-0.7393	-1	<b>9</b>	In the 3D	Points o	dialog, d	click ".TX	L.	
CSM_2	5.7610	-t Des	ktop	and nam	e the Co	ntrol Po	oint File (\	we	
						22.00			
CSM_3	12.0818	- 4	2	selected	to name	it "con	trol.txt")		
<ul> <li>CSM_3</li> <li>CSM_4</li> </ul>	12.0818 18.0128	- Mu Doc		selected	to name	it "con	trol.txt")		_
<ul> <li>CSM_3</li> <li>CSM_4</li> <li>CSM_5</li> </ul>	12.0818 18.0128 26.1172	-: My Doc	cuments	selected	to name	it "con	trol.txt")		<u></u>
CSM_3 CSM_4 CSM_5 CSM_6	12.0818 18.0128 26.1172 34.0345		cuments	selected	to name	it "con	trol.txt")		
<ul> <li>CSM_3</li> <li>CSM_4</li> <li>CSM_5</li> <li>CSM_6</li> <li>CSM_7</li> </ul>	12.0818 18.0128 26.1172 34.0345 40.6322		cuments	selected	to name	it "con	trol.txt")		
CSM_3 CSM_4 CSM_5 CSM_6 CSM_6 CSM_7 D	12.0818 18.0128 26.1172 34.0345 40.6322 0.0000	- - My Doc	cuments mputer	selected	to name	it "con	trol.txt")		
<ul> <li>CSM_3</li> <li>CSM_4</li> <li>CSM_5</li> <li>CSM_6</li> <li>CSM_7</li> <li>D</li> <li>E</li> </ul>	12.0818 18.0128 26.1172 34.0345 40.6322 0.0000 9.1833	- My Doc	mputer	selected		it "con	trol.txt")	Save	
CSM_3 CSM_4 CSM_5 CSM_6 CSM_6 CSM_7 D E E	12.0818 18.0128 26.1172 34.0345 40.6322 0.0000 9.1833 18.1951	My Doc	mputer etwork	Selected	to name trol.tx1	it "con	trol.txt")	Save	
<ul> <li>CSM_3</li> <li>CSM_4</li> <li>CSM_5</li> <li>CSM_6</li> <li>CSM_7</li> <li>D</li> <li>E</li> <li>F</li> <li>G</li> </ul>	12.0818 18.0128 26.1172 34.0345 40.6322 0.0000 9.1833 18.1964 35.3765	- My Doc C - My Co - My Co - My No - Pla	mputer etwork ces	File name: Save as type: Te	to name trol.txt	it "con	trol.txt")	Save	
<ul> <li>CSM_3</li> <li>CSM_4</li> <li>CSM_5</li> <li>CSM_6</li> <li>CSM_7</li> <li>D</li> <li>E</li> <li>F</li> <li>G</li> <li>H</li> </ul>	12.0818 18.0128 26.1172 34.0345 40.6322 0.0000 9.1833 18.1965 94.3765 54.2133	- My Doc C - My Doc - My Co - C - My Ne Pla - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2	mputer etwork ces	Selected	to name roltxi t Files	it "con	trol.txt")	Save Cancel Figu	re 2

**Save the "control.txt"** in the same folder as the project (in our case the project folder is named "Net 1". Click "**Save**" in Figure 2.

**Step 4:** In Figure 2, the 3D Points dialog is still open. **Click on the** ".DXF" button in the lower left of the dialog and name the DXF (in this case, name the DXF as "Net1.dxf") and save it to the Net 1 folder. Then click "close" in the 3D Points dialog. You are now complete with Net1.iwp. Close out of Net1.iwp, as we are ready to work with Net2.iwp.

Reiterated, Network2.iwp is into the "depth" of Figure 1. NOTE how there aren't any of the markers in the Network2 area of Figure 1. That is because one can "recycle the markers" from Network1, to Network2, **after** Network1 has been imaged. **It is critical that the CP's remain in the same location throughout all of imaging Network1 and also Network2!** 

**Step 5: Open the second network** (we named it Net2.iwp). If all CP's are present in one image, open the image in the workspace for control point marking. The point IDs for the CP's in Network2 are not the same Point IDs (unless you previously renamed them.) Figure 3 on the next page illustrates the 4 CP's ready for Control Point marking. Note: white lines were created (snapped) between the 4 CP's when this project was originally completed. These lines are not required, but give a good visual reference.



#### Step 6: Use the file pull down and select Photogrammetry + Transformation to control WitnessPRO - C: Wocuments and S



The Transformation to control dialog is now presented in Figure 4.

Control Label	Х	Y	Z	Z-Offset	Closest Point	DX	DY	DZ	Total
									Figure 4
Transformation Option				_					
Transformation Option	s		1	New Point	Unlink All	Link Clos	e Points	Control po	oints' scale used Quality: N/A

# **Step 7:** Click on the "Import Control Points" as noted in Figure 4.

Note: The MS Windows "Open" dialog is presented now. You will "**path" to the Net1** folder to **select the "control.txt"** file you previously made in Step 3, then click **Open.** See Figure 5 on the next page illustrates these actions.

Open				?	
Look jn:	Det 1		• 🔁	- 📸 🎟 -	
Recent C Desktop My Documents	backups 10-13-08 Net1 control net1 PA130026 PA130027 PA130027 PA130027 PA130028 PA130028 PA130028 PA130029 PA130029 PA130029 PA130029 PA130029	) .thumbnail3 .thumbnail3 .thumbnail3 .thumbnail3	<ul> <li>PA130030.JPG.thumbnail3</li> <li>PA130031</li> <li>PA130031.JPG.thumbnail3</li> <li>PA130032</li> <li>PA130032.JPG.thumbnail3</li> <li>PA130033.JPG.thumbnail3</li> <li>PA130034</li> <li>PA130034.JPG.thumbnail3</li> <li>PA130035</li> <li>PA130036.JPG.thumbnail3</li> </ul>	PA130037 PA130037.JPG.thum PA130038.JPG.thum PA130039 PA130039.JPG.thum PA130039.JPG.thum PA130040 PA130040.JPG.thum PA130041.JPG.thum PA130042 PA130042.JPG.thum PA130042.JPG.thum	nbnai nbnai nbnai nbnai Figure 5
My Computer	File name:	control		▼ <u>O</u> pen	
My Network Places	Files of <u>type</u> :	All Files	: read-only	Cance	

**Step 8:** You will be prompted to enter the **UNITS** (see Figure 6). Note: the units should be the same for all project networks. In our case the Units were **feet**. **Select the proper radio button** and then click **OK**.

	Select Units	×	
	Units C inches C millimetres I feet C metres		
(	OK Cancel		Figure 6

The Transformation to control dialog box **is now populated with the control.txt file information**. Figure 7 illustrates this on the next page. In our example, there are only 4 "**Control Labels**" that we're concerned with using - (highlighted for illustration with a red box in Figure 7.)

Control Label	х	Y	Z	Z-Offset	Closest Point	DX	DY	DZ	Total	^	
CP_9	100.0124	-9.6547	1.3416	0.0000	N/A	N/A	N/A	N/A	N/A		
CP_U	100.1271	-20.5445	1.5422	0.0000	N/A	N/A	N/A	N/A	N/A		
CP_V	111.1310	-19.9771	1.4784	0.0000	N/A	N/A	N/A	N/A	N/A		
CP_W	110.8155	-9.0537	1.1846	0.0000	N/A	N/A	N/A	N/A	N/A		
CSM_1	-0.7393	-10.7810	-0.1645	0.0000	N/A	N/A	N/A	N/A	N/A		
CSM_2	5.7610	-6.5985	-0.1874	0.0000	N/A	N/A	N/A	N/A	N/A		
CSM_3	12.0818	-3.1034	-0.2551	0.0000	N/A	N/A	N/A	N/A	N/A	~	
Transformation Opti  3D C 2D	© 1D	Help	New Point	t Unli	nk All Link	Close Point	s	Control p	ooints' scale ( Quality:	used N/A	
			Import Co	ontrol Points	Remove Con	trol Points			Close		
										Fi	

# Step 9:

To begin the control point labeling, the cursor is now presented in the shape of a blue triangle. **Hold the Ctrl key on the keyboard** and the cursor temporarily becomes the white 'select' arrow. **Marquee drag the cursor around the control point** (it will become yellow as shown in "Action 1" below). See Figure 8.

CP_9       100.0124       -9.6547       1.3416       0.0000       N/A       N/A<	Control Label	x	Y	Z	Z-Offset	Closest Point	DX	DY	DZ	Total	
CP_U       100.1271       -20.5445       1.5422       0.0000       N/A       Quality: N/A       Quality: 20/2	IP_9	100.0124	-9.6547	1.3416	0.0000	N/A	N/A	N/A	N/A	N/A	
CP_V       111.1310       -19.9771       1.4784       0.0000       N/A	IP_U 🔨	100.1271	-20.5445	1.5422	0.0000	N/A	N/A	N/A	N/A	N/A	
CP_W       110.8155       -9.0537       1.1846       0.0000       N/A       N/A       N/A       N/A       N/A       N/A         CSM_1       Action 2       -10.7810       -0.1645       0.0000       N/A       N/A       N/A       N/A       N/A       N/A         CSM_2       5.7610       -6.5985       -0.1874       0.0000       N/A       N/A       N/A       N/A       N/A         CSM_3       12.0818       -3.1034       -0.2551       0.0000       N/A       N/A       N/A       N/A       N/A         Transformation Options	IP_V	111.1310	-19.9771	1.4784	0.0000	N/A	N/A	N/A	N/A	N/A	and the second se
CSM_1       Action 2       -10.7810       -0.1645       0.0000       N/A       N/A       N/A       N/A       N/A         CSM_2       5.7610       -6.5985       -0.1874       0.0000       N/A       N/A       N/A       N/A       N/A         CSM_3       12.0818       -3.1034       -0.2551       0.0000       N/A       N/A       N/A       N/A       N/A         Transformation Options       Import Control Points       Control Points       Control points' scale used Quality: N/A         Import Control Points       New Point       Unlink All       Link Close Points       Close	IP_W	110.8155	-9.0537	1.1846	0.0000	N/A	N/A	N/A	N/A	N/A	
CSM_2 5.7610 -6.5985 -0.1874 0.0000 N/A N/A N/A N/A N/A N/A CSM_3 12.0818 -3.1034 -0.2551 0.0000 N/A N/A N/A N/A N/A N/A N/A N/A Transformation Options Transformation Options To 3D C 2D C 1D Help New Point Unlink All Link Close Points Control points' scale used Quality: N/A Import Control Points Remove Control Points Close	ISM_1 Act	tion 2 📃	-10.7810	-0.1645	0.0000	N/A	N/A	N/A	N/A	N/A	
CSM_3 12.0818 -3.1034 -0.2551 0.0000 N/A N/A N/A N/A N/A N/A M Transformation Options Transformation	ISM_2	5.7610	-6.5985	-0.1874	0.0000	N/A	N/A	N/A	N/A	N/A	
Internation Options       New Point       Unlink All       Link Close Points       Control points' scale used Quality: N/A         Import Control Points       Remove Control Points       Close         Import Control Points       Import Control Points       Close         Import Control Points       Import Control Points       Close	CSM_3	12.0818	-3.1034	-0.2551	0.0000	N/A	N/A	N/A	N/A	N/A	
Action 1	4	-			j.	2	A HERE	a della sulla -			and a
					G <sup>40</sup>	Actio	n 1		in the second	THE R. O.	Ŭ+1-

# Step 10:

Now click the cursor in the Control Label box for the specific control point, see "Action 2" noted above.

Once the control point has been successfully accomplished, you'll see a green tick mark as illustrated in Figure 9.

Control Label	х	Y	Z	Z-Offset	Closest Point	DX	DY	DZ	Total	<u>^</u>
А	38.9811	-12.1529	-0.0930	0.0000	N/A	N/A	N/A	N/A	N/A	
В	68.9624	-13.3813	-0.1067	0.0000	N/A	N/A	N/A	N/A	N/A	
BASE	0.9662	16.9898	1.1907	0.0000	N/A	N/A	N/A	N/A	N/A	
с	38.9971	-22.1315	0.1040	0.0000	MTA	N/A	N/A	N/A	N/A	
CP_9	100.0124	-9.6547	1.3416	0.0000	🔽 СР_9 🔵	0.000	-0.000	-0.000	0.000	
CP_U	100.1271	-20.5445	1.5422	0.0000	NIA	N/A	N/A	N/A	N/A	Figure
CP V	111.1310	-19.9771	1.4784	0.0000	N/A	N/A	N/A	N/A	N/A	
Transformation Options Ontrol Point Unlink All Link Close Points Control P									oints' scale Ouality	used : N/A
⊙ 3D C 2D	C 1D	Help	Import	Control Points	Remove	Control Poi	nts		Close	

Figure 10 illustrates the CP\_9 control point after accomplishing Step 10.



# Step 11:

**Continue the same actions of Step 9** for the **4 control points**. NOTE: once 3 (noncollinear) control points are marked, a coordinate transformation is automatically invoked within iWitness. We strongly recommend that you use a minimum of four control points.

In Figure 11, when all 4 control points have been successfully marked, there will be 4 green tick marks in the column named "Closest Point". Additionally, in the lower right corner of the dialog, it states "**Quality: RMS =** (*number*)." The lower the number the better. In this tip sheet example, the control points were semi-automatically "centroid-marked" with iWitness' X-key, so the Quality: RMS number is going to be very small. The RMS number is a function of how well the (2) XYZ data sets "matched" each other for image marking and as a rigid-body fit to each other. In real-world applications, where natural features are used for this process, you might see these numbers as high as Quality: RMS = 0.100 or even as much as 0.200. The user can also see which of the 4 CP's in our example fit the best (or worst) by analyzing the results in the DX, DY and DZ field as noted in Figure 11.

Control Label	X	γ	Z	Z-Offset	Closest Point	DX	DY	DZ	Total	<u>~</u>
с	38.9971	-22.1315	0.1040	0.0000	PA130067.JPG	50.744	0.292	4.217	50.919	
CP_9	100.0124	-9.6547	1.3416	0.0000	🗸 СР_9	-0.017	-0.015	-0.001	0.022	
CP_U	100.1271	-20.5445	1.5422	0.0000	V CP_U	0.001	0.013	0.001	0.013	
CP_V	111.1310	-19.9771	1.4784	0.0000	V CP_V	-0.002	0.004	-0.001	0.004	
CP_W	110.8155	-9.0537	1.1846	0.0000	V CP_W	0.018	-0.002	0.001	0.018	Figure 1
CSM_1	-0.7393	-10.7810	-0.1645	0.0000	PA130065.JPG	85.936	14.613	4.154	87.269	
- Transformation O	Iransformation Options     New Point     Unlink All     Link Close Points     Control points' scale used       Ousliky: RM5 = 0:009									used
··· 30 ··· 20	, ID	пер		port Control P	oints Remove	Control Po	ints		Close	

#### Step 12:

Click the **Close** button in Figure 11.

### Step 13:

DXF export the same as identified in Step 4, but this time save the DXF in the Network2 folder, and call it Net 2.dxf.

**Step 14:** At this point, you can drag both Net1.dxf and Net2.dxf into your favorite CAD program as both networks are in the same coordinate system. The process can be "leapfrogged" if there at least 4 common points from network2, to network3, etc., etc.

###

### Final thoughts:

### Don't use it if it isn't necessary

Using an average consumer grade 8 (or more) mega pixel digital camera, our customers are routinely doing "accident reconstruction mapping projects" as long as 600' (183m) **with just a** *single network (i.e., no need for transformation to control.)* The key is having enough common features in the images; this is why spreading the RPMS in the scene works well. For a good illustration of a 3D mapping project with a single network over 500' long, see the presentation at:

http://www.iwitnessphoto.com/solutions/auto\_ped\_fatality.html

### Use it when it's necessary

The iWitness 3D transformation to control is a very powerful tool that allows one to Stitch projects together. A good example would be working a crash scene, where one side of the street might be completely occluded by a jackknifed 18-wheeler semi truck. In this example, to "stitch" both sides of the streets crash scene together, all it takes is 4 common points for use in iWitness' Transformation to control dialog to get the multiple networks in the same coordinate reference system.