
RDVision Laser cutting control Software

User Manual

Shenzhen Ruida Technoloy Co.,Ltd.

Tel: 0086-075526066687

Fax:: 0086-075526066687

Addr:No.501,5/F,Building 2,Nanyou Tian'an Industry Park,Nanshan District,Shenzhen,Guangdong Prov.

WEB: www.rd-acs.com

PostCode:518052

Note: The actual mode of operation and feature setting are inconsistent with this manual which caused by the software upgrade.Please refer to software.

Contents

Contents.....	2
Chapter 1 Overview.....	5
1.1 Visual cutting control system introduction.....	5
1.2 The composition of the visual cutting control system.....	5
1.3 Software installation.....	5
1.3.1 Start the installation.....	5
1.3.2 Driver install and uninstall.....	6
1.3.3 Exit.....	9
1.4 Software Features.....	10
Chapter 2 Software Basic Operation.....	11
2.1 The main interface operation.....	11
2.2 Language settings and manufactures information.....	12
2.3 Page Setting.....	13
2.4 Import and export files.....	14
2.4.1 Import File.....	14
2.4.2 Export File.....	15
2.4.3 File parameters setting.....	16
2.5 Basic graphics creation.....	17
2.6 Object Selection.....	20
2.7 Object Transformation.....	21
2.7.1 Object Mirror.....	21
2.7.2 Object Rotate.....	22
2.7.3 Place Object.....	22
2.8 Object Align.....	23
2.9 Object View.....	23
2.10 Important Tool.....	24
2.10.1 Manual sorting and the set of cutting point and the cutting direction.....	24
2.10.2Curves Smooth.....	25
2.10.3 Check Closure.....	27
2.10.4 Remove The Overlap.....	28
2.10.5 Combine Curve.....	28
2.10.6 Data Check.....	28
2.10.7 Generating parallel lines.....	29
2.10.8 Model auto hide.....	30
Chpater 3 System Settings.....	31
3.1 General settings.....	31
3.2 System info.....	33

Chapter 4	Camera Management.....	34
4.1	Camera parameters.....	34
4.2	Camera Calibration:.....	36
4.2.1	Cross Calibration.....	36
4.2.2	Dot Calibration.....	36
4.2.3	Calibration file management.....	41
Chapter 5	Mode Management.....	43
5.1	Create Model.....	43
5.2	Extract Features.....	43
5.2.1	Select Feature Region.....	43
5.2.2	Set Model Parameters.....	44
5.2.3	Feature Processing.....	45
5.3	Model Edit.....	46
5.3.1	Extract Feature Contour.....	46
5.3.2	Edit Cutting Curve.....	1
5.3.3	Import Cut Contour.....	3
5.3.4	Copy Cut Contour.....	3
5.3.5	Multi-Models.....	3
5.4	Contour And Layers.....	2
5.4.1	Contour Output Parameters.....	2
5.4.2	Set Contour Layer.....	4
5.5	Splice Model And Multi-Features.....	4
5.6	Save Model.....	7
5.7	Open Model.....	7
5.8	Delete Model.....	7
5.9	Delete All Model.....	8
5.10	Save Model Image.....	8
5.11	Import Image.....	8
Chapter 6	Processing Management.....	9

6.1 Set Processing parameters.....	9
6.1.1 Layer Parameters And Layer Button.....	9
6.1.2 Feeding.....	11
6.1.3 Path Optimize.....	12
6.1.4Speed Match Parameters Set.....	13
6.2 Processing Status Parameters.....	13
6.3 Set Processing Format Parameters.....	14
6.4 Devices Connect.....	15
6.5 Control single-axis motion、 Back to zero.....	16
6.5.1 Manually control single-axis motion.....	16
6.5.2 Manually control back to zero.....	17
6.6 Processing and Simulate processing.....	18
6.6.1 Simulate processing.....	18
6.6.2 Cut Test.....	19
6.6.3 Processing.....	19

Chapter 1 Overview

1.1 Visual cutting control system introduction

Visual cutting control system (RDVision) is cutting system based on intelligent target recognition. This system is mainly composed of PCI motion control card and CCD industrial camera. Combined with image processing algorithm for target image feature extraction and target recognition and finish cutting work by rtificial cut outline. The system operating software control card and the upper machine by Ethernet or USB interface for communication. This system user friendly interface, stable performance, simple operation, suitable for large-format array type graphics cutting, such as trademark cutting field.

1.2 The composition of the visual cutting control system

Control system consists of two parts, hardware and software;
Of hardware equipment as shown in figure 1.1

Project	Number	Description
Control card	One	Many USB and Network port
USB cable, network cable	One	Within three meters in length
Camera	One	Including lens, lights, transmission line and Other accessories

1.1

Software is RDVisionSetUp


1.3 Software installation

Software installation and system hardware configuration requirements:

- (1) running on Windows xp and above version operating system, it is recommended to use the Windows xp.
- 2 CPU 586 above, it is recommended that the P P IV III or above.
- (3) it is recommended to use more than 1 gb of memory.

1.3.1 Start the installation

Double-click the install directory RDVisionSetUp. Exe icon, a dialog box (figure 1.2) as follows:

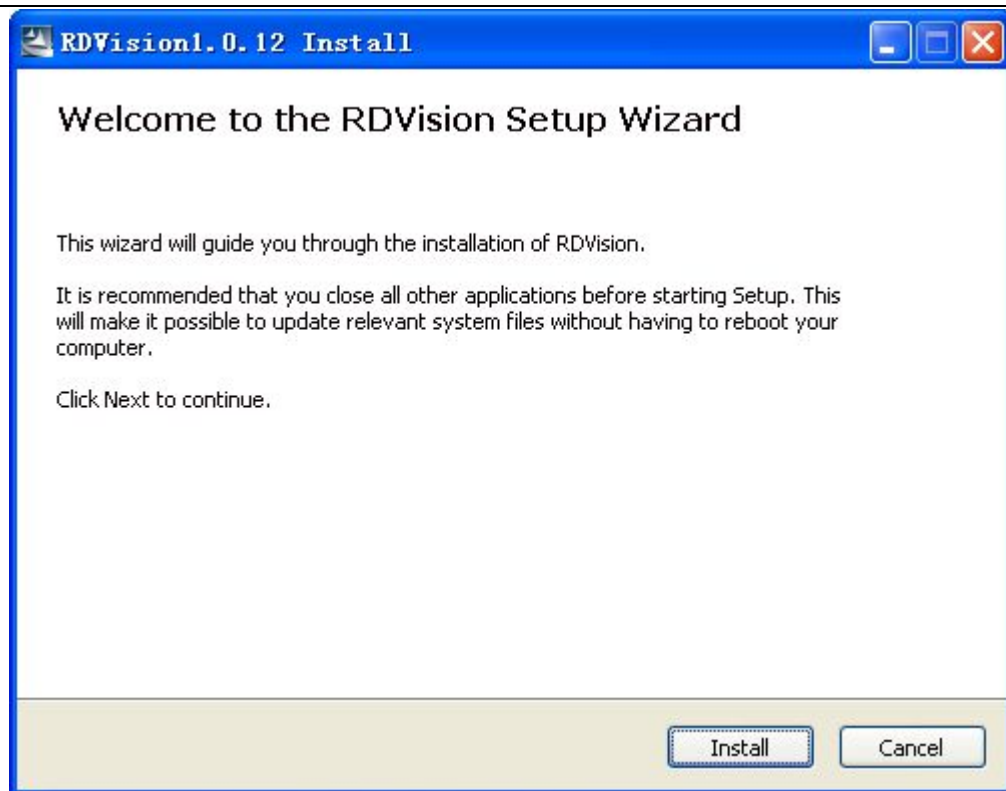

1.2

Click on the "Install" button, to extract the replication is complete, Install the interface (figure 1.3).



1.3

1.3.2 Driver install and uninstall

Install and uninstall for the Camera driver:

Click install on the main interface (figure 1.3) 【Install camera】 button, can appear in figure 1.4 installation interface



1.4

Click "next"



1.5

Click "finish" button to end the camera driver installation

If the user need to uninstall the camera driver ", click the install on the main interface (figure

1.3) 【uninstall camera】 button, can appear in figure 1.6 the interface:



1.6

Click "yes", uninstall the camera driver.

Motherboard driver install and uninstall:

Users click 【Install USB】 on the main interface (figure 1.3) button. Remind connection USB tip, make sure is connected USB, click ok.



1.7

And then displays the USB installation is complete interface (figure 1.8)



1.8

If the user need to uninstall the motherboard driver, click 【UnInstall USB】 on the main interface (figure 1.3) will appears figure1.9:



1.9

Click "ok" to complete the mainboard driver uninstall.

The Software installation:

When users install the camera driver and motherboard driver is completed, click on "Install software" button on the install main interface (figure 1.3) .and it will pop-up prompts the installation is complete.



1.10

Click ok, visual cutting software installation is complete.

If the user needs to manually set the installation path. Can check the option "manually locate the installation path" on the main interface (figure 1.3). In the installation process will occur after the position setting interface (figure 1.11).



1.11

After choose the required path, click [OK], the program will be installed on the user set the path.

1.3.3 Exit

The System software installation is complete, click "Exit" button on the install main interface (figure 1.3) to exit installation process.


1.4 Software Features

1. Compatible with AI, BMP, PLT, DXF, DST, and other graphics data format.
2. Can edit and typeset simple graphics, text, and import the data.
3. Layout and define the output sequence.
4. Can set the machining process and precision personally
5. It can realize processing path optimization function.
6. Suspension in the manufacturing process of processing.
7. According to the different requirements of processing can be set as a starting point, the work path.
8. Compatible with many kinds of communication mode, the user can according to the actual situation using USB port communication or network communication.


Chapter 2 Software Basic Operation

2.1 The main interface operation


Start the software, can see the interface as shown in the figure below. Familiar with the operating interface, the software will be used for the basis of laser processing

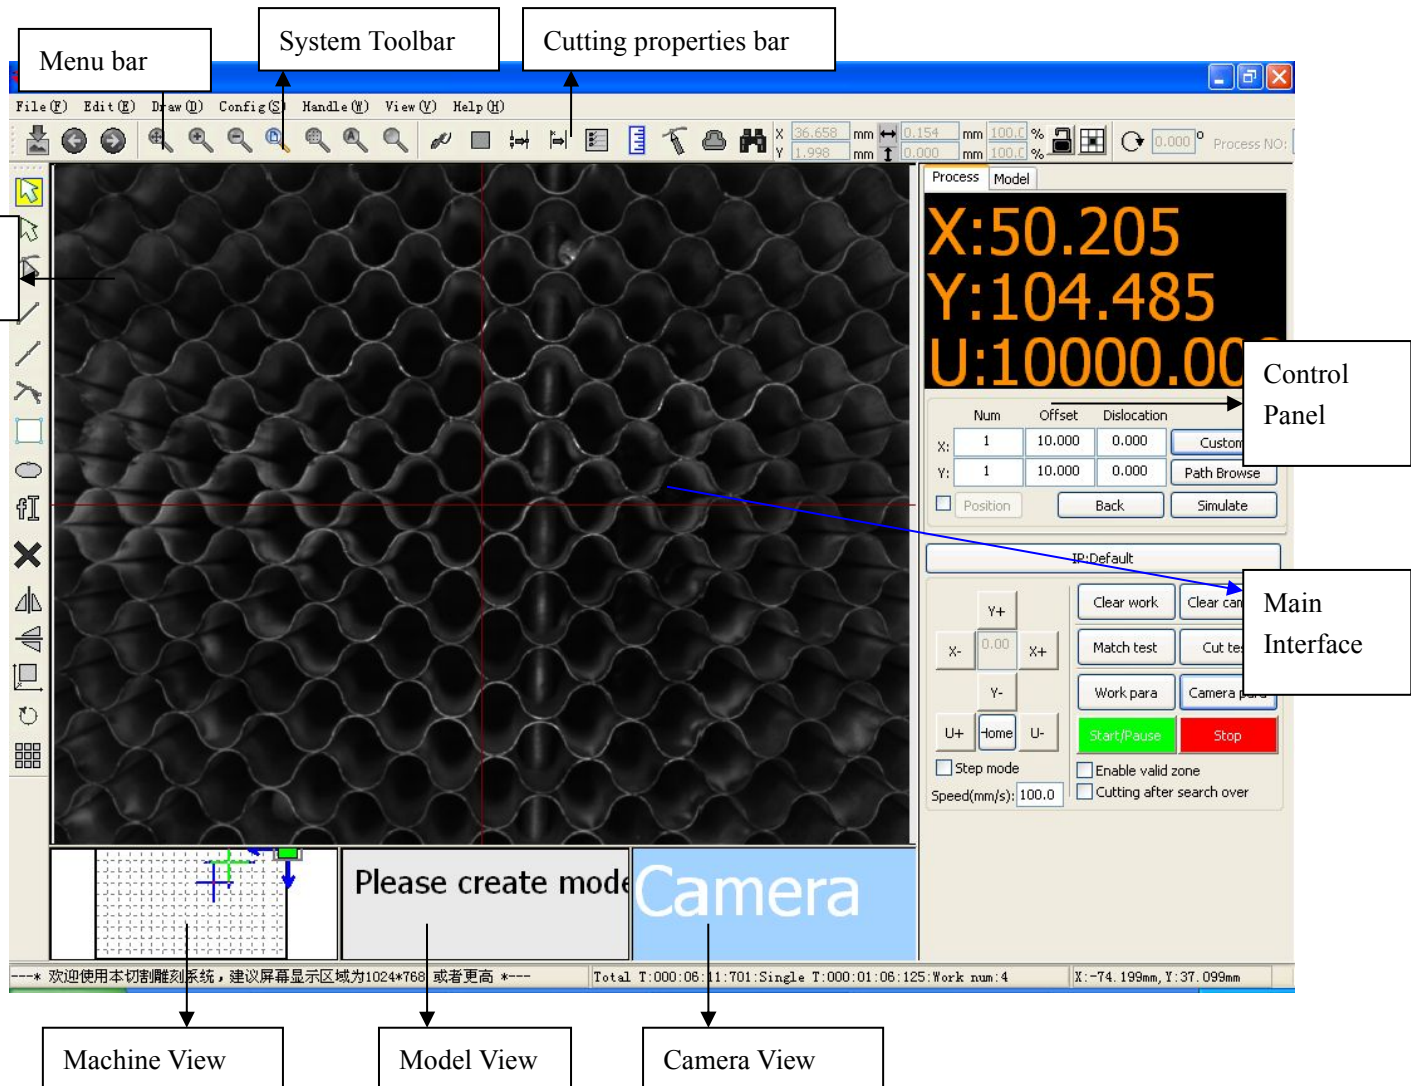

【Main interface】 : The current perspective is video, display data for the camera view. If need to switch into the Machine view, simply click on the Machine view, will switch to the Machine perspective:

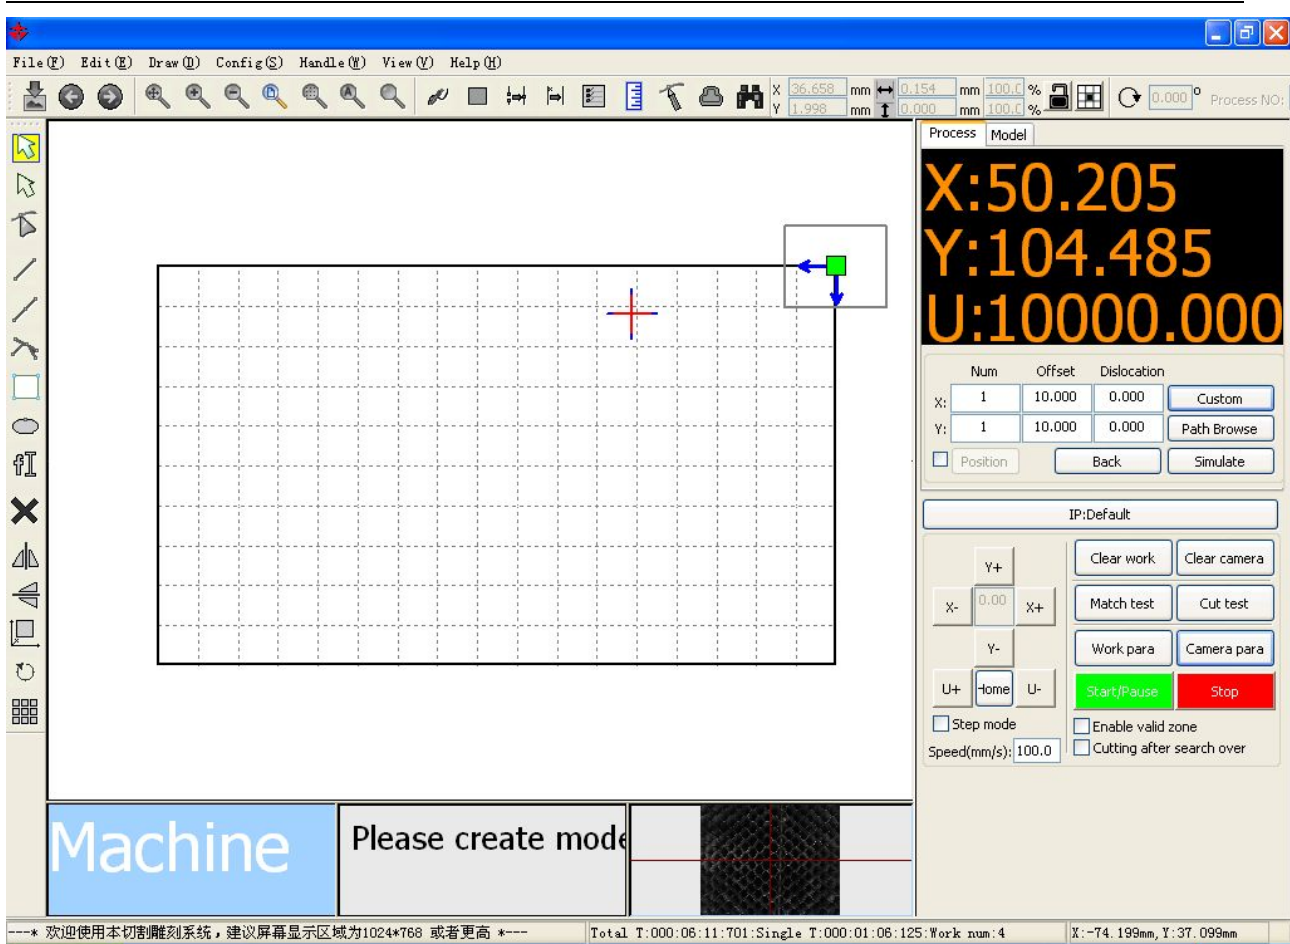

Ditto, perspective can also switch to the Model View

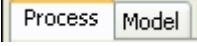As shown in figure:  as the switch on the control panel module management. Each model manages the important operating parameters and related functions.

【Menu bar】: the menu bar file, edit, drawing, setup, processing, view and help seven functions menu items.

【Cutting properties bar】: mainly is the basic attribute of graphics, contains graphic location, size, template basic properties such as zoom, and processing sequence number.

【System toolbar】: toolbar buttons for the most commonly used features, most of these options from the menu bar.

【Drawing toolbar】: when the system default is located in the work area on the left. On the drawing toolbar placed often use the editing tools, can undertake various edit operation to need to edit the object.

【Control panel】: Control panel and main implementation of some commonly used operation and Settings.

2.2 Language settings and manufactures information


In addition to the application installation process can set the language type of software, in use

process also can switch different languages.

Click "menu" -> "Help" -> "语言/Language", select the desired Language type, can realize the display Language switching.




Manufacturer information, so that manufacturers provide a better service for you. Click [menu] -> [help] -> [About RDVision], can be according to manufacturer's information.

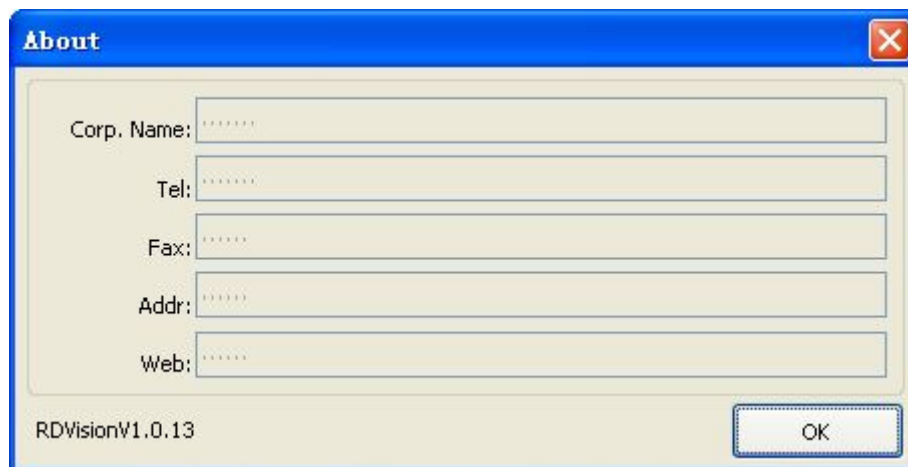

In "about prompt interface" below is the current software version number. In different software version, or the function interface. Through the software version number, can be convenient to users in need help contact and communication with manufacturer.

2.3 Page Setting

Click on the "menu" -> "Settings" -> "page setup", to appear the interface for the following:

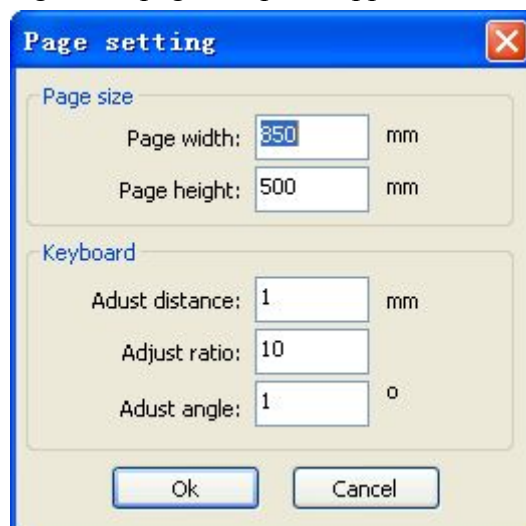

[Page width]: view page width, size of the X wide general Settings for the machine.

[Page height]: high view page, the Y wide general Settings for the machine size.

Usually, if the PC is connected to main board, the software will automatically gets the current machine working level, as the page size. Under the condition of PC is not connected to the motherboard, or the user needs to define your own page size (e.g., according to the material to set the page size), can use the page setup to reconfigure the page size.

[keyboard] : the software can be through the up and down or so key keyboard to adjust the positions of the graphics in the view.

According to a direction, moving distance = **【Adjust distance】** ;

Press the SHIFT key and press a key direction, moving distance = **【Adjust ratio】*【Adjust distance】**;


Press the Ctrl key and press the direction key, graphics rotation Angle = **【Adjust Angle】** ;

Press Ctrl + Shift and at the same time press the direction key, the graphics rotation Angle = **【Adjust Angle】 * 【Adjust ratio】**


2.4 Import and export files

Since this software is used. The RLD format file. Need other file format when making or editing done through import, derived by save as other file format data. Import the file formats supported: DXF, ai, PLT, DST, DSB... And so on; The exported file format support: PLT.

2.4.1 Import File

Click on the "menu" -> [file] -> [imported], or click on the import icon . Will display interface, as shown.


Choose the appropriate file, click on the "Open" button.

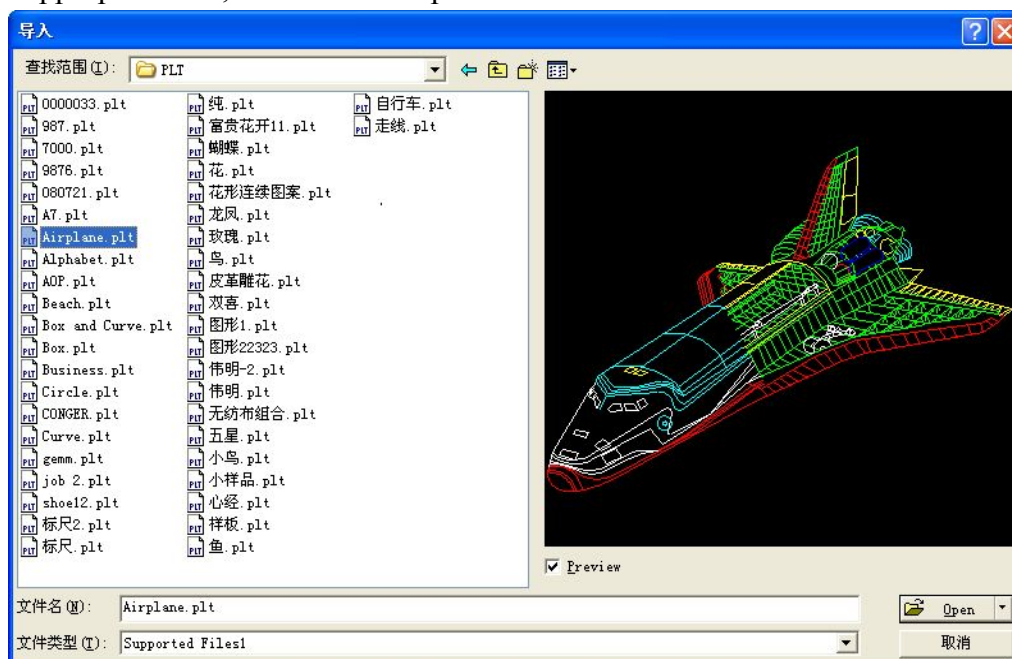


If selected to 【Preview】 , can choose files in an image of a file.

For vector data, the data according to the corresponding hierarchical description file format automatically imported into the RDCAM corresponding layer.

For some special file like DST/DSB will be import the current layer

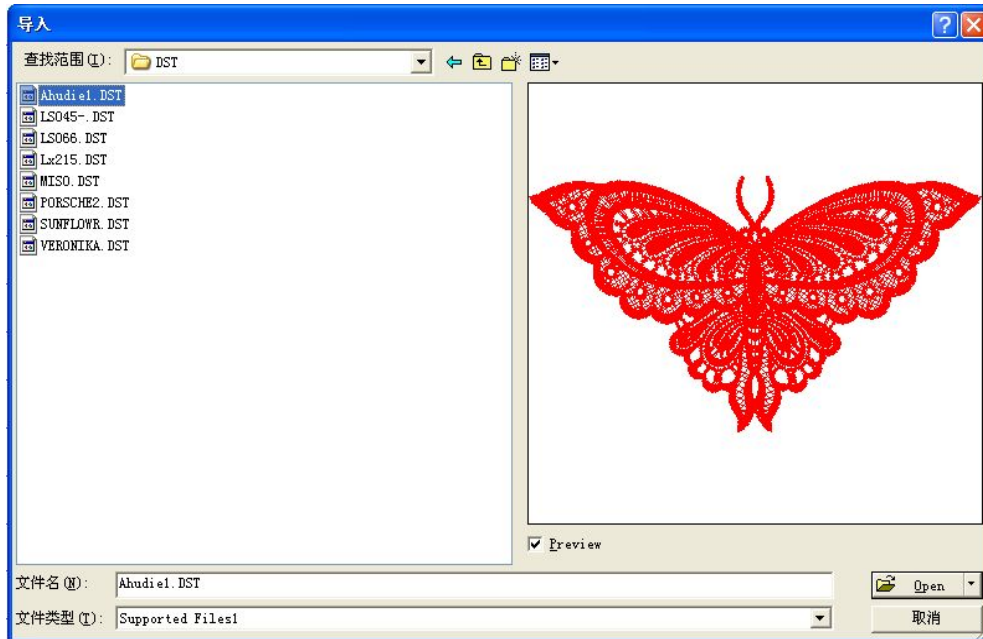


2.4.2 Export File

Click on the "menu" -> [file] -> [export] or click on the icon is deduced  . Then show that export operation interface;

Input the file name, then click "save" button.

2.4.3 File parameters setting

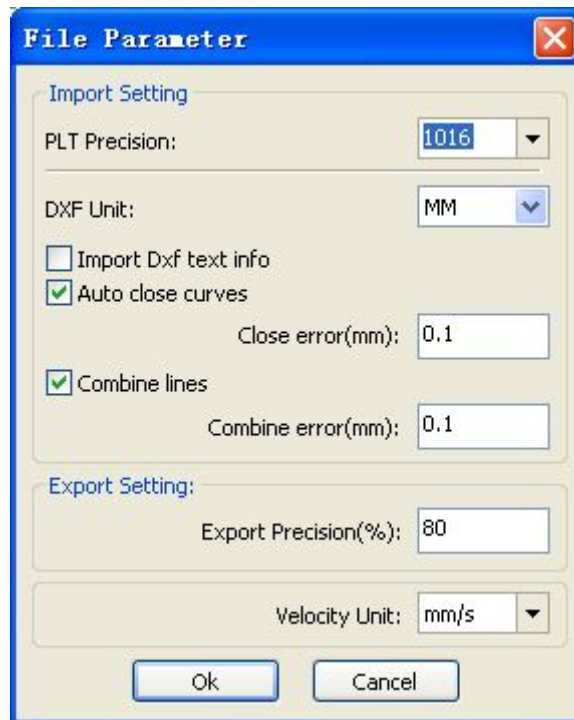

【PLT Precision】 According to the precision of the original PLT file to choose the appropriate import units

【DXF Unit】Software default DXF import unit is mm. If there is an import DXF data size does not agree with the original graphics, may be caused by unit does not match. Optional data unit is mm, cm, inch, custom, when choose the custom, any user set up a unit of data in DXF file corresponding to the RDCAM software in millimeters.

【Import Dxf text info】 When the user need only within the Dxf graphics information, without the need for a file in the text message, are not checked

【curve smooth】 Vector file import, automatic smooth not smooth the curve of the original graphics. For original graphics itself relatively smooth or need to repeatedly adjust the best smoothing effect, are not checked, reduce import processing time. Dealt with after file imports.

【Auto close curves】 According to the close tolerance automatically checks and closed curve


【Combine lines】 According to the merger of tolerance, automatic connection curve

【Velocity Unit】


Speed unit is mm/SEC, m/points two kinds, we can choose according to the habits, the selected interface about speed parameter units will change accordingly.

2.5 Basic graphics creation


【Node edit】

Click on the "menu" -> "Draw" -> "node editor", or click the edit toolbar , drag the mouse on the screen, click the mouse at any position, can draw the point.

【Line】

Click menu **【Draw】** -> **【Line】** , or click Edit toolbar , drag the mouse on the screen you can draw an arbitrary line 。 Press the “Ctrl” key while dragging the mouse to draw horizontal or vertical line.

【Polyline】


Click menu **【Draw】** -> **【Polyline】** , or click Edit toolbar  。 Drag the mouse on the screen And you can draw an arbitrary polyline.

【Bezier】 Click[Draw]->[Bezier]or click the Edit toolbar  .


The process of drawing refer to **【Polyline】** process.

Difference is that when you insert the middle point and hold down the left mouse button and drag to adjust the curve control points.


【Rectangle】


Click menu **【Draw】** -> **【Rectangle】** , or click Edit toolbar  。 Drag the mouse on the screen you can draw an arbitrary size rectangle.
Press the “Ctrl” key while dragging the mouse to draw square.

【Ellipse】

Click menu **【Draw】** -> **【Ellipse】** , or click Edit toolbar  。 Drag the mouse on the screen you can draw an arbitrary size ellipse.
Press the “Ctrl” key while dragging the mouse to draw round.

【Edit text】


Click on the "menu" -> "Draw" -> [text], r click Edit toolbar  and then click on the plot in any position, the pop-up text input dialog box.
Choose fonts, enter text, then set the word is high, the word width, line spacing, word spacing.
Click [Ok] to go again

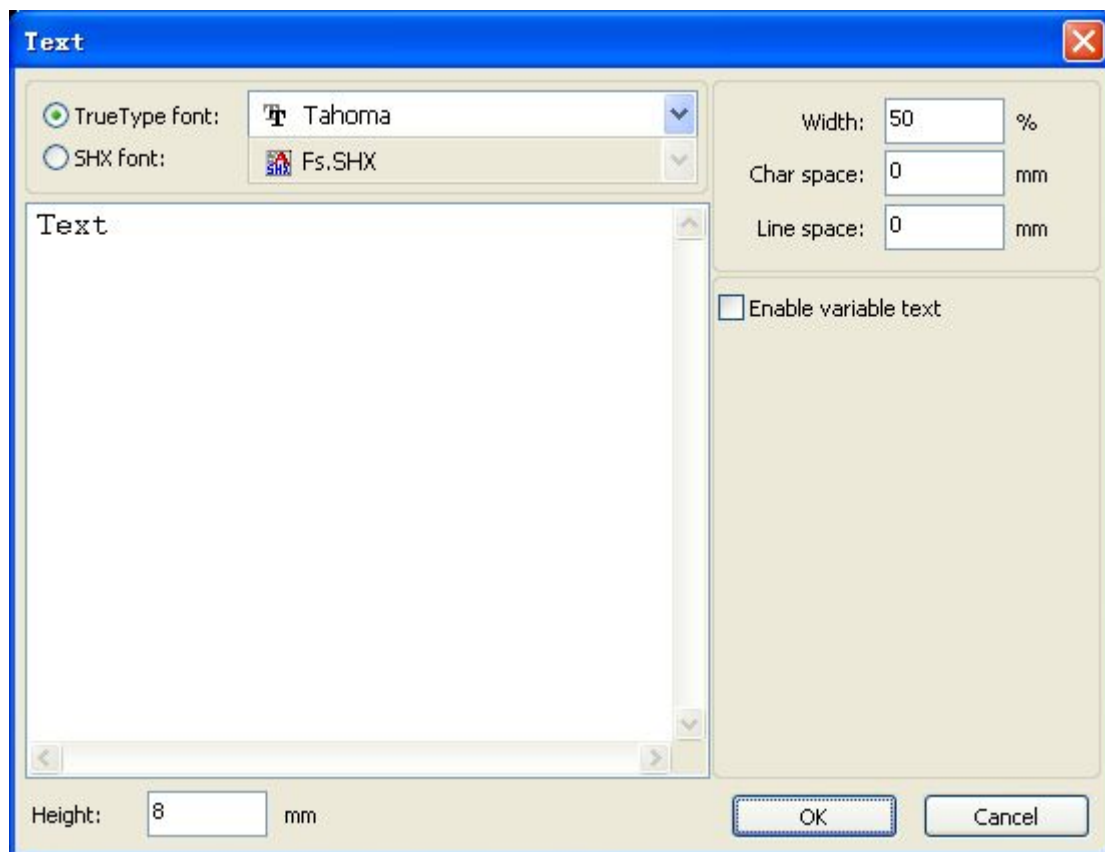


Software also supports variable text, the so-called variable text, the text is need to change according to certain rules, every output processing, text automatically change again. System support type text with date and serial number.

Every time date variables are processing in the current system time of the current computer output. Software provides a variety of date format for the user to choose from.

Users can set date migration, also have daily/monthly/yearly 3 kinds. Such as on product shelf life can be used on the packaging.

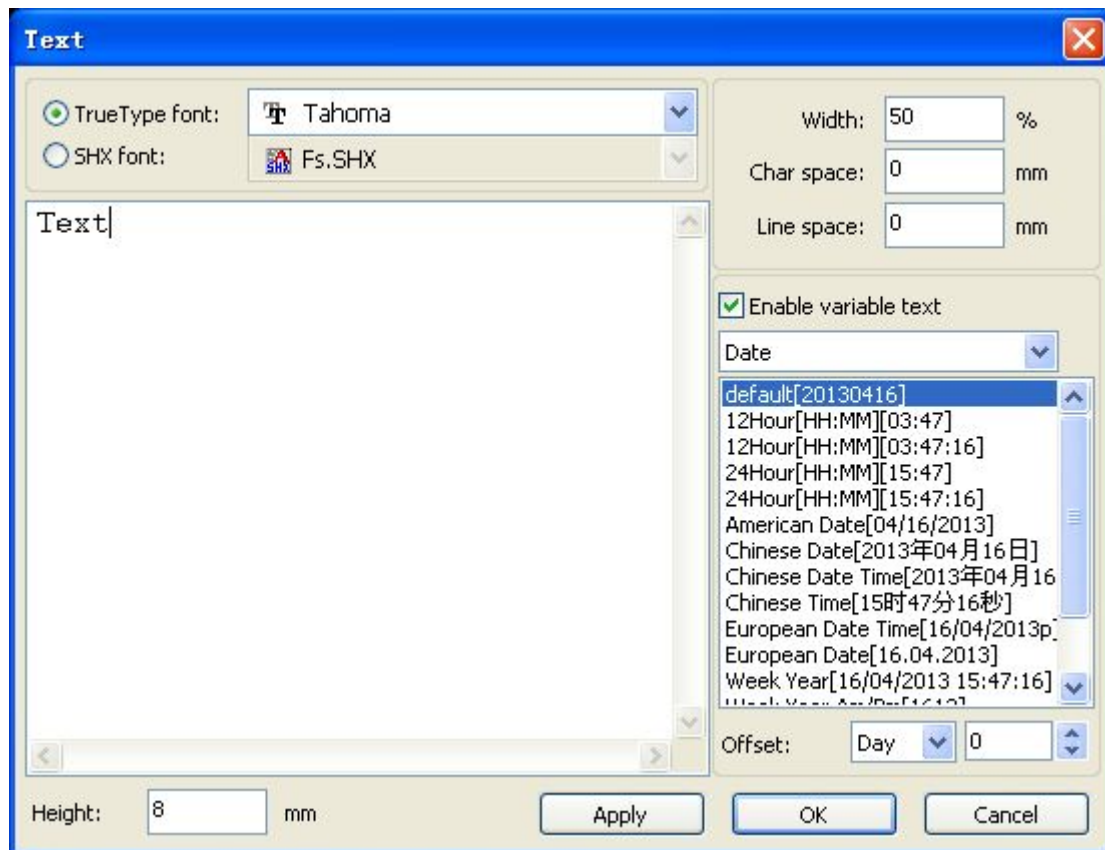

Serial number variable can be digital serial number (0-9) Numbers or letters (a-z or a-z).

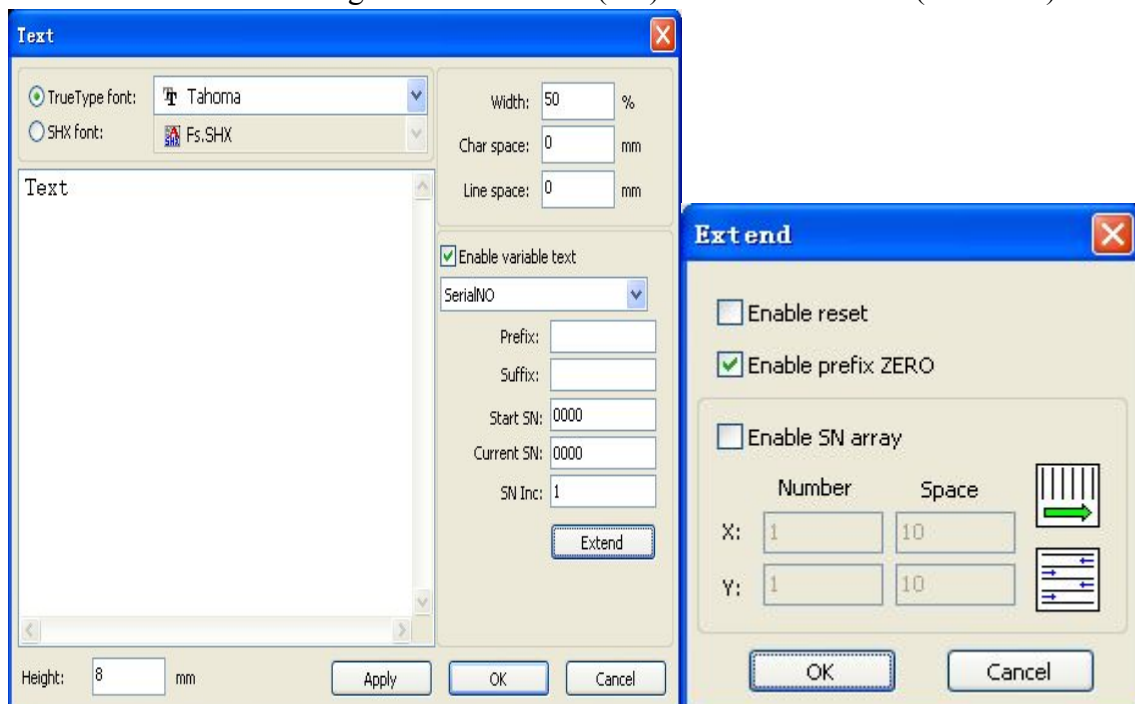

Suppose you want to processing ABC0001DEF repeatedly, ABC0002DEF, ABC003DEF until ABC9999DEF such a set of serial number.

[Prefic]: serial number prefix, case ABC's leading strings.

[Suffic]: serial number of the suffix, DEF in the example is after the string.

[Start SN] : to specify from which serial number to start processing, case 0001 is the starting serial number.

[Current SN] : the current processing to which the serial number, can also be used to specify the current processing which serial number. If when processing a set of serial Numbers, leaks, processing in one, can be processing, by specifying the serial number instead of setting start serial number, because in some cases a set of serial number requires repeated processing, namely to after a certain number, need to return to start serial number to start processing.

[SN Inc] :can specify the serial number on the number of intervals. Case to processing, from 0001 to 0001 in turn serial number, the increment of 1.

If you just need to output an even or odd number serial number, you can set increment of 2.

[Enable reset]: when machining to reset the serial number, serial number will be automatically reset to the current serial number start serial number.

Case requires repeated processing sequence number from 0001 to 9999, therefore can specify 9999 for reset the serial number, after when processing the 9999 serial number, text will automatically change to 0001

[Enable prefix ZERO]:without enabling leading zeros, then the system will automatically remove the serial number of the first nonzero Numbers in front of zero. As the serial number of the case, if there is no can make leading zeros that ABC0001DEF will become ABC1DEF. But it is worth noting that if we want to output the sequence number is ABC1DEF, ABC2DEF until ABC9999DEF, we cannot pass will be set to start serial number 1, but by eliminating, enabling leading zeros .this is because the set start serial number in a specified sequence number from which one number, also specifies the number of significant digits, such as to start the serial number is set to 1, the serial number of the change order is: 1,2,3,4,5,6,7,8,9,0,1,2,3,4,5... The serial number will not change to 10, because only one serial number of the effective bits.

[Enable SN array] in the form of arrays, one-time processing multiple serial Numbers.

Such as:

0001 0002 0003

0010 0011 0002

0006 0005 0004 after machining this batch number, directly to the next set of

0015 0014 0013


0007 0008 0009

0016 0017 0008

2.6 Object Selection

In the process of drawing and edit graphics,first of all is to select the object.

When the object is being selected,in the center of this object will have a shaped mark“ × ”, and surrounded by eight control points.

Click menu **【Draw】** -> **【Select】** , or click Edit Bar  , switch to status“Select”. Under this status,you can select object.The following are five kinds of method of selecting:

- ◆ Click menu **【Edit】** -> **【Select All】** (Shortcuts **Ctrl+A**) , select all objects。

-
- ◆ Click mouse on the screen to select single object



- ◆ Select object using select box

Press the mouse and drag, as long as the box come into contact with the object will be selected。


- ◆ Increased select object/minus select object

Increase select: Press “Shift” key, click or box select to increase select object.


Minus select: Press “Shift” key, click or box select the selected object.

2.7 Object Transformation

Transformation of object mainly include: object location、orientation and size. But does not change the basic shape of the object and its characteristics.

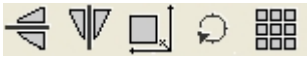
Transformation of object for users, provides a convenient user interface. User can mirror and rotation through  within the draw toolbar.

 
You can also use the Object Properties toolbar, transformation tools to transform and copy the graphics.



2.7.1 Object Mirror


Object image is flip the selected object in the horizontal or vertical direction.

 Click Edit Bar , flip the selected object horizontal.

Click Edit Bar , flip the selected object vertical.

Or through the lens to the transform tools, horizontal and vertical direction to the lens, and copy

2.7.2 Object Rotate


Click Edit Bar , will pop up the dialog of rotate angel setting.

Set rotate angle and click the button **【OK】**.



If you want to drag rotation, set rotate angle 0, and determine.


Dragging the mouse to adjust the rotate angle, in the dragging process, there will be followed by rotating wire-frame outline.

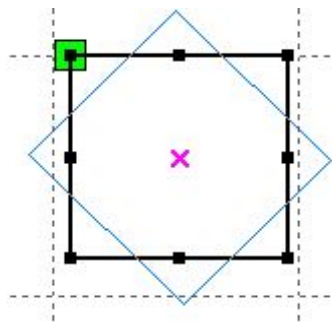


Or directly enter the rotation angle in the Object Properties toolbar.

2.7.3 Place Object

 Place the object is to facilitate the view or orientation. The following tools are provided by software:

, selected object will be placed in the center of the page, that is the object center coincides with the center of the page.

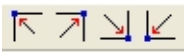
, Selected object will be placed on the page left, upper right, lower right, lower left, upper left corner of the object, upper right, lower right, lower left and upper left corner, top right, bottom right, bottom left corner of coincidence.

2.8 Object Align

Select objects, click tools on the Align Bar



 
.Which include:



Left alignment、Right alignment、Top alignment、Bottom alignment



 Vertical center alignment、Horizontal center alignment、center alignment



Horizontal equidistance、Vertical equidistance






 
 

 
Same width、Same height、Same size.

Benchmark object:

If you press “Shift”key and select object one by one,then the benchmark object is the last object.

If you select object by select box,then zhe benchmark object is the object which curve number in the final.

2.9 Object View

- ◆ Move: Click menu【Edit】->【Move】, or click . Then hold down the left mouse button in the drawing area, and drag pan.
- ◆ Zoom Out: Click menu【Edit】->【ZoomOut】, or click . Each click it, the drawing area zoom out once.Move mouse to the drawing area and click,each click,mouse position as center drawing area zoom out once.
- ◆ Zoom In: Click menu【Edit】->【ZoomIn】, or click . Each click it, the drawing area zoom in once.Move mouse to the drawing area and click,each click,mouse position as center drawing area zoom in once .
- ◆ View Select: Click menu【Edit】->【View Select】, or click . Move the mouse to the drawing area,hold down the left mouse button and drag, a dash border box will show in the drawing area,release mouse button, then the region in the dash border box will display in the drawing area with the largest proportion.
- ◆ View Page Frame: Click menu【Edit】->【View Page Frame】, or click . The page frame will full display.
- ◆ View Data Frame: Click menu【Edit】->【View Data Frame】, or click . The selected objects will full display
- ◆ View Feature Data : Click menu【Edit】->【View All】, or click . Feature data will


be display.

2.10 Important Tool


Here are some frequently used tools. Using these important tools, can make the current document in the graphics more orderly, and make the processing of output more fast.

2.10.1 Manual sorting and the set of cutting point and the cutting direction

Software provides users a convenient tool for the manual sorting. Select **【Edit】->【Set cutting property】**. Cutting property dialog box will pop up. All with manual sorting, and cut points, cutting the direction of the settings in this dialog box can be completed.

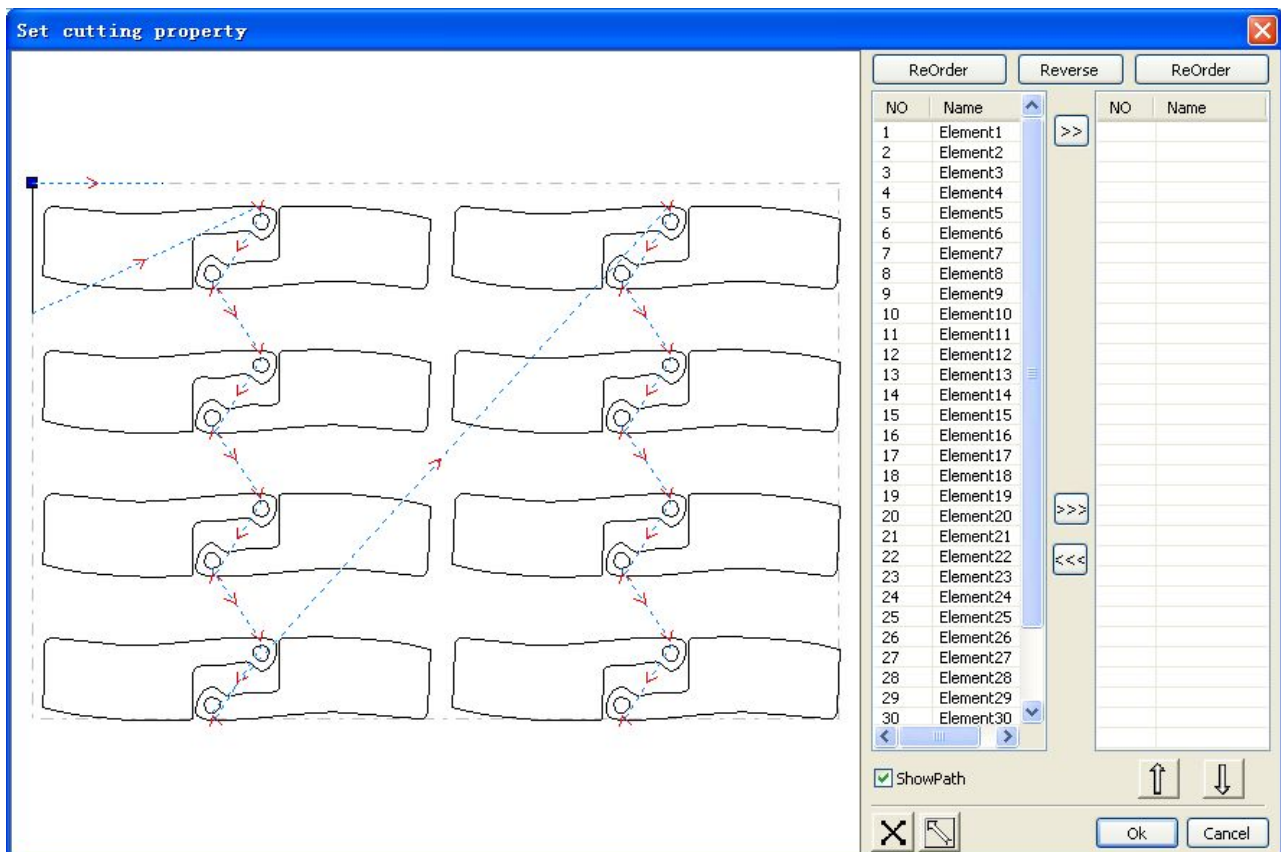

[ShowPath] First check the “showpath”, it will display the current graphics cutting order and the cutting direction.

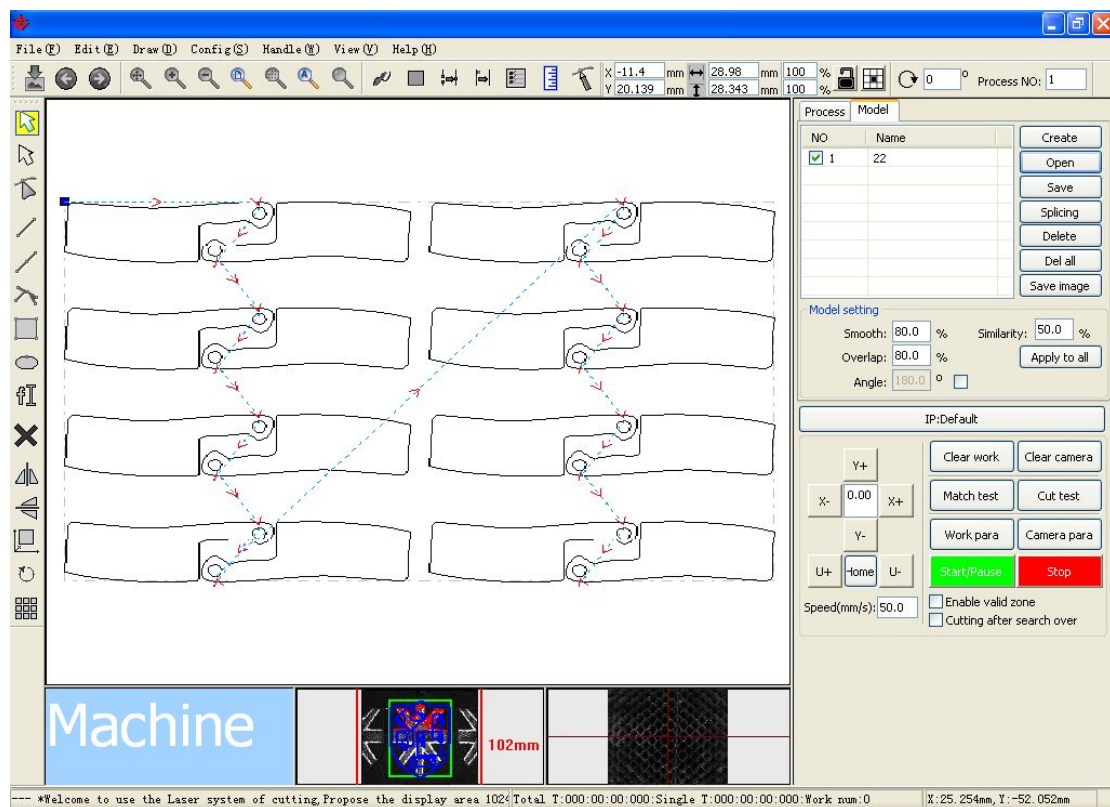

Change the direction of processing

Click the "edit" / set cutting direction, cutting direction into the edit mode.

Then double-click on any position on the selected graphic.

"Change the cutting point"


Click the [edit] / [setting] cutting, cutting point into the editor mode.

Then select to edit the curves, the node at the point want to set a cut double-click can complete cutting point changes

2.10.2 Curves Smooth


For some poor precision of curve, their graphics, curve smoothing can make the graphic more smooth, processing more smoothly.

Click menu **【Handle】** -> **【Curves Smooth】** ,the following dialog box is appears.

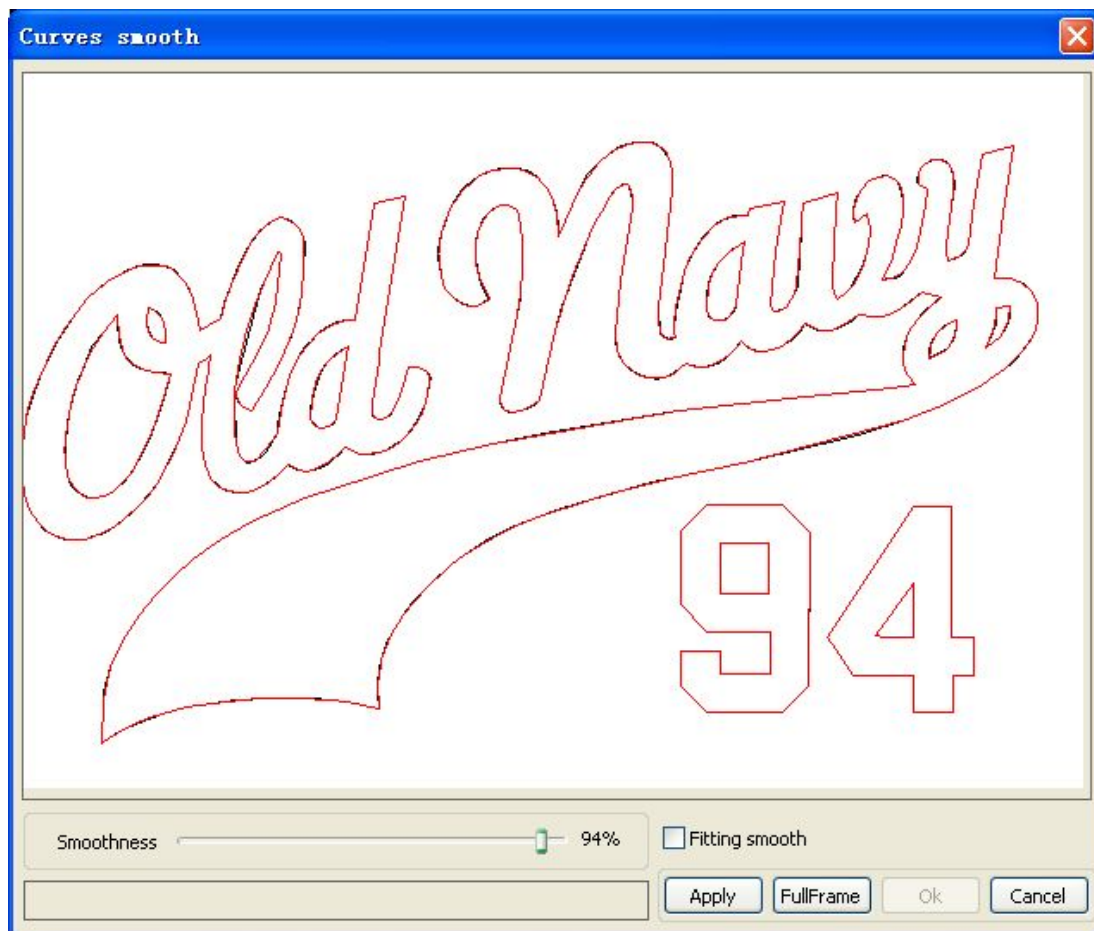

Drag smoothness, click **【Apply】** button, the screen will be displayed before the smooth and smooth curve, easy to compare.

One of the black curve for the original curve, after the red curve is smooth curve.

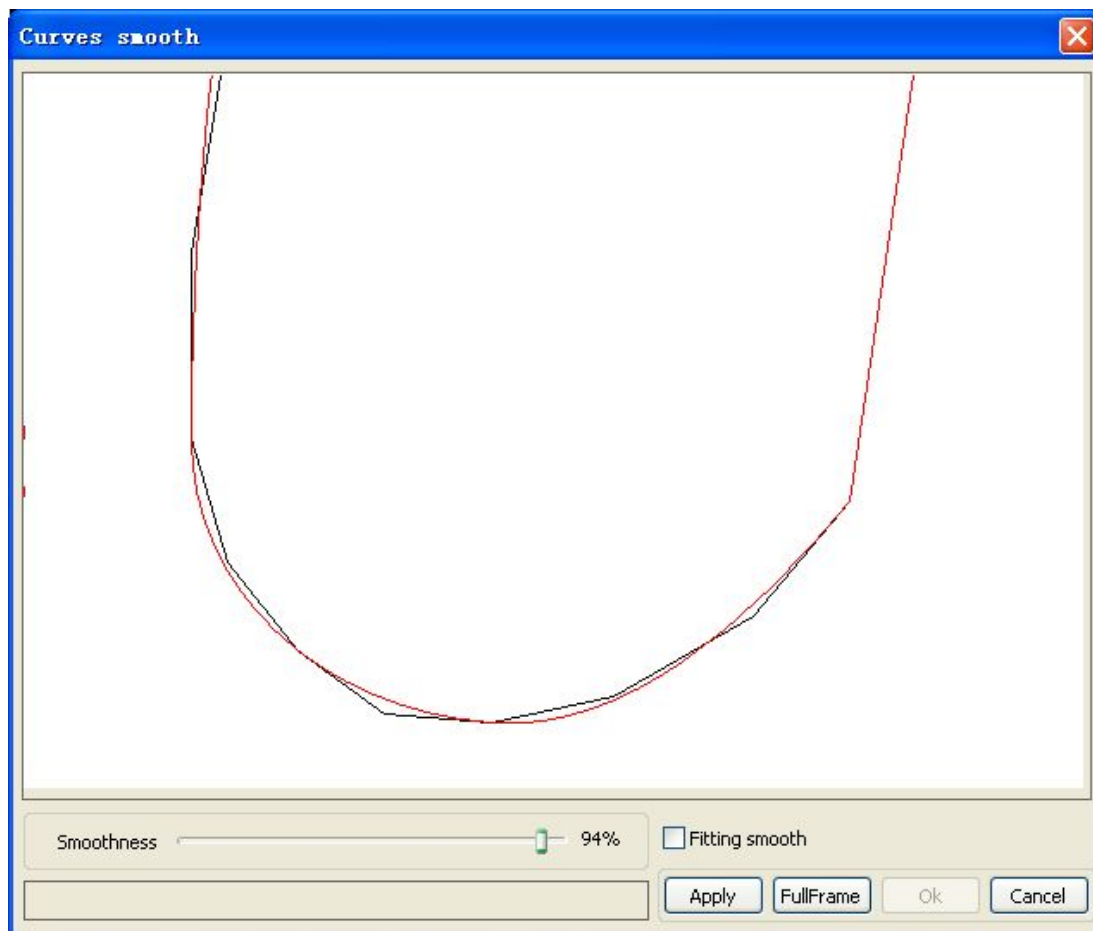

You can view the graphics with drag mouse.

You can zoom in/zoom out the graphics with scroll wheel.


Click button **【FullFrame】** , graphics will shown in the dialog box for largest.


After get satisfied smoothing effect, click button**【Apply】**, curves will processing smooth according to smoothness settings.

Select “Direct smooth” , you can use another smoothing method.

The choice of smoothing method should be changed with the needs of the actual graphic.

2.10.3 Check Closure

Click menu **【Handle】** -> **【Curve auto close】** , or click System Bar , the following dialog box appears.

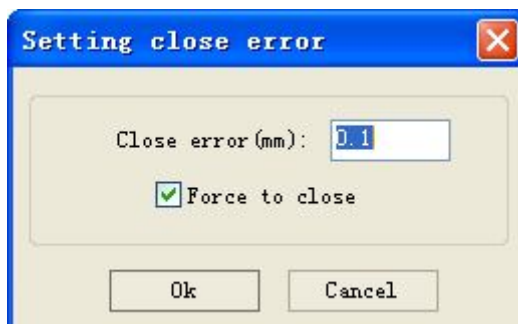


Close error: When distance from the starting point to ending point less than close tolerance, automatic closing of the curve.

Force to close: Mandatory closure of all selected curves.

2.10.4 Remove The Overlap

Click menu **【Handle】** -> **【Delete overlap】** ,or click , the dialog box appear.

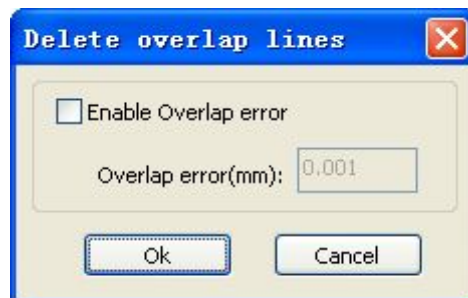

Under normal circumstances do not select the “Enable Overlap error”. Removing the overlapping lines when two lines are compared to a good degree of coincidence. If you need to delete overlapping lines, you should select “Enable Overlap error”, and set overlap error. Generally do not overlap error set too large, so as to avoid accidental deletion.


2.10.5 Combine Curve


Click menu **【Handle】** / **【Combine Curve】** , or click , the following dialog box appears.



The software automatically merge curves in the selected curves, when these curves merge tolerance is less than the setting of combine error.


2.10.6 Data Check


After the selected graphic to check, click the [menu] - > [Handle / [data check], or click toolbar icon , the system will appear the following interface

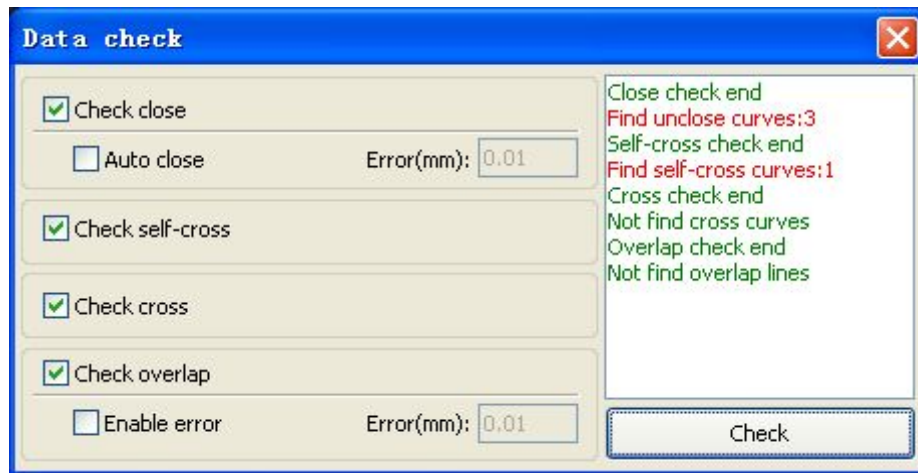


Data checking, integrates the closure checking, since the cross check overlap, cross check and data checking. Users can choose according to need to check the item, after data detected problem, in the dialog box on the right side tip problem has been detected and at the same time will question the graphics in the selected state. Over checking - > eliminate errors - > check process, until all the data are conform to the requirements of the processing.

2.10.7 Generating parallel lines

Selected to generate parallel lines of the data, click the [menu] - > [handle] / [generated parallel lines],or click the toolbar .

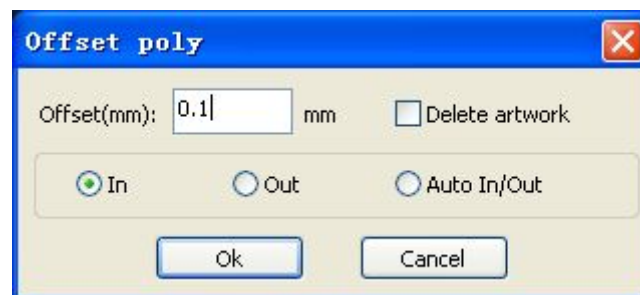


Red line as the original graphics, green line for the graphics.

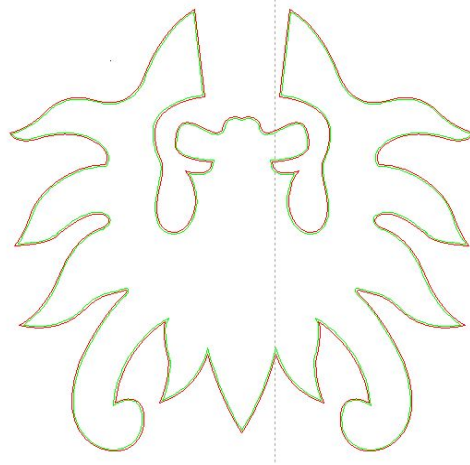


2.10.8 Model auto hide

In 'Model edit mode', hidden cutting data; In 'cutting edit mode', hidden feature data.

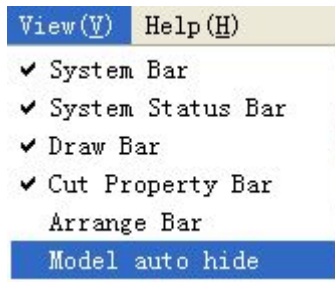


Chpater 3 System Settings

Before output graphics , required to determine whether the system settings are correct.Click menu **【Config】** -> **【System Setting】**

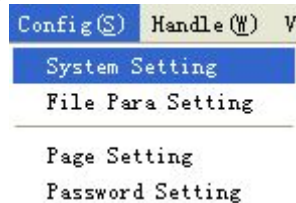

3.1 General settings

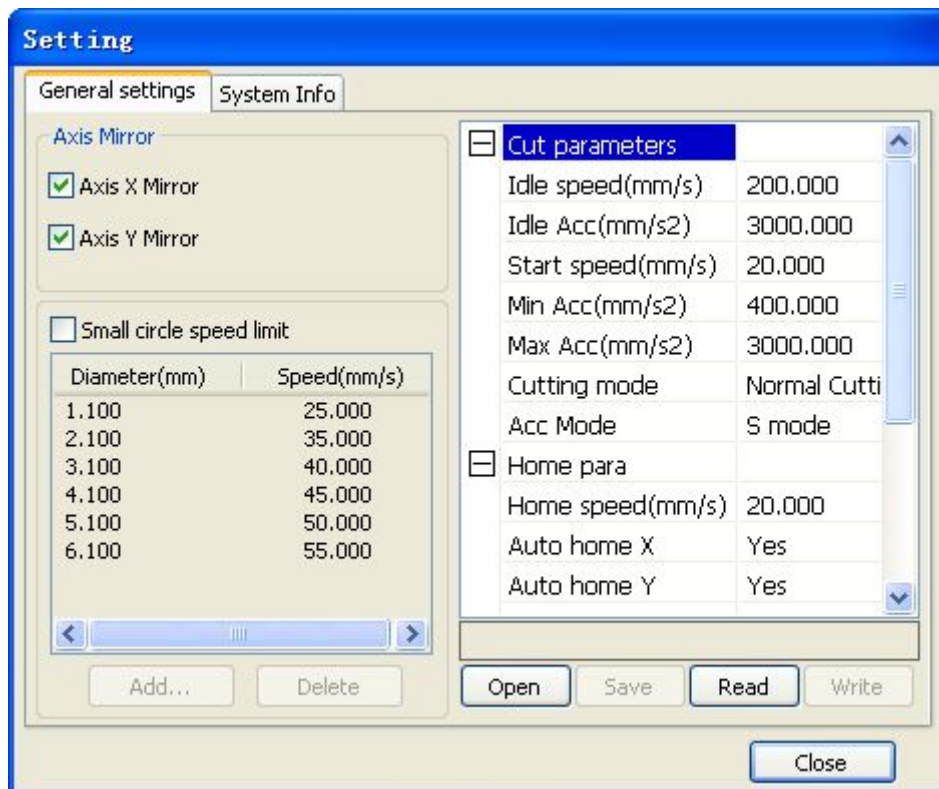

Axis Mirror

Generally, Axis direction of mirror is based on the actual location of the limit or home of machine.

The default coordinate system if Descartes coordinate system, and zero in the bottom left.

If the zero point of the machine is top left, then X-Axis do not need to mirror, but Y-Axis need to mirror.

If the zero point of the machine is top right, then both X-Axis and Y-Axis are all need to mirror.

In addition, this function can also use to other application for mirror.

Small Circle Speed Limit

On processing work, the software automatically determine whether the current round need to limit speed, then according to the diameter size of the circle to determine the speed. If parameter configuration appropriate, will greatly enhance the quality of small round. Click button **【Add】**, **【Delete】**, **【Modify】** to configuration.

Small circle is less than speed of the rules limiting the list of small round circle of minimum radius, minimum radius circle at the speed of the output of the corresponding.


If the speed greater than maximum speed limit list the speed round, the speed only associated with the speed of the layer.

If the speed is in the list, set the output speed by list.

If the request received by limiting layer parameters faster than the speed set in the layer, press the speed of the output layer.


1. Add backlash

Click the Add button, the screen will pop up as shown in Figure

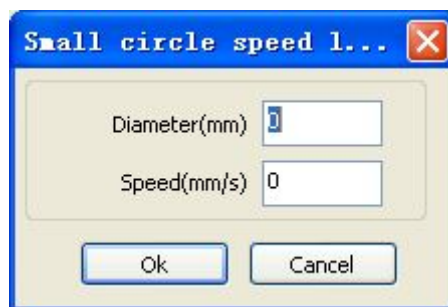

Set speed and backlash, click OK, the value to be inserted into the list of backlash. (2) 2.Modify backlash

Double-click the left mouse button scanning (reverse gap) need to modify the reverse block entry clearance, then the pop-up screen shown in Figure.

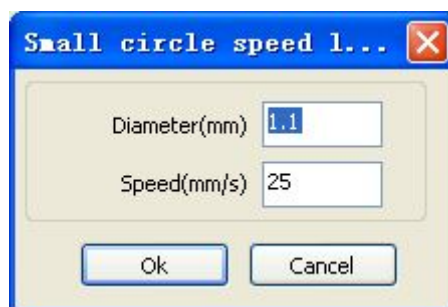


In the interface can modify the current speed of the corresponding backlash.

(3) Remove backlash

Right-click scanning (reverse gap) block in the backlash to delete the item, then click the **【Delete】** button

【Double spacing】

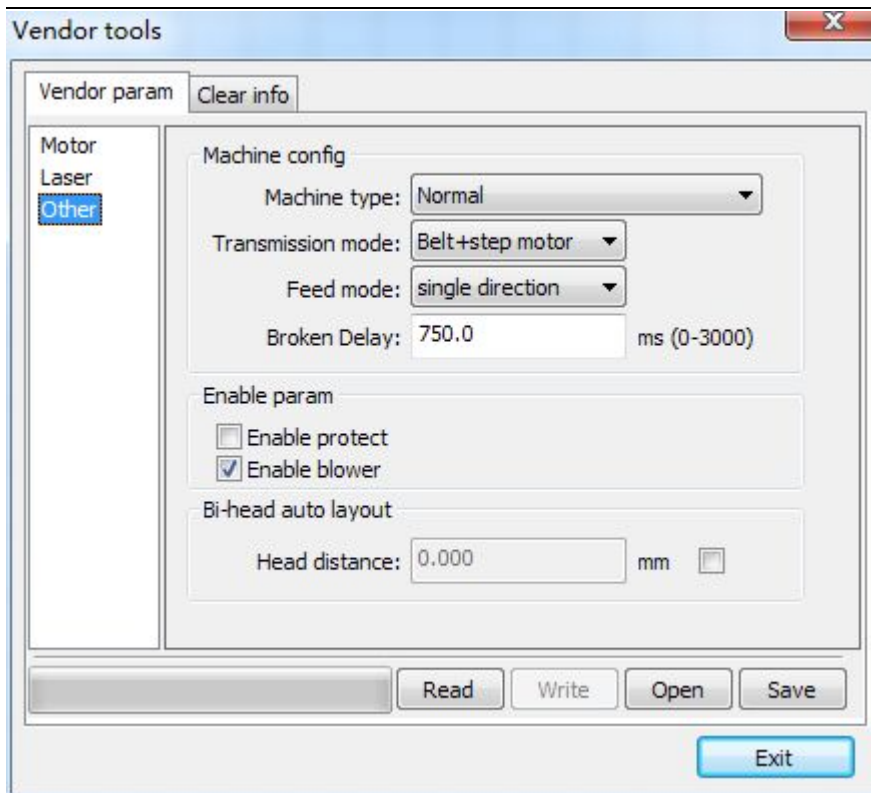

When machines have two laser in the manufacturer of other parameters, check the double spacing, and fill out the distance between two laser, distance between two laser head is fixed, the spacing is inevitable when machine design, please accurately measure the spacing value, and then fill in the box in the above parameters. If the value is not accurate, will lead to a double shift each cutting out graphics spacing was faulty. In general, the value you just need to set up a, unless there is a limit switch the mobile location.

Check after double spacing and set up the correct spacing value, click on "write" parameters, will be written to the controller parameters, in this way, the controller will enable a two-headed move mutual function; On the other hand, when writing parameter is not checked double spacing, this controller is not enabled double shift function.

[double shift each **】** : the purpose is to shorten the processing time, cutting a laser cutting is less than the edge of wide, if the controller is enabled double shift function, at the same time must make can open XYU triaxial boot reset, and let the XYU three axis in reliable reset when the phone is switched on, looking for their origin. In factory parameters, will XYU three axis "can make reset" checked, write parameters, and then in the user preferences, in XYZ axis whether boot reset, select "yes", and write parameters.

3.2 System info

Setting

General settings System Info

Vendor password: Input

Mainboard version: Read

Upgrade

Close

Information on the operation of the motherboard manufacturers need to enter password to view parameters.

Setting

General settings System Info

Total on time(hour:min:s):

Total processing time(hour:min:s):

Previous processing time(hour:min:s:ms):

Total laser on time(hour:min:s):

Total processing times:

X Total travel(m):

Y Total travel(m):

Mainboard version: Read

Upgrade

Close

- 1> **Total on time:** The total time of motherboard working
- 2> **Total processing time:** The total time of processing ,including the time of jump moving.

-
- 3> **Previous processing time:** The time of the last processing
 - 4> **Total laser on time:** The time of the laser processing
 - 5> **Total processing times:** The number of completed processing, not include the processing forcing to end.
 - 6> **X total travel:** The total travel of motor X.
 - 7> **Y total travel:** The total travel of motor Y.
- Motherboard version:** The version of the current controller.

The function of upgrades:

If the board has additional features, the manufacturers will provide the update file (*.bin format), the user can load the upgrade file to upgrade the motherboard. After the upgrade, you need to click on the control panel "Reset" button reset the motherboard before normal use.

Chapter 4 Camera Management

4.1 Camera parameters

Click **【camera para】** on the operation panel button, can appear the following camera parameters Settings dialog

Camera para

Camera param

Contrast: 0.0 %

Gain: 4.0 %

Exposure: 3.0 %

Threshold: Medium Stabilization time: 300 ms

Camera calibration

Speed: 200.0 mm/s Power: 20.00 %

1 Cut cross Calibration

2 Width: 100.0 mm Interval: 0.100 s

Height: 80.0 mm Space: 5.000 mm

Dot Correct

3 Redo 1st step Cut cross

4 Manually correct offset and size(Not recommended)

X: 0.000 mm Y: 0.000 mm

Ratio: 1.000 <<<

Reset SaveAs Load


The adjustment of the camera on the hardware mainly by adjusting the aperture and focal length to adjust the quality of the image but the camera is installed, can't adjust. Usually adjust the

environment light.

The camera parameters adjustment in the software are:

Contrast: Mainly through adjust the background color and contrast material color difference to fine image quality.

Gain: is the brightness of the image magnification.

Exposure: The longer the exposure, the brightness of the image higher. Click  can perform automatic exposure operation.


"contrast", "gain" are to deal with image data. So when image fainter, as far as possible to adjust the light source (lamp on the camera) and **Exposure**, if still can not get the desired effect, to adjust brightness, contrast, gain.

Stabilization time, stability time associated with the machine, the machine inertia large, After the high speed movement stability will take a long time. When you take a photo and needs a stable vision. Recommended value is 300 milliseconds.

Threshold: when user extracts the edges, you can set the level. and there three options (Low\Medium\High) for you. It can control the density of extract-edges. The lower level, the greater density.

4.2 Camera Calibration:

4.2.1 Cross Calibration

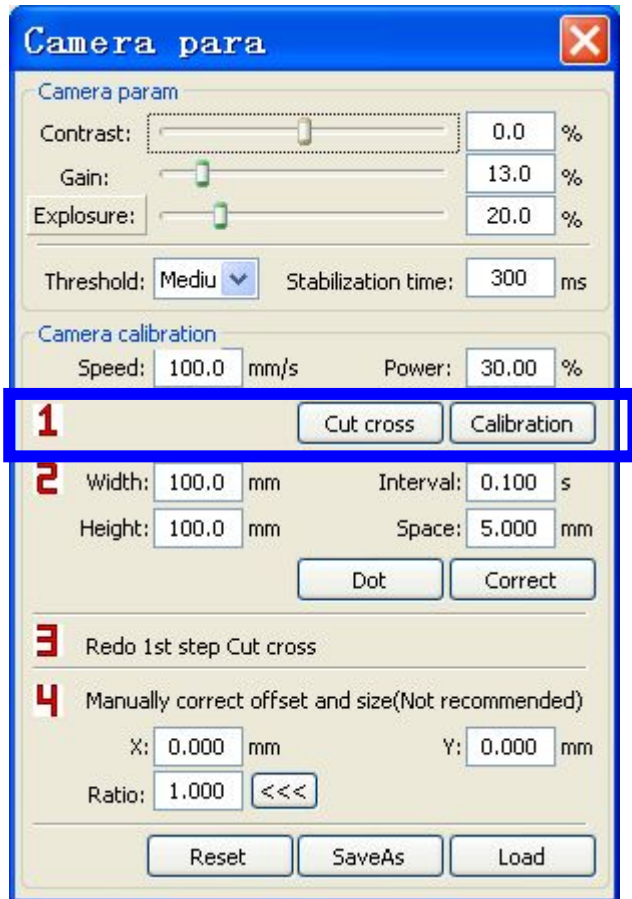

【Speed 】 In the process of camera calibration, or when cutting cross laser moving speed.

【Power 】 In the process of camera calibration processing power.

【Cut Cross】 , click on the "cross cutting", the laser will quickly cut out a cross.

【Calibration】 : cut a cross, then move the cross in the camera view center to center coincides with the cross and click on the "camera calibration". System will also have a camera view center offset to the center of the laser head.

4.2.2 Dot Calibration

Camera para

Camera param

Contrast: %

Gain: %

Explosure: %

Threshold: Stabilization time: ms

Camera calibration

Speed: mm/s Power: %

1

2 Width: mm Interval: s

Height: mm Space: mm

3 Redo 1st step Cut cross

4 Manually correct offset and size(Not recommended)

X: mm Y: mm

Ratio:

【Width】 The width of the camera view, after installation of the camera, users fill in according to the actual data.


【Height】 The height of the camera view, after installation of the camera, users fill in according to the actual data.

【Interval】 Rbis, laser make a point of light time.

【Space】 Set the distance between two points


【Dot】 Click on the "Dot" button, the system will be based on user fill in the camera view the size, print out the M * N could be covered with the camera point of view.

【Correct】 Use laser to play good outlets on the camera right in the middle of the visible area, click on the "correction" button, the camera calibration can be realized. The following figure:

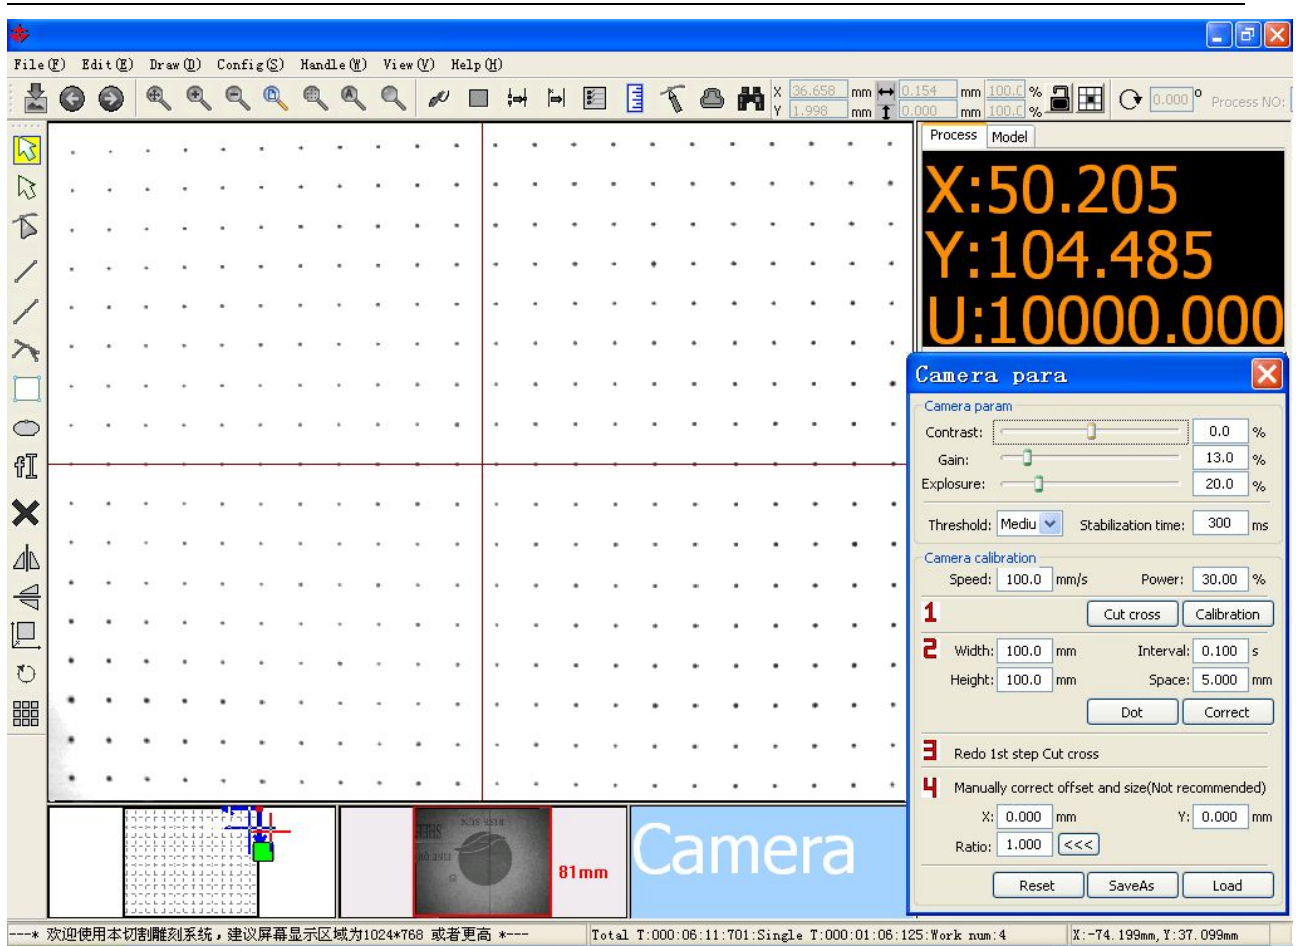

If the correction is successful, system prompt correction of success;

If it fails, the system prompt correction failure. Need to repeated correction, until success.

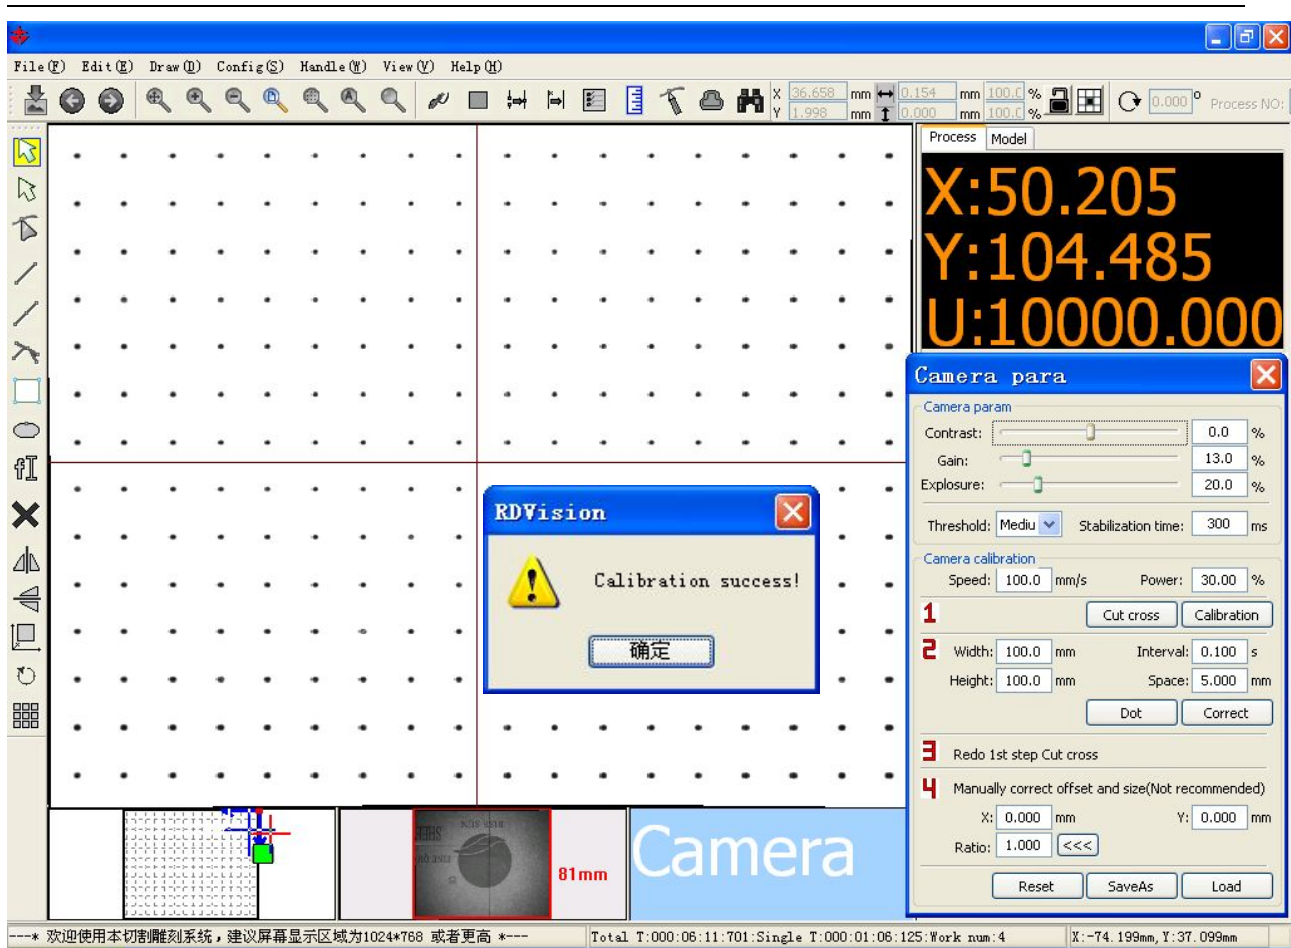

Note: Complete the Dot Calibration, Suggest that do Cross calibration again.

Camera para

Camera param

Contrast: 0.0 %

Gain: 13.0 %

Exposure: 20.0 %

Threshold: Mediu Stabilization time: 300 ms

Camera calibration

Speed: 100.0 mm/s Power: 30.00 %

1 Cut cross Calibration

2 Width: 100.0 mm Interval: 0.100 s
Height: 100.0 mm Space: 5.000 mm
Dot Correct

3 Redo 1st step Cut cross

4 Manually correct offset and size(Not recommended)
X: 0.000 mm Y: 0.000 mm
Ratio: 1.000 <<<

Reset SaveAs Load

【X】、【Y】 This parameters are set the compensation of cross calibration.


【Ratio】 There is tinydifference in height between the calibration plane and the actual match plane.Can improve cutting precision by this parameter.

Note:When calibration many times, cutting operation also can not meet the user needs precision. You can manually adjust parameters of 【X】、【Y】、【Ratio】 in step 4.


【Clear Camera】 Clear the data on the video area.

When the dot after correction, will display the extract to the outlets in the video. Area click operation panel "video" button, can be removed. Please check the position of the video area on The following figure:

4.2.3 Calibration file management

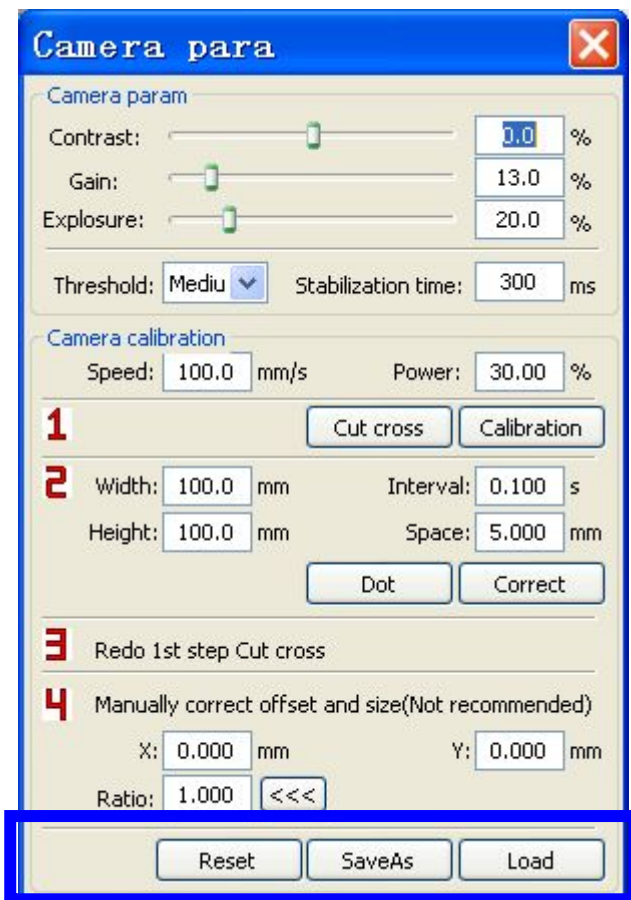


【Save As】: after the success of the correction, the user can save another "correction" keep the correction files saved to the specified directory, and set the file name. Interface as shown in the figure below:

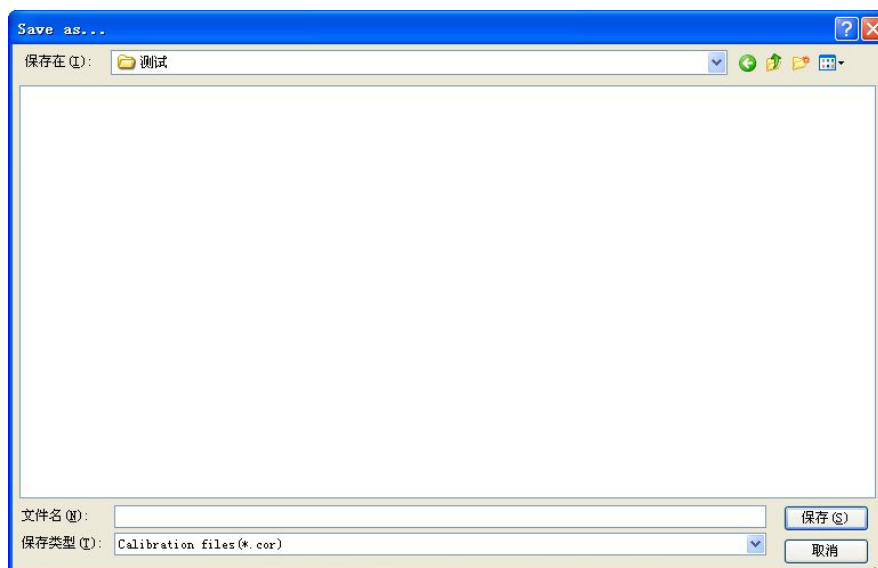

【Load】: under normal circumstances, every time do not need to use the software for correction operation. Users can load the existing calibration file, implement correction function. When the camera and the machine position has not changed, just load the existing calibration file.

Click on the "load file", issue a file dialog box. Find correction need to load the file, and click "open" button to complete loading operation. Interface is as follows:

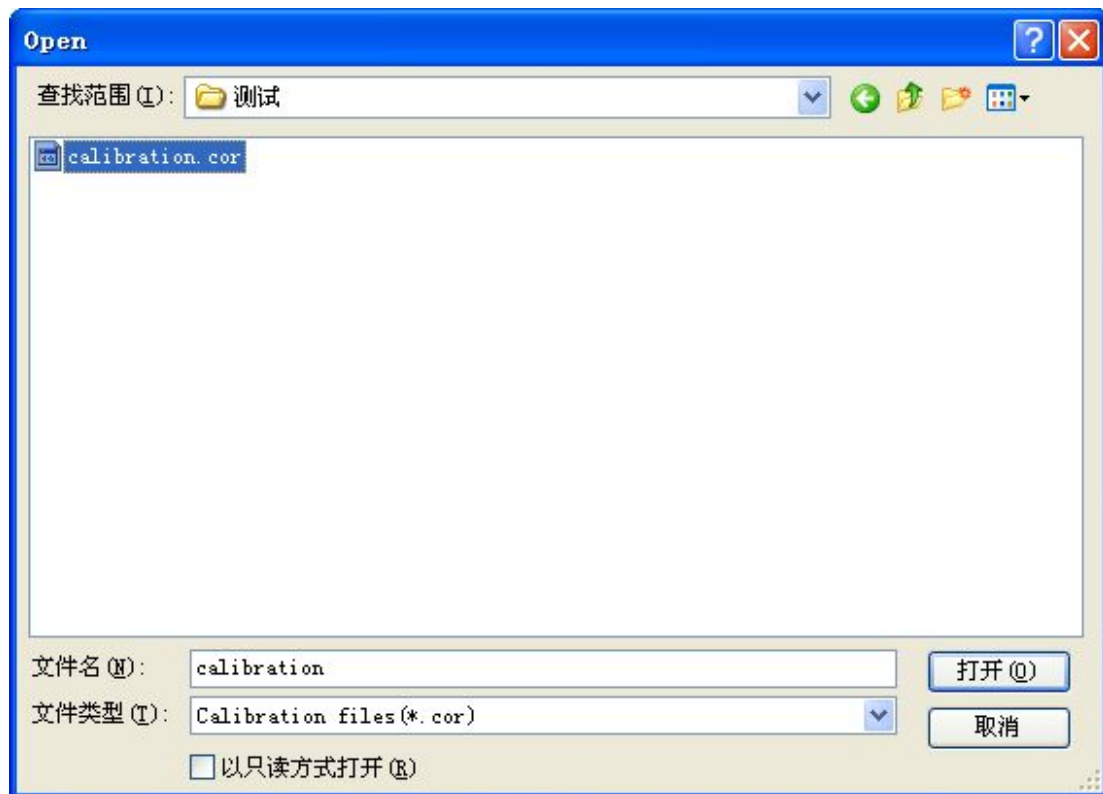

【Reset】 : Camera calibration, the calibration results are not ideal. Users need to be corrected again .Before the next correction,user must clear the calibration object. In this case, click the “Reset” to clear the calibration object.

Chapter 5 Mode Management

5.1 Create Model


Move the camera filed center of view to the center of the actual image.And then click **【Create】** operation button.The system will prompt user to enter a name of the model.As shown below:



Enter a non-existing model name.Then click **【OK】** ,a model carete successfully.

5.2 Extract Featurs


5.2.1 Select Feature Region

The sithching button of model editing mode .It can be switched between “Model edit mode ”and “Cutting edit mode”.

In the “Model edit mode”, Press down the right mouse button, Drag to draw a green rectangle (Can draw multiple times) .The area within the green rectangle is feature region.

Feature region selected Note:

1. Graph of the feature region,It must be a unique identifier of the unit target object.
2. In the feature region,The color of Graphics and background must be different.
3. The larger feature region,the longer matching time.So don't choose too large region.
4. If model is big model,the feature region cannot be located on the splicing clearance.

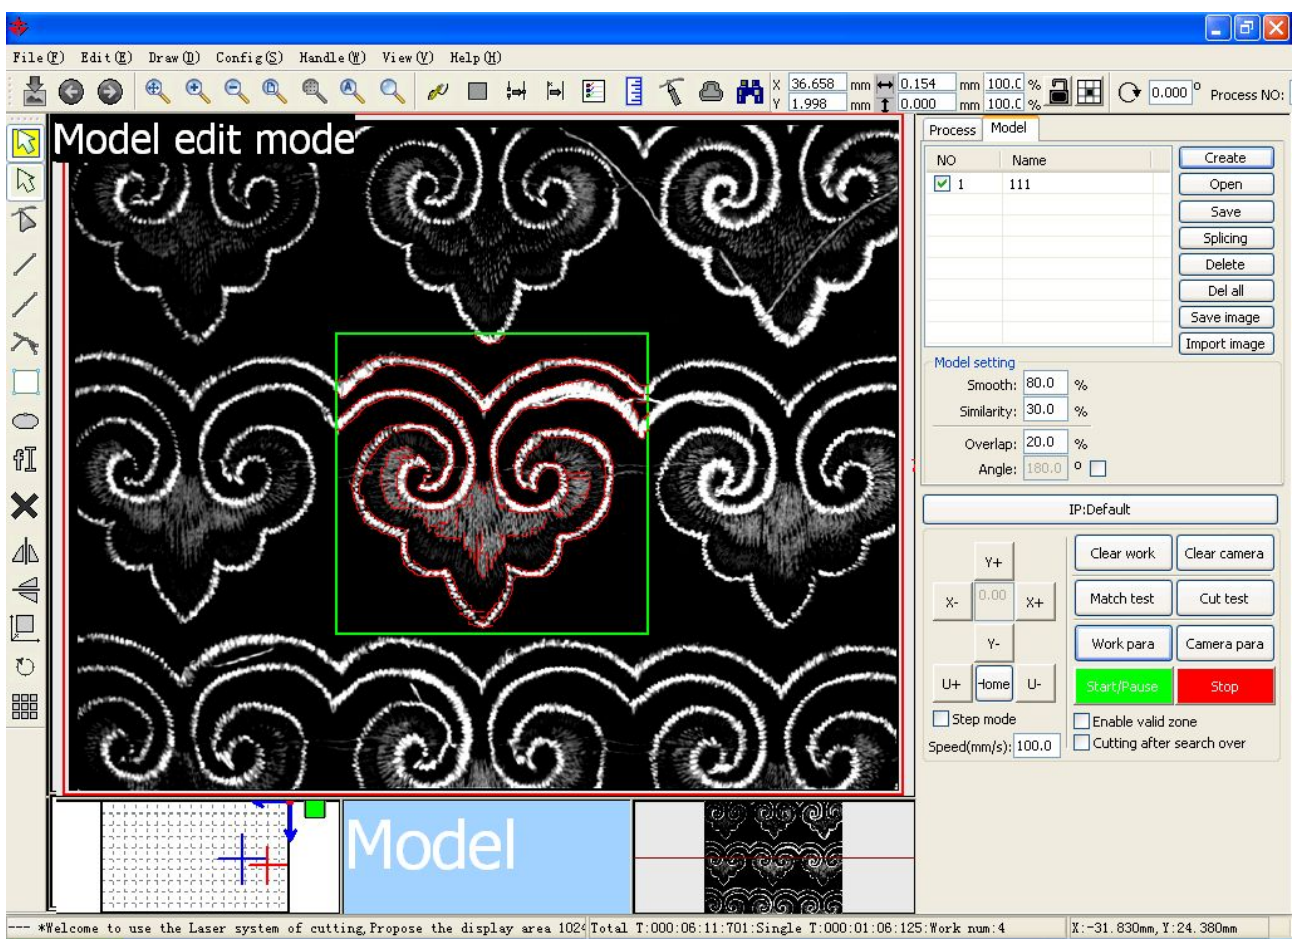

5.2.2 Set Model Parameters

【 Smooth 】 : The higher smoothing coefficient,the less scattered points of feature region be extracted. (Detailed Description please refer to chapter 5.2.3) 。

【 Similarity 】 : the matching score of model and actual graphic.The higher score,the more similar.The value of similarity directly affect the matching quality.

【 Overlap 】 : The overlap percentage of two target object envelope rectangular.This parameter controls whether targets that has overlapping part will be matched 。


【 Angle 】 : Set the angle range of model rotation search.For example,the value set to 180.In the matching process, search angle range is -180~180.

According to actual needs to set the search angle.The larger search angle,the longer matching time required.If the user does not need to set this parameter,and you should remove the check.

As shown below , There are two opposite triangles.If you use a model matching.You

must check this option and set the search angle to 180 Angle: 180.0 ° ☒ .That software can find the two opposite triangles. However, in the process of rotation

match, increase the amount of computation and slowing the speed of matching. And the matching accuracy of a certain reduction. Thus, in this case, it is recommended that using multi-model to match.

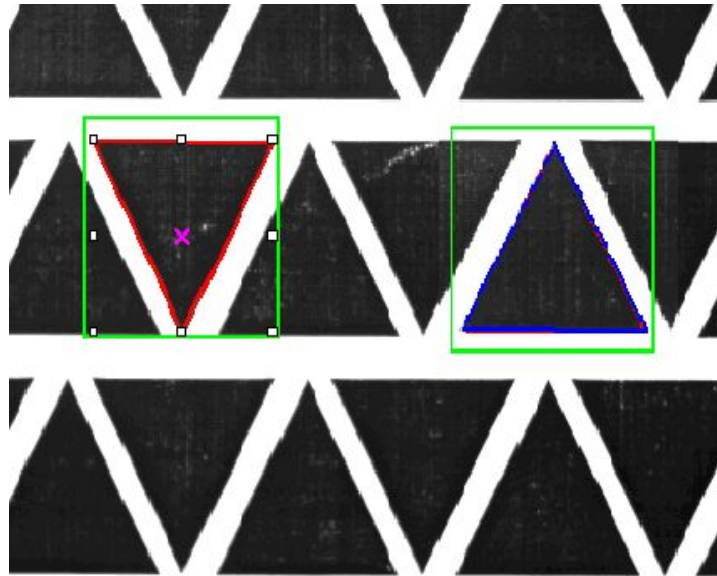

【Apply to all】： The current model parameter settings applied to all other models.

【Match test】： Current model match to the target image of camera field view. Test results will be returned as results-interface. When the matching results are not satisfactory, adjust the similarity and search-angle until the matching results are satisfactory.

5.2.3 Feature Processing

As shown below, In the green rectangular box, the red lines are feature curves. There are some excess scatter-points or curves. By improving the smooth coefficient, user can reduce the number of feature curves.




(Smooth 50%)




(Smooth 100%)


If users need to delete some curves, In “Model edit mode”, Hold down the left mouse button and drag to draw a rectangle that to select the curves. And then press the “Delete” key to delete excess curves.


5.3.2 Edit Cutting Curve

【Contour】 In 'Model edit mode', Feature contour has been existed. First select feature-curves, and then click system toolbar icon . It can automatically generate cutting curve contour. Then In "Cutting edit mode", Edit cutting curves. Please refer to section 2.4.

【Manual Paint Cutting Curve】 In "Cutting edit mode", Edit cutting curves. Please refer to section 2.4. In "Cutting edit mode", The blue lines are the cutting curves as shown below:

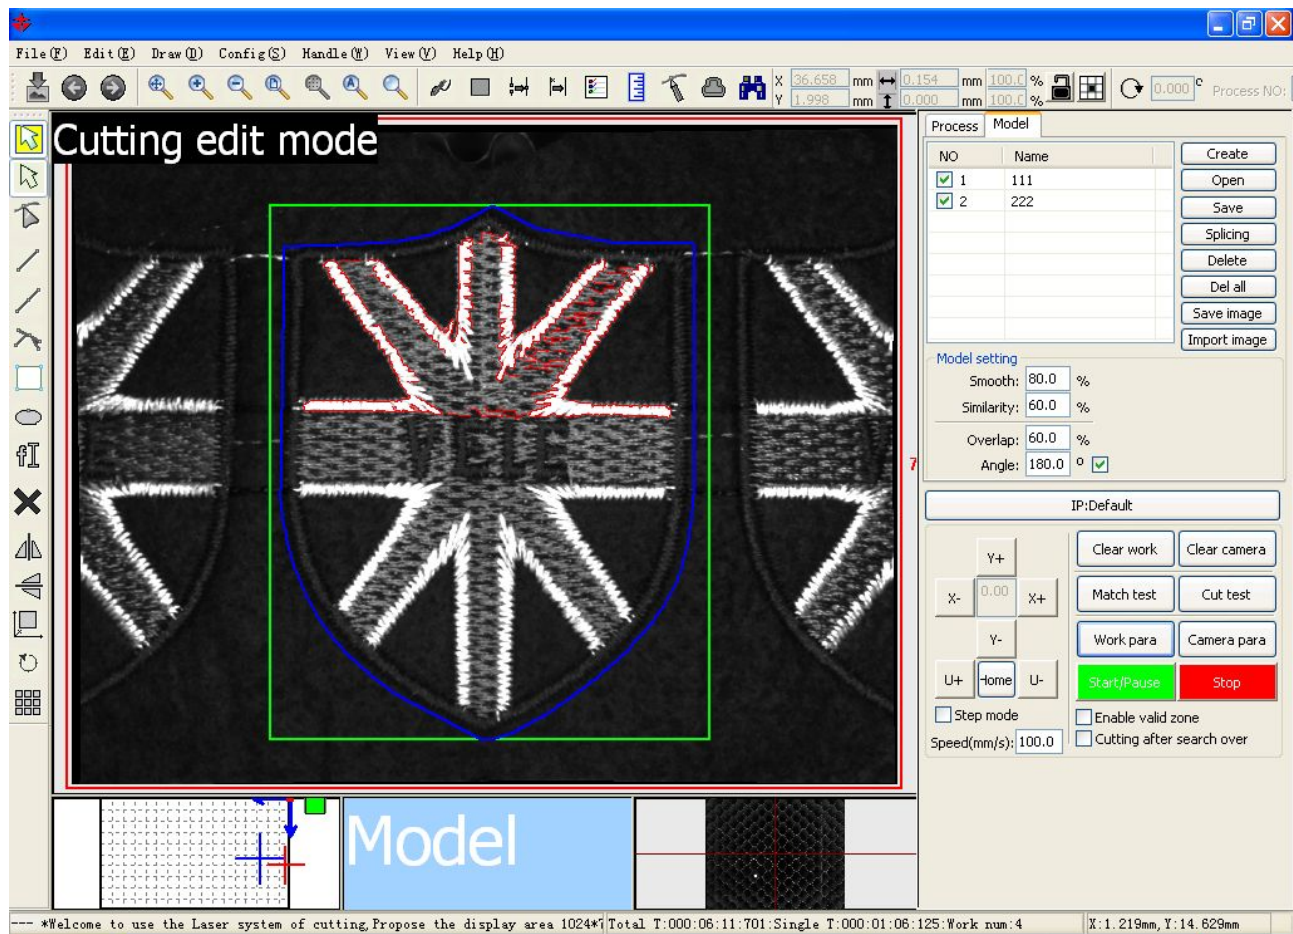

【Node Edit】 In "Cutting edit mode", Click the "Node Edit" tool , and user can edit nodes. Next, user can add nodes, delete nodes, and node drag.

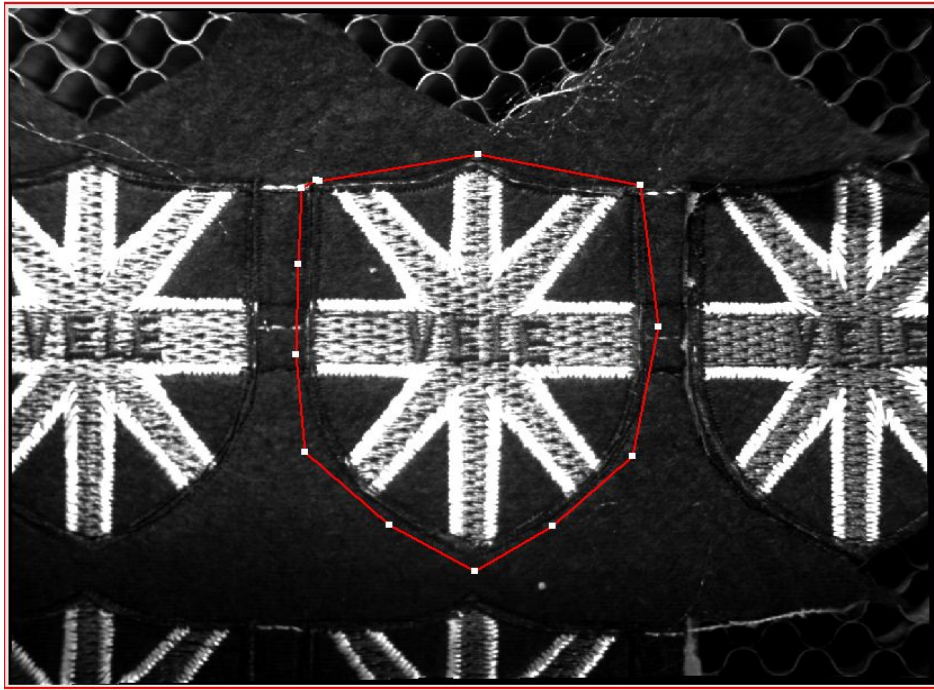


Drag node to change the graphical outline;

Double-click the left mouse button on the contour curve to add a node;

Double-click the left mouse button on the node to delete a single node; Marquee multiple nodes and press the “Delete” key to delete multiple nodes.

After editing, as shown below:

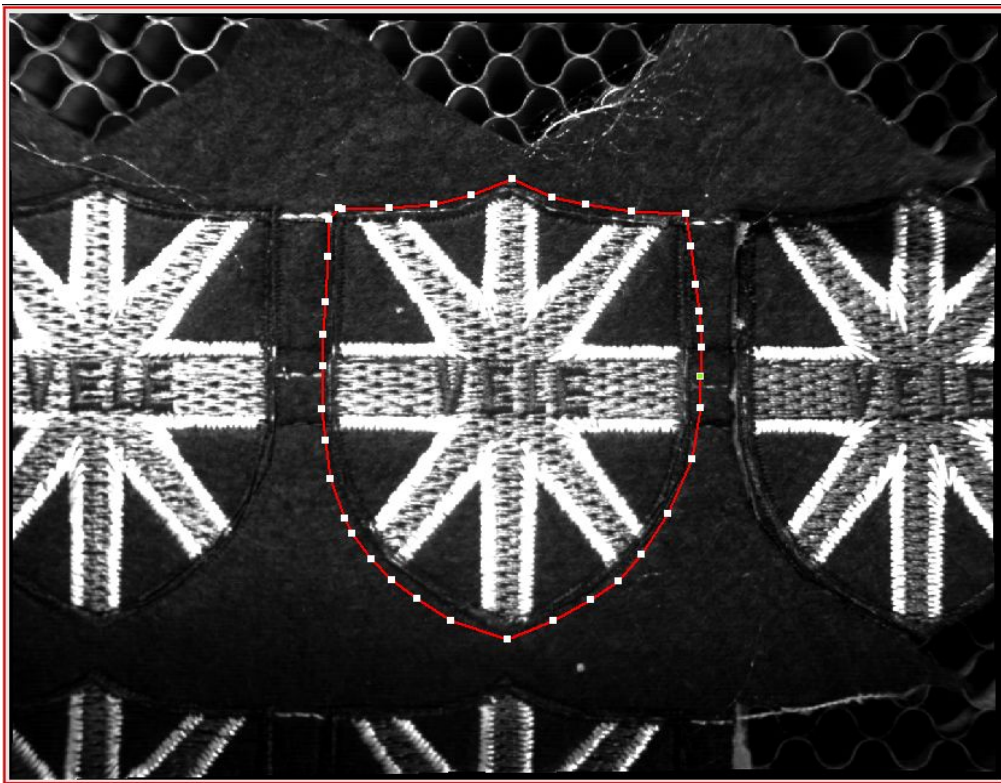


By the operation of node edit, user can adjust graphic outline. Graphic contour transformation processing in order to achieve the user's needs. Details please refer to sections 2.6 and 2.9

Supports importing contour from other graphics software (AutoCAD, Adobe Illustrator, CorelDraw) drawn to the model. Details please refer to sections 5.3.3

5.3.3 Import Cut Contour

In “Cutting edit mode”,Import cut contour.

In “Cutting edit mode”,Click【File】->【Import】, Appears open file dialog box.Next select file and then 【Open】 As shown below:

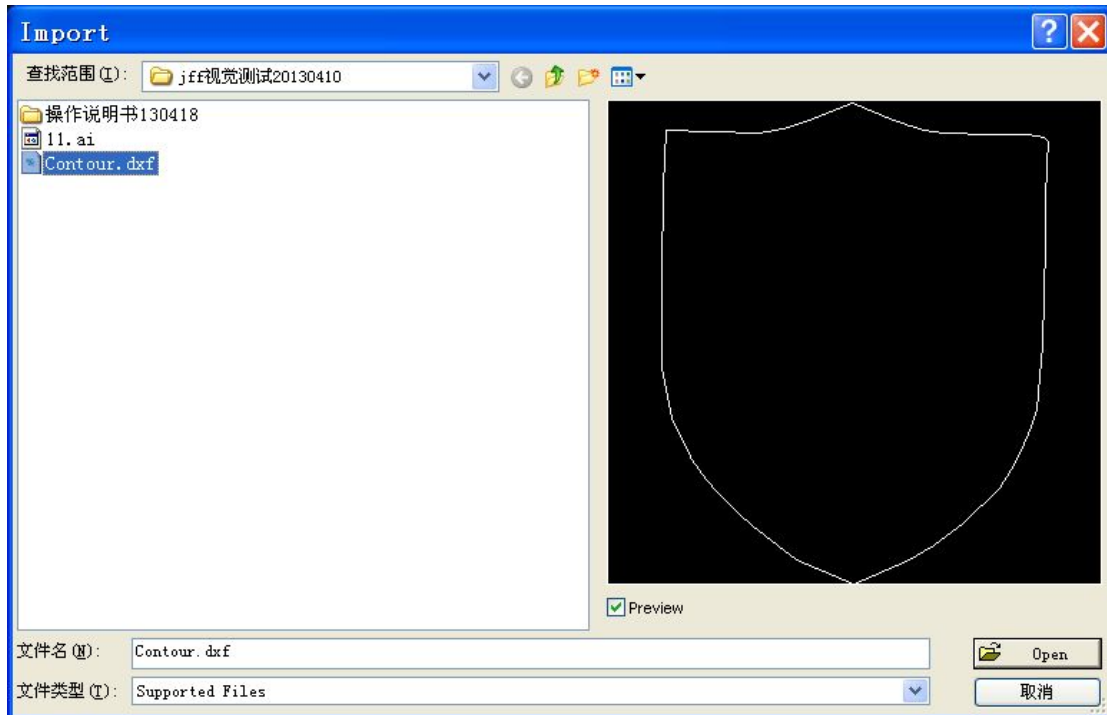

Import file to the model, the mouse to drag the contour curve placed at the right position. Fine-tuning can also be achieved by the top , bottom ,left and right keyboard keys.Details please refer to section 2 . 3

5.3.4 Copy Cut Contour

It can copy cut contour between different model.

First fo all, In “Cutting edit mode” of ‘Mode A’.Select the cut contour and press down Ctrl+C
Next,Switch to ‘Model B’,Press down Ctrl + V ,The copy operation is completed.

5.3.5 Multi-Models


In the same target image contains different graphics,this software provides multi-models matching-search function.

Its implementation steps:


First, create two models;


Secondly, when performing model matching, while checking the two models.

The following figure, there are two opposing triangular.

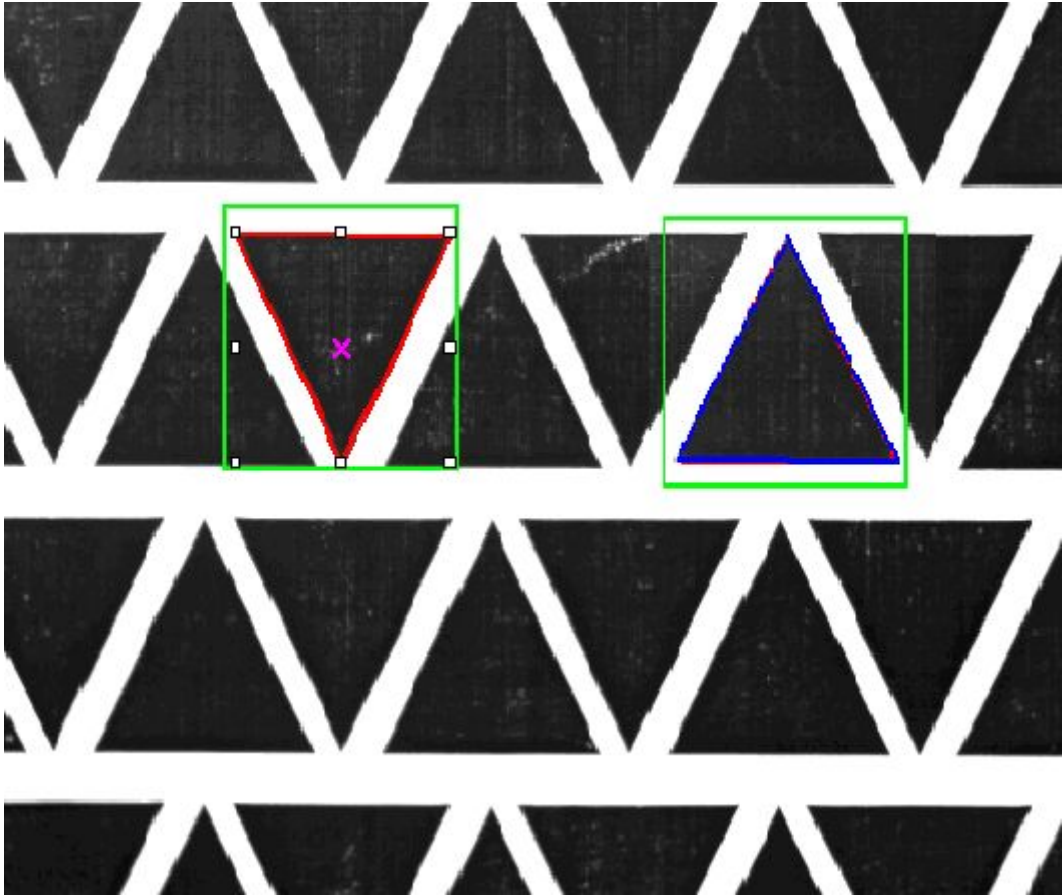

Create two models,as shown below:

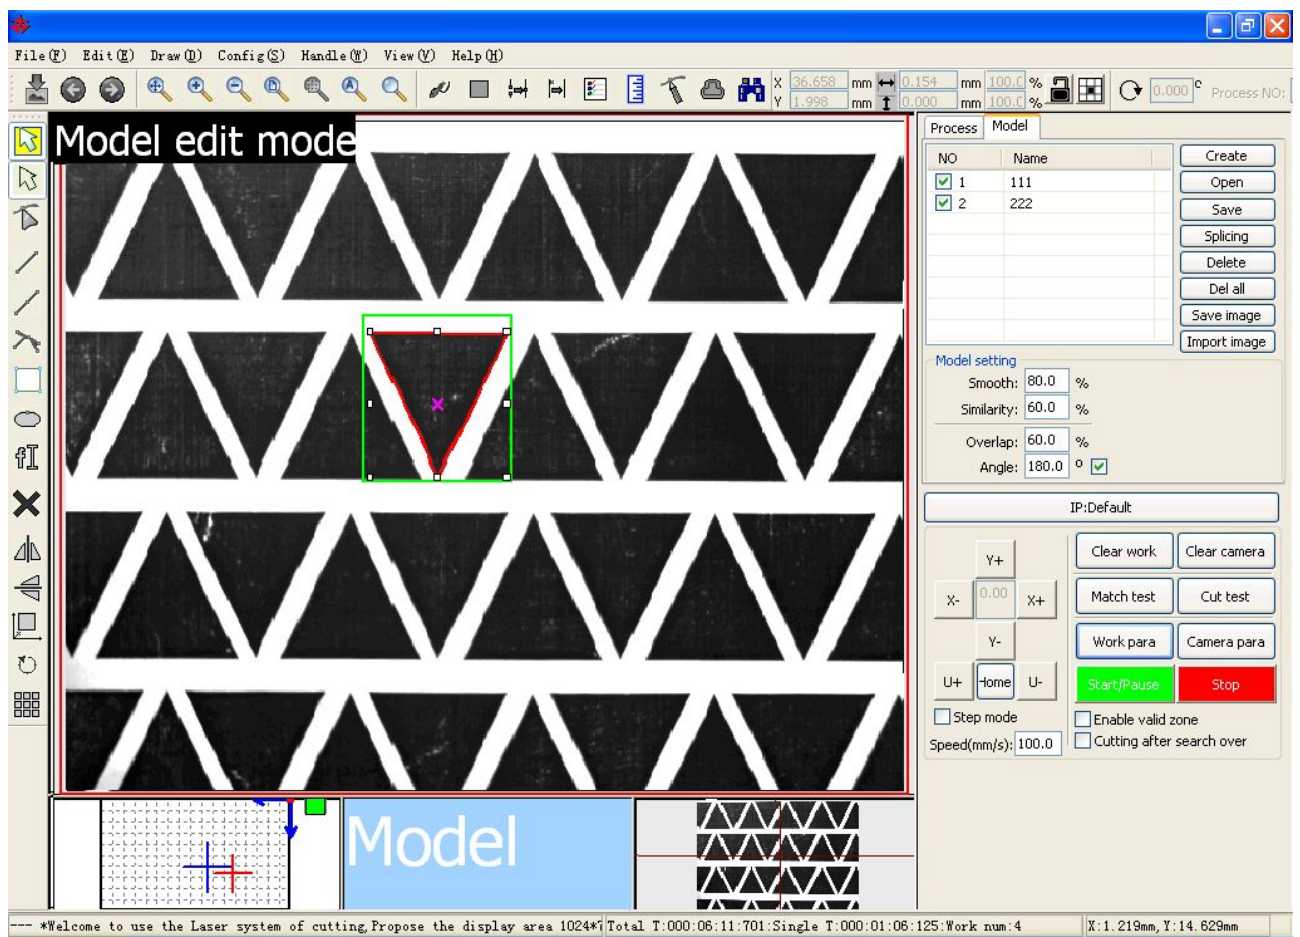

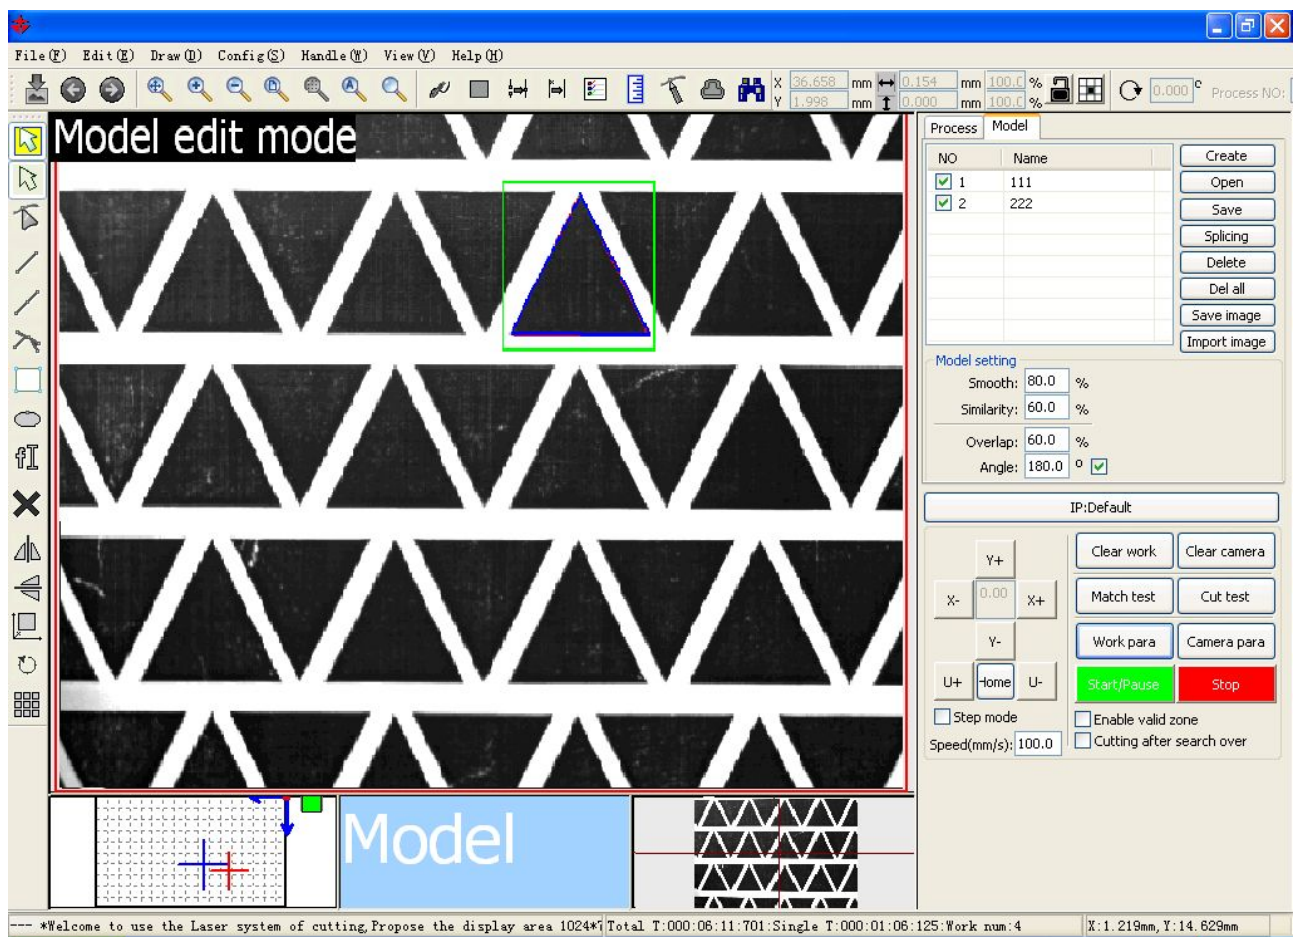


Then, Check the two models can be achieved multi-models matching. In the actual matching process, the inverted triangle with the inverted model to match and the upright triangle the upright model to match.


5.4 Contour And Layers

5.4.1 Contour Output Parameters

In the same batch of graphics processing, The different graphics need to set different processing parameters. Processing parameter corresponds to the color layers. Layer parameters is the contour of output parameters. Layer parameters can be modified according to user needs. As shown below:

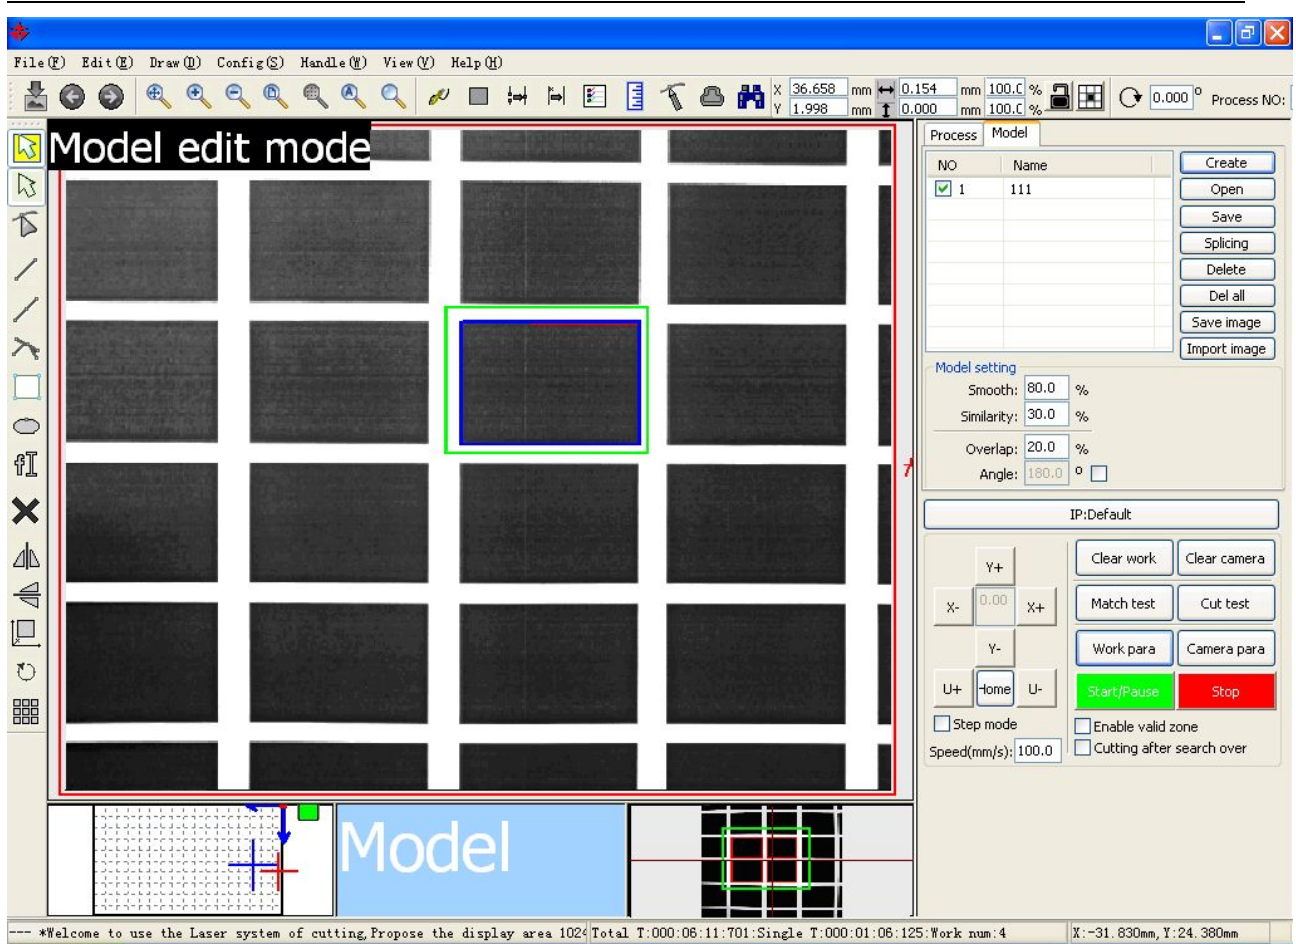

Modify layer parameters: Click **【Work para】** button, The left mouse button double-click the layer color list. Appears layer parameter dialog box.As shown below: （The blue layer, for example）

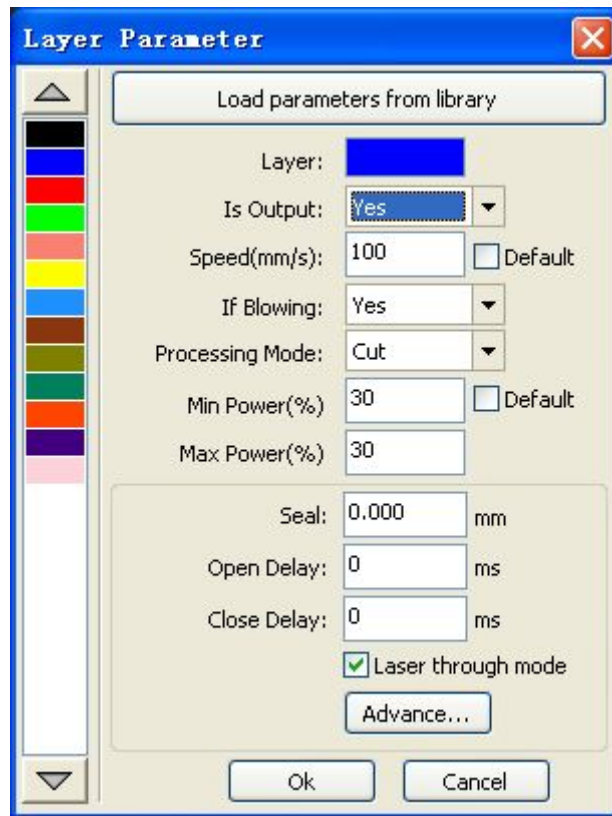


5.4.2 Set Contour Layer

Different layers with different colors. Different layers have different parameters. In the output of the processing, Different contours output in the same processing parameters, just all contours set to the same color (That the same layer) .

Different contours output in different processing parameters, just set contours to different color (That the different layer)


【 Set Contour Layer 】 : In “Cutting edit mode”,Select the contour.Click the layer button.As shownbelow:

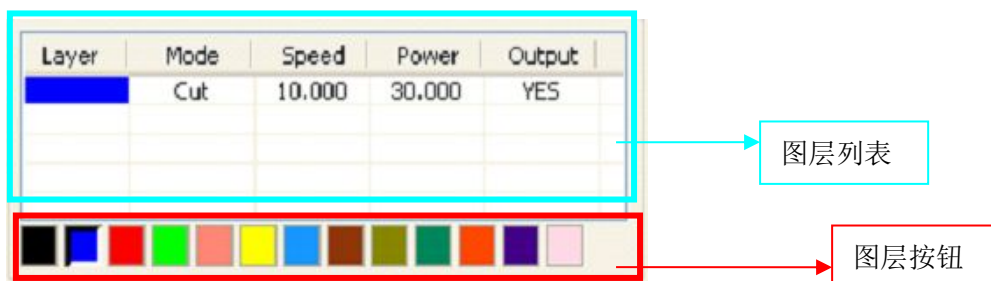

Note:For more details about layers,Please refer to section 6.1.1

5.5 Splice Model And Multi-Features

First,Click **【 Splicing 】** ,Appears follow dialog box:

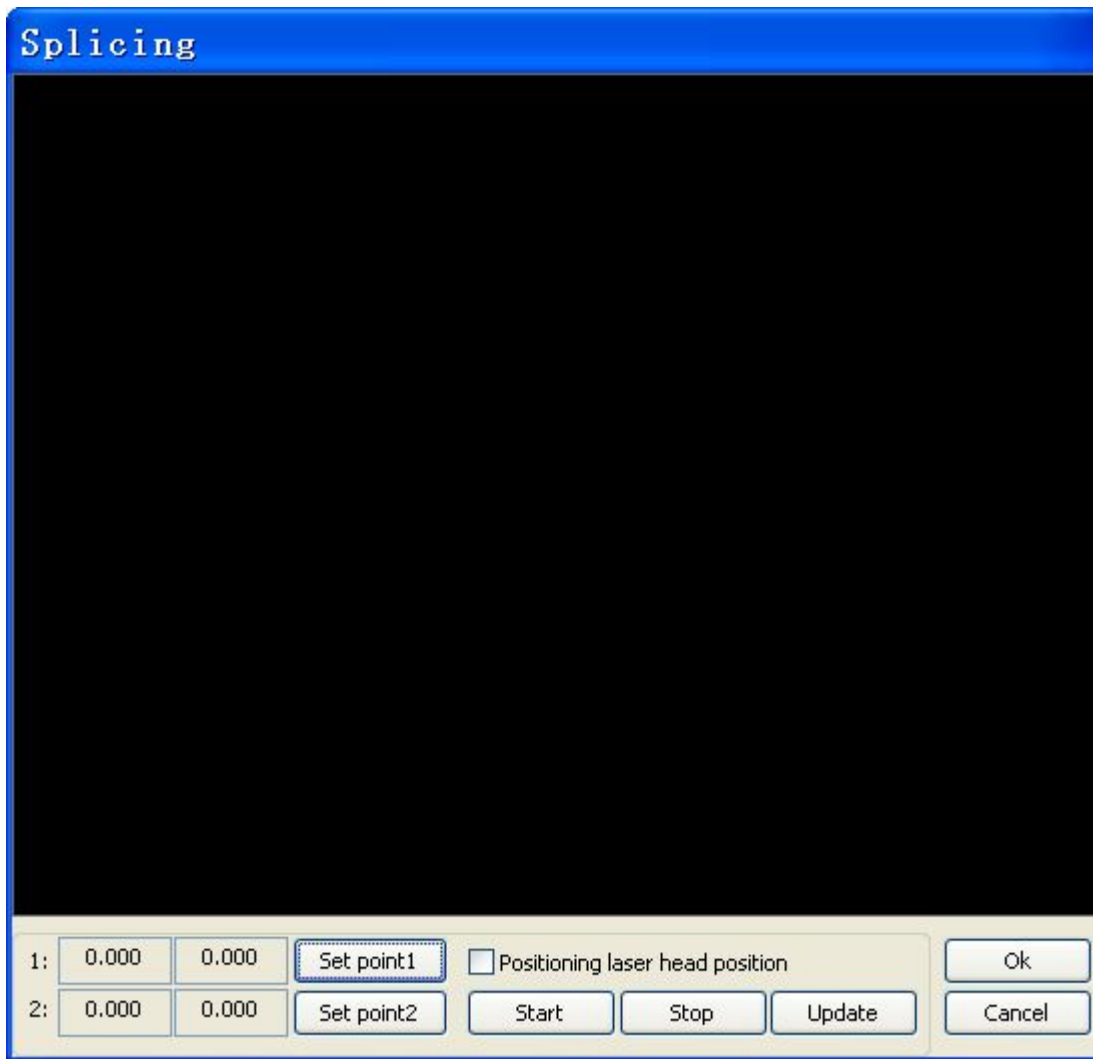


The Splicing operation requires two coordinates of graph diagonal.

Secondly, Move the center of camera filed view to upper left corner of graphic. Then Click **【Set point 1】** .As shown below:

Third, Move the center of camera filed view to lower-right corner. Then Click **【Set point 2】** .
As shown below:


Fourth: Click **【Start】** ,Splicing results as shown below:

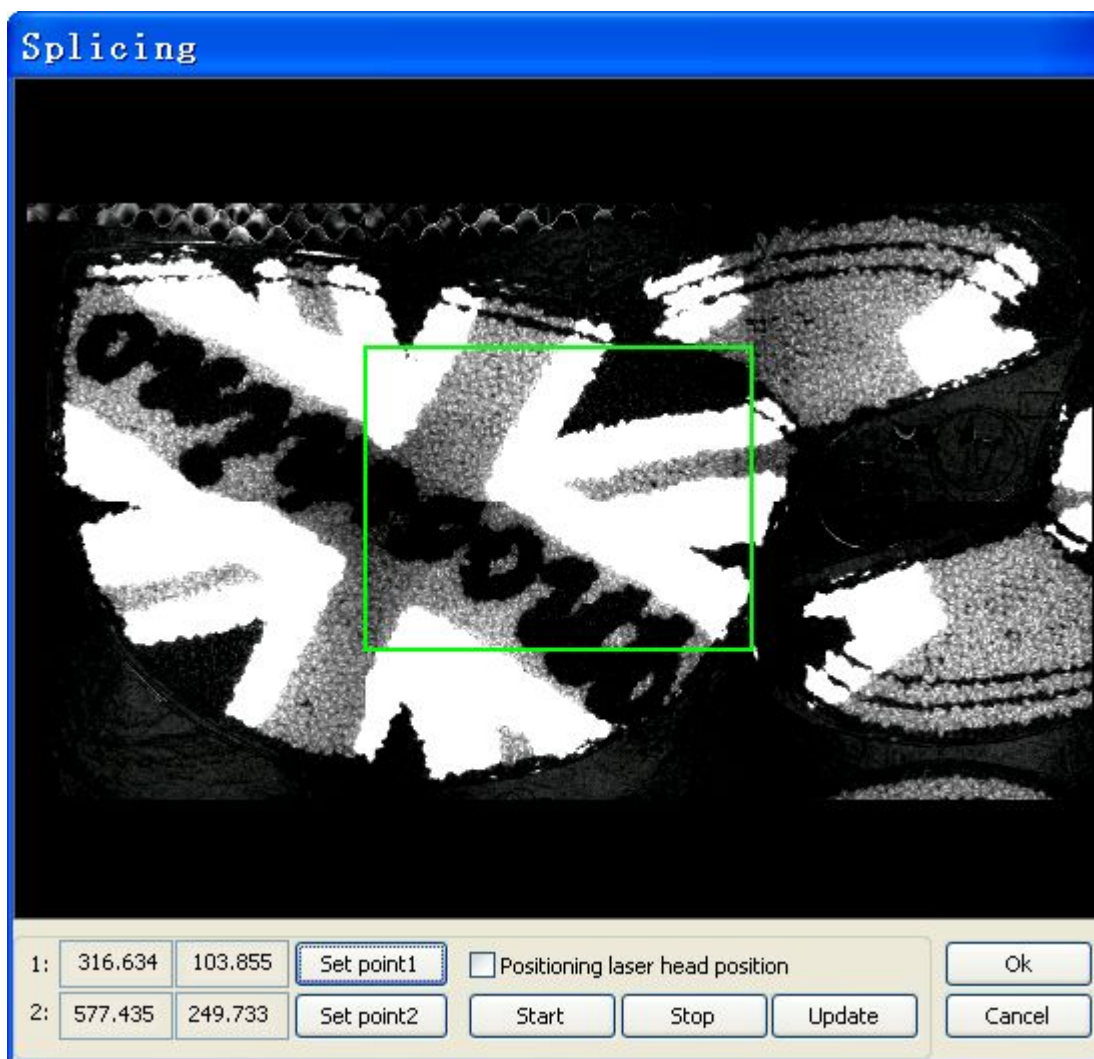

Fifth: If need to update the local area, Click the leftmouse button and drag to select area need to update. And click the"Update" button.

Completely splice , And click the"Ok" button.It will automaticlly create a model.

Splicing graphic as follows:

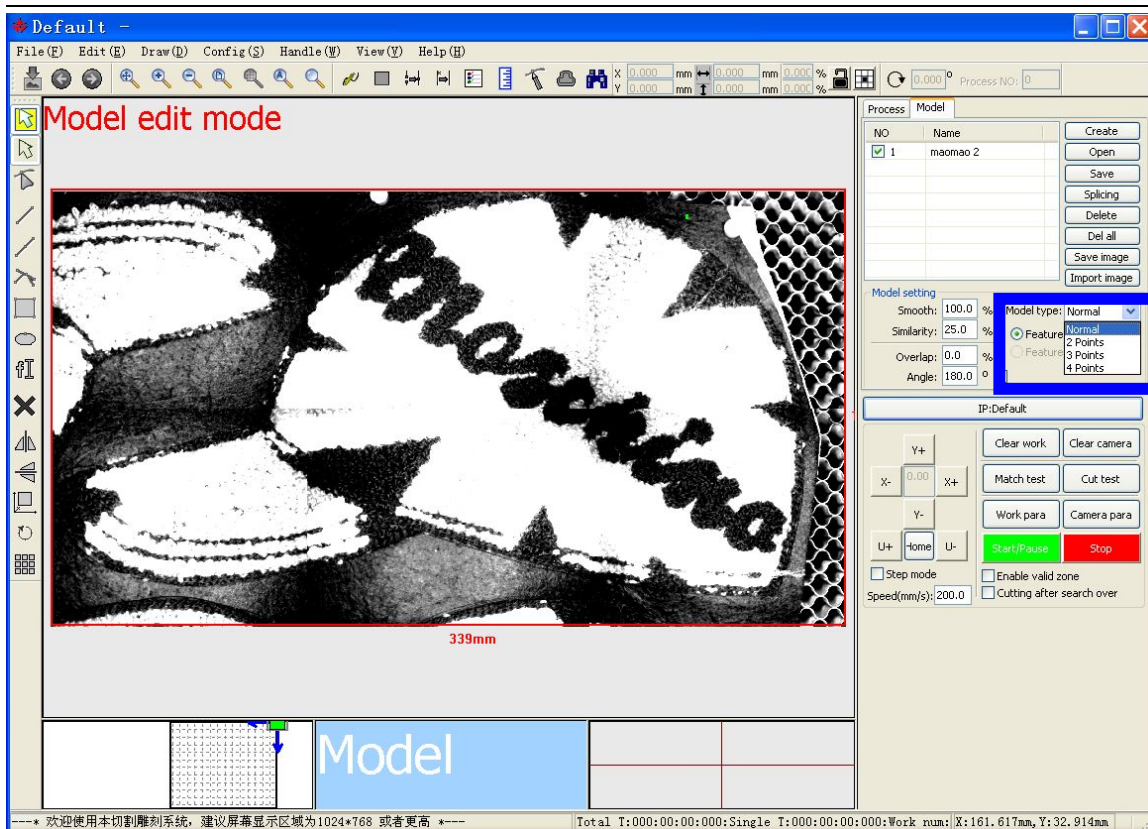

【Multi-Features】 For a larger model (Splice image) , You can choose many of its features to locate. In the 【Model type】 parameter sets the number of characteristics: Namal, 2 points, 3 points, 4 points.

Note:You can create Multi-Features mode by importing scanning graph,Details refer to ‘5.11 Import Image’

5.6 Save Model

User need to repeatedly use the model.The model should be saved as model file.Click 【Save】 and enter file name,model will be saved automaticlly.

5.7 Open Model

User need to open model file,Click 【Open】 and select the file that needs to open.Then click 【Open】 button on the open-dialog box.

5.8 Delete Model

Select the model that needs to delete, Click 【Delete】 button that the model will be deltete.

5.9 Delete All Model

This operation button will delete all model, Click **【Del all】** button that all model will be delete.

5.10 Save Model Image

Save the model image as a picture file, the picture file can be imported into other graphics software. Draw Cutting contour and save it as a data file. Our software provides import operation for cutting contour data.


5.11 Import Image

Splice larger image, also can use scanner to scan the larger image. Click the **【 Import Image 】** function button to import scanning graph and create Multi-Features model.

Chapter 6 Processing Management

6.1 Set Processing parameters


6.1.1 Layer Parameters And Layer Button

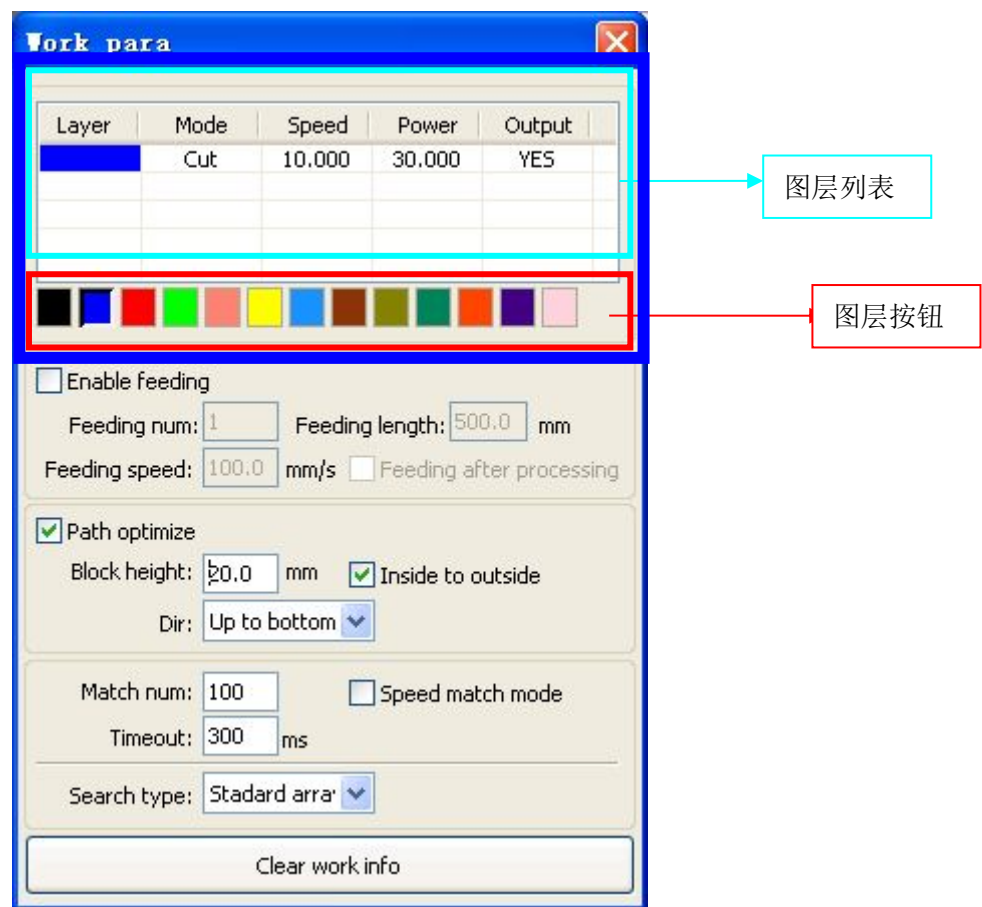


【Layer List】： Display layers paraneters.

【Layer Button】： Select the curve that need s to set layer color, And then click layer button.It can set layer color.

【Modify Layer Parameters】： When user needs to modify the layer parameters.The left mouse button Double-click the corresponding row in the layers list.It will appear layer parameter dialog box.

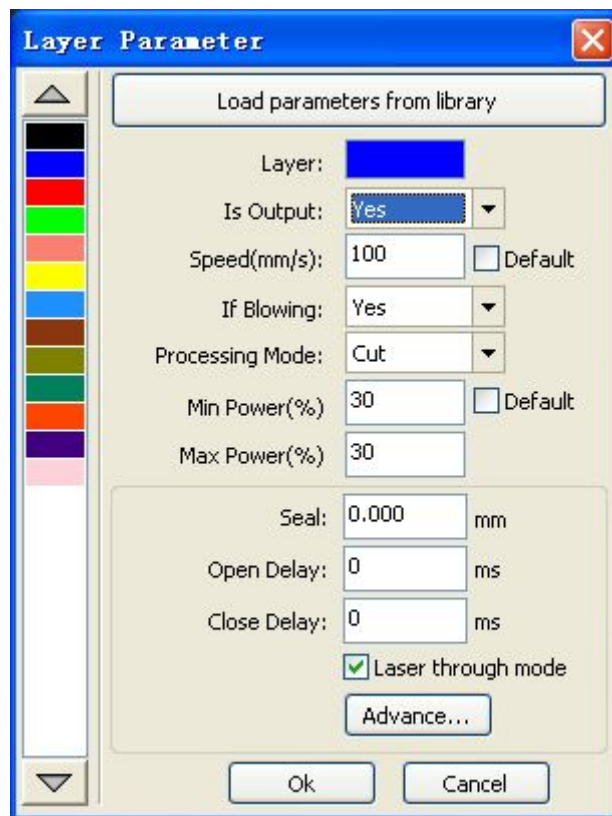

User can modify the parameters in the “Layer parameter” dialog box. You can load parameters from parameter library if parameters file have been saved, previously.
Click **【Load parameters from library】** , Appears follow dialog:

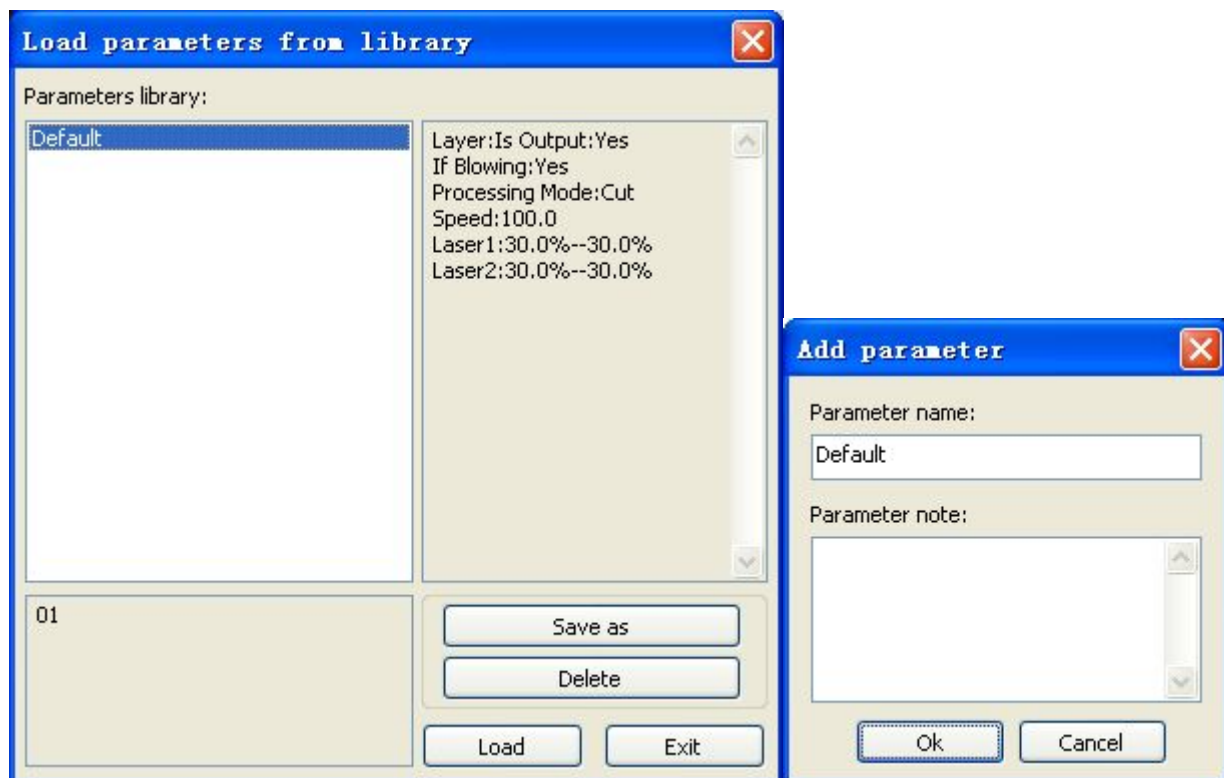

Select parameter file from the library , And then Click **【 Load 】** , Complete the parameters load.operation.

You can also save current parameter to file. Click **【Save as】** , And then enter the parameter name and parameter note.

If you want to delete a parameter file, You can select the file and Click **【Delete】** .

6.1.2 Feeding

The 'Work para' dialog box contains the following sections:

- Table:** A table with 5 columns: Layer, Mode, Speed, Power, and Output. The first row is highlighted in blue and contains the values: Cut, 10.000, 30.000, YES.
- Color Bar:** A horizontal bar with 12 colored squares: black, blue, red, green, yellow, cyan, magenta, brown, olive, dark green, orange, and pink.
- Feeding Section:** Contains a checkbox for 'Enable feeding'. Below it are input fields for 'Feeding num' (1), 'Feeding length' (500.0 mm), and 'Feeding speed' (100.0 mm/s). There is also a checkbox for 'Feeding after processing'.
- Path optimize Section:** Contains a checked checkbox for 'Path optimize'. Below it are input fields for 'Block height' (20.0 mm) and a dropdown for 'Dir' (Up to bottom). There is also a checked checkbox for 'Inside to outside'.
- Match num Section:** Contains input fields for 'Match num' (100) and 'Timeout' (300 ms). There is also a checkbox for 'Speed match mode'.
- Search type Section:** Contains a dropdown for 'Search type' (Stadard arra').
- Clear work info:** A button at the bottom of the dialog.

【Enable feeding】 : Automatic feeding

【Feeding num】 : Set the number of feeding.

【feeding length】 : Set the length of feed each time.

【feeding speed】 : Set the speed of feed.

【Feeding after processing】 : All processing are completed. Whether user needs to feed. If you need, check this option. If you needn't, do not check this option.

6.1.3 Path Optimize

Work para

Layer	Mode	Speed	Power	Output
	Cut	10.000	30.000	YES

Color bar: Black, Blue, Red, Green, Yellow, Cyan, Magenta, Brown, Olive, Teal, Orange, Purple, Pink

☐ Enable feeding
Feeding num: 1 Feeding length: 500.0 mm
Feeding speed: 100.0 mm/s ☐ Feeding after processing

☒ Path optimize
Block height: 20.0 mm ☒ Inside to outside
Dir: Up to bottom

Match num: 100 ☐ Speed match mode
Timeout: 300 ms
Search type: Standard array

Clear work info


【Path Optimise】： Just optimized only once matching results.

【Block height】: Optimize the processing data, the block can reduce the difficulty and optimization efficiency. The overall data is divided into a plurality of partial data blocks according to the block-height. In the optimization, the local data block as a unit for optimization.

【 Inside to outside 】： If there are inclusion relationship in the cutting path.User can set the processing path to “Inside to outside”.（check“Inside to outside”）。

【Dir】： In the path optimization processing,the direction of setting is the overall path direction.

6.1.4Speed Match Parameters Set

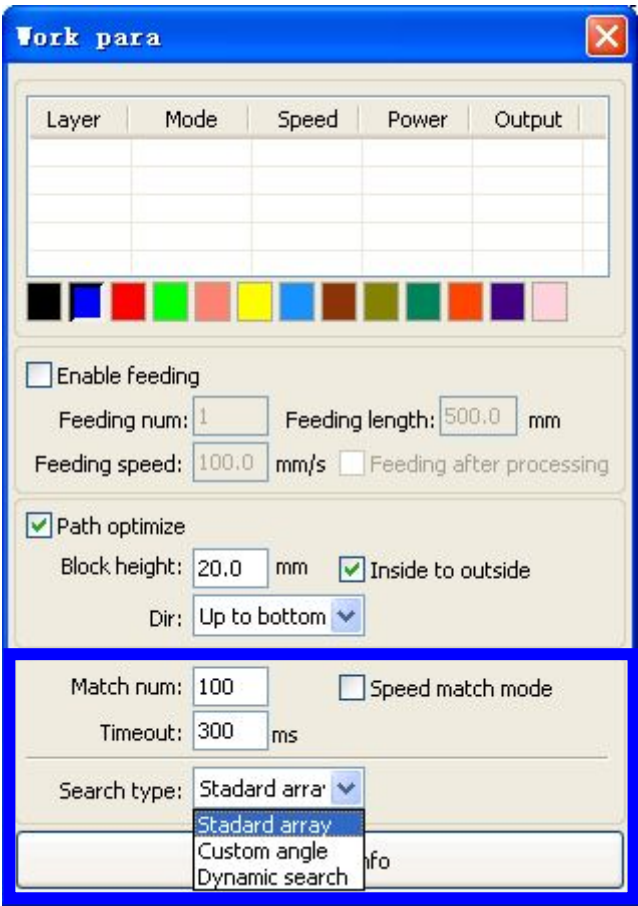

【Match num】 In the effective filed of camera view.The total number of existing matching-object.

【 Timeout 】 When you set the parameter of ‘Match num’,You need to set this parameter to control matching time.In process of matching,In order to avoid waiting for a long time or lack of time to cause the failure of target image matching.This parameter is mainly affected by the template characteristics of complexity and the target quantity.

【Speed match mode】 When select this option.system will take fast algorithm in process of target-matching.
Note:when select the option‘Speed match mode’,The Model parameters option ‘Angle’ must disable.

【 Serrch type 】 Define searching type.Options include‘Stadard array’,‘Custom angle’,Dynamic search.It combine


with

	Num	Offset	Dislocation	
X:	<input type="text" value="1"/>	<input type="text" value="10.000"/>	<input type="text" value="0.000"/>	<input type="button" value="Custom"/>
Y:	<input type="text" value="1"/>	<input type="text" value="10.000"/>	<input type="text" value="0.000"/>	<input type="button" value="Path Browse"/>

to work.

6.2 Processing Status Parameters

X: The laser head current position on the X-axis
Y: The laser head current position on the Y-axis

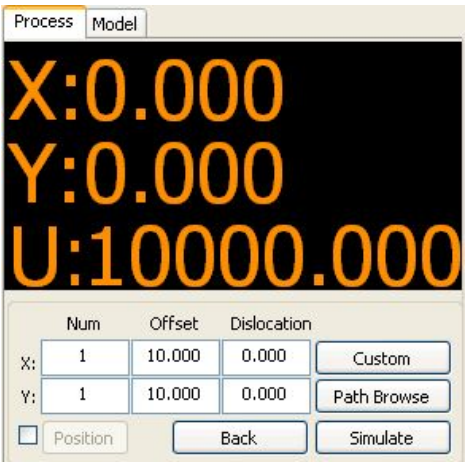

U: The laser head current position on the U-axis

Total T:000:00:00:000:Single T:000:00:00:000:Work num: X:78.759mm, Y:48.949mm

【Total T】: Total time of processing workpiece.

【Single T】: The time of processing one workpiece.

【Work num】: The total number of workpiece.

【Clear work info】: Click【Work Para】->【Clear work info】, Reset the time and work num zero.

6.3 Set Processing Format Parameters

【Num】 Specify the search target number to match.You can Specify the number of graphics on X-axis and Y-axis direction .

【Offset】 The distance of each move on axis direction. The offset in the X axis direction is the column spacing. The offset of the Y direction is the line spacing.

【Dislocation】 There are line dislocation or column dislocation in array-graphics,You can set the X-Dislocation and the Y-Dislocation respectively.

【Position】 Set current position-point as the machining-strating point.

【Back】 The laser head moves back to the machining-starting point。


【Path Browse】 Browsing matching-search path and view the camera zones.

【Simulate】 Details pelase refer to section 6.5.1

【Custom】 User defines search path,It can be nested custom search path.


When set ‘Array first’,array path for systemic circulation, and the custom path for the minor cycle.

When set ‘Custom first’ ,custom path for systemic circulation, and the array path for the minor cycle.

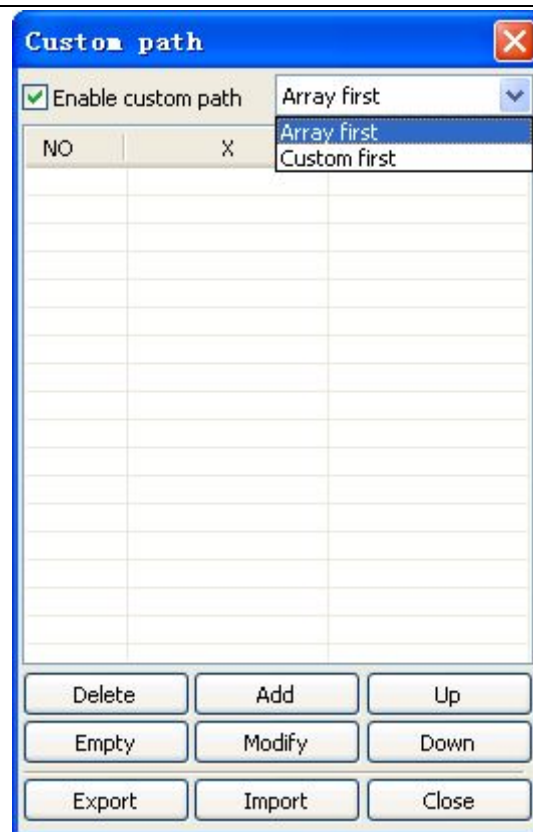


6.4 Devices Connect

Click 【Device port】 button,as follow:

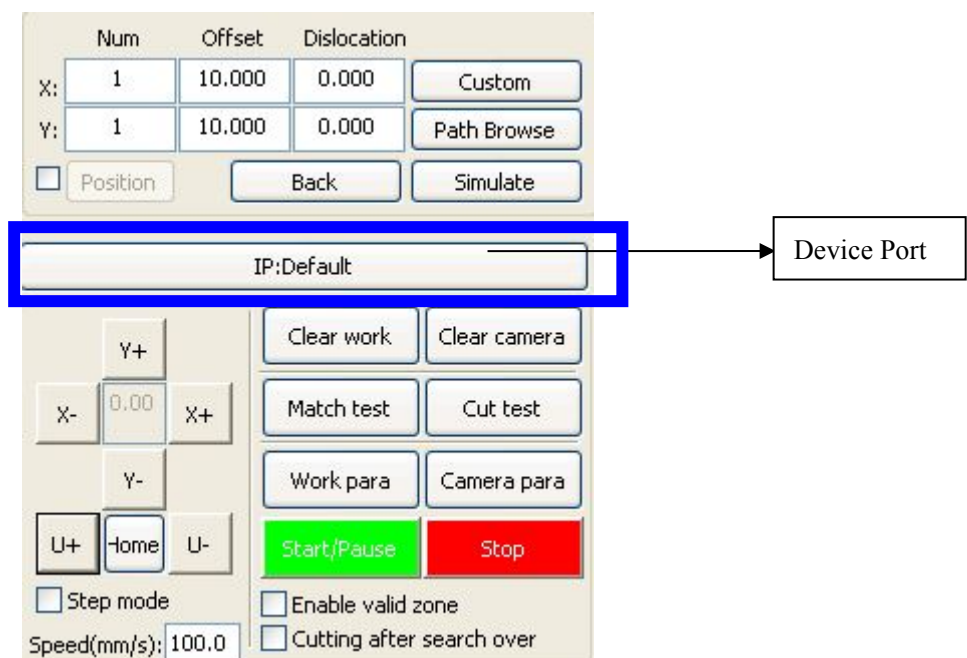

Appears follow dialog box:

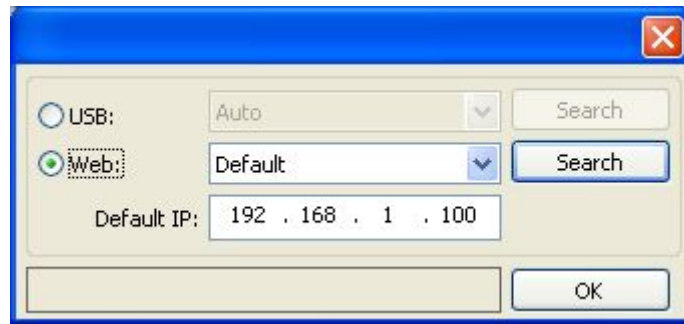

There are two device connect ways:USB and Web. Click **【 Device port 】** button,Then set the connection ways and select connection port.

【 USB 】 : If the computer is only connected to a laser device, you can set this option to automatically. The software will automatically determine the connection interface to the device. When the computer is connected to more than one laser equipment, you need to first click on the **【 Device Port 】** button. In the dialog box, click [Search] button. The search is completed, the drop-down list will be displayed the connected currently device interface. User selects the desired device interface, can output to the specified device.

【 Web 】 : If the computer is only connected to a laser device ,You can directly input IP address in the default device IP. When the computer is connected to more than one laser equipment,Similar to the **【 USB 】** . Find the device has been connected, and select corresponding IP address of the device from the drop-down list.

6.5 Control single-axis motion、 Back to zero

6.5.1 Manually control single-axis motion

Single-axis motion control, you can only control one axis motion, you can set distance, speed of movement.

	Num	Offset	Dislocation	
X:	1	10.000	0.000	Custom
Y:	1	10.000	0.000	Path Browse
<input type="checkbox"/> Position	Back		Simulate	

IP:Default

<div style="border: 2px solid blue; padding: 5px; text-align: center;"> Y+ X- 0.00 X+ Y- U+ Home U- <input type="checkbox"/> Step mode Speed(mm/s): 100.0 </div>			Clear work	Clear camera
			Match test	Cut test
			Work para	Camera para
			Start/Pause	Stop
			<input type="checkbox"/> Enable valid zone	<input type="checkbox"/> Cutting after search over

X-	0.0	X+

【Stepping distance】：As shown：

Fill out the step value in the edit box.

Single-axis movements, in accordance with the stepping distance move as a unit.

【Speed】：Set a single-axis movement speed, user-defined movement speed value.

6.5.2 Manually control back to zero

Click 【Home】，The XY axis will return to the origin of the coordinate system.

	Num	Offset	Dislocation	
X:	1	10.000	0.000	Custom
Y:	1	10.000	0.000	Path Browse
<input type="checkbox"/> Position	Back		Simulate	

IP:Default

Y+		Clear work	Clear camera
X-	0.00	Match test	Cut test
X+		Work para	Camera para
Y-		Start/Pause	Stop
U+	Home	U-	
<input type="checkbox"/> Step mode	<input type="checkbox"/> Enable valid zone		
Speed(mm/s): 100.0	<input type="checkbox"/> Cutting after search over		

6.6 Processing and Simulate processing

6.6.1 Simulate processing

Processing data is ready, the user can simulate processing to preview machining results. Click **【Simulate】** button, Starting the simulate processing.

Need to pause ,Click **【Start / Pause】** button, Need to stop,Click **【Stop】** button.


	Num	Offset	Dislocation	
X:	1	10.000	0.000	Custom
Y:	1	10.000	0.000	Path Browse
<input type="checkbox"/> Position	Back		Simulate	

IP:Default

Y+		Clear work	Clear camera
X-	0.00	Match test	Cut test
X+		Work para	Camera para
Y-		Start/Pause	Stop
U+	Home	U-	
<input type="checkbox"/> Step mode	<input type="checkbox"/> Enable valid zone		
Speed(mm/s): 100.0	<input type="checkbox"/> Cutting after search over		


6.6.2 Cut Test

Cut matching graphics at the current position.
Click **【Cut test】** button.

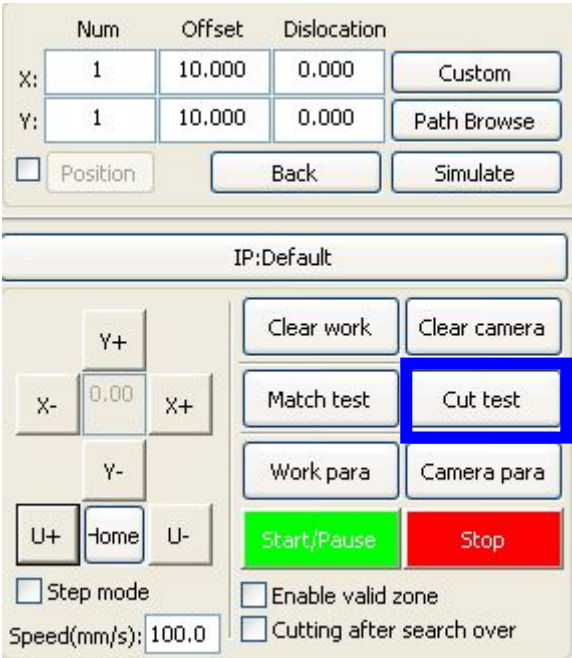

6.6.3 Processing

Determine processing parameters correct.Click **【Start/Pause】** button to process workpiece.Need to pause,Click **【Start/Pause】** button,Need to stop,Click **【stop】** button.

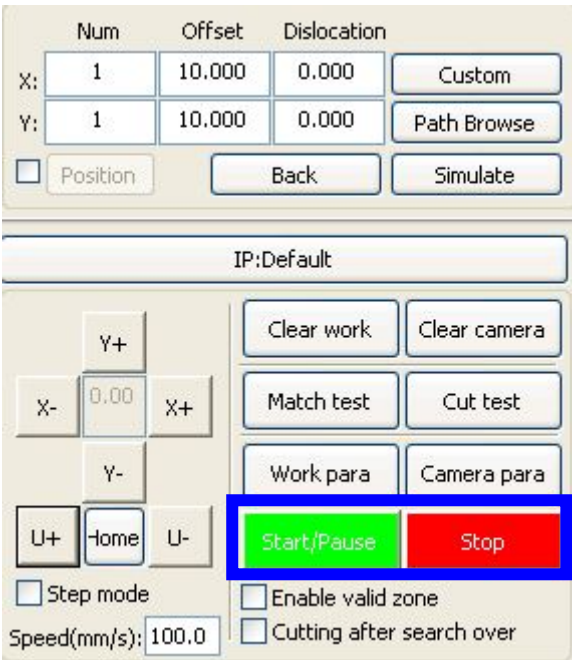

Note: **【Match test】** Details information please refer to 5.4.2

Thank you for using Shenzhen RuiDa Technology Co., Ltd. Products!All parts of the present note, economic rights own by the Shenzhen RuiDa Technology Co., Ltd.. Without the permission of our Company. Any unit or individual can not shall, copy or distribute the content in the productmanual.If the content of this product information is changed.Please forgive without notice.

If users have any comments and suggestions while using this product and introductions, Please call the Advisory.

Tel: 0086-075526066687

Fax:: 0086-075526066687

Addr:No.501,5/F,Building2,Nanyou
District,Shenzhen,Guangdong Prov.

Tian'an

Industry

Park,Nanshan

WEB: www.rd-ac.com