## BRICK\_4 Ford Generation 2 Upgrade Kit for vehicles with Sync and Sirius Satellite Radio

#### For 2009-2010 F150 with 3 or 6 button configuration

#### **Requires:**

1. Pre-programmed AL8T-18K931 navigation radio Note – this upgrade kit uses the brick navigation (center stack navigation only available from factory).

#### Kit includes:

- 1. Right-hand steering wheel control (8A8Z-9C888-AA)
- 2. GPS antenna (8G1Z-10E893-B)
- 3. F150 radio bracket (XANAVIF150Bracket)
- 4. Amplifier harness (4S7T-14489-YRA-3)
- 5. Amplifier (9L1T-18T806-A)
- 6. Procedure 1 harness (XP1HARNESS\_ESC)
- 7. Procedure 2 harness (XP2HARNESS)
- 8. 2 harness pins

#### **Sold separately:**

- 1. Bezel
  - a. 3 Button Configuration
    - i. Black (95-5820)
  - b. 6 Button Configuration
    - i. Black (95-5822B)
    - ii. Platinum (99-5822AS)
    - iii. King Ranch (99-5822CM)
    - iv. Lariat (99-5822MM)

#### Dealer will need to perform the following modifications:

#### For detailed installation instructions see attached Procedures

- 1. Swap the bracket on the navigation radio with the XanaviF150Bracket (unless done at United Radio, Inc.).
- 2. Securely mount GPS antenna underneath the center of the dashboard (as far forward as possible) toward the windshield with the metal side down/plastic side up. Locate a spot away from other modules and make sure there is no metal above the GPS antenna.
- 3. Replace right-hand steering wheel with factory steering wheel control for vehicles with Sync and Navigation from factory (8A8Z-9C888-AA) (see Procedure 1).
- 4. Only perform the procedure below if Sync cannot hear your voice (see Procedure 2):
  - a. Plug provided XP2HARNESS into radio and vehicle harness.
  - b. Run and pin red & blue wire into sync module (blue to 13 & red to 12).
- 5. If vehicle has Sony Sound and you <u>cannot</u> hear the navigation voice prompts see Procedure 3.

#### **Notes:**

- 1. If customer has backup camera running to rear-view mirror, installing the navigation radio will NOT automatically re-route the video to the navigation radio. A physical re-wire modification will need to take place, but United Radio cannot advise on the procedure. If the dealership chooses to do this modification or add a backup camera, they MUST advise United Radio to program the radio to accept Backup Camera Video (Camera On). If needed, a rear camera radio input plug is available from United Radio to assist in the wiring modifications or addition of a backup camera (FRD09-BC1).
- 2. United radio will give credit for these items from the dealer:
  - a. Radio in vehicle:
    - i. \$25 for AM/FM radio
    - ii. \$50 for non-sat-ready CD ACM
    - iii. \$75 for a sat-ready CD ACM
    - iv. \$100 for a non-sat-ready CD6 ACM
    - v. \$125 for a sat-ready CD6 ACM

# Procedure #1 SWC Wiring Instructions


- 1.) Plug XP1HARNESS\_ESC into clockspring and connector C218(A) (at steering column).
- 2.) Follow one of the steps below:

TO CLOCKSPRING 16 PIN PLUG

a) If vehicle does <u>not</u> have Sony or THX sound, avoiding any interference with moving parts, run the 2 pin Molex from the XP1HARNESS\_ESC to the 2 pin Molex on the 4S7T-14489-YRA-3 (amplifier harness).

OR


b) If vehicle has Sony or THX sound, avoiding any interference with moving parts, run the 2 pin Molex from the XP1HARNESS\_ESC to the radio and then cut the 2 pin Molex off and connect the yellow wire to pin 16 and the red wire to pin 17 on the 24 pin radio connector C240A.

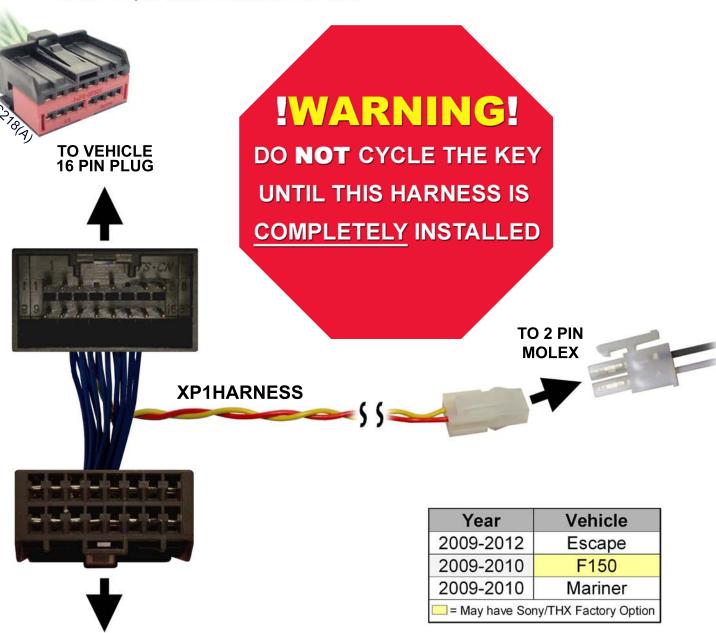

## Procedure #2 Microphone Wiring Instructions

### Only perform this procedure if Sync cannot hear your voice

- 1.) Plug XP2HARNESS into radio and vehicle harness
- 2.) Run and pin red & blue wire into sync module (blue to 13 & red to 12)

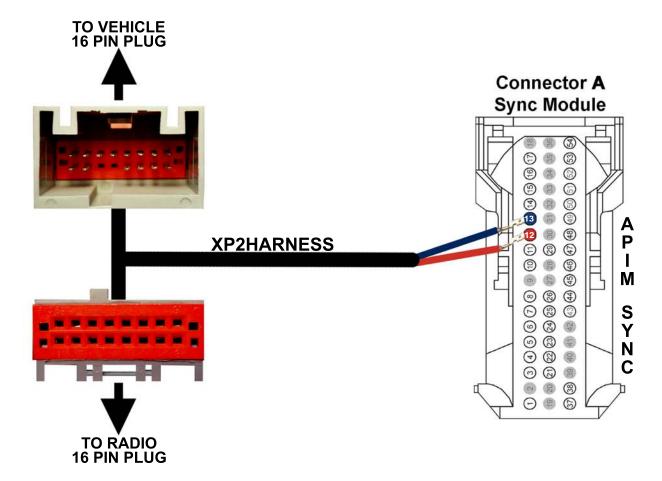


Year	Vehicle	Connector A Location	Connector A Sync Module
2009-11	Econoline	In dash below radio	C2383
2009-10	Edge	Rear of center console	C3342
2009-11	Escape	Center console	C3338
2009-11	Expedition	Bottom of center console	C3342
2009-10	Explorer	Center console	C3342
2009-11	F150	Top center of dash	C2383
2009-11	F250	Above passenger kick	C2298
2009-11	Flex	Middle of center console	C3342
2009-11	Fusion	Rear of center console	C3338
2009-11	Mariner	Center console	C3338
2009-11	Milan	Rear of center console	C3338
2009-11	MKS	Rear of center console	C3342
2009-11	MKT	Center console	C3342
2009-10	MKX	Rear of center console	C3342
2009-11	MKZ	Rear of center console	C3338
2009-10	Mountaineer	Center console	C3342
2009-10	Mustang	Behind radio	C2383
2009-11	Navigator	Bottom of center console	C3342
2008-10	Sable	Rear of center console	C3342
2009-10	Sport Trac	Center console	C3342
2008-11	Taurus/TaurusX	Rear of center console	C3342

## **Procedure #3**

## **Navigation Voice Prompt Wiring Instructions for 2009-11 F150**

Only perform this procedure if vehicle has Sony Sound and you cannot hear navigation voice prompts

- \*Connect pin 2 from connector C290A to pin 4 on connector C3154A
- \*Connect pin 14 from C290A to pin 14 on connector C3154A

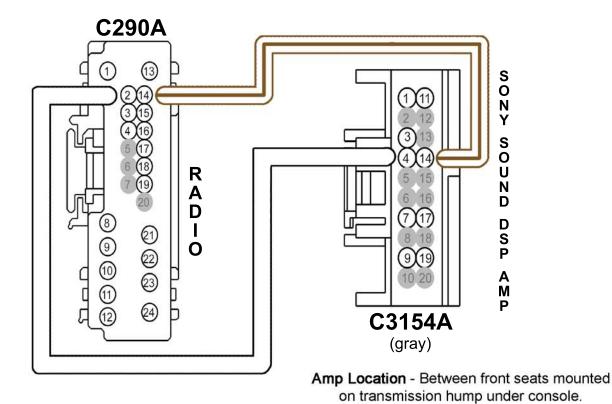

**Notes:** If the DSP already has wires in 4 & 14, cut and extend those wires from the amp to the radio. Insulate both remaining wire ends.

If the vehicle has Sony Sound you do NOT use a separate amplifier