

Artisan Technology Group is your source for quality new and certified-used/pre-owned equipment

 FAST SHIPPING AND DELIVERY TENS OF THOUSANDS OF **IN-STOCK ITEMS** EQUIPMENT DEMOS HUNDREDS OF SUPPORTED LEASING/MONTHLY

SECURE ASSET SOLUTIONS

at our full-service, in-house repair center Instra View REMOTE INSPECTION

Experienced engineers and technicians on staff

SERVICE CENTER REPAIRS

Remotely inspect equipment before purchasing with our interactive website at www.instraview.com ↗

Contact us: (888) 88-SOURCE | sales@artisantg.com | www.artisantg.com

WE BUY USED EQUIPMENT Sell your excess, underutilized, and idle used equipment We also offer credit for buy-backs and trade-ins

www.artisantg.com/WeBuyEquipment >

LOOKING FOR MORE INFORMATION?

Visit us on the web at **www.artisantg.com** [→] for more

information on price quotations, drivers, technical

specifications, manuals, and documentation

OPERATION & SERVICE MANUAL

for

Torque-Switch Series®

Model SMA8115 Model SMA8215 Model SMA8315

Brushless Amplifier System



MANUAL#: 8015-1040

REVISION: (E) DATE: 7-1-96.

TABLE OF CONTENTS	Page
Introduction	7
Chapter One: Description, Features and Specifications	
1.1 Description	8-9
1.2 Features	9-11
1.2.1 Single Amplifier Module (SMA8X15-1)	9-10 11 11
1.3 Specifications	12-13
1.3.1 Single Amplifier Module (SMA8X15-1) 1.3.1.1 Input and Output Power 1.3.1.2 Signal Inputs 1.3.1.3 Digital Inputs 1.3.1.4 System 1.3.1.5 Outputs 1.3.2 Stand Alone One Axis Amplifier (SMA8X15-1A-1) 1.3.3 Multi-Axis Power Supply 1.3.3.1 Input and Output Power 1.3.4 Mechanical	12 12 12 13 13 13
Chapter Two: Theory of Operation	
2.1 Introduction	14
2.2 Driving DC Servo Motors	14
2.3 Servo Loops	15
2.4 Brushed Motors vs Brushless Motors	16-17
2.5 Sinusoidal vs Trapezoidal	17
2.6 The Advantages and Disadvantages of a Trapezoidal Amplifier Syste	em 18
2.7 Current Mode vs Velocity Mode	18
2.8 Tachometer (Velocity Mode) Feedback Options	19
2.9 Commutation Using Resolver	19
2.10 Current Mode in Sine/Resolver or Trapezoidal Amplifier vs Two/Thr Phase Input Current Mode Amplifier	ee 19
2.11 Protection Circuits	19

	Page
Chapter Three: Model Numbering	
3.1 Introduction	20
3.2 Single Amplifier Modules	20-22
3.2.1 Trapezoidal Mode	21
3.3 Stand Alone Amplifier	23-24
3.3.1 Trapezoidal Mode	23
3.4 Multi Axis Amplifier System	25
Chapter Four: Installation	
4.1 Introduction	26
4.2 Mounting	26
4.3 Wiring	26-28
4.3.1 RFI/EMI and Wiring Technique	27 27-28 27 28
4.4 Single Amplifier Module Connections (SMA8X15-1)	29-30
4.4.1 Buss and Motor Connections - J2	29 30 31
4.5 Stand Alone Amplifier Connections (SMA8X15-1A-1)	32
4.5.1 Motor Connections - J2	
4.6 Multi Axis Power Supply Connections	32

	Page
Chapter Five: Configuration	
5.1 Introduction	.33
5.2 Logic Input Configuration	. 33
5.3 Trapezoidal Mode Amplifier Configuration	. 33-35
5.3.1 +15V/+5V Logic Level Configuration 5.3.2 Standard Configuration 5.3.3 Integrator Configuration 5.3.4 Hall-Sensor Configuration 5.3.5 Motor Reverse Configuration 5.3.6 Simulated Tach - Disable Configuration 5.3.7 Simulated Tach - Reverse Configuration 5.3.8 Simulated Tach - Speed Configuration 5.4 Sine/Resolver Mode Amplifier Configuration 5.4.1 +15V/+5V Logic Level Configuration 5.4.2 Standard Configuration 5.4.3 Encoder Output Resolution Configuration 5.4.4 Motor Pole Configuration	.34 .34 .34 .34 .35 .35 .35 .35 .35 .35 .35
5.5 Two/Three Phase Input Current Mode Amplifier Configuration	
5.5.1 +15V/+5V Logic Level Configuration 5.5.2 Standard Configuration	
Chapter Six: Start Up and Calibration	
6.1 Introduction	.38
6.2 Initial Start Up	.38
6.3 Trapezoidal Mode Amplifier Calibration	. 38-40
6.3.1 Velocity and Simulated Velocity Mode Calibration Procedure	. 39-40 . 40
6.4 Sine/Resolver Mode Amplifier Calibration	. 41-43
6.4.1 Velocity Mode Calibration Procedure	. 41-42 . 42-43
6.5 Two/Three Phase Input Current Mode Amplifier Calibration	. 43-44
6.5.1 Two Phase Input Current Mode Calibration Procedure 6.5.2 Three Phase Input Current Mode Calibration Procedure	. 43 . 44

	Page
6.6 Calibration Setup Record	45
6.7 Resolver Alignment Procedure	46-47
Chapter Seven: Maintenance, Repair and Warranty	
7.1 Maintenance	48
7.2 Amplifier Faults	48-50
7.2.1 Table of Fault LED Conditions 7.2.2 Under Voltage Fault 7.2.3 Motor Over Temp Fault 7.2.4 High Speed Electronic Circuit Breaker (HS/ECB) Fault 7.2.5 Low Speed Electronic Circuit Breaker (LS/ECB) Fault 7.2.6 Over Temp Fault 7.2.7 Over Voltage Fault 7.2.8 Resetting A Fault	49 49 49 49 50 50
7.3 Amplifier Failure	50
7.4 Factory Repair	51
7.5 Warranty	51
Appendix A: Amplifier Drawings	
SMA8015 Brushless Power Board Installation Schematic (8015-1030)	53
SMA8015 Brushless Power Board Assembly Drawing (8015-1031)	54-55
SMA8115-1 Trapezoidal Single Amplifier Module Installation(8015-1032)	56
SMA8215-1 Sine/Resolver Single Amplifier Module Installation(8015-1033)	57
SMA8315-1 Two/Three Phase Single Amplifier Module Installation(8015-103	34) . 58
SMA8115-1A-1 Trapezoidal Stand Alone Amplifier Installation(8015-1035)	59
SMA8215-1A-1 Sine/Resolver Stand Alone Amplifier Installation(8015-1036)	60
SMA8315-1A-1 Two/Three Phase Stand Alone Amplifier Installation(8015-10	37)61
SMA8X15-2A-2 2-axis Installation Drawing (8000-1833)	62
SMA8X15-4A-4 4-axis Installation Drawing (8000-1835)	63
SMA8X15-6A-6 6-axis Installation Drawing (8000-1837)	64

TABLE OF CONTENTS

	Page
GP8600-2030 30A Power Supply Assembly Drawing (8600-2030)	65
GP8600-2031 60A Power Supply Assembly Drawing (8600-2031)	66
Appendix B: Personality Module (Pre-amp)	
SMA8115 Trapezoidal Mode Installation Schematic (8000-1130)	68
SMA8115 Trapezoidal Mode Assembly Drawing (8000-1131)	69
SMA8215 Sine/Resolver Mode Installation Schematic (8000-1430)	70-71
SMA8215 Sine/Resolver Mode Assembly Drawing (8000-1431)	72
SMA8315 2Ø/3Ø Current Mode Installation Schematic (8000-1330)	73
SMA8315 2Ø/3Ø Current Mode Assembly Drawing (8000-1331)	74

Introduction

Glentek's brushless DC motors and amplifiers offer the ultimate in low maintenance and high performance motion-control. Glentek offers a full line of matched motors and amplifiers to meet virtually every motion-control application.

This manual provides all the technical information necessary to install, configure, operate, and maintain our TORQUE-SWITCH™ series, brushless servo-motor amplifiers, models SMA8115, SMA8215, SMA8315, the high power versions: SMA8115HP, SMA8215HP, SMA8315HP. These amplifiers combine the economy of trapezoidal drive current or the high performance of sinusoidal motor current with the efficiency of pulse-width modulation (PWM).

We suggest that you take the time to read this manual from cover-to-cover before attempting to work with these amplifiers for the first time. If at any time you have questions not addressed in this manual, or have any special requirements, please feel free to call and discuss them with a Glentek applications engineer. We are happy to provide both off-the-shelf and custom products. With over three decades in the servo-motor/amplifier business, we have a vast pool of applications knowledge waiting to assist you.

Thank you for selecting Glentek for your motion-control needs. It is our goal to save you time and money, and to provide you with a superior product.

Chapter One: Description, Features and Specifications

1.1 Description:

This brushless amplifier system has been designed to offer you, our customer, a large degree of flexibility and customization with a standard, in stock product. Each amplifier module consists of a standard power output board with one of our three types of personality modules mounted on it. (To help you understand the various brushless amplifier and motor system combinations and their respective advantages and disadvantages, please refer to chapter two of this manual which describes the theory of operation). Following is a brief description of these three personality modules and their mode(s) of operation:

- Trapezoidal Mode (SMA8115/SMA8115HP) In this mode of operation, which is also
 commonly referred to as six step, the brushless motor is commutated by hall sensors or
 an encoder which contains these commutation signals. This personality module can be
 configured for the following three different types of operation:
 - VELOCITY MODE In this mode of operation, a velocity signal from a brushless or brush type tachometer is used to close a velocity loop in the amplifier. Please see section 2.3, 2.7, 2.8 of this manual for more detailed information.
 - SIMULATED VELOCITY MODE In this mode of operation, a circuit on the
 personality module looks at the hall sensors and generates a simulated velocity
 signal which is used to close a velocity loop in the amplifier. This mode of operation
 offers an extremely cost effective velocity mode system for medium to high velocity
 applications. Please see section 2.6 of this manual for more detailed information.
 - CURRENT MODE In this mode of operation, which is also commonly referred to as torque mode, a current in the motor is produced which is directly proportional to the input signal. Please see section 2.2, 2.5, 2.7 of this manual for more detailed information.
- Sine/Resolver Mode (SMA8215/SMA8215HP) In this mode of operation, a brushless
 motor with an integral resolver is required. The personality module contains a resolver to
 digital converter which provides the positional information to the amplifier that is required
 to commutate the motor. This positional information is also used by the personality
 module to emulate a quadrature encoder output. This personality module can be
 configured for the following two different types of operation:
 - VELOCITY MODE In this mode of operation, the personality module generates a tachometer signal which is used to close a velocity loop in the amplifier. Please see section 2.3, 2.5, 2.8 of this manual for more detailed information.
 - CURRENT MODE In this mode of operation, which is also commonly referred to as torque mode, sine wave currents in the motor are produced that are directly proportional to the input signal. Please see section 2.5, 2.7, 2.9 of this manual for more detailed information.
- Two/Three Phase Input Current Mode (SMA8315/SMA8315HP) In the two phase current mode, the amplifier generates three sine wave currents that are proportional to two input signals. This third command is generated on the personality module as the negative sum of the other two signals. In the three phase current mode, the amplifier generates three sine wave currents that are proportional to three input signals. Please see section 2.5, 2.9 of this manual for more detailed information.

These brushless amplifiers come with all industry standard inputs such as ±limit, fault output, etc. They are available in the following types of configurations:

- As amplifier modules where you supply the DC Buss voltage, cooling fan(s), fusing and shunt regulator. Please see section 1.2.1 for more detailed information.
- As a stand alone one axis amplifier, SMA8X15-1A-1, which contains a DC power supply. cooling fan, fusing and shunt regulator. Please see section 1.2.2 for more detailed information.
- For multi-axis applications, the multi-axis baseplate power supply can supply DC power, cooling fans, zero crossing solid state relays, fusing and a shunt regulator for up to 6 axis or 60 amperes continuous. Please see section 1.2.3 for more detailed information.

1.2 Features:

1.2.1 Single Amplifier Module (SMA8X15-1):

Ergonomic design: Easy access to connections, adjustments, and test points.

Wide operating buss voltage:

70-350VDC.

Complete isolation: Complete isolation from input to output.

Two single-ended or one differential. Both single-ended inputs Dual signal inputs:

may be used simultaneously. All inputs have up to 15,000 A/V

gain, and all inputs will accept ±13VDC.

The standard amplifier may be configured for velocity (RPM) Dual mode operation: (8115 & 8215 only)

control or current (torque) control.

Current limit: Maximum motor current is adjustable.

Carrier frequency is 20KHz. Silent operation:

Short circuit protection: Complete short circuit and ground fault protection.

LED diagnostics: Red LED(S) illuminate to display various fault conditions and a

green LED illuminates to indicate normal operating conditions.

Encoder emulation: Encoder emulation comes standard with line driver outputs,

(8215 only) quadrature and zero index.

Frequency response: 750 Hz minimum.

(Velocity Loop)

Frequency response: 2 KHz minimum.

(Current Loop)

CHAPTER 1: DESCRIPTION, FEATURES AND SPECIFICATIONS

Digital limit/enable Threading
 Inputs: dire

Three separate logic inputs can stop the motor in either or both directions. Inputs may be configured for active-high or active-low, pull-up or pull-down termination, and a 0 to +5V or 0 to +15V range.

 Pseudo tach. option: (8115 only)

For medium and high-speed, unidirectional or bidirectional applications, an option allows the hall sensor inputs to produce a simulated tachometer voltage thus eliminating the need for an external tachometer.

 Encoder outputs: (8215 only) Incremental (quadrature) position outputs with separate index. 19 different encoder counts, from 125 to 4096 counts/revolution, are available. Differential line-driver output devices sink and source 40mA.

 Tachometer output: (8115 & 8215 only) DC output proportional to motor RPM.

Fault input/output:

Open-collector output goes low in the event of a fault. This input is configured so that externally forcing this output low will inhibit the amplifier. This allows all fault outputs in a multi-axis system to be connected together (wire-ORed) to shut down all amplifiers should any amplifier have a fault.

Manual and external fault reset:

Push button and a separate input is provided to reset the amplifier after a fault.

 High-Speed Electronic Circuit Breaker (HS/ECB): Instantly shuts down the amplifier in the event of a short across the motor leads or a ground fault condition. (i.e. amplifier exceeds 80A for 10 microseconds)

 Low-Speed Electronic Circuit Breaker (LS/ECB): Shuts down the amplifier if the amplifier is operated above the maximum continuous current rating (i.e.15A for standard 120VAC, 10A for standard 240VAC; 20A for High Power 120VAC and 15A for High Power 240VAC) for a pre-determined period (i.e. 3 seconds).

 Over/under voltage and over temperature: These circuits constantly monitor the amplifier power-supply voltages, and the motor and amplifier-heatsink temperatures. They will shut down the amplifier in the event of any out-of-specification condition. (The overvoltage protection circuit is set to turn on at +250VDC for 120VAC line input and +450VDC for 240VAC line input.)

Multi-axis chassis:

Up to six amplifier modules may be mounted on a single baseplate. Multi-axis baseplates include a DC power supply, cooling fan(s) and wiring for each respective amplifier module.

1.2.2 Stand Alone One Axis Amplifier (SMA8X15-1A-1):

The stand alone amplifier has all the features that the Single Amplifier Module (section 1.2.1) have, plus the following additional features:

- Line operated AC power operation: Fused AC input for single or three phase input with in-rush current protection at turn-on. No power isolation transofrmer is required.
- Fused regen clamp circuit (shunt regulator) with LED indicator and 50W internal load resistor bank bleeds off excess DC Buss voltage when decelerating a large load inertia. The regen clamp circuit is set to turn on at +215VDC for 120VAC operation and +400VDC for 240VAC operation.
- All faults can be monitored through isolated logic signals.

1.2.3 Multi-Axis Power Supply (GP8600-203X):

- Power supply for 2 to 6 axis amplifier baseplate.
- Line operated AC power operation: Fused AC input for single or three phase inputs with a solid state zero-crossing switch which limits in-rush current at turn-on. No power isolation transofrmer is required.
- Fused regen circuit (shunt regulator) with LED indicator and 300W internal load resistor bank bleeds off excess DC Buss voltage when decelerating a large load inertia. Additional regen resistor can be connected externally.
- Bridge rectifier(s) and filter capacitor.
- Power turn on in-rush limiter (solid state zero crossing switch).
- Cooling fans.

1.3 Specifications:

This section contains the specifications for the brushless trapezoidal, sine/resolver and two or three phase input current mode D.C. Servo Amplifiers. These specifications also include power supplies for the amplifiers.

NOTE: All data in this section is based on the following ambient conditions: 120 °F (50 °C) maximum. Forced air cooling.

1.3.1 Single Amplifier Module (SMA8X15-1):

The amplifier module(s) require an external DC power supply which must include a bridge rectifier, buss capacitor, solid-state relay and shunt regulator. Forced air cooling is required to meet the maximum power ratings specified below.

1.3.1.1 Input and Output Power:

Input Power/ Buss Voltage(B+)	Output Power (current)			
	Standard High Power		ower	
	R.M.S.	Peak	R.M.S.	Peak
120VAC/170VDC	15A	25A	20A	40A
240VAC/340VDC	10A	25A	15A	35A

1.3.1.2 Signal Inputs:

Amplifier Model	Signal Input	Maximum Voltage (VDC)	Minimum Impedance W	Velocity Gain Amp./Volt	Current Gain Amp./Volt
8115/8215	Differential	13	10,000	15,000(min.)	0-5
8115/8215	Single-ended	±13	10,000	15,000(min.)	0-5
8315	2/3phase input	±13	10,000		0-5

1.3.1.3 Digital Inputs:

±Limit, Inhibit & Reset: 40/-0.5V max. Terminated by 10,000W.
 Fault (as input): 40/-0.5V max. Terminated by 10,000W.

• Typical for all digital inputs: Digital inputs have hysteresis with thresholds at 1/3 and 2/3 of +5V or +15V depending on range select jumper.

1.3.1.4 System:

Drift offset over temperature reference to input: 0.01mV/ °C max.
 Frequency response (Velocity loop): 750Hz min.

Frequency response (Velocity loop): 750Hz min.
 Frequency response (Current loop): 2KHz min.

Dead band:
 Form factor:
 Prequency response (Current loop).
 None.
 1.01.

SMA8115, SMA8215, and SMA8315 MANUAL

1.3.1.5 Outputs:

Fault (as output): Active low. Open-collector output can sink 500mA max.

Abs. motor current: 10A/V.

Tachometer: 1000W source impedance, a high input impedance meter must

be used (1MW /volt). Maximum Tachometer output voltage for

12 bit = 1.5 V/KRPM, 14 bit = 2 V/KRPM.

Encoder outputs: Standard TTL levels with 20mA sink or source capability.

(8215 only)

1.3.2 Stand Alone One Axis Amplifier (SMA8X15-1A-1):

The stand alone one axis amplifier contains a single amplifier module, a DC power supply, a cooling fan, fusing and shunt regulator in a sheet metal enclosure. It has the same specifications as the single amplifer module, refer to 1.3.1, except the DC power supply and cooling fan are included. The shunt regulator within the DC power supply has a 50W internal load resistor bank which bleeds off excess DC Buss voltage when decelerating a large load inertia. (Consult with factory).

NOTE: Customer must specify the input AC voltage(105-120VAC/205-250VAC) and the number of input phases (Single or Three Phase) when ordering (see chapter 3: model numbering), so that the proper fan and power supply can be installed.

1.3.3 Multi Axis Power Supply:

The multi-axis power supply contains all items listed under 1.2.3. Note: If you do not need the shunt regulator and or solid state zero crossing switch, please specify at time of order as these items can be deleted which will in-turn decrease the cost of the unit accordingly.

1.3.3.1 Input and Output Power:

Input Power (Buss, B+, Control Power, Fans): 120/240VAC.
Buss Voltage, B+: 170/340VDC.

• Output Power: 30/60A continuous.

1.3.4 Mechanical:

Model	L x W x H (inches)	Weight (lbs)
SMA8X15-1(Single Amplifier Module)	7.125 x 1.38 x 4.53	1.28
SMA8X15-1A-1 (Stand Alone Amplifier)	9.025 x 4.00 x 5.66	5.25
SMA8X15-2A-2 (2 Axis Amplifier System)	9.00 x 10.50 x 7.70	9.36
SMA8X15-4A-4 (4 Axis Amplifier System)	13.00 x 10.50 x 7.70	15.12
SMA8X15-6A-6 (6 Axis Amplifier System)	16.50 x 10.50 x 7.70	19.90

Chapter Two: Theory of Operation

2.1 Introduction:

This chapter contains the basic control theory of how brush-type and brushless servo motors and amplifiers operate. It also compares and contrasts the advantages and disadvantages of brushless and brush type motors and amplifiers to help you select which is best suited for your application. The following is a summary of the topics:

- The theory behind an amplifer driving DC servo-motors.
- A comparison between brush-type and brushless motors.
- A comparison between trapezoidal mode and sinusoidal mode amplifier system.
- The advantages and disadvantages of trapezoidal mode amplifier systems.
- A comparasion between velocity mode and current mode.
- Various kinds of velocity feedback.
- Commutation using resolver.
- Current mode in sine/resolver or trapezoidal amplifier vs two/three phase input currenamplifier.
- Protection circuits.

2.2 Driving DC Servo-Motors:

The torque of any DC motor is proportional to motor current: the stronger the magnetic field, the stronger the pull. Motor current may be controlled in two ways: linear and PWM (Pulse-Width Modulation). Linear control is achieved by simply inserting a resistance in series with the motor. This resistance is usually a partially turned-on transistor. The transistor is said to be in its "linear" region. Linear amplifiers are simple, accurate, and effective. However, they are very inefficient and they generate a lot of heat. Linear amplifiers are used when low electrical noise, high bandwidths (2KHz or higher) and or low inductance (less than 1mH) motors are used. In pulse-width modulation the control devices (output transistors) are rapidly turned full-on and full-off. The ratio of the on-time (the pulse width) and off-time determines the average motor current. Refer to figure 2.1. For example: if the output is on 25% of the time and off 75% of the time, the average motor current is approximately 25% of maximum.

A coil of wire, such as the windings of a motor, forms an inductor. Inductors resist changes in current. This resistance to change, known as reactance, acts to dampen or average the high-current spikes that would otherwise occur when the output devices are on. In fact, if motor inductance is low, external inductors may have to be added in series with each motor lead to ensure proper operation.

A brush-type motor may be run from a steady DC voltage since the brushes and commutator switch the current from winding to winding. However, a brushless motor requires that the voltage be switched from winding to winding externally; the voltage that drives a brushless motor is a constantly changing AC waveform. Section 2.5 dicusses these waveforms.

 


Figure 2.1
Pulse Width Modulation Waveform

2.3 Servo Loops:

A basic velocity-mode servo-loop for a brush-type motor is shown in figure 2.2a. An external controller commands a given velocity (RPM). The velocity-loop summing-amplifier compares this command with the actual motor velocity, supplied by a DC tachometer on the motor shaft, and produces an error voltage proportional to the difference between the actual and commanded velocity.

The velocity error is used to command motor current in the inner servo-loop. The current-loop summing-amplifier compares the command current (velocity error) with the actual current in the motor and produces an error voltage proportional to the difference between the actual and commanded current.

Finally, the current-error signal is used to produce an output (linear or PWM) to drive the motor.

The velocity loop may be bypassed, and an external current command fed directly to the current loop. In this case, the external command signal controls the torque of the motor, rather than the velocity. This is known as current-mode operation.

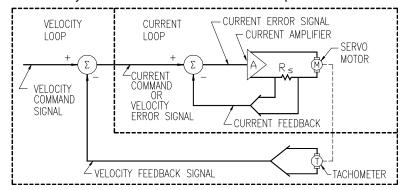


Figure 2.2a
Velocity-mode sevo loop for a brush-type motor

The servo-loops of a brushless amplifier (figure 2.2b) operate in much the same way, except there are now three current loops, one for each phase of the motor.

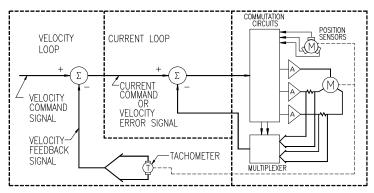


Figure 2.2b
Velocity-mode sevo loop for a brushless motor

2.4 Brushed Motors vs Brushless Motors:

There are two basic types of motor design that are used for high-performance motion control systems: brush-type PM (permanent magnet), and brushless-type PM. As you can see in figure 2.3, a brush-type motor has windings on the rotor (shaft) and magnets in the stator (frame). In a brushless-type motor, the magnets are on the rotor and the windings are in the stator.

To produce optimal torque in a motor, it is necessary to direct the flow of current to the appropriate windings with respect to the magnetic fields of the permanent magnets. In a brush-type motor, this is accomplished by using a commutator and brushes. The brushes, which are mounted in the stator, are connected to the motor wires, and the commutator contacts, which are mounted on the rotor, are connected to the windings. As the rotor turns, the brushes switch the current flow to the windings which are optimally oriented with respect to the magnetic field, which in turn produces maximum torque.

In a brushless motor there is no commutator to direct the current flow through the windings. Instead, an encoder, hall sensors or a resolver on the motor shaft senses the rotor position (and thus the magnet orientation). The position data is fed to the amplifier which in turn commutates the motor electronically by directing the current through the appropriate windings to produce maximum torque. The effect is analogous to a string of sequencing Christmas lights: the lights seem to chase each other around the string. In this case, the magnets on the rotor "chase" the magnetic fields of the windings as the fields "move" around the stator.

The relative advantages and/or disadvantages of a brush-type motor/amplifier combination vs. a brushless motor/amplifier combination can be significant. On the next page is a summary of advantages and disadvantages of brush type motor/amplifiers and brushless type motor/amplifiers to help you decide which type to select for your applications.

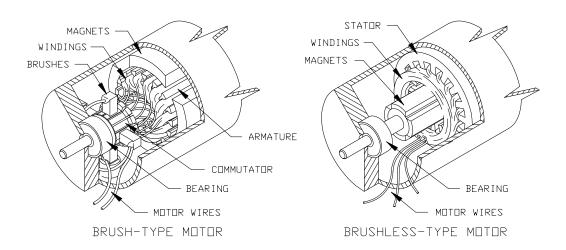


Figure 2.3
Brush-type and Brushless-type Motors

Brushless Motors/Amplifiers	Brushed Motors/Amplifiers
Advantages	Disadvantages
No scheduled maintenance and no brush dust is generated.	Motor brushes must be checked periodically for wear and excess brush dust.
Higher RPM limits.	Approximately 3000RPM maximum.
Lower inertia/torque ratio.	Higher inertia to torque ratio.
Dissipates heat more efficiently due to windings being located in stator.	Not as efficient at dissipating heat. Heat is trapped at rotor and shortens bearing life.
Safer for explosive atmospheres. Quieter and less electrical noise generated.	Brushes spark and generate electrical and audible noise.
Disadvantages	Advantages
Amplifiers are complicated and expensive.	Amplifiers are simpler and less expensive.
Higher torque ripple.	Lower torque ripple.
No Industry standard packaging.	Industry standard packaging.

2.5 Sinusoidal vs Trapezoidal:

Figure 2.4 shows the two most common waveforms used to drive a brushless motor. Note that in each case, there are actually three different waveforms. Each waveform drives a motor winding and is 120 $^{\circ}$ out-of-phase with the other two. Again, the waveform may be generated from a DC source by linear or PWM techniques.

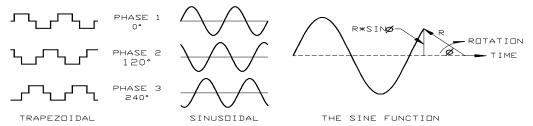


Figure 2.4
Trapezoidal and sinusoidal waveform used to drive brushless motor.

The first waveform is known as trapezoidal or six-step since the voltage is literally stepped from winding to winding (like the Christmas-light analogy). This is the simplest and least expensive method of driving a brushless motor. Its principal disadvantage is that the large current steps produce high torque ripple. (Torque ripple is a repetitive fluctuation in torque as the motor turns and is independent of load.) The SMA8115 trapezoidal mode amplifier produces a trapezoidal output.

The second waveform is known as sinusoidal. To minimize torque ripple, the motor current needs to be constantly varied according to the orientation of the magnets and windings. As it happens, this is a sine function. In fact, a sine wave is defined as a rotating radius (like a motor shaft) revolving through time (see figure 2.4). A sine wave is the most natural way to drive a motor and produces the minimum torque ripple. The SMA8215 sine/resolver mode amplifier produces a sinusoidal output.

2.6 The Advantages and Disadvantages of a Trapezoidal Amplifier System:

A trapezoidal motor has three stator windings and together with the rotor magnets are designed so that the magnetic flux coupling between them produce a constant torque. The torque of the motor is proportional to the three stator phase currents which are 120 ° out-of-phase to the other two. Shaft position sensors are required to provide the commutation signals to commutate the motor. The two most common sensor types are Hall-effect sensors and an optical encoder with commutation tracks.

A common class of applications for trapezoidal amplifiers is for motor speed control. Classically, this is implemented by adding a brushless DC tachometer to the motor shaft and driving the motor through a velocity controlled servo loop. A high performance velocity loop can be implemented in this manner.

Another way of implementating the motor speed control is by using a simulated digital tachometer synthesized by the motor commutation signals. The commutation signals are used to trigger an one shot signal at every transition of the commutation signals. After smoothing, a voltage proportional to velocity (RPM) is obtained.

Two additional system features were implementated in the synthesized tachometer design:

1 At 100% of full RPM, the PSEUDO-TACH voltage is limited by the power supply voltage. If an RPM is commanded above 100% RPM, the servo will run away. To prevent this from occuring, the absolute value of the PSEUDO-TACH signal is compared to a 95% of full RPM reference. If the PSEUDO-TACH signal exceeds this value, an over speed latch is set and the servo is disabled.

2 The PSEUDO-TACH one shot pulse is buffered and brought to the control interface. The controller can use this signal to determine the exact velocity (RPM) of the motor.

The SMA8115 is a trapezoidal brushless amplifier which contains the necessary electronics for motor commutation and also has the PSEUDO-TACH option for better speed control.

2.7 Current Mode vs Velocity Mode:

The fundamental difference between current mode and velocity mode is that in current mode, an external command signal controls the torque of the motor, rather than the velocity. In velocity mode, an external command signal controls the velocity (RPM) of the motor, rather than the torque. In a current mode amplifier, the command signal is proportional to the motor current, thus it is also proportional to the torque of the motor. In a velocity mode amplifier, the current loop amplifier stage is preceded by a high gain error amplifier which compares the command signal and the tachometer feedback signal.

Current mode amplifiers are usually used in Position Control Systems where no tachometer feedback is required. While velocity mode amplifiers are usually used in Classic Cascaded Contol Systems where there are position, velocity and current loops in the system. Velocity loops tend to have a higher bandwidth and operate better near zero speed.

2.8 Tachometer (Velocity Mode) Feedback Options:

The following is a list of ways one can choose to implement tachometer feedback in order to drive the motor through a velocity controlled servo loop:

- Brush-type and brushless DC mechanical tachometer.
- Simulated tachometer using the motor commutation signals (PSEUDO-TACH).
- Sinusoidal resolver.
- Simulated tachometer using the encoder signals.

The simplest way to simulate the actual velocity of the motor is by installing a mechanical brush-type or brushless DC tachometer on the motor shaft which converts the velocity of the motor into DC voltage.

The second method is to synthesize a digital tachometer using the motor commutation signals (refer to section 2.6). The SMA8115 provides this option.

In the third method, with a sine/resolver amplifier (SMA8215) an analogue tachometer signal is generated as part of the Resolver-to-Digital conversion process and is immediately available for use thru the dip-switch options for velocity mode(S1-7).

The fourth method is to have an optical encoder installed on the motor shaft to determine the direction and position of the motor as it runs. The incoming encoder signals are converted into quadrature clock pulses. The frequency of this clock pulses changes with the velocity of the motor and the up/down clock output signals change with the direction of which the motor is running at. The frequency of the clock is then converted into the tach DC voltage signal using the Frequency-to-Voltage converter.

2.9 Commutation Using Resolver:

The Resolver-to-Digital converter in the SMA8215 generates the necessary excitation for the resolver, and converts the resolver's sine and cosine signals into position data. This position information is used to amplitude modulate the velocity error signal into three-phase, sinusoidal and current-error signals like the one in section 2.5.

2.10 Current Mode in Sine/Resolver or Trapezoidal Amplifier vs Two/Three **Phase Input Current Mode Amplifier:**

The fundamental difference between the current mode in sine/resolver or trapezoidal amplifiers and the two or three phase input current mode amplifiers is that in the former case, the commutation of the command and feedback signals is done within the amplifier itself. The latter case accepts two or three 120 of out of phase commutated drive signals. In other words, the user's controller has to do the commutation of the command and feedback signals themselves. The user can either input two or three commutated drive signals. If the user has chosen two phase input, the third phase is generated as the negative sum of the other two inputs.

2.11 Protection Circuit:

The High- and Low-Speed Electronic Circuit Breakers(HS/ECB and LS/ECB) protect the amplifier and motor from being damaged by high motor current(specified max. peak and rms current values). The Over Temperature and Over Voltage detection circuits will shut off the amplifier when the temperature of the amplifier or the buss(B+) voltage exceeds a specified limit. Also, there are circuits which limit the motor from running in either or both directions.


Chapter Three: Model Numbering

3.1 Introduction:


This chapter contains the model numbering system for the SMA8115, SMA8215 and SMA8315 single module, stand alone one axis amplifier and multi-axis applications. The model numbering system is designed so that you, our customer will be able to create the correct model number of the product that you need as quick and as accurately as possible.


3.2 Single Amplifier Modules:


3.2.1 Trapezoidal Mode:

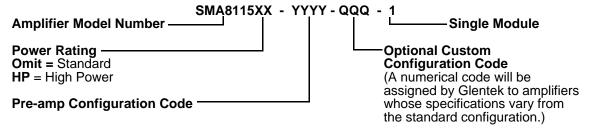

Pre-amp Configuration Code

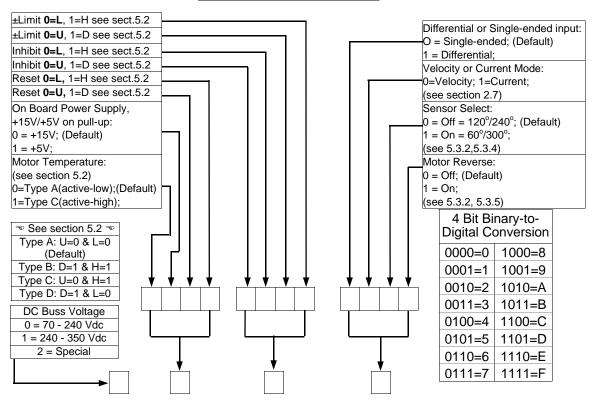


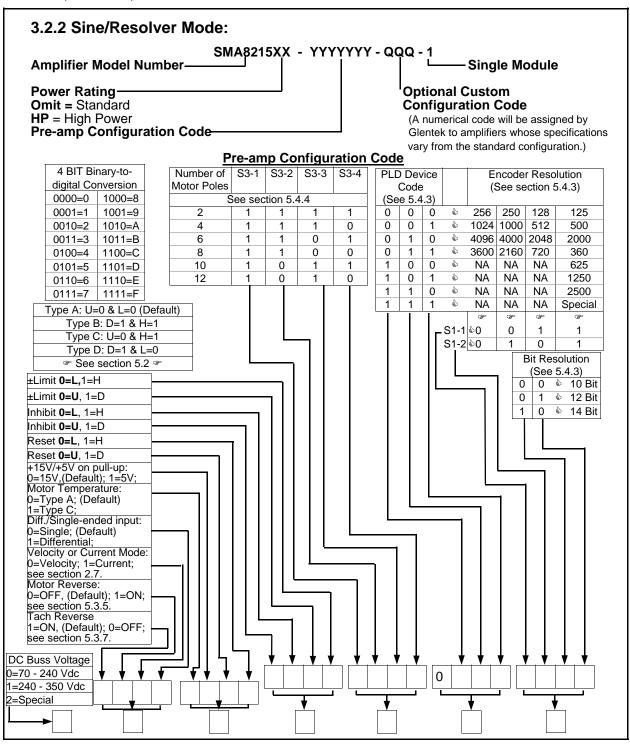

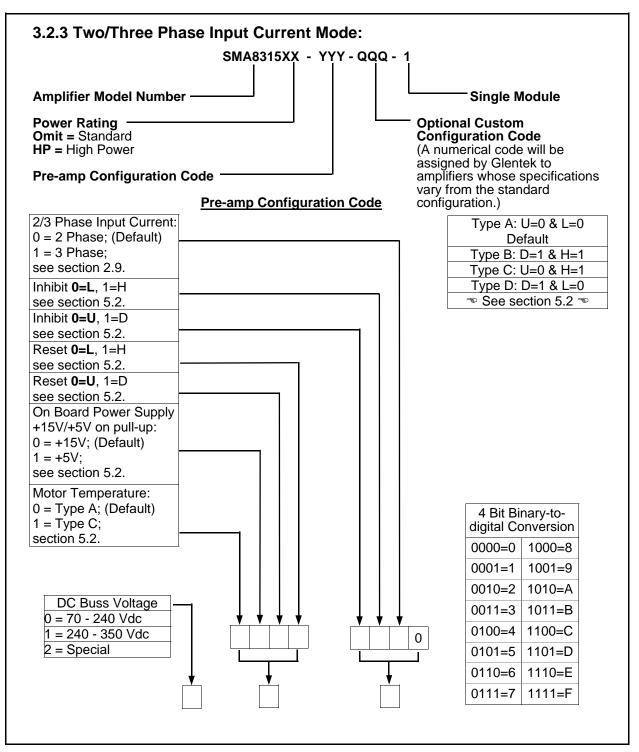

3.3 Stand Alone Amplifier:

3.3.1 Trapezoidal Mode:

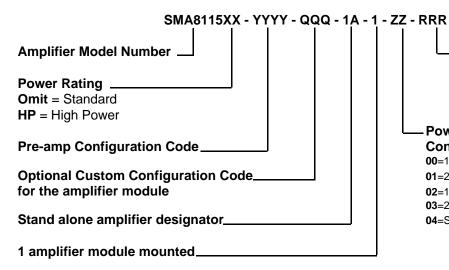


-Optional Custom Configuration Code for the power supply and the regen circuit

Power Supply Configuration Code

=110-130VAC, SINGLE PHASE =208-240VAC, SINGLE PHASE =110-130VAC, THREE PHASE =208-240VAC, THREE PHASE **04**=SPECIAL

3.3.2 Sine/Resolver Mode:

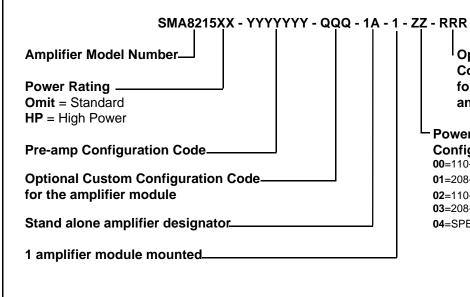


Optional Custom
Configuration Code
for the power supply
and the regen circuit

Power Supply
Configuration Code

=110-130VAC, SINGLE PHASE =208-240VAC, SINGLE PHASE =110-130VAC, THREE PHASE =208-240VAC, THREE PHASE **04**=SPECIAL

3.3.3 Two/Three Phase Input Current Mode: **SMA8315XX - YYY - QQQ - 1A - 1 - ZZ - RRR** Amplifier Model Number -**Optional Custom Configuration Code** Power Rating for the power supply Omit = Standard and the regen circuit **HP** = High Power **Power Supply** Pre-amp Configuration Code -**Configuration Code** 00=110-130VAC, SINGLE PHASE Optional Custom Configuration Code-**01**=208-240VAC, SINGLE PHASE for the amplifier module **02**=110-130VAC, THREE PHASE 03=208-240VAC, THREE PHASE Stand alone amplifier designator_ 04=SPECIAL 1 amplifier module mounted _____

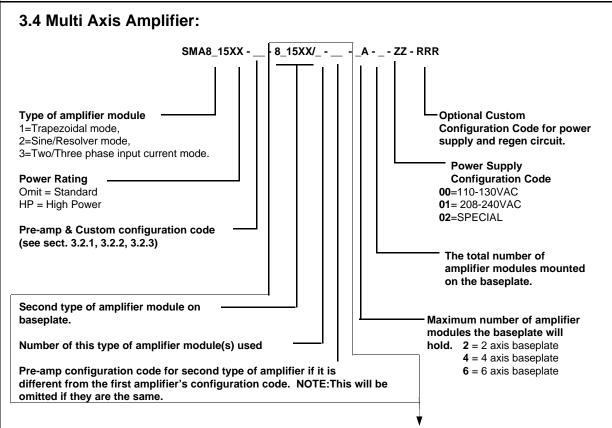

When there is only one type of amplifier used on the baseplate, this part of the model number will be omitted. If there are more than two types of amplifier modules on the baseplate, this part of the model number will be repeated for each amplifier type.

NOTE: The multi-axis amplifier label will be mounted on the baseplate and each amplifier module will contain its own label and serial number.

Chapter Four: Installation

4.1 Introduction:

This chapter provides the necessary information to make all the wiring connections for the amplifiers to operate properly.

4.2 Mounting:

Appendix A contains all the wiring diagrams, assembly drawings, and mechanical information necessary to install the amplifiers. The amplifier package should be mounted in a clean, dry enclosure, free of dust, oil, or other contaminants.

NEVER INSTALL THE AMPLIFIER PACKAGE IN ANY LOCATION WHERE FLAMMABLE OR EXPLOSIVE VAPORS ARE PRESENT.

IMPORTANT: Muffin fan(s) are mounted along one edge of the baseplate to provide cooling. At least 3 inches must be allowed between the fan side and the side opposite the fans and any other surface. The clearance to any other side of the amplifier package is not critical, although sufficient space should be allowed for easy wiring and servicing.

4.3 Wiring:

4.3.1 RFI/EMI and Wiring Technique:

IMPORTANT: All PWM equipment inherently generates radio-frequency interference (RFI), and wiring acts as antennae to transmit this interference. In addition, motors inherently generate electromagnetic interference (EMI). Unless the wiring is very short, some sort of shielding on the motor wires is necessary to meet FCC RFI/EMI guidelines and to protect other equipment from the effects of RFI/EMI. We recommend that shielded wire be used, or the wires should be run in metallic conduit. The shield or conduit should be connected to the amplifier baseplate, which in turn <u>must</u> be earth grounded. In addition, a conductor of the same gauge as the motor wires must be connected from the motor case to the amplifier baseplate to provide protection from shock hazard. The earth grounding is necessary to meet National Electrical Code (NEC) requirements as well as suppressing RFI/EMI.

Additional RFI suppression may be obtained by placing inductors in each motor lead near the amplifier. Consult a Glentek applications engineer for inductor recommendations. Glentek stocks a complete line of inductors for virtually every application.

IMPORTANT: The signal wiring to hall-sensors for the SMA8115, resolver for SMA8215 (if used) and the signal inputs to the amplifier are susceptible to noise pickup. Excessive noise pickup will cause erratic amplifier operation. We urge that each signal input be run in a twisted-pair, shielded cable. The hall-sensor signal lines, the resolver excitation lines, and the resolver output lines should be run in a three twisted-pair, shielded cable. In each case the shield should be terminated at the amplifier end only to a common terminal. We also recommend that the signal lines be kept as far as possible from any power or motor wires.

4.3.2 Wire Size and Type:

IMPORTANT: To ensure safe operation, Glentek strongly recommends that all wiring conform to all local and national codes.

Recommended Wire Size and Type:

• Motor Wires: 14AWG, shielded - Standard.

12AWG, shielded - High Power.

Motor Case Ground: Same as motor wires, or use metallic conduit.

Main Power: Same as motor wires.

Signal Input:
Logic Inputs/Outputs:
External Tachometer:
22AWG, twisted-pair, shielded.
22AWG, shielded with its return lead.
22AWG, twisted-pair, shielded.

• Hall Sensors (SMA8115): 22AWG, three twisted-pairs, over-all shielded.

Resolver Outputs and

Excitation (SMA8215): 22AWG, three twisted-pairs, over-all shielded.

4.3.3 Connector Size and Type:

4.3.3.1 The Power Connector of the Single Amplifier Modules - J2 of the Main Amplifier:

All amplifiers are shipped with the right angle AUGAT terminal block mounted as it power connector . The vertical angle AUGAT terminal block and the PHOENIX connector are two options one can choose to use for the power connector. The specifications of these connectors are listed as follow:

- AUGAT® RDI 6 Series Tri-Barrier Terminal Blocks(PART# 6PCR-05) **Default**:
 - Screw Size/Spacing: 6 (#6-32 on .375" centers).
 - Terminal Style: PC (Printed Circuit Pin).
 - Terminal Orientation: R (Right Angle).
 - Number of Screw Terminals: 05 (5 screw positions).
 - Terminal lugs: Thomas & Betts (PART# A116 for 18AWG wire, PART# B19 for 14AWG wire and PART# C133 for 12/10AWG wire).
- AUGAT[®]RDI 6 Series Tri-Barrier Terminal Blocks(PART# 6PCV-05):
 - Screw Size/Spacing: 6 (#6-32 on .375" centers).
 - Terminal Style: PC (Printed Circuit Pin).
 - Terminal Orientation: V (Vertical Angle).
 - Number of Screw Terminals: 05 (5 screw positions).
 - Terminal lugs: Thomas & Betts (PART# A116 for 18AWG wire, PART# B19 for 14AWG wire and PART# C133 for 12/10AWG wire).
- PHOENIX CONTACT, COMBICON Headers and Plugs with 7.62mm pitch (Header P/N: GMSTBA 2,5/5-G-7,62, Plug P/N: GMSTB 2,5/5-ST-7,62):
 - Header with side panels, plug-in direction parallel to PCB.
 - 5 positions.
 - Color: green.

4.3.3.2 The Signal Connector:

The signal connectors are supported by the molex $^{\mbox{\it R}}$ KK .100" (2,54mm) Centerline Connector System.

- J1 of the Main Amplifier: Mating Connector: molex[®] 2695 Series .100 (2.54mm) Center Crimp Terminal Housing(P/N: 22-01-3175):
 - red nylon housing.
 - 15 positions.
 - with polarizing rib.
- J4 of the Trapezoidal Pre-amp: Mating Connector: molex[®] 2695 Series (P/N: 22-01-3107).
- J4 and J5 of the Sine/Resolver Pre-amp: Mating connector for J4: molex[®] 2695 Series (P/N: 22-01-3077). Mating connector for J5: molex[®] 2695 Series (P/N: 22-01-3057).
 - Crimp Terminals for the above mating connector: molex Crimp Terminals (P/N: 08-55-0102):
 - 15 microinch select gold plated.
 - brass.

4.3.3.3 The Power and Motor Connector of the Stand Alone Amplifier:

- Motor J2 of the Stand Alone Amplifier: Mating Connector: PHOENIX CONTACT, COMBICON Plugs in 7.62mm Pitch (P/N: GMVSTBR 2.5/3-ST-7.62):
 - with vertical plug-in direction to the conductor axis.
 - 3 positions.
 - Color: green.
- Power Input J6 of the Stand Alone Amplifier: Mating Connector: PHOENIX CONTACT, COMBICON Plugs in 7.62mm Pitch (P/N: GMVSTBW 2.5/4-ST-7.62):
 - with vertical plug-in direction to the conductor axis.
 - 4 positions.
 - Color: green.

4.4 Single Amplifier Module Connections(SMA8X15-1):

4.4.1 Buss and Motor Connections - J2:

Signal Name	Terminal	Notes
B -	J2-1	DC Buss -
B +	J2-2	DC Buss+
MOTOR T	J2-3	Phase T of the motor.
MOTOR S	J2-4	Phase S of the motor.
MOTOR R	J2-5	Phase R of the motor.

4.4.2 Signal Connections for the Trapezoidal and Sine/Resolver Mode Amplifier - J1:

Signal Name	SMA8115/SMA8215 Terminal	Notes
SIGNAL 1+	J1-1	Differential signal input.
SIGNAL 1-	J1-2	Differential signal return.
SIGNAL 2+	J1-3	Single-ended signal 2 in.
COMMON	J1-4	Single common.
TACH OUT	J1-5	DC output proportional to RPM.
COMMON	J1-6	Tachometer common.
ABS. I	J1-7	Absolute value of the motor current (10A/V)
LIMIT +	J1-8	Inhibits the motor in + direction.
LIMIT -	J1-9	Inhibits the motor in - direction.
INHIBIT	J1-10	Inhibits the motor in both directions.
FAULT	J1-11	Goes low for a fault on this amplifier, or inhibits the amplifier when forced low.
COMMON	J1-12	Digital common.
RESET IN	J1-13	Resets fault latch.
MTR TEMP	J1-14	Motor over temperature switch input.
DIG. TACH(SMA8115) N/C(SMA8215)	J1-15	Digital tach output in trapezoidal mode or Auxillary in sine/resolver mode.

4.4.3 Signal Connections for the Two/Three Phase Current Mode Amplifier:

Signal Name	Terminal	Notes
PHASE R+	J1-1	Sinusoidal input phase R.
PHASE R-	J1-2	Sinusoidal input phase R return.
PHASE S+	J1-3	Sinusoidal input phase S.
PHASE S-	J1-4	Sinusoidal input phase S return.
PHASE T+	J1-5	Sinusoidal input phase T.
COMMON	J1-6	Signal common.
ABS I	J1-7	Absolute value of the motor current (10A/V).
N/C	J1-8	No connection.
N/C	J1-9	No connection.
INHIBIT	J1-10	Inhibits the motor in both directions.
FAULT	J1-11	Goes low for a fault on this amplifier, or inhibits the amplifier when forced low.
COMMON	J1-12	Digital common.
RESET IN	J1-13	Resets fault latch.
MTR TEMP	J1-14	Motor over temperature switch input.
N/C	J1-15	No connection.

4.4.4 Signal connections for the Trapezoidal Mode Pre-amp:

Signal Name	Terminal	Notes
+15 VDC	J4-1	+15V for external brushless tachometer.
-15 VDC	J4-2	-15V for external brushless tachometer.
TACH	J4-3	External tachometer input (if used).
COMMON	J4-4	External tachometer common.
HALL +15	J4-5	+15V power for Hall-effect sensors.
HALL +5	J4-6	+5V power for Hall-effect sensors.
HALL 1	J4-7	Hall sensor 1. Check motor data for phasing.
HALL 2	J4-8	Hall sensor 2. Check motor data for phasing.
HALL 3	J4-9	Hall sensor 3. Check motor data for phasing.
COMMON	J4-10	Common for hall sensors.

4.4.5 Signal connections for the Sine/Resolver Mode Pre-amp:

Signal Name	Terminal	Notes		
Encoder Output (J4):				
Α	J4-A	Phase A signal output.		
Ā	J4-B	Negative phase A signal output.		
В	J4-C	Phase B signal output.		
B	J4-D	Negative phase B signal output.		
<u>Z</u>	J4-E	Phase Z signal output.		
Z	J4-F	Negative phase Z signal output.		
СОМ	J4-G	Common ground.		
Resolver (J5):			
SIN	J5-A	Sine signal input.		
СОМ	J5-B	Sine/Cosine return.		
cos	J5-C	Cosine signal input.		
COM	J5-D	Excitation return.		
EXC	J5-E	Excitation signal input.		

4.5 Stand Alone Amplifier Connections (SMA8X15-1A-1):

The Stand Alone Amplifier has the same signal connections as the Single Amplifier Module. The Power and Motor connections are as follows:

4.5.1 Motor Connections - J2:

Signal Name	Terminal	Notes
MOTOR T	J2-1	Motor phase T
MOTOR S	J2-2	Motor phase S
MOTOR R	J2-3	Motor phase R

4.5.2 Power Connections - J6:

Signal Name	Terminal	Notes
GND	J6-1	Chassis ground.
AC	J6-2	AC power input.
		(Omit for single-phase input)
AC	J6-3	AC power input.
AC	J6-4	AC power input.

4.6 Multi Axis Power Supply Connections:

Connector TB201 is shown in the following drawings: 8000-1833 for 2-axis baseplate, 8000-1835 for 4-axis baseplate and 8000-1837 for 6-axis baseplate. Fuse Block FB301 is shown in drawings 8600-2030 and 8600-2031. All of the above drawings are in Appendix A.

Signal Name	Terminal	Notes	
AC - FAN	TB201 on baseplate.	AC fan power input.	
AC - FAN	TB201 on baseplate.	AC fan power input.	
AC - MAIN	FB301 on Power Supply Sub-assembly	AC main power input.	
AC - MAIN	FB301 on Power Supply Sub-assembly	AC main power input.	
AC - MAIN	FB301 on Power Supply Sub-assembly	AC main power input.	

Chapter Five: Configuration

5.1 Introduction:

Each amplifier has several configuration options. This chapter describes these options and how to implement them. If desired, Glentek will be happy to pre-configure your amplifiers.

NOTE: Each amplifier module and multi-axis amplifier is configured and shipped according to the model number (instructions to construct a model number is in chapter three) when the order is placed. It is important for the user to realize that any adjustment on the dip-switches by the user will result in discrepancies between the model number and the actual configuration of the amplifier.

5.2 Logic Input Configuration:

There are five logic inputs: Limit +, Limit -, Inhibit, Reset In, Motor Temp. The first four may be configured for active-high or active-low signals, and pulled-up or pulled-down termination (type A, B, C, and D). The motor-temp may be configured for active-high or active-low signals, and is always pulled-up (type A, and C). All five logic inputs have a selectable 0 to +5VDC or 0 to +15VDC range.

- Type "A": Requires grounding of input to disable the amplifier (pull-up, active-low).
- Type "B": Requires a positive voltage at input to disable the amplifier (pull-down, active-high).
- Type "C": Requires grounding of input to enable the amplifier (pull-up, active-high).
- Type "D": Requires a positive voltage at input to enable the amplifier (pull-down, active-low).

5.3 Trapezoidal Mode Amplifier Configuration:

The following table shows the dip switches that need to be configured for the Type A, B, C, and D configurations. The standard configuration is shown in bold.

	Type A	Type B	Type C	Type D
LIMIT±	S1-8 - OFF	S1-8 - ON	S1-8 - OFF	S1-8 - ON
	S1-5 - ON	S1-5 - OFF	S1-5 - OFF	S1-5 - ON
INHIBIT	S1-7 - OFF	S1-7 - ON	S1-7 - OFF	S1-7 - ON
	S1-4 - ON	S1-4 - OFF	S1-4 - OFF	S1-4 - ON
RESET IN	S1-6 - OFF	S1-6 - ON	S1-6 - OFF	S1-6 - ON
	S1-3 - ON	S1-3 - OFF	S1-3 - OFF	S1-3 - ON
MTR TEMP	S1-2 - ON	not available	S1-2 - OFF	not available
FAULT	standard	not available	not available	not available

5.3.1 +15V/+5V Logic Level Configuration (Default: S1-1=OFF):

- +15V: S1-1 = OFF.
- +5V: S1-1 = ON.

5.3.2 Standard Configuration for Trapezoidal Velocity Mode, Simulated Velocity Mode and Current Mode:

Dip Switch (S2)	Name	Velocity Mode (with External Tachometer)	Simulated Velocity Mode	Current Mode
S2-10	CUR MODE	OFF	OFF	ON
S2-9	VEL MODE	ON	ON	OFF
S2-8	INTEGRATOR	See section	5.3.3 (normally OF	F)
S2-7	SENSOR SEL	See section	5.3.4 (normally OF	F)
S2-6	MTR REVERSE	See section 5.3.5 (normally OFF)		
S2-5	TACH LEAD	ON OFF (OFF
S2-4	SIM. TACH - ON/OFF	OFF	ON	OFF
S2-3	SIM. TACH - DISABLE	ON	See section 5.3.6 (normally OFF)	OFF
S2-2	SIM. TACH - REVERSE	OFF	See section 5.3.7 (normally OFF)	OFF
S2-1	SIM. TACH - SPEED	OFF	See section 5.3.8 (normally ON)	OFF

5.3.3 Integrator Configuration (Default: S2-8=OFF):

The integrator switch is turned ON to lower the integration proportional break point in the velocity Proportional Integral Derivative (PID) loop. The lower break point may be required with motors having high inductance amatures. This switch should remain off unless instructed to turn on by a Glentek engineer.

5.3.4 Hall-Sensor Configuration (Default: S2-7=OFF):

There are four standard sensor configurations: 60°, 120°, 240°, and 300°. The 60°/300°, and 120°/240° sensor spacing are identical except for the direction of motor rotation which results.

To configure the amplifiers for $60^{\circ}/300^{\circ}$ sensor configuration: S2-7 (ON). To configure the amplifiers for $120^{\circ}/240^{\circ}$ sensor configuration: S2-7 (OFF).

5.3.5 Motor Reverse Configuration (Default: S2-6=OFF):

The motor reverse switch is turned ON to reverse the spinning direction of the motor for both current and velocity mode. It can also solve the problem when a motor running away by reversing the polarity of the motor lead without physically reversing the motor lead.

5.3.6 Simulated Tach - Disable Configuration(Default: S2-3=ON):

The simulated tachometer disable is turned ON when external tachometer is used.

5.3.7 Simulated Tach - Reverse Configuration (S2-2: Default=OFF):

The simulated tachometer reverse switch is turned ON to reverse the spinning direction of the motor or prevent the motor from running away in case of incorrect polarity of the feedback signal.

5.3.8 Simulated Tach - Speed Configuration (S2-1, Default=ON):

The simulated tach speed switch should be ON unless the user cannot reach the maximum rpm required per the following formula: Low Speed Applications(S2-1:ON) - MAX. RPM at 25500/number of motor poles, High Speed Applications(S2-1:OFF) - MAX. RPM at 51000/number of motor poles.

5.4 Sine/Resolver Mode Amplifier Configuration:

The following table shows the dip switches that need to be configured for the Type A, B, C, and D configurations. The standard configuration is shown in bold.

	Type A	Type B	Type C	Type D
LIMIT®	S2-8 - OFF	S2-8 - ON	S2-8 - OFF	S2-8 - ON
	S2-5 - ON	S2-5 - OFF	S2-5 - OFF	S2-5 - ON
INHIBIT	S2-7 - OFF	S2-7 - ON	S2-7 - OFF	S2-7 - ON
	S2-4 - ON	S2-4 - OFF	S2-4 - OFF	S2-4 - ON
RESET IN	S2-6 - OFF	S2-6 - ON	S2-6 - OFF	S2-6 - ON
	S2-3 - ON	S2-3 - OFF	S2-3 - OFF	S2-3 - ON
MTR TEMP	S2-2 - ON	not available	S2-2 - OFF	not available
FAULT	standard	not available	not available	not available

5.4.1 +15V/+5V Logic Level Configuration (Default, S2-1=OFF):

+15V: S2-1 - OFF.+5V: S2-1 - ON.

5.4.2 Standard Configuration for Sine/Resolver Velocity Mode and Current Mode:

Dip-switch	Name	Velocity Mode	Current Mode
S1-1	ENCODE / 2	See section 5.4.3	
S1-2	ENCODE * 125 / 128	See section	on 5.4.3
S1-3	(NOT USED)	OFF	OFF
S1-4	MTR REVERSE	See section 5.3.5 (normally OFF)	
S1-5	TACH REVERSE	See section 5.3.7 (normally ON)	
S1-6	INTEGRATOR	See section 5.3.3 (normally OFF)	
S1-7	VEL MODE	ON OFF	
S1-8	CUR MODE	OFF	ON

5.4.3 Encoder Output Resolution Configuration:

Refer to Appendix B drawing 8000-1430 and 8000-1431. There are nineteen standard resolutions. Up to four resolutions are contained in a single PLD. To configure the pre-amp for a given resolution, ensure that you have the correct PLD (U13) and then configure the dip-switches S1-1, S1-2, S3-7 and S3-8 as shown below. The PLD code refers to the table in the model numbering chapter and the PLD part number is marked on the part.

Resolution	PLD Code	PLD Part	S1-1	S1-2	Bits Min.	S3-7	S3-8	Max. RPM	Tach. Volts V/1000RPM
125	000	Number	ON	ON	10	ON	ON	(S3-5:ON)	0.13
		8000-1212			10			62,400	
128	000	8000-1212	ON	OFF	10	ON	ON	62,400	0.13
250	000	8000-1212	OFF	ON	10	ON	ON	62,400	0.13
256	000	8000-1212	OFF	OFF	10	ON	ON	62,400	0.13
500	001	8000-1213	ON	ON	12	OFF	ON	15,600	0.5
512	001	8000-1213	ON	OFF	12	OFF	ON	15,600	0.5
1000	001	8000-1213	OFF	ON	12	OFF	ON	15,600	0.5
1024	001	8000-1213	OFF	OFF	12	OFF	ON	15,600	0.5
2000	010	8000-1214	ON	ON	14	ON	OFF	3,900	2
2048	010	8000-1214	ON	OFF	14	ON	OFF	3,900	2
4000	010	8000-1214	OFF	ON	14	ON	OFF	3,900	2
4096	010	8000-1214	OFF	OFF	14	ON	OFF	3,900	2
360	011	8000-1218	ON	ON	12	OFF	ON	15,600	0.5
720	011	8000-1218	ON	OFF	12	OFF	ON	15,600	0.5
2160	011	8000-1218	OFF	ON	14	ON	OFF	3,900	2
3600	011	8000-1218	OFF	OFF	14	ON	OFF	3,900	2
625	100	8000-1215	ON	ON	12	OFF	ON	15,600	0.5
1250	101	8000-1216	ON	ON	14	ON	OFF	3,900	2
2500	110	8000-1217	ON	ON	14	ON	OFF	3,900	2

The BITS refer to the Resolver-to-Digital resolution which must be factory configured. Encoder resolution may be changed at any time to a resolution which requires the same or fewer bits. Increasing the bits increases the possible encoder resolution, but decreases the maximum motor RPM(refer to the table above). The Tach. Volts (V/1000RPM) are given for the MAX. RPM of the BIT resolution. Consult a Glentek applications engineer should you have any questions.

NOTE: The MAX. RPM in the above table is valid when RANGE (S3-5) is ON. The MAX. RPM is half of what is shown in the table when RANGE (S3-5) is OFF.

5.4.4 Motor Pole Configuration:

Dip-switch S3-1, S3-2, S3-3 and S3-4 configures the pre-amp for the number of poles in the motor. They are also used to set up certain calibration modes. Refer to the chart below and set the dip switches for the correct number of poles.

Motor:	S3-1	S3-2	S3-3	S3-4
2 Pole	ON	ON	ON	ON
4 Pole	ON	ON	ON	OFF
6 Pole	ON	ON	OFF	ON
8 Pole	ON	ON	OFF	OFF
10 Pole	ON	OFF	ON	ON
12 Pole	ON	OFF	ON	OFF
Zero	ON	OFF	OFF	ON
Index	ON	OFF	OFF	OFF

5.5 Two/Three Phase Input Current Mode Amplifier Configuration:

The following table shows the dip switches that need to be configured for the Type A, B, C, and D configurations. The standard configuration is shown in bold.

	Type A	Type B	Type C	Type D
INHIBIT	S1-5 - OFF	S1-5 - ON	S1-5 - OFF	S1-5 - ON
	S1-3 - ON	S1-3 - OFF	S1-3 - OFF	S1-3 - ON
RESET IN	S1-4 - OFF	S1-4 - ON	S1-4 - OFF	S1-4 - ON
	S1-2 - OFF	S1-2 - ON	S1-2 - ON	S1-2 - OFF
MTR TEMP	S1-1 - OFF	not available	S1-1 - ON	not available

5.5.1 +15V/+5V Logic Level Configuration:

+15V: S1-6 - OFF.+5V: S1-6 - ON.

5.5.2 Standard Configuration for Two/Three Phase Input Current Mode:

Dip-switch	Switch Name	2Ø current mode	3Ø current mode
S1-8	2 pase input	ON	OFF
S1-7	3 phase input	OFF	ON

Chapter Six: Start up and Calibration

6.1 Introduction:

This chapter contains the procedure required for initial start up and amplifier calibration. Both trapezoidal and sine/resolver modes can be configured to run in velocity mode and current mode operations.

Required Equipment: Oscilloscope, voltmeter & battery box. The battery box serves as a step input voltage command, applying and removing a flashlight battery can also be used for this function. Glentek sells a battery box BB-700 which is ideal for this function.

6.2 Initial Start Up:

When applying power to start up your amplifier system for the first time, we recommend you follow this procedure. If you have already gone through this procedure you can skip to the appropriate calibration procedure.

Check for any loose or damaged components.
Check that all connections are tight.
Be sure that the motor mechanism is clear of obstructions. If the mechanism has limited motion, e.g. a lead-screw, set the mechanism to mid-position.
Disconnect the signal and auxiliary inputs.
Be sure the Loop-Gain pot(s) are fully CCW.
Remove input fuses on the baseplate and apply main power. Check for the correct AC voltage at fuse block. The DC Bus (amplifier supply-voltage) will be 1.4 times this value. If voltage is correct, remove power and reinstall fuses.
Work on only one amplifier at a time.

6.3 Trapezoidal Mode Amplifier Calibration:

The following pots will be set during calibration: Note: RV1-RV6 are 12-turn pots and RV7 is a single turn pot.

		,
Pots	Name of Port	Note
RV1	SIG 1	Sets the input voltage to RPM ratio, e.g. 10V=2000RPM (velocity
	(Differential Input	mode) or input voltage to torque ratio, e.g. 10V=25A (current
	Signal Gain)	mode) required by your system for the differential signal input.
RV2	SIG 2	Same as Signal 1 input, except it is for the single-ended signal
	(Single-ended	input.
	Input Signal Gain)	
RV3	TACH	Used in conjunction with the compensation pot to set the system
	(Tach Gain)	bandwidth. Not used in current mode. Shipped set at 75%.
RV4	BAL (Balance)	Used to null any offsets in system.
RV5	COMP	Used in conjunction with the TACH pot to set the system
	(Compensation)	bandwidth. Not used in current mode. Shipped set at full CW (minimum bandwidth).
RV6	I LIMIT	Sets the maximum motor current. Shipped set at full CW
	(Current Limit)	(maximum current limit).
RV7	LOOP	Used to shut off uncalibrated amplifiers. When the loop gain is
	(Loop Gain)	CCW, no current is delivered to the motor. Shipped set at full CCW.

6.3.1 Trapezoidal Mode Amplifier Calibration Procedure - Velocity Mode and Simulated Velocity Mode:


The amplifier, in this configuration, receives an analog, bi-polar input command which is proportional to the required motor velocity. The amplifier receives velocity feedback from a tachometer which is usually mounted to the rear of the motor.

- 1. Turn Current Limit (RV6) to mid position and the Loop Gain (RV7) full CCW.
- 2. Apply main power and fan power.
- 3. Slowly turn the Loop Gain (RV7) CW. Motor should be stopped or turning slowly. If the motor starts running away, turn Loop Gain (RV7) full CCW, switch MTR REVERSE (S2-6) from OFF to ON (or vice versa) or reverse the TACH OUT and COMMON at J1-5 and J1-6 and retest. Leave the Loop Gain (RV7) full CW for all remaining adjustments.
- 4. Set Balance (RV4) for zero motor rotation.
- 5. Connect the oscilloscope to ABS I (J1-7) and the battery box to Signal 2 (J1-2 and 3) for single-ended signal input. The voltage at J1-7 is a function of motor current: 1V=10A for SMA8X15. While applying a step input voltage, adjust the Current Limit (RV6) for the desired peak current. If the desired peak current cannot be achieved with the pot(RV6) full CW, increase the input voltage or increase the corresponding Signal 2 Gain (RV2).

The purpose of the following procedure is to set the system bandwidth to obtain a critically-damped response with the maximum possible tach gain. There are many possible settings of Tach Gain and Compensation which will yield a critically damped waveform. The optimum setting will occur when the Tach Gain is as CW as possible and the Compensation is as CCW as possible. However, the servo-loop may become unstable (the motor oscillates or hunts) with a very low (near CCW) setting of the Compensation. In this case, stability is the limiting factor. At no time should the servo-loop be allowed to be unstable.

Amplifiers are normally shipped with the Tach Gain (RV3) set at 75%. This is a good place to start. If you are unsure of where the Tach Gain is set, turn the Tach Gain fully CW (up to 12 turns), then CCW 4 turns.

- 6. Move the oscilloscope to the TACH OUT (J1-5), set the battery box for a steady DC voltage and adjust the input voltage or Signal 2 Gain for about 400RPM.
- 7. Pulse the input and compare the waveform with figure 6.1.

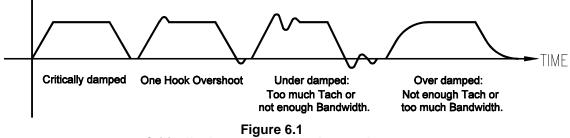

Critically damped, One Hook Overshoot, Under and Over damped waveforms

- 8. Adjust the Compensation pot CCW until the waveform is critically damped or one hook overshoot. Then proceed to step 10.
- 9. If the desired waveform cannot be obtained by adjusting the Compensation pot, back off(CCW) the Tach Gain pot a few turns and repeat step 8.
- 10. Do not adjust the Tach Gain or Compensation for the rest of the calibration procedure.
- 11. With battery box still connected at J1-3 and J1-4 for single-ended input (or if your system uses the differential input, move battery box to J1-1 and J1-2), set battery box for a known DC voltage. Adjust Signal Gain, RV2 (or RV1 for differential input) to obtain the desired motor velocity.
- 12. If the motor is rotating in the wrong direction for a given input polarity, turn the Loop Gain pot full CCW. Switch the MTR REVERSE (S2-6) from OFF to ON (or vice-versa) or reverse the TACH input leads. Turn the Loop Gain pot back to full CW.
- 13. Remove the battery box, and repeat only step 4.
- 14. Calibration complete. Reconnect signal wires.

6.3.2 Trapezoidal Mode Amplifier Calibration Procedure - Current Mode:

The amplifier in this configuration, receives an analog, bi-polar input command which is proportional to the required motor current(motor torque).

- 1. Turn the current limit (RV6) to mid position and the Loop Gain (RV7) full CCW.
- 2. Apply main power and fan power.
- 3. Slowly turn the Loop Gain (RV7) pot CW. Motor should be stopped or turning slowly. Set the Balance (RV4) for 0V at J1-7 (ABS I).
- 4. Connect the oscilloscope to ABS I (J1-7), and the battery box to the Signal 2(single-ended) Input, J1-3 (J1-4 as common). The voltage on J1-7 is a function of motor current: 1V=10A. While pulsing a step input voltage, adjust the Current Limit for desired peak current. If the desired peak current cannot be achieved with Current Limit pot full CW, increase either the input signal or Signal Gain (RV2) for single-ended Input or Differential Gain (RV1) for differential input.
- 5. With battery box still connected at J1-3 and J1-4 for single-ended input (or if your system uses the differential input, move battery box to J1-1 and J1-2), set battery box for a known DC voltage. Apply ①input signal pulses and adjust the Signal Gain (RV2) pot or (RV1 for differential input) to obtain the desired current gain of the amplifier.
- If the motor is rotating in the wrong direction for a given polarity, turn the Loop Gain pot full CCW. Switch MTR REVERSE (S1-6) from OFF to ON (or vice-versa). Turn the Loop Gain pot back to full CW.
- 7. Remove battery box, and repeat step 3.
- 8. Calibration complete. Reconnect signal wires.

6.4 Sine/Resolver Mode Amplifier Calibration:

The following pots will be set during calibration:

Note: RV1 and RV8 are single turn pots; RV2-RV7 and RV9-RV14 are 12-turn pots. Note: RV9-RV14 are factory set and should not be adjusted. Adjusting these pots voids warranty.

Pots	Name of Port	Note
RV2	SIG 1	Sets the input voltage to RPM ratio, e.g. 10V=2000RPM (velocity
		mode) or input voltage to torque ratio, e.g. 10V=25A (current mode)
	Signal Gain)	required by your system for the differential input.
RV3	SIG 2	Same as Signal 1 input, except this is for single-ended input.
	(Single-ended	
	Input Signal Gain)	
RV4	TACH	Used in conjunction with the compensation pot to set the system
	(Tach Gain)	bandwidth. Not used in current mode. Shipped set at 75%.
RV5	BAL (Balance)	Used to null any offsets in system.
RV6	COMP	Used in conjunction with the TACH pot to set the system bandwidth.
	(Compensation)	Not used in current mode. Shipped set at full CW (minimum
		bandwidth).
RV7	I LIMIT	Sets the maximum motor current. Shipped set at full CW (maximum
	(Current Limit)	current limit).
RV8	LOOP	Used to shut off uncalibrated amplifiers. When the loop gain is
	(Loop Gain)	CCW, no current is delivered to the motor. Shipped set at full CCW.

6.4.1 Sine/Resolver Mode Amplifier Calibration Procedure - Velocity Mode:

The amplifier, in this configuration, receives an analog, bi-polar input command which is proportional to the required motor velocity.

- 1. Turn the Current Limit (RV7) to mid position and the Loop Gain (RV8) full CCW.
- 2. Apply main power and fan power.
- 3. Slowly turn the Loop Gain (RV8) CW. The motor should be stopped or turning slowly. If the motor starts running away, turn Loop Gain pot(RV8) CCW, switch TACH REVERSE (S1-5) from OFF to ON (or vice versa) and retest. Leave the Loop Gain (RV8) full CW for all remaining adjustments.
- 4. Set the Balance (RV5) for zero motor rotation.
- 5. Connect the oscilloscope to ABS I (J1-7) and the battery box to Signal 2 Input. The voltage at J1-7 is a function of motor current: 1V=10A for SMA8X15. While applying a step input voltage, adjust the Current Limit (RV7) for the desired peak current. If the desired peak current cannot be achieved with the pot full CW, increase the input voltage or increase the Signal Gain (RV3).

The purpose of the following procedure is to set the system bandwidth to obtain a critically-damped response with the maximum possible tach gain. There are many possible settings of Tach Gain and Compensation which will yield a critically damped waveform. The optimum setting will occur when the Tach Gain is as CW as possible and the Compensation is as CCW as possible.

However, the servo-loop may become unstable (the motor oscillates or hunts) with a very low (near CCW) setting of Compensation. In this case, stability is the limiting factor. At no time should the servo-loop be allowed to be unstable.

Amplifiers are normally shipped with the Tach Gain (RV4) set at 75%. This is a good place to start. If you are unsure of where the Tach Gain is set, turn the Tach Gain fully CW (up to 12 turns), then CCW 4 turns.

- 6. Move the oscilloscope to the TACH OUT (J1-5), set the battery box for a steady DC voltage and adjust the input voltage or Signal 2 gain for about 400RPM.
- 7. Pulse the input and compare the waveform with figure 6.1.
- 8. Adjust the Compensation pot CCW until the waveform is critically damped or one hook overshoot. Then proceed to step 10.
- 9. If the desired waveform cannot be obtained by adjusting the Compensation pot, back off (CCW) the Tach Gain pot a few turns and repeat step 8.
- Do not adjust the Tach Gain or Compensation pots for the rest of the calibration procedure.
- 11. With the battery box still connected at J1-3 and J1-4 for single-ended input (or if your system uses the differential input, move battery box to J1-1 and J1-2), set battery box for a known DC voltage. Adjust Signal 1 Gain (RV3) or (RV2 for differential input) to obtain the desired motor velocity.
- 12. If the motor is rotating in the wrong direction for a given input polarity, turn the Loop Gain pot full CCW. Switch MTR REVERSE (S1-4) from OFF to ON (or vice-versa). Turn the Loop Gain pot back to full CW.
- 13. Remove the battery box, and repeat only step 4.
- 14. Calibration complete. Reconnect signal wires.

6.4.2 Sine/Resolver Mode Amplifier Calibration Procedure - Current Mode:

The amplifier in this configuration, receives an analog, bi-polar input command which is proportional to the required motor current (motor torque).

- 1. Turn the current limit (RV7) to mid position and the Loop Gain (RV8) full CCW.
- 2. Apply main power and fan power. Slowly turn the Loop Gain (RV8) full CW. Motor should be stopped or turning slowly.
- 3. Set Balance (RV5) for 0V at ABS I (J1-7).

- 4. Connect the oscilloscope to ABS I (J1-7), and the battery box to the Signal 2 Signal-ended Input (J1-3 and J1-4). The voltage on J1-7 is a function of motor current: 1V=10A. While pulsing a step input voltage, adjust the Current Limit for the desired peak current. If the desired peak current cannot be achieved with the pot full CW, increase the input voltage or increase the Signal 2 Gain (RV3).
- 5. With battery box still connected at J1-3 and J1-4 for single-ended input (or if your system uses the differential input, move battery box to J1-1 and J1-2), set battery box for a known DC voltage. Apply ①input signal pulses and adjust the Signal 2 Gain pot (RV2) or (RV1 for differential input) to obtain the desired current gain of the amplifier.
- 6. If the motor is rotating in the wrong direction for a given input polarity, turn the Loop Gain pot full CCW. Switch MTR REVERSE (S1-4) from OFF to ON (or vice-versa). Turn the Loop Gain pot back to full CW.
- 7. Remove battery box, and repeat step 3.
- 8. Calibration complete. Reconnect single wires.

6.5 Two/Three Phase Current Mode Amplifier Calibration:

The amplifier in this configuration, receives either two or three bi-polar phase current command signals input. The amplifier generates three sine wave currents that are proportional to the input signals. The following pots will be set during calibration: Note: RV1 to RV4 are 12-turn pots.

Pots	Name of Pot	Note
RV1	PHASE R	Signal gain for phase R input current.
RV2	PHASE S	Signal gain for phase S input current.
RV3	PHASE T	Signal gain for phase T input current.
RV4	I LIMIT	Sets maximum motor current. Shipped
	(Current Limit)	set CW (maximum current limit).

6.5.1 Two Phase Input Current Mode Amplifier Calibration Procedure:

- Turn the Current Limit (RV4) to mid position, phase R (RV1) full CCW and phase S (RV2) full CCW.
- 2. Apply main power and fan power.
- 3. Slowly turn phase R and phase S full CW.
- Connect the oscilloscope to I Limit (J3-E), and set the current limit for (5A/V) at I LIM SET (RV4).
- 5. Connect the oscilloscope to ABS I (J1-7), and the two phase modulated input waveform at Phase R+ (J1-1), Phase R- (J1-2) and Phase S+ (J1-3), Phase S- (J1-4). Adjust the I LIM SET (RV4) for the desired peak current.
- 6. Calibration complete.

6.5.2 Three Phase Input Current Mode Amplifier Calibration Procedure:

- Turn the Current Limit (RV4) to mid position, phase R (RV1) full CCW, phase S (RV2) full CCW and phase T (RV3) full CCW.
- 2. Apply main power and fan power.
- 3. Slowly turn phase R (RV1), phase S (RV2) and phase T (RV3) full CW.
- Connect the oscilloscope to I Limit (J3-E), and set the current limit for (5A/V) at I LIM SET (RV4).
- Connect oscilloscope to ABS I (J1-7), and the three modulated input waveforms at Phase R[⊕](J1-1,J1-2), Phase S[⊕](J1-3,J1-4) and Phase T[⊕](J1-5,J1-6). Adjust I LIM SET (RV4) for desired peak current.
- 6. Calibration complete.

6.6 Calibration Setup Record:

It is good practice to keep a record of all pot settings. Doing so will facilitate calibration on future units and repair on this unit. Although not a substitute for the calibration procedure, it will at least get you "in the ballpark." Remove the power and allow all capacitors to discharge before taking measurements. Note: The balance pot should not be measured in this fashion, set per step 4 in the calibration procedure.

Pot/Dip Switches	AMP1	AMP2	AMP3	AMP4	AMP5	AMP6
TACH J3-C to J3-F (W)						
SIG. 1 J3-A to J3-F (W)						
SIG. 2 J3-B to J3-F (W)						
COMP J3-D to J3-F (W)						
CURRENT LIMIT J3-E to J3-F (W)						
Signal input to Tach ratio: _V Signal / _V Tach						
LIMIT(PULL UP/DN) S1-8(8115), S2-8(8215)						
INHIBIT(PULL UP/DN) S1-7(8115), S2-7(8215), S1-5(8315)						
RESET(PULL UP/DN) S1-3(8115), S2-3(8215), S1-4(8315)						
LIMIT(ACTIVE HI/LOW) S1-5(8115), S2-5(8215)						
INHIBIT(ACTIVE HI/LOW) S1-4(8115), S2-4(8215), S1-3(8315)						
RESET(ACTIVE HI/LOW) S1-3(8115), S2-3(8215), S1-2(8315)						
MTR TEMP(ACTIVE HI/LOW) S1-2(8115), S2-2(8215), S1-1(8315)						
+15/+5 S1-1(8115), S2-1(8215), S1-6(8315)						

Date data taken:	/	/	Serial number S/N:	
Model number SMA				<u>.</u>

6.7 Resolver Alignment:

Note: Glentek motors with built-in resolvers are factory aligned. Consult a Glentek applications engineer prior to attempting a resolver realignment. Failure to do so may void the warrantv.

Note: Consult a Glentek applications engineer before aligning a non-Glentek motor/resolver. Some motor/resolvers require procedures other than that described here.

Note:Dip-switches S3-1, S3-2, S3-3 and S3-4 allow the converter to be operated in one of eight modes. The first six modes set the number of motor "poles". One pole corresponds to one magnet, thus a motor with two "north" and two "south" magnets has four poles. The number of electrical revolutions is equal to one-half the number of poles. An electrical revolution refers to the arc-length the motor will rotate when one complete sine-wave is Therefore, a four-pole motor has two electrical revolutions and requires two sine-waves to make one mechanical (shaft) revolution. The significance of this is, any motor with more than one electrical revolution will have more than one electrical "index" (0 position), while there is only one mechanical index. From an electrical viewpoint, any index may be used, however from a mechanical viewpoint, using a different electrical index may alter the mechanical index by as much as 180 from its previous position. This will show itself as a change in where the encoder index (channel C) pulse occurs.

Note that the emulated encoder has an index per mechanical (shaft) revolution.

Of the remaining two modes, the INDEX is used to generate an index output and is used for resolver alignment.

Motor:	S3-1	S3-2	S3-3	S3-4
2 Pole	ON	ON	ON	ON
4 Pole	ON	ON	ON	OFF
6 Pole	ON	ON	OFF	ON
8 Pole	ON	ON	OFF	OFF
10 Pole	ON	OFF	ON	ON
12 Pole	ON	OFF	ON	OFF
Zero	ON	OFF	OFF	ON
Index	ON	OFF	OFF	OFF

Procedure:

All adjustments are made to the 8000-14 Sine/Resolver pre-amp. Refer to Appendix B, drawings 8000-1430 and 8000-1431.

- 1. Connect and configure the amplifier as described in the installation section. Do not apply power yet.
- 2. Loosen the resolver mounting-screws just enough to allow the resolver to be adjusted.
- 3. Note the positions of S3-1, S3-2, S3-3 and S3-4, then set S3-1, S3-2, S3-3 and S3-4 for **index** (i.e. S3-1:ON, S3-2:OFF, S3-3:OFF and S3-4:OFF).
- Make sure the amplifier is in current mode(S1-7:OFF and S1-8:ON), and set S1-4 to the 'ON' position.
- 5. Apply power. Adjust the motor shaft until the red index LED lights.
- 6. Slowly apply signal input voltage SIGNAL 1+ and SIGNAL 1- (J1-1 & J1-2) for differential input or SIGNAL 2+ and COMMON (J1-3 & J1-4) for single-ended input until the motor shaft becomes reasonably "stiff" (then it can not be easily adjusted). Use Caution! This procedure is applying continuous current to the motor. An excessive CW setting may result in motor damage! The motor will rotate to the correct index position. The amount of rotation will be proportional to the alignment error.
- 7. Slowly rotate the resolver CW or CCW until the index LED is constantly illuminated. Tighten the resolver mounting screws, the LED should still be on.
- 8. Turn the power off.
- 9. Restore the dip-switch settings for the correct type and number of poles for the motor being used by adjusting S3-1, S3-2, S3-3 and S3-4 according to the table on page 45. Set S1-4 back to the 'OFF' position. If the amplifier is to be operated in velocity mode, then set S1-7:ON and S1-8:OFF, otherwise proceed to step 10.
- 10. Turn the power back on and apply a signal input command while monitoring the DC voltage at the tach. out (J1-5) with a digital voltmeter and record this voltage. Now reverse the polarity of the signal input command and record this voltage.

NOTE: Be sure to set the tach. out voltage for 1000 RPM (12-14 bit resolution)

- 11. If the difference between both of the above readings is less than 100mV, the motor is ready to operate. However, if the difference is greater than 100mV, proceed to step12.
- 12. Loosen the resolver mounting screws.
- 13. Alternately apply a positive and negative signal input command while monitoring the tach. out voltage at J1-5.
- 14. Rotate the resolver body slowly back and forth until the difference between both tach. out voltage readings is less than 100mV.
- 15. Tighten the resolver mounting screws and turn the power off.
- 16. Resolver alignment complete.

Chapter Seven: Maintenance, Repair, and Warranty

7.1 Maintenance:

Glentek amplifiers do not require any scheduled maintenance, although it is a good idea to occasionally check for dust build-up or other contamination.

7.2 Amplifier Faults:

If an amplifier should cease to operate and one or more of the fault LED's are lit, review the sections which follow on the fault in question for information and possible causes.

A FAULT CAN ONLY BE CAUSED BY ABNORMAL CONDITIONS. LOCATE AND CORRECT THE CAUSE OF THE FAULT BEFORE REPEATED RECYCLING OF POWER TO THE AMPLIFIER TO PREVENT POSSIBLE DAMAGE.

7.2.1 Table of Fault LED Conditions:

Input or Fault Condition	RUN LED	HS/ECB LED	LS/ECB LED	OVER VOLT LED	OVERTEMP LED	FAULT OUTPUT
Normal Operation	ON	OFF	OFF	OFF	OFF	NO
Limit + (ON)	ON	OFF	OFF	OFF	OFF	NO
Limit - (ON)	ON	OFF	OFF	OFF	OFF	NO
Inhibit (ON)	OFF	OFF	OFF	OFF	OFF	NO
Reset In (ON)	OFF	OFF	OFF	OFF	OFF	NO
Ext. Fault (ON)	OFF	OFF	OFF	OFF	OFF	YES
Undervoltage (+15V)	OFF	OFF	OFF	OFF	OFF	YES
HS/ECB (Latched)	OFF	ON	OFF	OFF	OFF	YES
LS/ECB (Latched)	OFF	OFF	ON	OFF	OFF	YES
Over-voltage B+ (Latched)	OFF	OFF	OFF	ON	OFF	YES
Overtemp (Latched)	OFF	OFF	OFF	OFF	ON	YES

7.2.2 Under Voltage Fault:

When the +15VDC is below +12VDC, a level that would cause unreliable operation, the Run LED will turn off, a Fault Output is generated, and the amplifier is inhibited. This is not a latched condition: that is, if the problem is resolved the amplifier will resume operation.

The following is a list of possible causes:

- 1. Main AC line voltage is too low.
- 2. Bad rectifier bridge.
- 3. Bad DC buss filter capacitor.

7.2.3 Motor Over Temp Fault:

When the motor temperature has reached a level that, if exceeded, would damage the motor, the Run LED will turn off, the OVER TEMP LED will turn on and a Fault Output is generated, and the amplifier is inhibited. Note: This is a latched condition.

The following is a list of possible causes:

- 1. The continuous motor current is too high.
- 2. Binding or stalling of motor shaft due to excessive mechanical overload.
- 3. Motor rating too small for the load.

7.2.4 High Speed Electronic Circuit Breaker (HS/ECB) Fault:

When the peak output of the amplifier exceeds 80A for 10 micro-seconds, the Run LED will turn off, the HS/ECB LED will turn on and a Fault Output is generated, and the amplifier is inhibited. Note: This is a latched condition.

The following is a list of possible causes:

- 1. Shorted motor leads.
- 2. Motor inductance too low.
- 3. Short from a motor lead to ground.

7.2.5 Low Speed Electronic Circuit Breaker (LS/ECB) Fault:

When the RMS output of the amplifier exceeds 15/10A for standard 120/240VAC or 20/15A for High Power 120/240VAC for 3 seconds, the Run LED will turn off, the LS/ECB LED will turn on and a Fault Output is generated, and the amplifier is inhibited. Note: This is a latched condition.

The following is a list of possible causes:

- 1. Binding or stalling of motor shaft due to excessive mechanical overload.
- 2. Overload of amplifier output to motor.
- 3. Large reflected load inertia.

7.2.6 Over Temp Fault:

When the heatsink and or motor temperature has reached a level that, if exceeded, would damage the output transistors or the motor, the Run LED will turn off, the OVER TEMP LED is latched on, a Fault Output is generated, and the amplifier is inhibited.

The following is a list of possible causes:

- 1. Loss of cooling air Fans are defective or airflow is blocked.
- Excessive rise in cooling air temperature due to cabinet ports being blocked or excessive hot air being ingested.
- Extended operational duty cycle due to mechanical overload of motor or defective motor.
- 4. The motors thermal switch has been tripped due to excessive overloading.

7.2.7 Over Voltage Fault:

When the DC-Buss voltage reaches a level that, if exceeded, would harm the amplifier or motor (i.e. +250VDC for standard and +450VDC for High Power), the Run LED will turn off, the Over-voltage LED's are latched on, a Fault Output is generated, and the amplifier is inhibited.

The following is a list of possible causes:

- 1. Main AC line voltage is too high.
- 2. Decelerating a large inertial load. When decelerating, a DC motor acts as a generator. If the inertial load is large, the generated voltage can pump-up the DC-Buss. If this fault occurs, you may need a Regen Clamp. Consult Glentek.

7.2.8 Resetting A Fault:

The fault latch may be reset by pushing the Reset button, activating the Reset input J1-13 or by removing power and allowing the filter capacitor(s) to discharge. Note that the fault latch will not reset unless the fault has been cleared.

7.3 Amplifier Failure:

If an amplifier should fail, that is, if it should cease to operate with no apparent fault, the drawings in appendices A and B will enable a skilled technician to trouble-shoot an amplifier to even lower levels.

The modular construction of the amplifier allows fast and easy repair. This is especially true due to the plug-in personality module card, since all user adjustments and configuration changes are made on this card. If an amplifier module should fail, simply unplug the pre-amp and plug it into a replacement amplifier.

The lowest-level parts or modules which Glentek recommends for field replacement are:

- 1. Fuses on the GP8600 power supply sub-assembly or the ones on the baseplate.
- 2. Fans 201-203
- 3. Amplifier modules A1-A6.

7.4 Factory Repair:

Should it become necessary to return an amplifier to Glentek for repair, please follow the procedure described below:

- Reassemble the unit, if necessary, making certain that all the hardware is in place.
- 2. Tag the unit with the following information:
 - A. Serial number and model number.
 - B. Company name, phone number, and representative returning the unit.
 - C. A brief notation explaining the malfunction.
 - D. Date the unit is being returned.
- 3. Repackage the unit with the same care and fashion in which it was received. Label the container with the appropriate stickers (e.g. FRAGILE: HANDLE WITH CARE).
- 4. Contact a Glentek representative, confirm that the unit is being returned to the factory and obtain an RMA (Return Material Authorization) number. The RMA number must accompany the unit upon return to Glentek.
- 5. Return the unit by the best means possible. The method of freight chosen will directly affect the timeliness of its return.

Glentek also offers a one-day repair service in the unlikely event that your system is down and you do not have a replacement amplifier module.


7.5 Warranty:


Any product, or part thereof, manufactured by Glentek, Inc., described in this manual, which, under normal operating conditions in the plant of the original purchaser thereof, proves defective in material or workmanship within one year from the date of shipment by us, as determined by an inspection by us, will be repaired or replaced free of charge, FOB our factory, El Segundo, California, U.S.A. provided that you promptly send to us notice of the defect and establish that the product has been properly installed, maintained, and operated within the limits of rated and normal usage, and that no factory sealed adjustments have been tampered with. Glentek's liability is limited to repair or replacement of defective parts.


Any product or part manufactured by others and merely installed by us, such as an electric motor, etc., is specifically not warranted by us and it is agreed that such product or part shall only carry the warranty, if any, supplied by the manufacturer of that part. It is also understood that you must look directly to such manufacturer for any defect, failure, claim or damage caused by such product or part.

Under no circumstances shall Glentek, Inc. or any of our affiliates have any liability whatsoever for claims or damages arising out of the loss of use of any product or part sold to you. Nor shall we have any liability to yourself or anyone for any indirect or consequential damages such as injuries to person and property caused directly or indirectly by the product or part sold to you, and you agree in accepting our product or part to save us harmless from any and all such claims or damages that may be initiated against us by third parties.


_	APPENDIX A: AMPLIFIER DRAWINGS
	Appendix A
	Amplifier Drawings
1	

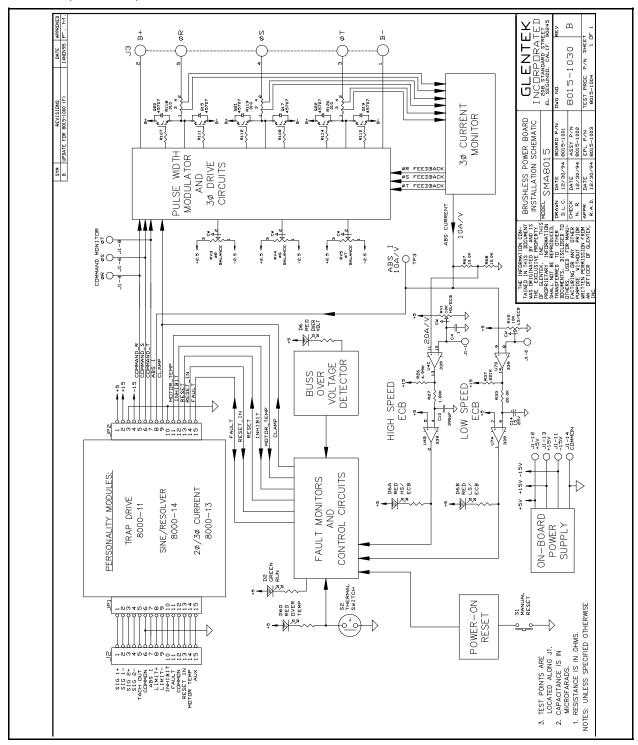


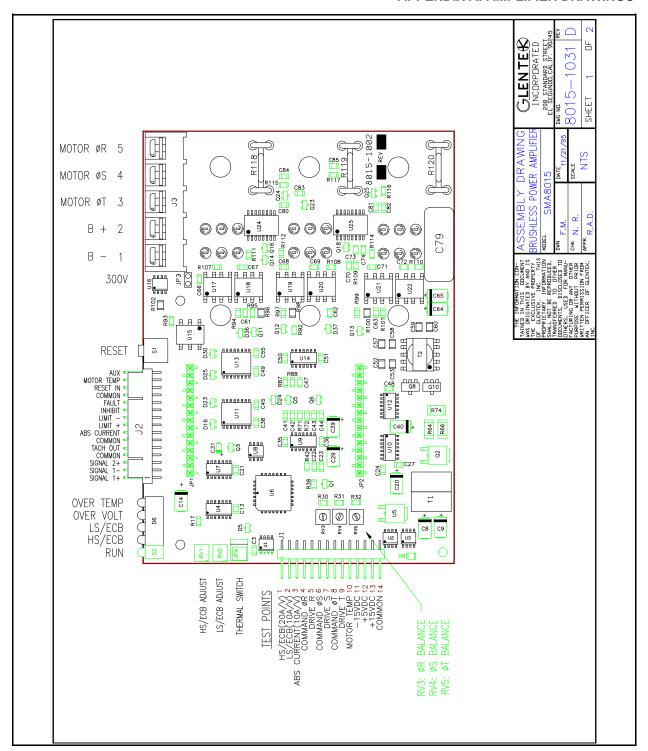


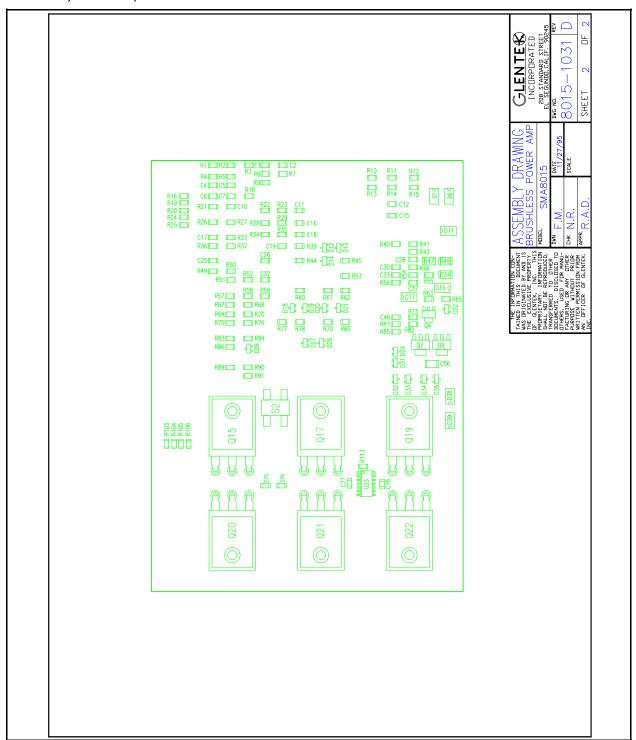



APPENDIX A: AMPLIFIER DRAWINGS

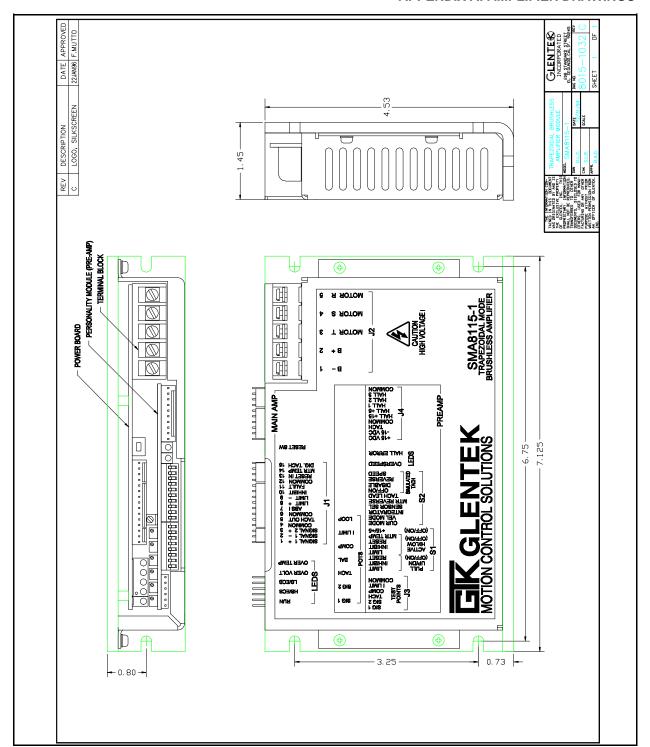


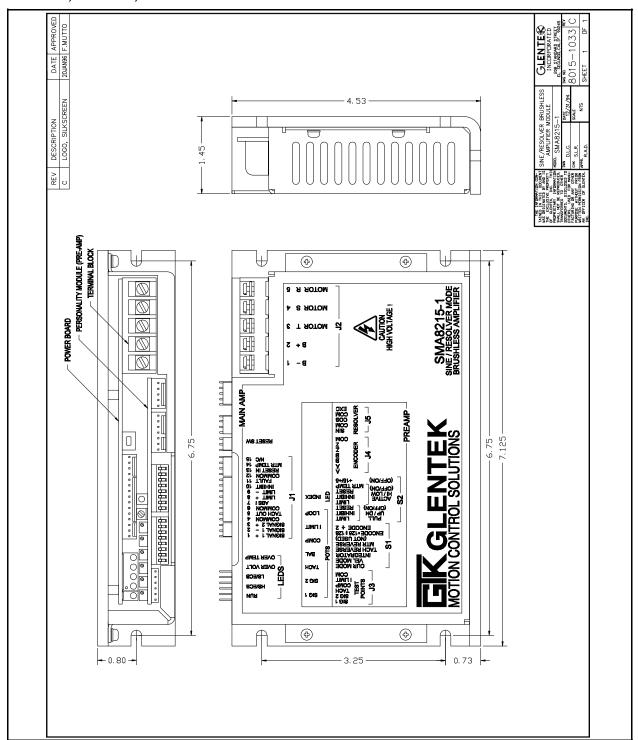


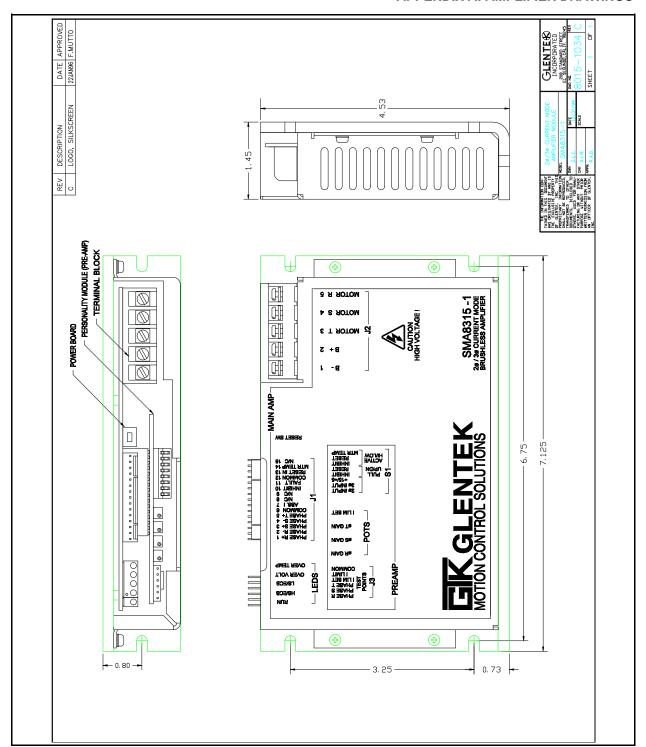


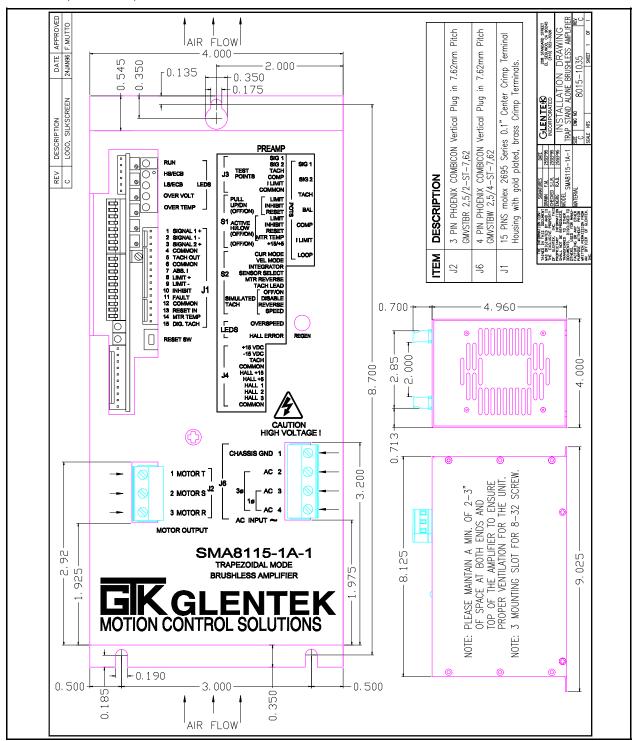


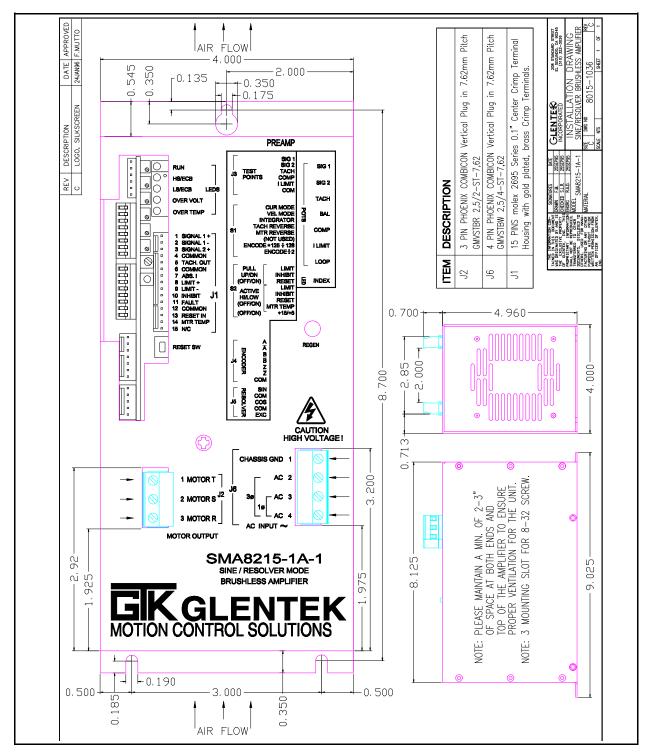


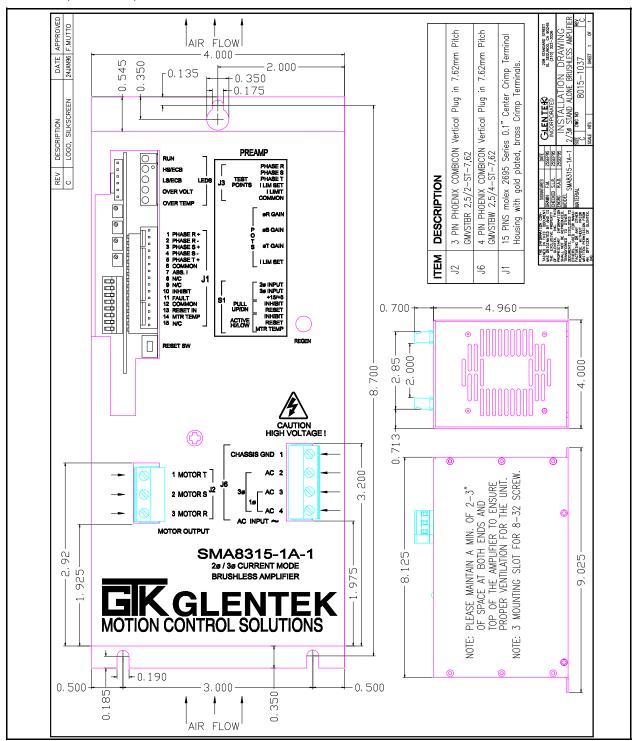

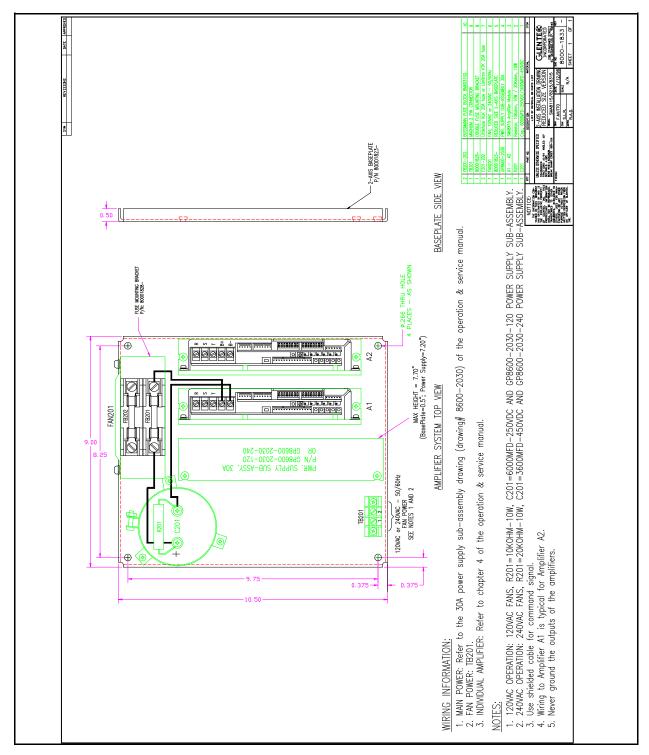


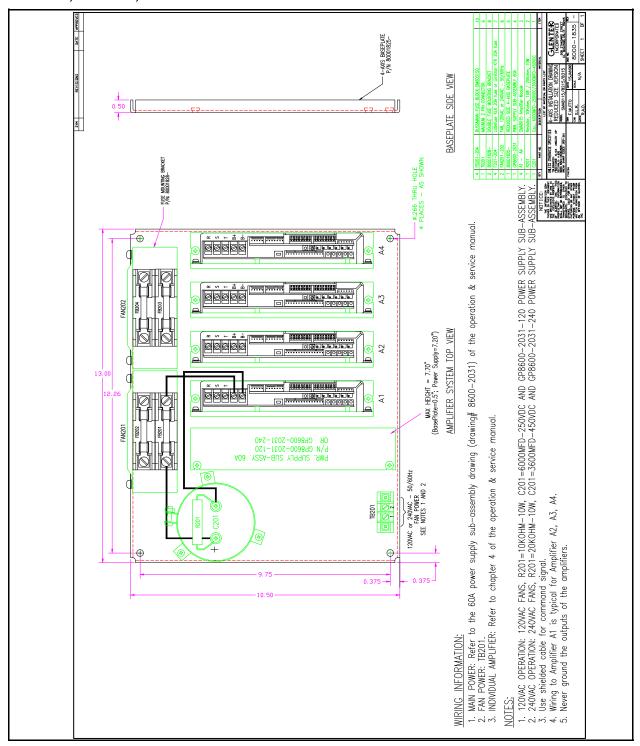


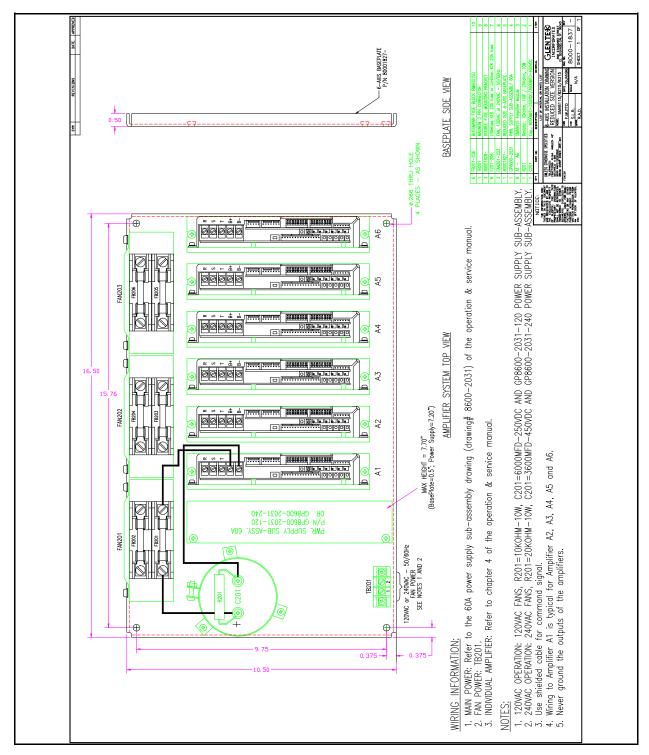


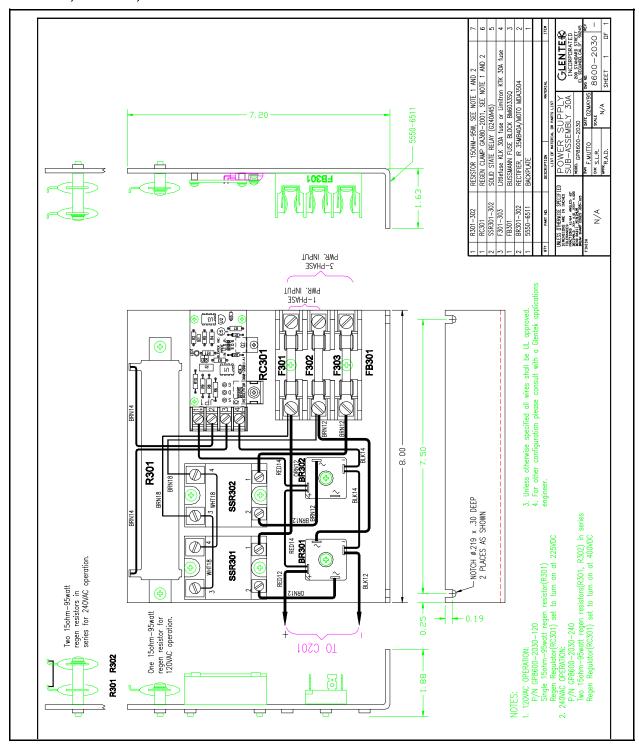



APPENDIX A: AMPLIFIER DRAWINGS

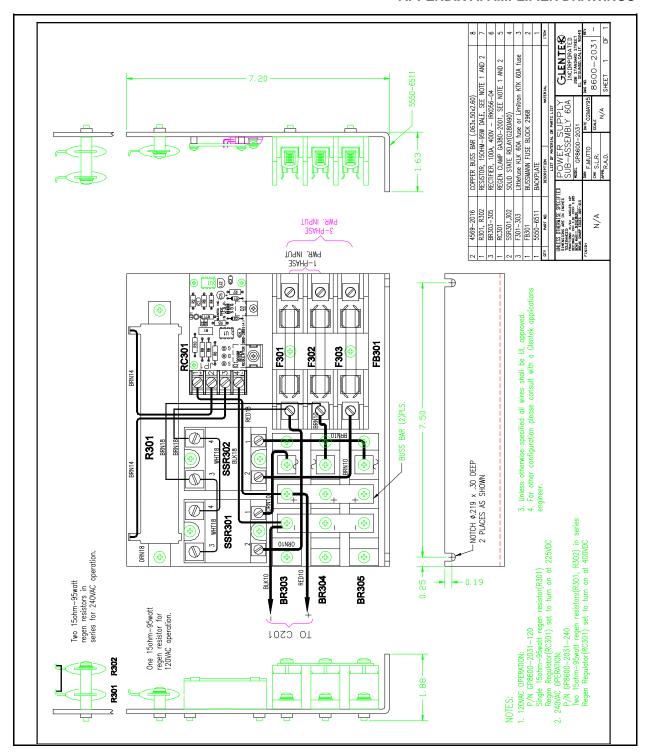


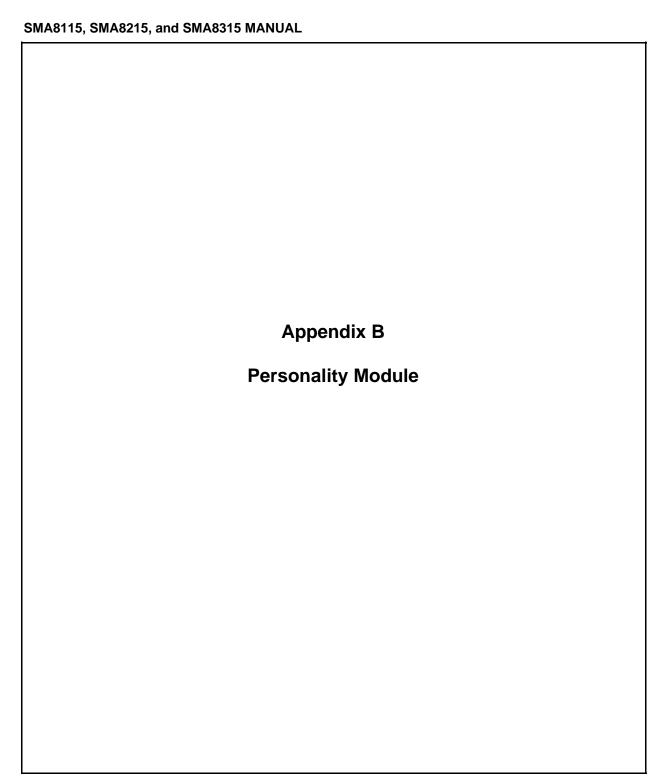


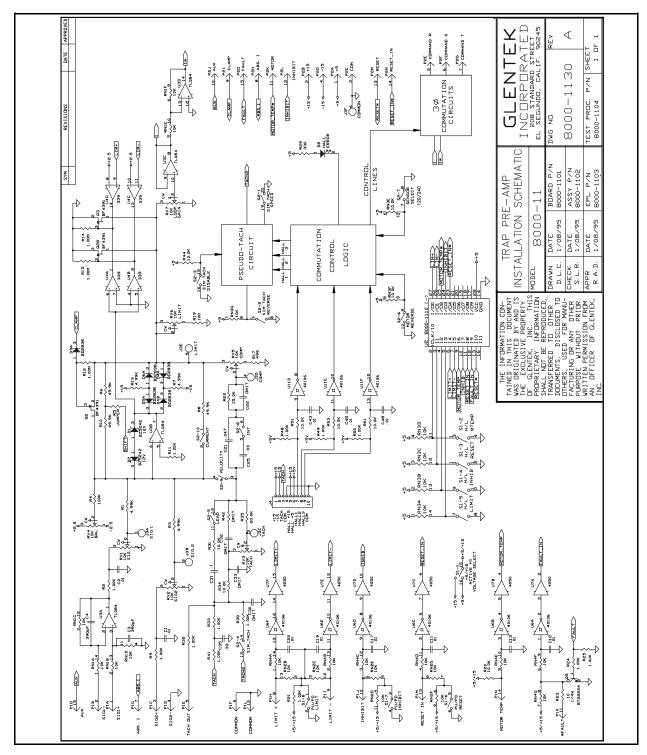


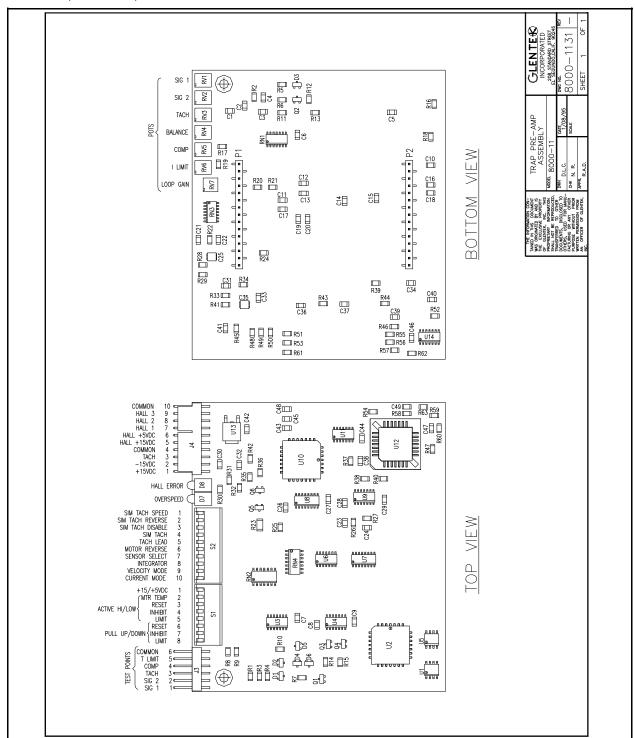


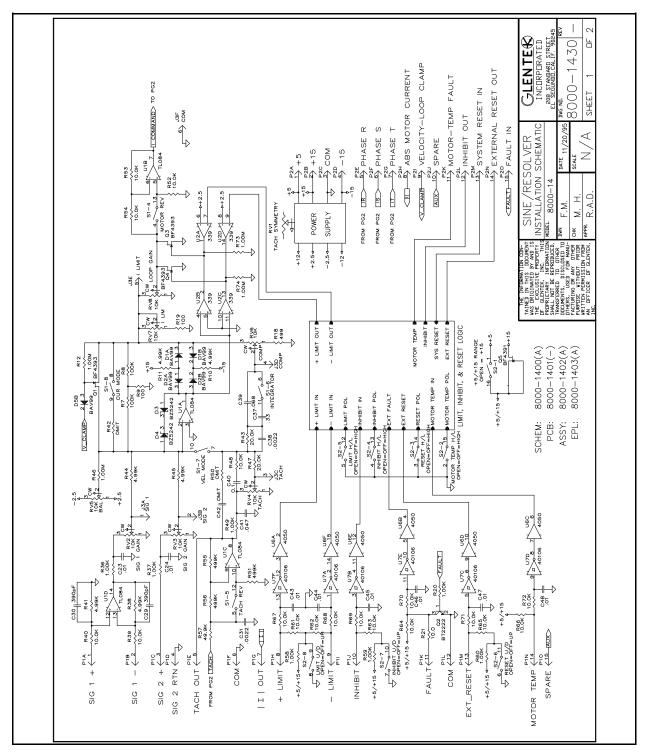

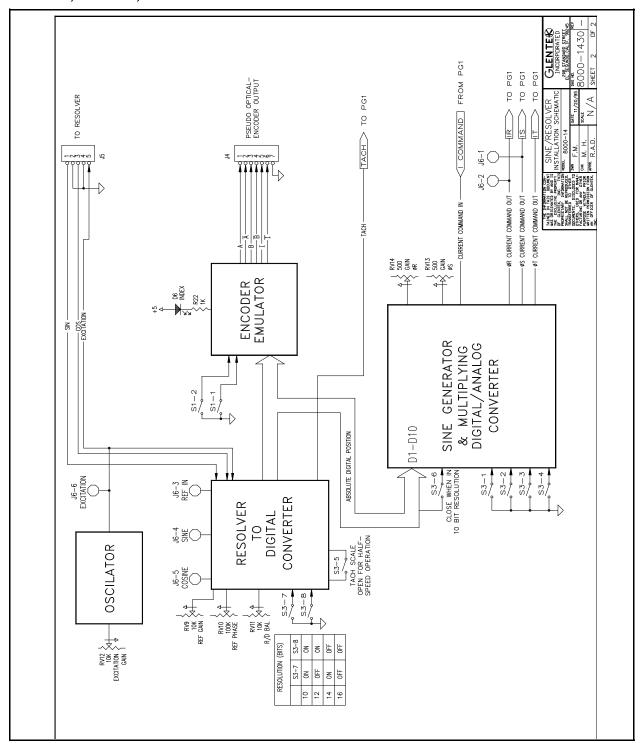

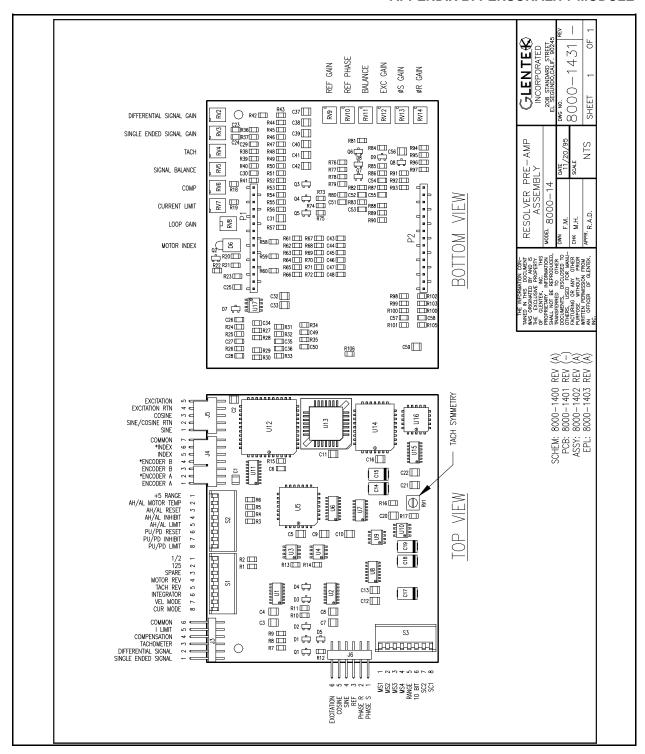

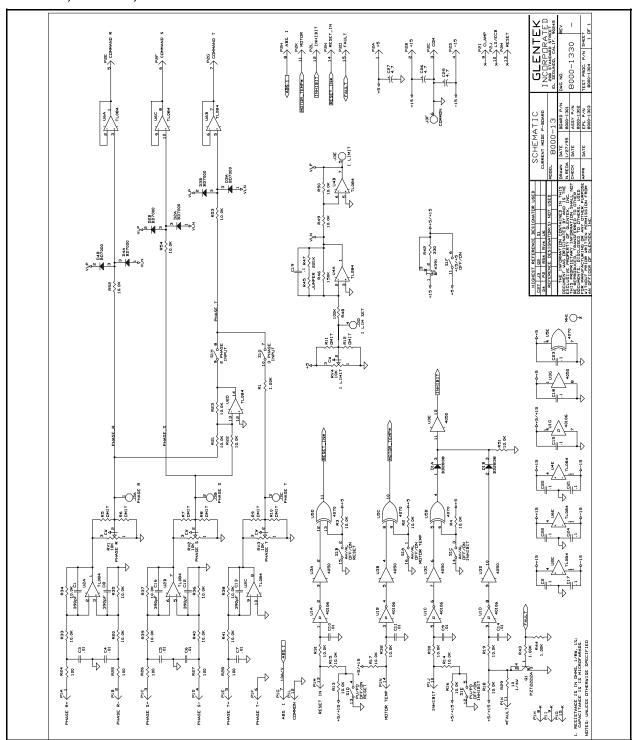

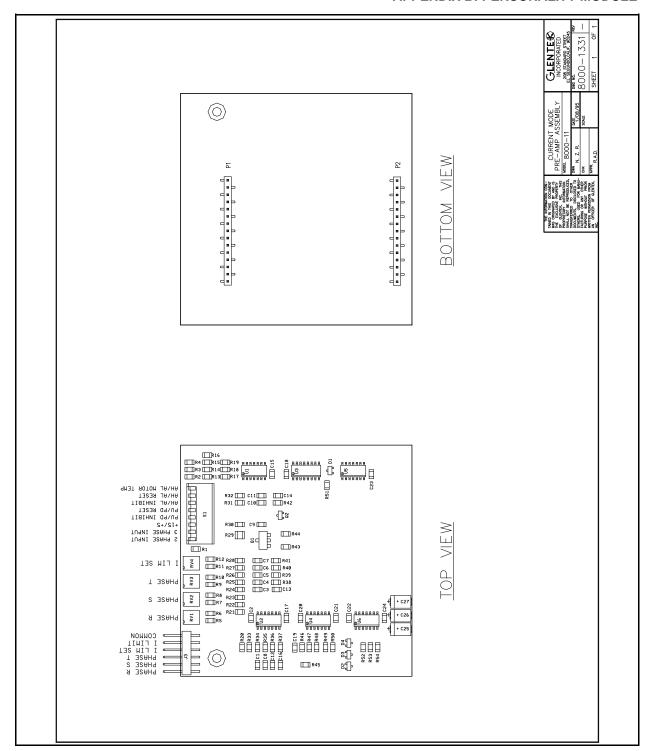

NOTES

High Bandwidth Brush Type Servo Amplifiers

- Linear Brush type servo amplifiers to 2.25KW
- PWM (Pulse-width-modulated) Brush type servo amplifiers to 70KW

High Bandwidth Brushless Servo Amplifiers

- Linear Brushless servo amplifiers to 2.25KW
- PWM (Pulse-width-modulated) Brushless servo amplifiers to 65KW

Permanent Magnet DC Brush Type Servo Motors

- Continuous Torques to 335 in. lb.
- Peak Torques to 2100 in. lb.

Permanent Magnet DC Brushless Servo Motors

- Continuous Torques to 1100 in. lb.
- Peak Torques to 2200 in. lb.



208 STANDARD STREET, EL SEGUNDO, CALIFORNIA 90245, USA. TELEPHONE: (310)322-3026 FAX: (310)322-7709



Artisan Technology Group is your source for quality new and certified-used/pre-owned equipment

 FAST SHIPPING AND DELIVERY TENS OF THOUSANDS OF **IN-STOCK ITEMS** EQUIPMENT DEMOS HUNDREDS OF SUPPORTED LEASING/MONTHLY

SECURE ASSET SOLUTIONS

Instra View REMOTE INSPECTION

SERVICE CENTER REPAIRS

Remotely inspect equipment before purchasing with our interactive website at www.instraview.com ↗

Experienced engineers and technicians on staff

at our full-service, in-house repair center

Contact us: (888) 88-SOURCE | sales@artisantg.com | www.artisantg.com

www.artisantg.com/WeBuyEquipment >

LOOKING FOR MORE INFORMATION? Visit us on the web at **www.artisantg.com** [→] for more information on price quotations, drivers, technical

Sell your excess, underutilized, and idle used equipment

We also offer credit for buy-backs and trade-ins

WE BUY USED EQUIPMENT

specifications, manuals, and documentation