

**HOBART**  
W E L D E R S



OM-235 281A

2009-07

**Processes**



Gas Metal Arc (MIG) Welding


Flux Cored Arc (FCAW)  
Welding

**Description**



Arc Welding Power Source and Wire  
Feeder

# IronMan<sup>TM</sup> 230 And H200L4-15 Gun

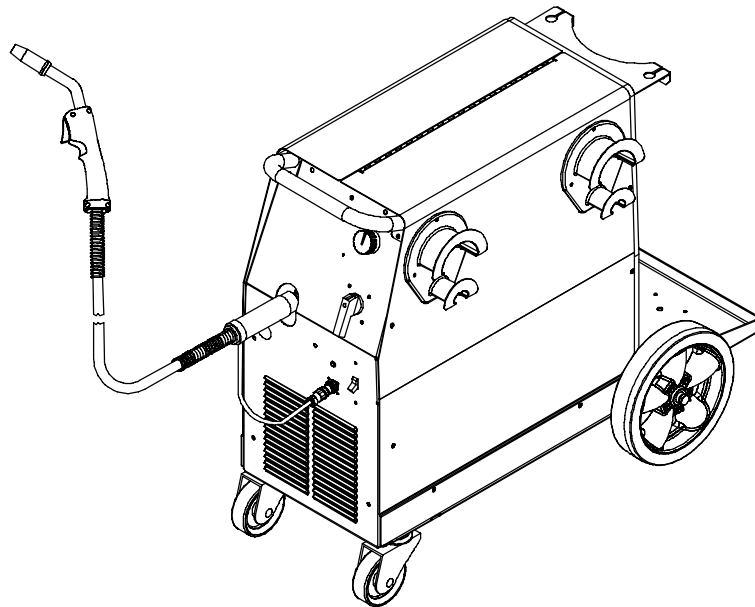

[www.HobartWelders.com](http://www.HobartWelders.com)



## OWNER'S MANUAL

File: MIG (GMAW)



# From Hobart to You

---


*Thank you and congratulations* on choosing Hobart. Now you can get the job done and get it done right. We know you don't have time to do it any other way.

This Owner's Manual is designed to help you get the most out of your Hobart products. Please take time to read the Safety precautions. They will help you protect yourself against potential hazards on the worksite.



Hobart is registered to the ISO 9001:2000 Quality System Standard.

We've made installation and operation quick and easy. With Hobart you can count on years of reliable service with proper maintenance. And if for some reason the unit needs repair, there's a Troubleshooting section that will help you figure out what the problem is. The parts list will then help you to decide the exact part you may need to fix the problem. Warranty and service information for your particular model are also provided.

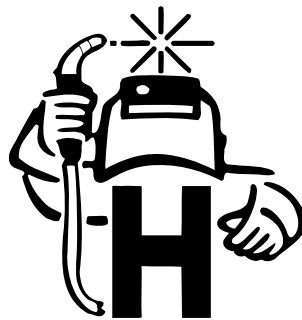

Hobart Welders manufactures a full line of welders and welding related equipment. For information on other quality Hobart products, contact your local Hobart distributor to receive the latest full line catalog or individual specification sheets. **To locate your nearest distributor or service agency call 1-877-Hobart1 or visit our website at [www.HobartWelders.com](http://www.HobartWelders.com).**

For Technical Help call 1-800-332-3281.

## 5/3/1 WARRANTY

Working as hard as you do – every power source from Hobart is backed by the best warranty in the business.

**Protect Your Investment!**



**Register your product at:**  
**[HobartWelders.com](http://HobartWelders.com)**

# TABLE OF CONTENTS

---

<b>SECTION 1 – SAFETY PRECAUTIONS - READ BEFORE USING</b> .....	<b>1</b>
1-1. Symbol Usage .....	1
1-2. Arc Welding Hazards .....	1
1-3. Additional Symbols For Installation, Operation, And Maintenance .....	3
1-4. California Proposition 65 Warnings .....	4
1-5. Principal Safety Standards .....	4
1-6. EMF Information .....	4
<b>SECTION 2 – CONSIGNES DE SÉCURITÉ – LIRE AVANT UTILISATION</b> .....	<b>5</b>
2-1. Symboles utilisés .....	5
2-2. Dangers relatifs au soudage à l'arc .....	5
2-3. Dangers supplémentaires en relation avec l'installation, le fonctionnement et la maintenance .....	7
2-4. Proposition californienne 65 Avertissements .....	8
2-5. Principales normes de sécurité .....	9
2-6. Information EMF .....	9
<b>SECTION 3 – INTRODUCTION</b> .....	<b>11</b>
3-1. Specifications .....	11
3-2. Welding Power Source Duty Cycle And Overheating .....	11
3-3. Volt-Ampere Curves .....	12
3-4. Installing Welding Gun .....	13
3-5. Connecting To Weld Output Terminals .....	14
3-6. Installing Work Clamp .....	14
3-7. Setting Gun Polarity For Wire Type .....	15
3-8. Installing 2 lb Wire Spool And Adjusting Hub Tension .....	15
3-9. Installing 10 lb Wire Spool And Adjusting Hub Tension .....	16
3-10. Installing 33 lb Wire Spool And Adjusting Hub Tension .....	16
3-11. Installing Gas Supply .....	17
3-12. Positioning Jumper Links .....	18
3-13. Electrical Service Guide .....	19
3-14. Selecting A Location And Connecting Input Power .....	20
3-15. Threading Welding Wire .....	21
3-16. Installing Optional DP 3545 Spool Gun To Welding Power Source .....	22
<b>SECTION 4 – OPERATION</b> .....	<b>23</b>
4-1. Controls .....	23
4-2. Weld Parameters .....	24
<b>SECTION 5 – MAINTENANCE AND TROUBLESHOOTING</b> .....	<b>25</b>
5-1. Routine Maintenance .....	25
5-2. Supplementary Protectors .....	25
5-3. Replacing Drive Roll And Wire Inlet Guide .....	26
5-4. Removing Knob From Front Panel .....	26
5-5. Aligning Drive Rolls and Wire Guide .....	27
5-6. Replacing Gun Contact Tip .....	27
5-7. Installing Cable Hangers .....	28
5-8. Removing Nozzle, Contact Tip, And Adapter, Changing Liner, And Cleaning Gun Casing .....	29
5-9. Welding Troubleshooting Table .....	30
5-10. Wire Drive/Gun Troubleshooting Table .....	30

# TABLE OF CONTENTS

---


<b>SECTION 6 – MIG WELDING (GMAW) GUIDELINES</b> .....	<b>31</b>
6-1. Typical MIG Process Connections .....	31
6-2. Typical MIG Process Control Settings .....	32
6-3. Holding And Positioning Welding Gun .....	33
6-4. Conditions That Affect Weld Bead Shape .....	34
6-5. Gun Movement During Welding .....	35
6-6. Poor Weld Bead Characteristics .....	35
6-7. Good Weld Bead Characteristics .....	35
6-8. Troubleshooting – Excessive Spatter .....	36
6-9. Troubleshooting – Porosity .....	36
6-10. Troubleshooting – Excessive Penetration .....	36
6-11. Troubleshooting – Lack Of Penetration .....	37
6-12. Troubleshooting – Incomplete Fusion .....	37
6-13. Troubleshooting – Burn-Through .....	37
6-14. Troubleshooting – Waviness Of Bead .....	38
6-15. Troubleshooting – Distortion .....	38
6-16. Common MIG Shielding Gases .....	39
6-17. Troubleshooting Guide For Semiautomatic Welding Equipment .....	39
<b>SECTION 7 – ELECTRICAL DIAGRAM</b> .....	<b>41</b>
<b>SECTION 8 – PARTS LIST</b> .....	<b>42</b>
<b>WARRANTY</b>	


# SECTION 1 – SAFETY PRECAUTIONS - READ BEFORE USING

som\_2009-07

 Protect yourself and others from injury — read and follow these precautions.

## 1-1. Symbol Usage

 **DANGER!** – Indicates a hazardous situation which, if not avoided, will result in death or serious injury. The possible hazards are shown in the adjoining symbols or explained in the text.

 Indicates a hazardous situation which, if not avoided, could result in death or serious injury. The possible hazards are shown in the adjoining symbols or explained in the text.


**NOTICE** – Indicates statements not related to personal injury.

 Indicates special instructions.



This group of symbols means Warning! Watch Out! ELECTRIC SHOCK, MOVING PARTS, and HOT PARTS hazards. Consult symbols and related instructions below for necessary actions to avoid the hazards.

## 1-2. Arc Welding Hazards

 The symbols shown below are used throughout this manual to call attention to and identify possible hazards. When you see the symbol, watch out, and follow the related instructions to avoid the hazard. The safety information given below is only a summary of the more complete safety information found in the Safety Standards listed in Section 1-5. Read and follow all Safety Standards.

 Only qualified persons should install, operate, maintain, and repair this unit.

 During operation, keep everybody, especially children, away.



### ELECTRIC SHOCK can kill.

Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.

- Do not touch live electrical parts.
- Wear dry, hole-free insulating gloves and body protection.
- Insulate yourself from work and ground using dry insulating mats or covers big enough to prevent any physical contact with the work or ground.
- Do not use AC output in damp areas, if movement is confined, or if there is a danger of falling.
- Use AC output ONLY if required for the welding process.
- If AC output is required, use remote output control if present on unit.
- Additional safety precautions are required when any of the following electrically hazardous conditions are present: in damp locations or while wearing wet clothing; on metal structures such as floors, gratings, or scaffolds; when in cramped positions such as sitting, kneeling, or lying; or when there is a high risk of unavoidable or accidental contact with the workpiece or ground. For these conditions, use the following equipment in order presented: 1) a semiautomatic DC constant voltage (wire) welder, 2) a DC manual (stick) welder, or 3) an AC welder with reduced open-circuit voltage. In most situations, use of a DC, constant voltage wire welder is recommended. And, do not work alone!
- Disconnect input power or stop engine before installing or servicing this equipment. Lockout/tagout input power according to OSHA 29 CFR 1910.147 (see Safety Standards).

- Properly install and ground this equipment according to its Owner's Manual and national, state, and local codes.
- Always verify the supply ground – check and be sure that input power cord ground wire is properly connected to ground terminal in disconnect box or that cord plug is connected to a properly grounded receptacle outlet.
- When making input connections, attach proper grounding conductor first – double-check connections.
- Keep cords dry, free of oil and grease, and protected from hot metal and sparks.
- Frequently inspect input power cord for damage or bare wiring – replace cord immediately if damaged – bare wiring can kill.
- Turn off all equipment when not in use.
- Do not use worn, damaged, undersized, or poorly spliced cables.
- Do not drape cables over your body.
- If earth grounding of the workpiece is required, ground it directly with a separate cable.
- Do not touch electrode if you are in contact with the work, ground, or another electrode from a different machine.
- Do not touch electrode holders connected to two welding machines at the same time since double open-circuit voltage will be present.
- Use only well-maintained equipment. Repair or replace damaged parts at once. Maintain unit according to manual.
- Wear a safety harness if working above floor level.
- Keep all panels and covers securely in place.
- Clamp work cable with good metal-to-metal contact to workpiece or worktable as near the weld as practical.
- Insulate work clamp when not connected to workpiece to prevent contact with any metal object.
- Do not connect more than one electrode or work cable to any single weld output terminal.

### SIGNIFICANT DC VOLTAGE exists in inverter welding power sources AFTER removal of input power.

- Turn Off inverter, disconnect input power, and discharge input capacitors according to instructions in Maintenance Section before touching any parts.



### HOT PARTS can burn.

- Do not touch hot parts bare handed.
- Allow cooling period before working on equipment.
- To handle hot parts, use proper tools and/or wear heavy, insulated welding gloves and clothing to prevent burns.



### FUMES AND GASES can be hazardous.

Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

- Keep your head out of the fumes. Do not breathe the fumes.
- If inside, ventilate the area and/or use local forced ventilation at the arc to remove welding fumes and gases.
- If ventilation is poor, wear an approved air-supplied respirator.
- Read and understand the Material Safety Data Sheets (MSDSs) and the manufacturer's instructions for metals, consumables, coatings, cleaners, and degreasers.
- Work in a confined space only if it is well ventilated, or while wearing an air-supplied respirator. Always have a trained watch-person nearby. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.
- Do not weld in locations near degreasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapors to form highly toxic and irritating gases.
- Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.



### ARC RAYS can burn eyes and skin.

Arc rays from the welding process produce intense visible and invisible (ultraviolet and infrared) rays that can burn eyes and skin. Sparks fly off from the weld.

- Wear an approved welding helmet fitted with a proper shade of filter lenses to protect your face and eyes from arc rays and sparks when welding or watching (see ANSI Z49.1 and Z87.1 listed in Safety Standards).
- Wear approved safety glasses with side shields under your helmet.
- Use protective screens or barriers to protect others from flash, glare and sparks; warn others not to watch the arc.
- Wear protective clothing made from durable, flame-resistant material (leather, heavy cotton, or wool) and foot protection.




### WELDING can cause fire or explosion.

Welding on closed containers, such as tanks, drums, or pipes, can cause them to blow up. Sparks can fly off from the welding arc. The flying sparks, hot workpiece, and hot equipment can cause fires and burns. Accidental contact of electrode to metal objects can cause sparks, explosion, overheating, or fire. Check and be sure the area is safe before doing any welding.

- Remove all flammables within 35 ft (10.7 m) of the welding arc. If this is not possible, tightly cover them with approved covers.
- Do not weld where flying sparks can strike flammable material.
- Protect yourself and others from flying sparks and hot metal.
- Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas.
- Watch for fire, and keep a fire extinguisher nearby.
- Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.
- Do not weld on closed containers such as tanks, drums, or pipes, unless they are properly prepared according to AWS F4.1 (see Safety Standards).
- Do not weld where the atmosphere may contain flammable dust, gas, or liquid vapors (such as gasoline).
- Connect work cable to the work as close to the welding area as practical to prevent welding current from traveling long, possibly unknown paths and causing electric shock, sparks, and fire hazards.
- Do not use welder to thaw frozen pipes.

- Remove stick electrode from holder or cut off welding wire at contact tip when not in use.
- Wear oil-free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap.
- Remove any combustibles, such as a butane lighter or matches, from your person before doing any welding.
- After completion of work, inspect area to ensure it is free of sparks, glowing embers, and flames.
- Use only correct fuses or circuit breakers. Do not oversize or bypass them.
- Follow requirements in OSHA 1910.252 (a) (2) (iv) and NFPA 51B for hot work and have a fire watcher and extinguisher nearby.

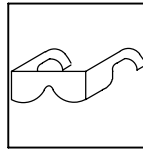


### FLYING METAL or DIRT can injure eyes.

- Welding, chipping, wire brushing, and grinding cause sparks and flying metal. As welds cool, they can throw off slag.
- Wear approved safety glasses with side shields even under your welding helmet.




### BUILDUP OF GAS can injure or kill.

- Shut off shielding gas supply when not in use.
- Always ventilate confined spaces or use approved air-supplied respirator.

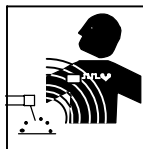

### MAGNETIC FIELDS can affect Implanted Medical Devices.


- Wearers of Pacemakers and other Implanted Medical Devices should keep away.
- Implanted Medical Device wearers should consult their doctor and the device manufacturer before going near arc welding, spot welding, gouging, plasma arc cutting, or induction heating operations.

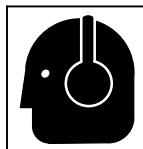

### NOISE can damage hearing.

Noise from some processes or equipment can damage hearing.

- Wear approved ear protection if noise level is high.

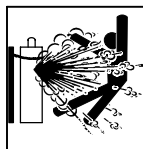

### CYLINDERS can explode if damaged.

Shielding gas cylinders contain gas under high pressure. If damaged, a cylinder can explode. Since gas cylinders are normally part of the welding process, be sure to treat them carefully.

- Protect compressed gas cylinders from excessive heat, mechanical shocks, physical damage, slag, open flames, sparks, and arcs.
- Install cylinders in an upright position by securing to a stationary support or cylinder rack to prevent falling or tipping.
- Keep cylinders away from any welding or other electrical circuits.
- Never drape a welding torch over a gas cylinder.
- Never allow a welding electrode to touch any cylinder.
- Never weld on a pressurized cylinder – explosion will result.
- Use only correct shielding gas cylinders, regulators, hoses, and fittings designed for the specific application; maintain them and associated parts in good condition.
- Turn face away from valve outlet when opening cylinder valve.
- Keep protective cap in place over valve except when cylinder is in use or connected for use.
- Use the right equipment, correct procedures, and sufficient number of persons to lift and move cylinders.
- Read and follow instructions on compressed gas cylinders, associated equipment, and Compressed Gas Association (CGA) publication P-1 listed in Safety Standards.

## 1-3. Additional Symbols For Installation, Operation, And Maintenance




### FIRE OR EXPLOSION hazard.

- Do not install or place unit on, over, or near combustible surfaces.
- Do not install unit near flammables.
- Do not overload building wiring – be sure power supply system is properly sized, rated, and protected to handle this unit.




### FALLING EQUIPMENT can injure.

- Use lifting eye to lift unit only, NOT running gear, gas cylinders, or any other accessories.
- Use equipment of adequate capacity to lift and support unit.
- If using lift forks to move unit, be sure forks are long enough to extend beyond opposite side of unit.
- Keep equipment (cables and cords) away from moving vehicles when working from an aerial location.
- Follow the guidelines in the Applications Manual for the Revised NIOSH Lifting Equation (Publication No. 94-110) when manually lifting heavy parts or equipment.

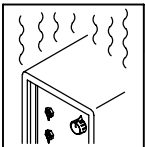


### OVERUSE can cause OVERHEATING

- Allow cooling period; follow rated duty cycle.
- Reduce current or reduce duty cycle before starting to weld again.
- Do not block or filter airflow to unit.

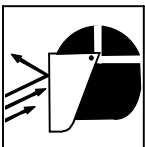

### FLYING SPARKS can injure.

- Wear a face shield to protect eyes and face.
- Shape tungsten electrode only on grinder with proper guards in a safe location wearing proper face, hand, and body protection.
- Sparks can cause fires — keep flammables away.

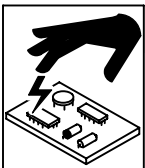

### STATIC (ESD) can damage PC boards.

- Put on grounded wrist strap BEFORE handling boards or parts.
- Use proper static-proof bags and boxes to store, move, or ship PC boards.



### MOVING PARTS can injure.

- Keep away from moving parts.
- Keep away from pinch points such as drive rolls.




### WELDING WIRE can injure.

- Do not press gun trigger until instructed to do so.
- Do not point gun toward any part of the body, other people, or any metal when threading welding wire.




### MOVING PARTS can injure.

- Keep away from moving parts such as fans.
- Keep all doors, panels, covers, and guards closed and securely in place.
- Have only qualified persons remove doors, panels, covers, or guards for maintenance and troubleshooting as necessary.
- Reinstall doors, panels, covers, or guards when maintenance is finished and before reconnecting input power.

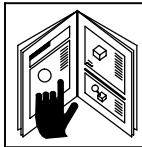


### READ INSTRUCTIONS.

- Read and follow all labels and the Owner's Manual carefully before installing, operating, or servicing unit. Read the safety information at the beginning of the manual and in each section.
- Use only genuine replacement parts from the manufacturer.
- Perform maintenance and service according to the Owner's Manuals, industry standards, and national, state, and local codes.

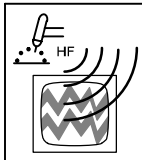

### H.F. RADIATION can cause interference.

- High-frequency (H.F.) can interfere with radio navigation, safety services, computers, and communications equipment.
- Have only qualified persons familiar with electronic equipment perform this installation.
- The user is responsible for having a qualified electrician promptly correct any interference problem resulting from the installation.
- If notified by the FCC about interference, stop using the equipment at once.
- Have the installation regularly checked and maintained.
- Keep high-frequency source doors and panels tightly shut, keep spark gaps at correct setting, and use grounding and shielding to minimize the possibility of interference.

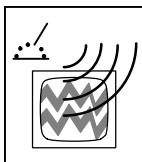


### ARC WELDING can cause interference.


- Electromagnetic energy can interfere with sensitive electronic equipment such as computers and computer-driven equipment such as robots.
- Be sure all equipment in the welding area is electromagnetically compatible.
- To reduce possible interference, keep weld cables as short as possible, close together, and down low, such as on the floor.
- Locate welding operation 100 meters from any sensitive electronic equipment.
- Be sure this welding machine is installed and grounded according to this manual.
- If interference still occurs, the user must take extra measures such as moving the welding machine, using shielded cables, using line filters, or shielding the work area.

## 1-4. California Proposition 65 Warnings


 Welding or cutting equipment produces fumes or gases which contain chemicals known to the State of California to cause birth defects and, in some cases, cancer. (California Health & Safety Code Section 25249.5 et seq.)

 Battery posts, terminals and related accessories contain lead and lead compounds, chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. Wash hands after handling.

For Gasoline Engines:

 Engine exhaust contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.

For Diesel Engines:

 Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm.

## 1-5. Principal Safety Standards

*Safety in Welding, Cutting, and Allied Processes*, ANSI Standard Z49.1, from Global Engineering Documents (phone: 1-877-413-5184, website: [www.global.ihs.com](http://www.global.ihs.com)).

*Safe Practices for the Preparation of Containers and Piping for Welding and Cutting*, American Welding Society Standard AWS F4.1, from Global Engineering Documents (phone: 1-877-413-5184, website: [www.global.ihs.com](http://www.global.ihs.com)).

*National Electrical Code*, NFPA Standard 70, from National Fire Protection Association, Quincy, MA 02269 (phone: 1-800-344-3555, website: [www.nfpa.org](http://www.nfpa.org) and [www.sparky.org](http://www.sparky.org)).

*Safe Handling of Compressed Gases in Cylinders*, CGA Pamphlet P-1, from Compressed Gas Association, 4221 Walney Road, 5th Floor, Chantilly, VA 20151 (phone: 703-788-2700, website: [www.cganet.com](http://www.cganet.com)).

*Safety in Welding, Cutting, and Allied Processes*, CSA Standard W117.2, from Canadian Standards Association, Standards Sales, 5060 Spectrum Way, Suite 100, Ontario, Canada L4W 5NS (phone: 800-463-6727, website: [www.csa-international.org](http://www.csa-international.org)).

*Safe Practice For Occupational And Educational Eye And Face Protection*, ANSI Standard Z87.1, from American National Standards Institute,

25 West 43rd Street, New York, NY 10036 (phone: 212-642-4900, website: [www.ansi.org](http://www.ansi.org)).

*Standard for Fire Prevention During Welding, Cutting, and Other Hot Work*, NFPA Standard 51B, from National Fire Protection Association, Quincy, MA 02269 (phone: 1-800-344-3555, website: [www.nfpa.org](http://www.nfpa.org)).

OSHA, Occupational Safety and Health Standards for General Industry, Title 29, Code of Federal Regulations (CFR), Part 1910, Subpart Q, and Part 1926, Subpart J, from U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250-7954 (phone: 1-866-512-1800) (there are 10 OSHA Regional Offices—phone for Region 5, Chicago, is 312-353-2220, website: [www.osha.gov](http://www.osha.gov)).

U.S. Consumer Product Safety Commission (CPSC), 4330 East West Highway, Bethesda, MD 20814 (phone: 301-504-7923, website: [www.cpsc.gov](http://www.cpsc.gov)).

*Applications Manual for the Revised NIOSH Lifting Equation*, The National Institute for Occupational Safety and Health (NIOSH), 1600 Clifton Rd, Atlanta, GA 30333 (phone: 1-800-232-4636, website: [www.cdc.gov/NIOSH](http://www.cdc.gov/NIOSH)).

## 1-6. EMF Information

Considerations About Welding And The Effects Of Low Frequency Electric And Magnetic Fields

Welding current, as it flows through welding cables, will cause electromagnetic fields. There has been and still is some concern about such fields. However, after examining more than 500 studies spanning 17 years of research, a special blue ribbon committee of the National Research Council concluded that: "The body of evidence, in the committee's judgment, has not demonstrated that exposure to power-frequency electric and magnetic fields is a human-health hazard." However, studies are still going forth and evidence continues to be examined. Until the final conclusions of the research are reached, you may wish to minimize your exposure to electromagnetic fields when welding or cutting.

To reduce magnetic fields in the workplace, use the following procedures:

1. Keep cables close together by twisting or taping them, or using a cable cover.
2. Arrange cables to one side and away from the operator.
3. Do not coil or drape cables around your body.
4. Keep welding power source and cables as far away from operator as practical.
5. Connect work clamp to workpiece as close to the weld as possible.

### About Implanted Medical Devices:

Implanted Medical Device wearers should consult their doctor and the device manufacturer before performing or going near arc welding, spot welding, gouging, plasma arc cutting, or induction heating operations. If cleared by your doctor, then following the above procedures is recommended.



# SECTION 2 – CONSIGNES DE SÉCURITÉ – LIRE AVANT UTILISATION

fre\_som\_2007-04

**!** Se protéger et protéger les autres contre le risque de blessure — lire et respecter ces consignes.

## 2-1. Symboles utilisés



**DANGER!** – Indique une situation dangereuse qui si on l'évite pas peut donner la mort ou des blessures graves. Les dangers possibles sont montrés par les symboles joints ou sont expliqués dans le texte.



Indique une situation dangereuse qui si on l'évite pas peut donner la mort ou des blessures graves. Les dangers possibles sont montrés par les symboles joints ou sont expliqués dans le texte.

**NOTE** – Indique des déclarations pas en relation avec des blessures personnelles.

 Indique des instructions spécifiques.



Ce groupe de symboles veut dire Avertissement! Attention! DANGER DE CHOC ELECTRIQUE, PIECES EN MOUVEMENT, et PIECES CHAUDES. Consulter les symboles et les instructions ci-dessous y afférant pour les actions nécessaires afin d'éviter le danger.

## 2-2. Dangers relatifs au soudage à l'arc



Les symboles représentés ci-dessous sont utilisés dans ce manuel pour attirer l'attention et identifier les dangers possibles. En présence de l'un de ces symboles, prendre garde et suivre les instructions afférentes pour éviter tout risque. Les instructions en matière de sécurité indiquées ci-dessous ne constituent qu'un sommaire des instructions de sécurité plus complètes fournies dans les normes de sécurité énumérées dans la Section 2-5. Lire et observer toutes les normes de sécurité.



Seul un personnel qualifié est autorisé à installer, faire fonctionner, entretenir et réparer cet appareil.



Pendant le fonctionnement, maintenir à distance toutes les personnes, notamment les enfants de l'appareil.



### UNE DÉCHARGE ÉLECTRIQUE peut entraîner la mort.

Le contact d'organes électriques sous tension peut provoquer des accidents mortels ou des brûlures graves. Le circuit de l'électrode et de la pièce est sous tension lorsque le courant est délivré à la sortie. Le circuit d'alimentation et les circuits internes de la machine sont également sous tension lorsque l'alimentation est sur Marche. Dans le mode de soudage avec du fil, le fil, le dérouleur, le bloc de commande du rouleau et toutes les parties métalliques en contact avec le fil sont sous tension électrique. Un équipement installé ou mis à la terre de manière incorrecte ou impropre constitue un danger.

- Ne pas toucher aux pièces électriques sous tension.
- Porter des gants isolants et des vêtements de protection secs et sans trous.
- S'isoler de la pièce à couper et du sol en utilisant des housses ou des tapis assez grands afin d'éviter tout contact physique avec la pièce à couper ou le sol.
- Ne pas se servir de source électrique à courant électrique dans les zones humides, dans les endroits confinés ou là où on risque de tomber.
- Se servir d'une source électrique à courant électrique UNIQUEMENT si le procédé de soudage le demande.
- Si l'utilisation d'une source électrique à courant électrique s'avère nécessaire, se servir de la fonction de télécommande si l'appareil en est équipé.
- D'autres consignes de sécurité sont nécessaires dans les conditions suivantes : risques électriques dans un environnement humide ou si l'on porte des vêtements mouillés ; sur des structures métalliques telles que sols, grilles ou échafaudages ; en position coincée comme assise, à genoux ou couchée ; ou s'il y a un risque élevé de contact inévitable ou accidentel avec la pièce à souder ou le sol. Dans ces conditions, utiliser les équipements suivants, dans l'ordre indiqué : 1) un poste à souder DC à tension constante (à fil), 2) un poste à souder DC manuel (électrode) ou 3) un poste à souder AC à tension à vide réduite. Dans la plupart des situations, l'utilisation d'un poste à souder DC à fil à tension constante est recommandée. En outre, ne pas travailler seul !
- Couper l'alimentation ou arrêter le moteur avant de procéder à l'installation, à la réparation ou à l'entretien de l'appareil. Déverrouiller l'alimentation selon la norme OSHA 29 CFR 1910.147 (voir normes de sécurité).
- Installer le poste correctement et le mettre à la terre convenablement selon les consignes du manuel de l'opérateur et les normes nationales, provinciales et locales.
- Toujours vérifier la terre du cordon d'alimentation. Vérifier et s'assurer que le fil de terre du cordon d'alimentation est bien raccordé à la borne de terre du sectionneur ou que la fiche du cordon est raccordée à une prise correctement mise à la terre.
- En effectuant les raccordements d'entrée, fixer d'abord le conducteur de mise à la terre approprié et contre-vérifier les connexions.
- Les câbles doivent être exempts d'humidité, d'huile et de graisse; protégez-les contre les étincelles et les pièces métalliques chaudes.
- Vérifier fréquemment le cordon d'alimentation afin de s'assurer qu'il n'est pas altéré ou à nu, le remplacer immédiatement s'il l'est. Un fil à nu peut entraîner la mort.
- L'équipement doit être hors tension lorsqu'il n'est pas utilisé.
- Ne pas utiliser des câbles usés, endommagés, de grosseur insuffisante ou mal épissés.
- Ne pas enrouler les câbles autour du corps.
- Si la pièce soudée doit être mise à la terre, le faire directement avec un câble distinct.
- Ne pas toucher l'électrode quand on est en contact avec la pièce, la terre ou une électrode provenant d'une autre machine.
- Ne pas toucher des porte électrodes connectés à deux machines en même temps à cause de la présence d'une tension à vide doublée.
- N'utiliser qu'un matériel en bon état. Réparer ou remplacer sur-le-champ les pièces endommagées. Entretenir l'appareil conformément à ce manuel.
- Porter un harnais de sécurité si l'on doit travailler au-dessus du sol.
- S'assurer que tous les panneaux et couvercles sont correctement en place.
- Fixer le câble de retour de façon à obtenir un bon contact métal-métal avec la pièce à souder ou la table de travail, le plus près possible de la soudure.
- Isoler la pince de masse quand pas mis à la pièce pour éviter le contact avec tout objet métallique.
- Ne pas raccorder plus d'une électrode ou plus d'un câble de masse à une même borne de sortie de soudage.

**Il reste une TENSION DC NON NÉGLIGEABLE dans les sources de soudage onduleur quand on a coupé l'alimentation.**

- Arrêter les convertisseurs, débrancher le courant électrique et décharger les condensateurs d'alimentation selon les instructions indiquées dans la partie Entretien avant de toucher les pièces.



### **DES PIÈCES CHAUDES peuvent provoquer des brûlures graves.**


- Ne pas toucher à mains nues les parties chaudes.
- Prévoir une période de refroidissement avant de travailler à l'équipement.
- Ne pas toucher aux pièces chaudes, utiliser les outils recommandés et porter des gants de soudage et des vêtements épais pour éviter les brûlures.



### **LES FUMÉES ET LES GAZ peuvent être dangereux.**

Le soudage génère des fumées et des gaz. Leur inhalation peut être dangereux pour votre santé.

- Eloigner votre tête des fumées. Ne pas respirer les fumées.
- À l'intérieur, ventiler la zone et/ou utiliser une ventilation forcée au niveau de l'arc pour l'évacuation des fumées et des gaz de soudage.
- Si la ventilation est médiocre, porter un respirateur anti-vapeurs approuvé.
- Lire et comprendre les spécifications de sécurité des matériaux (MSDS) et les instructions du fabricant concernant les métaux, les consommables, les revêtements, les nettoyants et les dégraissants.
- Travailler dans un espace fermé seulement s'il est bien ventilé ou en portant un respirateur à alimentation d'air. Demander toujours à un surveillant dûment formé de se tenir à proximité. Des fumées et des gaz de soudage peuvent déplacer l'air et abaisser le niveau d'oxygène provoquant des blessures ou des accidents mortels. S'assurer que l'air de respiration ne présente aucun danger.
- Ne pas souder dans des endroits situés à proximité d'opérations de dégraissage, de nettoyage ou de pulvérisation. La chaleur et les rayons de l'arc peuvent réagir en présence de vapeurs et former des gaz hautement toxiques et irritants.
- Ne pas souder des métaux munis d'un revêtement, tels que l'acier galvanisé, plaqué en plomb ou au cadmium à moins que le revêtement n'ait été enlevé dans la zone de soudure, que l'endroit soit bien ventilé, et en portant un respirateur à alimentation d'air. Les revêtements et tous les métaux renfermant ces éléments peuvent dégager des fumées toxiques en cas de soudage.

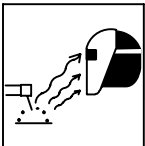

### **LES RAYONS DE L'ARC peuvent provoquer des brûlures dans les yeux et sur la peau.**

Le rayonnement de l'arc du procédé de soudage génère des rayons visibles et invisibles intense (ultraviolets et infrarouges) susceptibles de provoquer des brûlures dans les yeux et sur la peau. Des étincelles sont projetées pendant le soudage.


- Porter un casque de soudage approuvé muni de verres filtrants approprié pour protéger visage et yeux pendant le soudage (voir ANSI Z49.1 et Z87.1 énuméré dans les normes de sécurité).
- Porter des lunettes de sécurité avec écrans latéraux même sous votre casque.
- Avoir recours à des écrans protecteurs ou à des rideaux pour protéger les autres contre les rayonnements les éblouissements et les étincelles ; prévenir toute personne sur les lieux de ne pas regarder l'arc.
- Porter des vêtements confectionnés avec des matières résistantes et ignifuges (cuir, coton lourd ou laine) et des bottes de protection.



### **LE SOUDAGE peut provoquer un incendie ou une explosion.**

Le soudage effectué sur des conteneurs fermés tels que des réservoirs, tambours ou des conduites peut provoquer leur éclatement. Des étincelles peuvent être projetées de l'arc de soudure. La projection d'étincelles, des pièces chaudes et des équipements chauds peut provoquer des incendies et des brûlures. Le contact accidentel de l'électrode avec des objets métalliques peut provoquer des étincelles, une explosion, un surchauffement ou un incendie. Avant de commencer le soudage, vérifier et s'assurer que l'endroit ne présente pas de danger.

- Déplacer toutes les substances inflammables à une distance de 10,7 m de l'arc de soudage. En cas d'impossibilité les recouvrir soigneusement avec des protections homologués.
- Ne pas souder dans un endroit où des étincelles peuvent tomber sur des substances inflammables.
- Se protéger et d'autres personnes de la projection d'étincelles et de métal chaud.
- Des étincelles et des matériaux chauds du soudage peuvent facilement passer dans d'autres zones en traversant de petites fissures et des ouvertures.
- Surveiller tout déclenchement d'incendie et tenir un extincteur à proximité.
- Le soudage effectué sur un plafond, plancher, paroi ou séparation peut déclencher un incendie de l'autre côté.
- Ne pas effectuer le soudage sur des conteneurs fermés tels que des réservoirs, tambours, ou conduites, à moins qu'ils n'aient été préparés correctement conformément à AWS F4.1 (voir les normes de sécurité).
- Ne soudez pas si l'air ambiant est chargé de particules, gaz, ou vapeurs inflammables (vapeur d'essence, par exemple).
- Brancher le câble de masse sur la pièce la plus près possible de la zone de soudage pour éviter le transport du courant sur une longue distance par des chemins inconnus éventuels en provoquant des risques d'électrocution, d'étincelles et d'incendie.
- Ne pas utiliser le poste de soudage pour dégeler des conduites gelées.
- En cas de non utilisation, enlever la baguette d'électrode du porte-électrode ou couper le fil à la pointe de contact.
- Porter des vêtements de protection dépourvus d'huile tels que des gants en cuir, une chemise en matériau lourd, des pantalons sans revers, des chaussures hautes et un couvre chef.
- Avant de souder, retirer toute substance combustible de vos poches telles qu'un allumeur au butane ou des allumettes.
- Une fois le travail achevé, assurez-vous qu'il ne reste aucune trace d'étincelles incandescentes ni de flammes.
- Utiliser exclusivement des fusibles ou coupe-circuits appropriés. Ne pas augmenter leur puissance; ne pas les ponter.
- Une fois le travail achevé, assurez-vous qu'il ne reste aucune trace d'étincelles incandescentes ni de flammes.
- Utiliser exclusivement des fusibles ou coupe-circuits appropriés. Ne pas augmenter leur puissance; ne pas les ponter.
- Suivre les recommandations dans OSHA 1910.252(a)(2)(iv) et NFPA 51B pour les travaux à chaud et avoir de la surveillance et un extincteur à proximité.

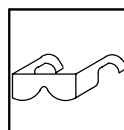

### **DES PIÈCES DE METAL ou DES SALETES peuvent provoquer des blessures dans les yeux.**

- Le soudage, l'écaillage, le passage de la pièce à la brosse en fil de fer, et le meulage génèrent des étincelles et des particules métalliques volantes. Pendant la période de refroidissement des soudures, elles risquent de projeter du laitier.
- Porter des lunettes de sécurité avec écrans latéraux ou un écran facial.



### LES ACCUMULATIONS DE GAZ risquent de provoquer des blessures ou même la mort.

- Fermer l'alimentation du gaz protecteur en cas de non-utilisation.
- Veiller toujours à bien aérer les espaces confinés ou se servir d'un respirateur d'adduction d'air homologué.



### LES CHAMPS MAGNETIQUES peuvent affecter des implants médicaux.


- Porteur de simulateur cardiaque ou autre implants médicaux, rester à distance.
- Les porteurs d'implants doivent d'abord consulter leur médecin avant de s'approcher des opérations de soudage à l'arc, de soudage par points, de gougeage, du coupage plasma ou de chauffage par induction.



### LE BRUIT peut endommager l'ouïe.

Le bruit des processus et des équipements peut affecter l'ouïe.

- Porter des protections approuvées pour les oreilles si le niveau sonore est trop élevé.

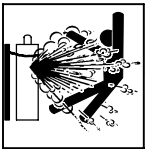

### LES BOUTEILLES peuvent exploser si elles sont endommagées.

Des bouteilles de gaz protecteur contiennent du gaz sous haute pression. Si une bouteille est endommagée, elle peut exploser. Du fait que les bouteilles de gaz font normalement partie du procédé de soudage, les manipuler avec précaution.


- Protéger les bouteilles de gaz comprimé d'une chaleur excessive, des chocs mécaniques, des dommages physiques, du laitier, des flammes ouvertes, des étincelles et des arcs.
- Placer les bouteilles debout en les fixant dans un support stationnaire ou dans un porte-bouteilles pour les empêcher de tomber ou de se renverser.
- Tenir les bouteilles éloignées des circuits de soudage ou autres circuits électriques.
- Ne jamais placer une torche de soudage sur une bouteille à gaz.
- Une électrode de soudage ne doit jamais entrer en contact avec une bouteille.
- Ne jamais souder une bouteille pressurisée – risque d'explosion.
- Utiliser seulement des bouteilles de gaz protecteur, régulateurs, tuyaux et raccords convenables pour cette application spécifique ; les maintenir ainsi que les éléments associés en bon état.
- Détourner votre visage du détendeur-régulateur lorsque vous ouvrez la soupape de la bouteille.
- Le couvercle du détendeur doit toujours être en place, sauf lorsque la bouteille est utilisée ou qu'elle est reliée pour usage ultérieur.
- Utiliser les équipements corrects, les bonnes procédures et suffisamment de personnes pour soulever et déplacer les bouteilles.
- Lire et suivre les instructions sur les bouteilles de gaz comprimé, l'équipement connexe et le dépliant P-1 de la CGA (Compressed Gas Association) mentionné dans les principales normes de sécurité.

## 2-3. Dangers supplémentaires en relation avec l'installation, le fonctionnement et la maintenance



### Risque D'INCENDIE OU D'EXPLOSION.

- Ne pas placer l'appareil sur, au-dessus ou à proximité de surfaces inflammables.
- Ne pas installer l'appareil à proximité de produits inflammables.
- Ne pas surcharger l'installation électrique – s'assurer que l'alimentation est correctement dimensionnée et protégée avant de mettre l'appareil en service.

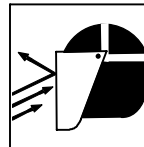


### LES ÉTINCELLES VOLANTES risquent de provoquer des blessures.

- Porter un écran facial pour protéger le visage et les yeux.
- Affûter l'électrode au tungstène uniquement à la meuleuse dotée de protecteurs. Cette manœuvre est à exécuter dans un endroit sûr lorsque l'on porte l'équipement homologué de protection du visage, des mains et du corps.
- Les étincelles risquent de causer un incendie – éloigner toute substance inflammable.




### LA CHUTE DE L'APPAREIL peut blesser.

- Utiliser l'anneau de levage uniquement pour soulever l'appareil, NON PAS les chariots, les bouteilles de gaz ou tout autre accessoire.
- Utiliser un équipement de levage de capacité suffisante pour lever l'appareil.
- En utilisant des fourches de levage pour déplacer l'unité, s'assurer que les fourches sont suffisamment longues pour dépasser du côté opposé de l'appareil.

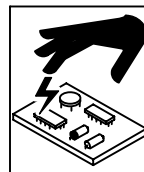


### LES CHARGES ÉLECTROSTATIQUES peuvent endommager les circuits imprimés.

- Établir la connexion avec la barrette de terre avant de manipuler des cartes ou des pièces.
- Utiliser des pochettes et des boîtes antistatiques pour stocker, déplacer ou expédier des cartes de circuits imprimés.

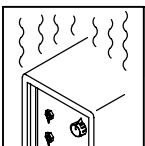

### L'EMPLOI EXCESSIF peut SURCHAUFFER L'ÉQUIPEMENT.

- Prévoir une période de refroidissement ; respecter le cycle opératoire nominal.
- Réduire le courant ou le facteur de marche avant de poursuivre le soudage.
- Ne pas obstruer les passages d'air du poste.

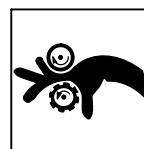

### DES ORGANES MOBILES peuvent provoquer des blessures.

- Ne pas s'approcher des organes mobiles.
- Ne pas s'approcher des points de coincement tels que des rouleaux de commande.




### LES FILS DE SOUDAGE peuvent provoquer des blessures.

- Ne pas appuyer sur la gâchette avant d'en avoir reçu l'instruction.
- Ne pas diriger le pistolet vers soi, d'autres personnes ou toute pièce mécanique en engageant le fil de soudage.




### DES ORGANES MOBILES peuvent provoquer des blessures.

- S'abstenir de toucher des organes mobiles tels que des ventilateurs.
- Maintenir fermés et verrouillés les portes, panneaux, recouvrements et dispositifs de protection.
- Seules des personnes qualifiées sont autorisées à enlever les portes, panneaux, recouvrements ou dispositifs de protection pour l'entretien.
- Remettre les portes, panneaux, recouvrements ou dispositifs de protection quand l'entretien est terminé et avant de rebrancher l'alimentation électrique.

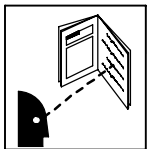

### LIRE LES INSTRUCTIONS.

- Lisez le manuel d'instructions avant l'utilisation ou la maintenance de l'appareil.
- N'utiliser que les pièces de rechange recommandées par le constructeur.
- Effectuer régulièrement le contrôle et l'entretien de l'installation.
- Maintenir soigneusement fermés les portes et les panneaux des sources de haute fréquence, maintenir les éclateurs à une distance correcte et utiliser une terre et un blindage pour réduire les interférences éventuelles.

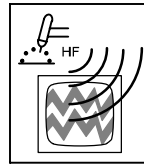

### LE RAYONNEMENT HAUTE FRÉQUENCE (H.F.) risque de provoquer des interférences.

- Le rayonnement haute fréquence (H.F.) peut provoquer des interférences avec les équipements de radio-navigation et de communication, les services de sécurité et les ordinateurs.
- Demander seulement à des personnes qualifiées familiarisées avec des équipements électroniques de faire fonctionner l'installation.
- L'utilisateur est tenu de faire corriger rapidement par un électricien qualifié les interférences résultant de l'installation.
- Si le FCC signale des interférences, arrêter immédiatement l'appareil.



### LE SOUDAGE À L'ARC risque de provoquer des interférences.

- L'énergie électromagnétique risque de provoquer des interférences pour l'équipement électronique sensible tel que les ordinateurs et l'équipement commandé par ordinateur tel que les robots.
- Veiller à ce que tout l'équipement de la zone de soudage soit compatible électromagnétiquement.
- Pour réduire la possibilité d'interférence, maintenir les câbles de soudage aussi courts que possible, les grouper, et les poser aussi bas que possible (ex. par terre).
- Veiller à souder à une distance de 100 mètres de tout équipement électronique sensible.
- Veiller à ce que ce poste de soudage soit posé et mis à la terre conformément à ce mode d'emploi.
- En cas d'interférences après avoir pris les mesures précédentes, il incombe à l'utilisateur de prendre des mesures supplémentaires telles que le déplacement du poste, l'utilisation de câbles blindés, l'utilisation de filtres de ligne ou la pose de protecteurs dans la zone de travail.

## 2-4. Proposition californienne 65 Avertissements

**⚠ Les équipements de soudage et de coupage produisent des fumées et des gaz qui contiennent des produits chimiques dont l'État de Californie reconnaît qu'ils provoquent des malformations congénitales et, dans certains cas, des cancers. (Code de santé et de sécurité de Californie, chapitre 25249.5 et suivants)**

**⚠ Les batteries, les bornes et autres accessoires contiennent du plomb et des composés à base de plomb, produits chimiques dont l'État de Californie reconnaît qu'ils provoquent des cancers et des malformations congénitales ou autres problèmes de procréation. Se laver les mains après manipulation.**

**Pour les moteurs à essence :**

**⚠ Les gaz d'échappement des moteurs contiennent des produits chimiques dont l'État de Californie reconnaît qu'ils provoquent des cancers et des malformations congénitales ou autres problèmes de procréation.**

**Pour les moteurs diesel :**

**⚠ Les gaz d'échappement des moteurs diesel et certains de leurs composants sont reconnus par l'État de Californie comme provoquant des cancers et des malformations congénitales ou autres problèmes de procréation.**

## 2-5. Principales normes de sécurité

*Safety in Welding, Cutting, and Allied Processes*, ANSI Standard Z49.1, de Global Engineering Documents (téléphone : 1-877-413-5184, site Internet : [www.global.ihc.com](http://www.global.ihc.com)).

*Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping*, American Welding Society Standard AWS F4.1 de Global Engineering Documents (téléphone : 1-877-413-5184, site Internet : [www.global.ihc.com](http://www.global.ihc.com)).

*National Electrical Code*, NFPA Standard 70, de National Fire Protection Association, P.O. Box 9101, Quincy, MA 02269-9101 (téléphone : 617-770-3000, site Internet : [www.nfpa.org](http://www.nfpa.org)).

*Safe Handling of Compressed Gases in Cylinders*, CGA Pamphlet P-1, de Compressed Gas Association, 4221 Walney Road, 5th Floor, Chantilly, VA 20151 (téléphone : 703-788-2700, site Internet : [www.cganet.com](http://www.cganet.com)).

*Code for Safety in Welding and Cutting*, CSA Standard W117.2, de Canadian Standards Association, 5060 Mississauga, Ontario, Canada

L4W 5NS (téléphone : 800-463-6727 ou à Toronto 416-747-4044, site Internet : [www.csa-international.org](http://www.csa-international.org)).

*Safe Practice For Occupational And Educational Eye And Face Protection*, ANSI Standard Z87.1, de American National Standards Institute, 11 West 43rd Street, New York, NY 10036-8002 (téléphone : 212-642-4900, site Internet : [www.ansi.org](http://www.ansi.org)).

*Standard for Fire Prevention During Welding, Cutting, and Other Hot Work*, NFPA Standard 51B, de National Fire Protection Association, P.O. Box 9101, Quincy, MA 02269-9101 (téléphone : 617-770-3000, site Internet : [www.nfpa.org](http://www.nfpa.org)).

OSHA, Occupational Safety and Health Standards for General Industry, Title 29, Code of Federal Regulations (CFR), Part 1910, Subpart Q, and Part 1926, Subpart J, de U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250-7954 (téléphone : 1-866-512-1800) (il y a 10 bureaux régionaux—le téléphone de la région 5, Chicago, est 312-353-2220, site Internet : [www.osha.gov](http://www.osha.gov)).

## 2-6. Information EMF

Considérations sur le soudage et les effets de basse fréquence et des champs magnétiques et électriques.

Le courant de soudage, pendant son passage dans les câbles de soudage, causera des champs électromagnétiques. Il y a eu et il y a encore un certain souci à propos de tels champs. Cependant, après avoir examiné plus de 500 études qui ont été faites pendant une période de recherche de 17 ans, un comité spécial ruban bleu du National Research Council a conclu : « L'accumulation de preuves, suivant le jugement du comité, n'a pas démontré que l'exposition aux champs magnétiques et champs électriques à haute fréquence représente un risque à la santé humaine ». Toutefois, des études sont toujours en cours et les preuves continuent à être examinées. En attendant que les conclusions finales de la recherche soient établies, il vous serait souhaitable de réduire votre exposition aux champs électromagnétiques pendant le soudage ou le coupage.

Pour réduire les champs magnétiques sur le poste de travail, appliquer les procédures suivantes :

1. Garder les câbles ensemble, les torsader, les scotcher, ou les recouvrir d'une housse.
2. Disposer les câbles d'un côté et à distance de l'opérateur.
3. Ne pas courber et ne pas entourer les câbles autour de votre corps.
4. Garder le poste de soudage et les câbles le plus loin possible de vous.
5. Connecter la pince sur la pièce aussi près que possible de la soudure.

### En ce qui concerne les implants médicaux :

Les porteurs d'implants doivent d'abord consulter leur médecin avant de s'approcher des opérations de soudage à l'arc, de soudage par points, de gougeage, du coupage plasma ou de chauffage par induction. Si le médecin approuve, il est recommandé de suivre les procédures précédentes.


 



# SECTION 3 – INTRODUCTION

## 3-1. Specifications

Rated Output	Max. Open Circuit Voltage	Amps Input at Rated Output, 60 Hz, Single-Phase			
		200 V	230 V	KVA	KW
175 A at 25.5 VDC, 60% Duty Cycle	38	37.0 2.4*	32.5 2.3*	7.4 0.54*	6.3 0.30*
* While idling					
Wire Type and Diameter			No Load Wire Feed Speed	Dimensions	Weight
<b>Solid Steel/ Stainless Steel</b>	<b>Aluminum</b>	<b>Flux Cored</b>	0-700 IPM (0-17.8 m/min)	H: 32 in (813 mm) W: 18-7/8 in (479 mm) D: 37 in (940 mm)	185 lb (84 kg)
.023 - .045 in (0.6 - 1.2 mm)	.030 - .035 in (0.8 - 0.9 mm)	.030 - .045 in (0.8 - 1.2 mm)			

## 3-2. Welding Power Source Duty Cycle And Overheating

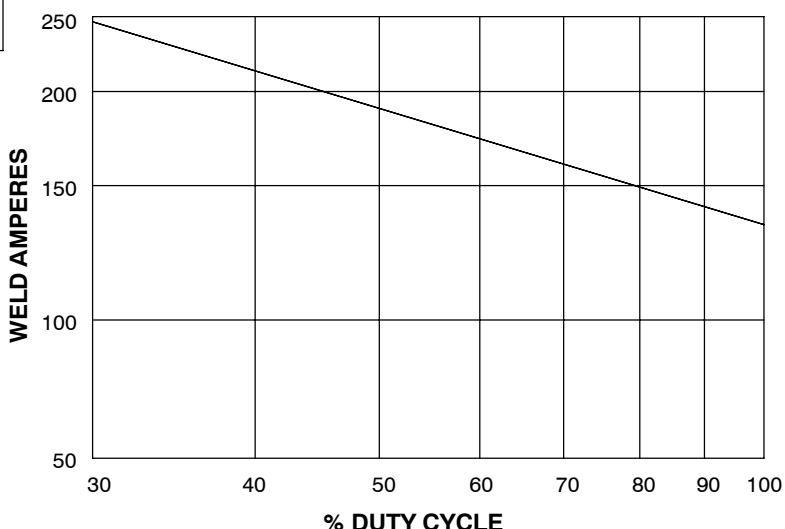

**WELD AMPERES**


**% DUTY CYCLE**

Duty Cycle is percentage of 10 minutes that unit can weld at rated load without overheating.

If unit overheats, thermostat(s) opens, output stops, and cooling fan runs. Wait fifteen minutes for unit to cool. Reduce amperage or voltage, or duty cycle before welding.

**NOTICE** - Exceeding duty cycle can damage unit or gun and void warranty.


60% duty cycle

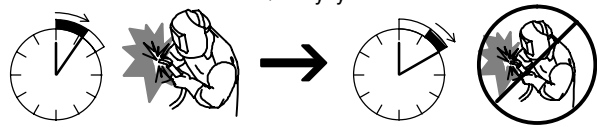

6 Minutes Welding      4 Minutes Resting

---

**Overheating**

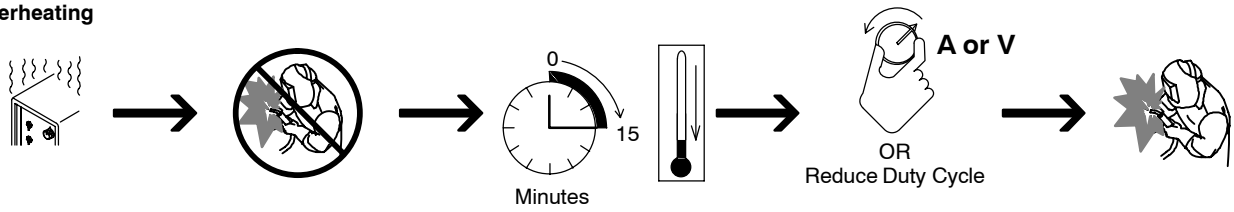


Minutes      OR      Reduce Duty Cycle

duty1 4/95 - 227 953-A

### 3-3. Volt-Ampere Curves


Volt-ampere curves show minimum and maximum voltage and amperage output capabilities of unit. Curves of other settings fall between curves shown.

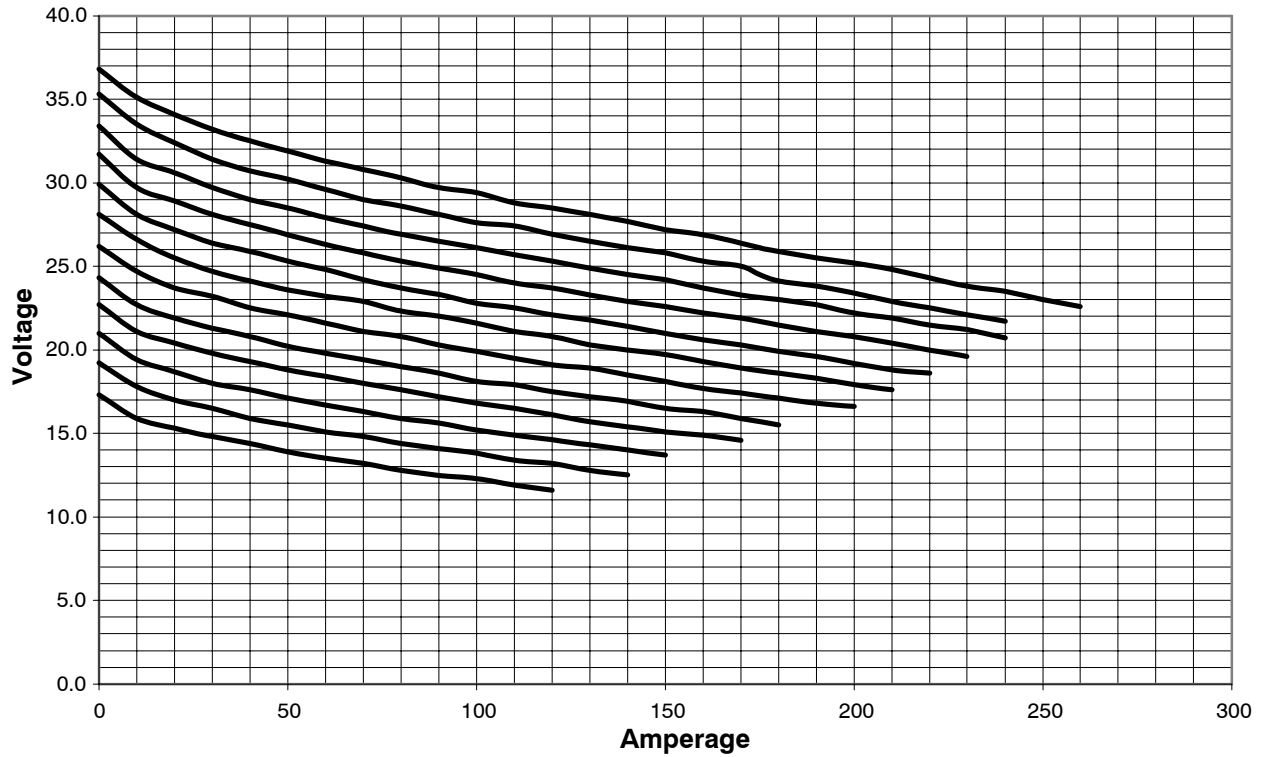

va\_curve1 4/95 - 240 913-A



### 3-4. Installing Welding Gun

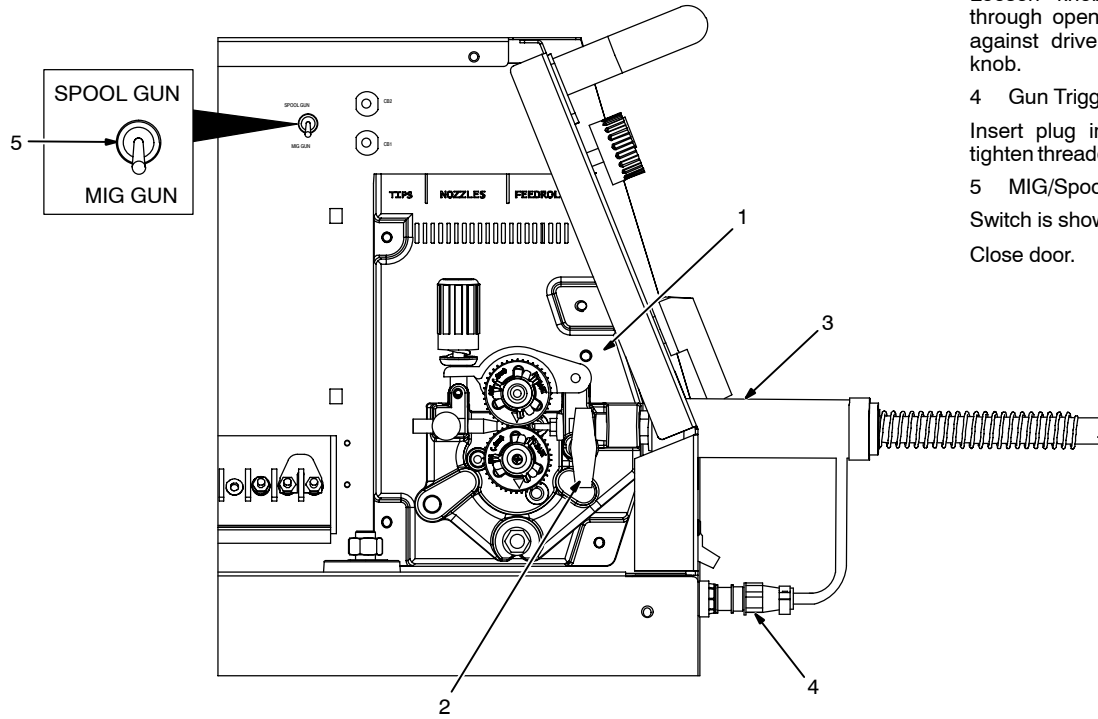

- 1 Drive Assembly
- 2 Gun Securing Knob
- 3 Gun End

Loosen knob. Insert gun end through opening until it bottoms against drive assembly. Tighten knob.

- 4 Gun Trigger Plug

Insert plug into receptacle, and tighten threaded collar.


- 5 MIG/Spool Gun Switch

Switch is shown in MIG position.


Close door.

Ref. 242 143-A


### 3-5. Connecting To Weld Output Terminals

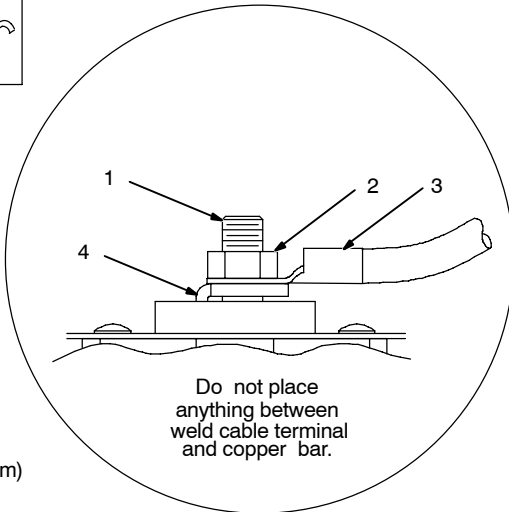

Tools Needed:

 

Correct Installation

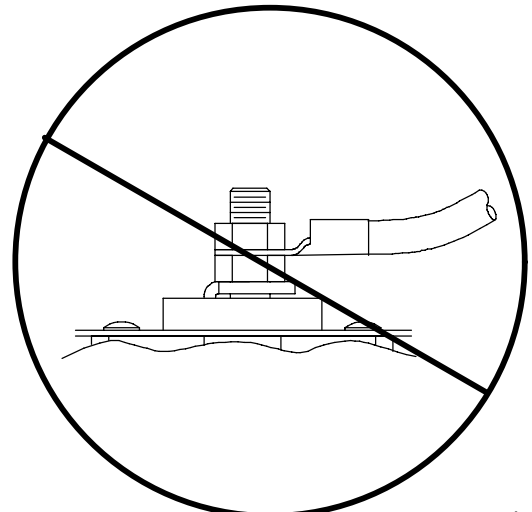


803 778-A

- ⚠ Turn off power before connecting to weld output terminals.**
- ⚠ Failure to properly connect weld cables may cause excessive heat and start a fire, or damage your machine.**

- 1 Weld Output Terminal
  - 2 Supplied Weld Output Terminal Nut
  - 3 Weld Cable Terminal
  - 4 Copper Bar
- Remove supplied nut from weld output terminal. Slide weld cable terminal onto weld

output terminal and secure with nut so that weld cable terminal is tight against copper bar. **Do not place anything between weld cable terminal and copper bar. Make sure that the surfaces of the weld cable terminal and copper bar are clean.**

### 3-6. Installing Work Clamp

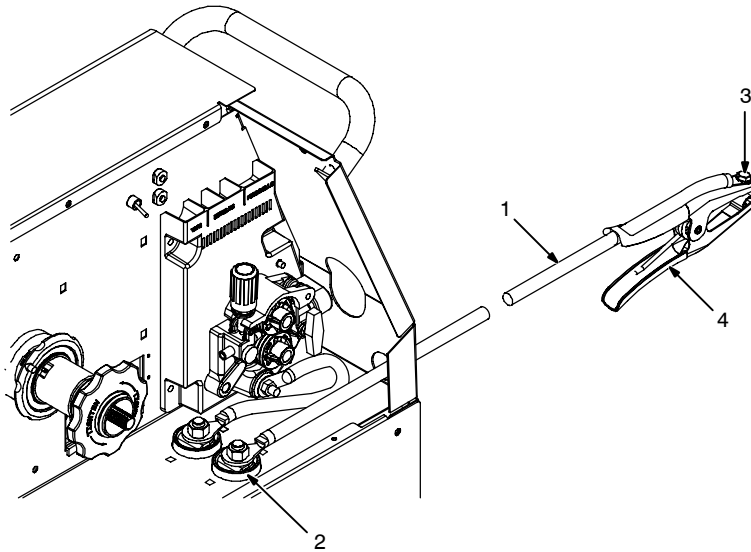

- 1 Work Cable  
Route cable out front panel opening from inside.
- 2 Negative (-/Black) Output Terminal  
Connect cable to terminal.
- 3 Hardware
- 4 Work Clamp  
Route cable through clamp handle and secure as shown.  
Close door.

Tools Needed:




Ref. 242 145-A

### 3-7. Setting Gun Polarity For Wire Type




#### Changing Polarity

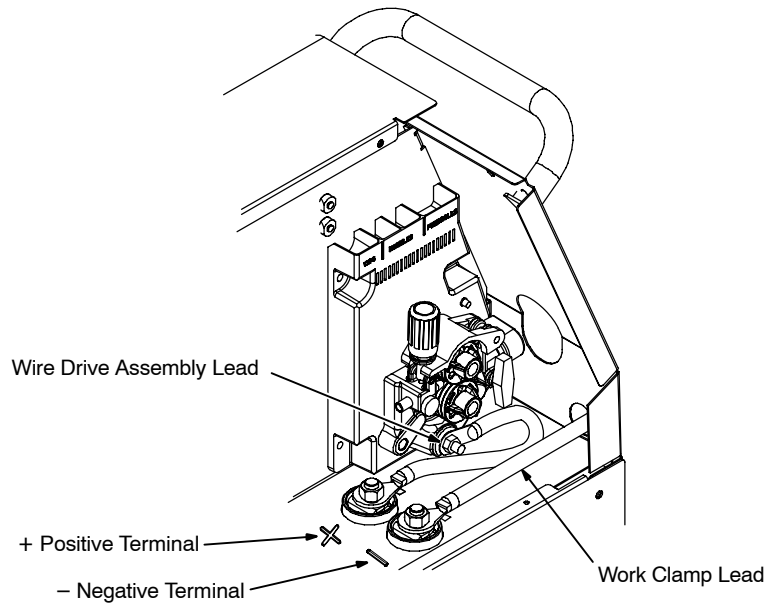

Shown as shipped - **Electrode Positive (DCEP)**:  
For solid steel, stainless steel, aluminum, or flux  
core with gas wires (GMAW).


**Electrode Negative (DCEN)**:  
Reverse lead connections at terminals from that  
shown above for gasless flux core wires (FCAW).  
Drive assembly becomes negative.

 Tools Needed:



Ref. 242 145-A

### 3-8. Installing 2 lb Wire Spool And Adjusting Hub Tension

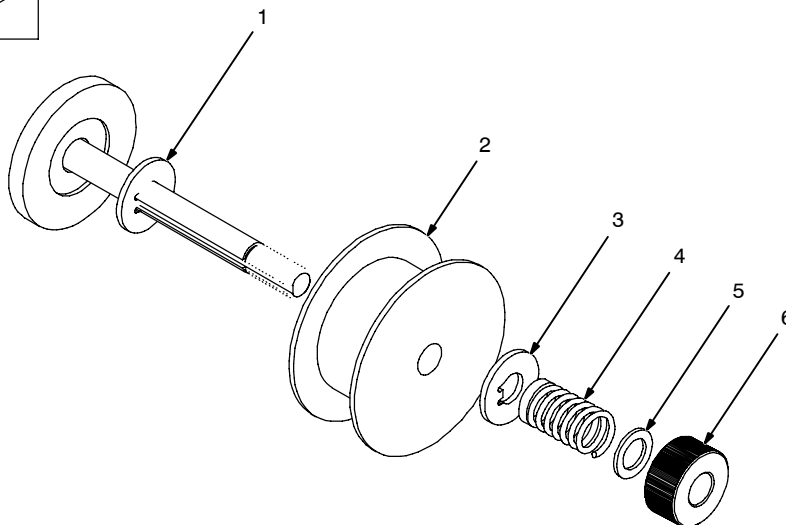

- 1 Keyed Washer
- 2 Wire Spool (2 LB)
- 3 Keyed Washer
- 4 Compression Spring
- 5 Washer
- 6 Nut


Assemble components in numerical order as shown.

Hand tighten nut to create a slight drag while rotating wire spool.

Over tightening nut may cause wire slippage.

242 146-A

### 3-9. Installing 10 lb Wire Spool And Adjusting Hub Tension

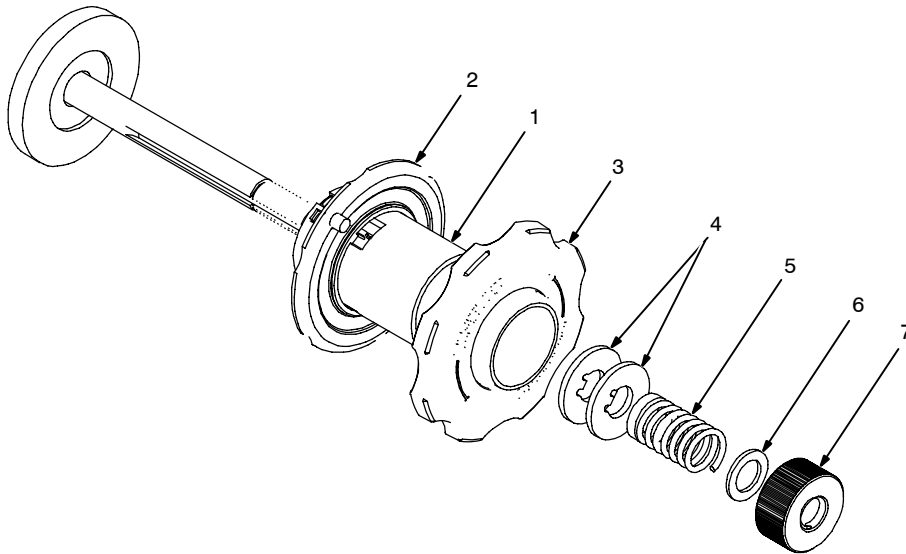

- 1 Spool Hub
- 2 Spool Hub Adapter
- 3 Spool Hub Nut
- 4 Keyed Washer (2)
- 5 Compression Spring
- 6 Washer
- 7 Nut

 
Assemble components in numerical order as shown.

Slide spool hub adapter up on hub for the smaller spool making sure it is positioned in the anti-rotation notches.

Secure hub nut on spool hub adaptor.


Position remaining components.

Hand tighten nut to create a slight drag while rotating wire spool.

 *Over tightening nut may cause wire slippage.*

242 147-A

### 3-10. Installing 33 lb Wire Spool And Adjusting Hub Tension

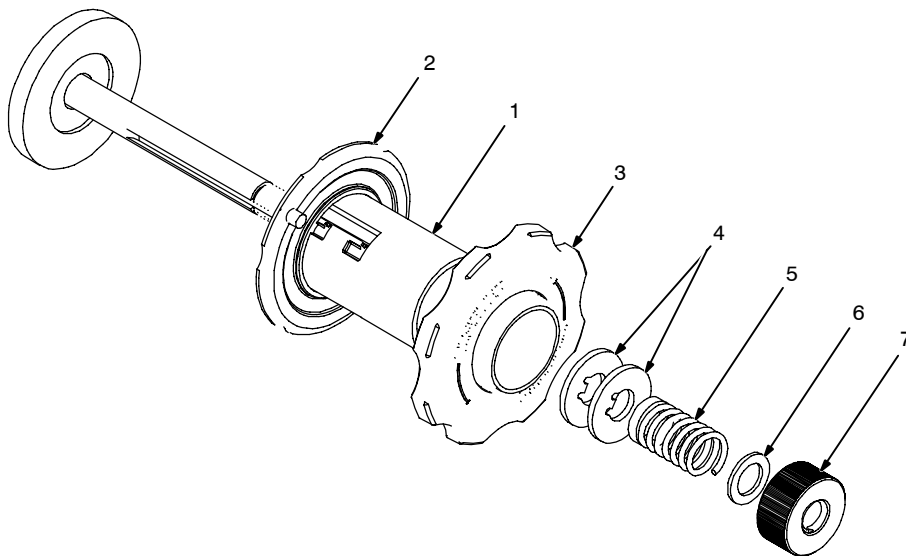

- 1 Spool Hub
- 2 Spool Hub Adapter
- 3 Spool Hub Nut
- 4 Keyed Washer (2)
- 5 Compression Spring
- 6 Washer
- 7 Nut

 
Assemble components in numerical order as shown.

Slide spool hub adapter up on hub for the smaller spool making sure it is positioned in the anti-rotation notches.

Secure hub nut on spool hub adaptor.

Position remaining components.

Hand tighten nut to create a slight drag while rotating wire spool.


 *Over tightening nut may cause wire slippage.*

242 148-A

### 3-11. Installing Gas Supply



**DO NOT** use Argon/Mixed gas regulator/flowmeter with CO<sub>2</sub> shielding gas. See Parts List for optional CO<sub>2</sub> gas regulator/flowmeter.

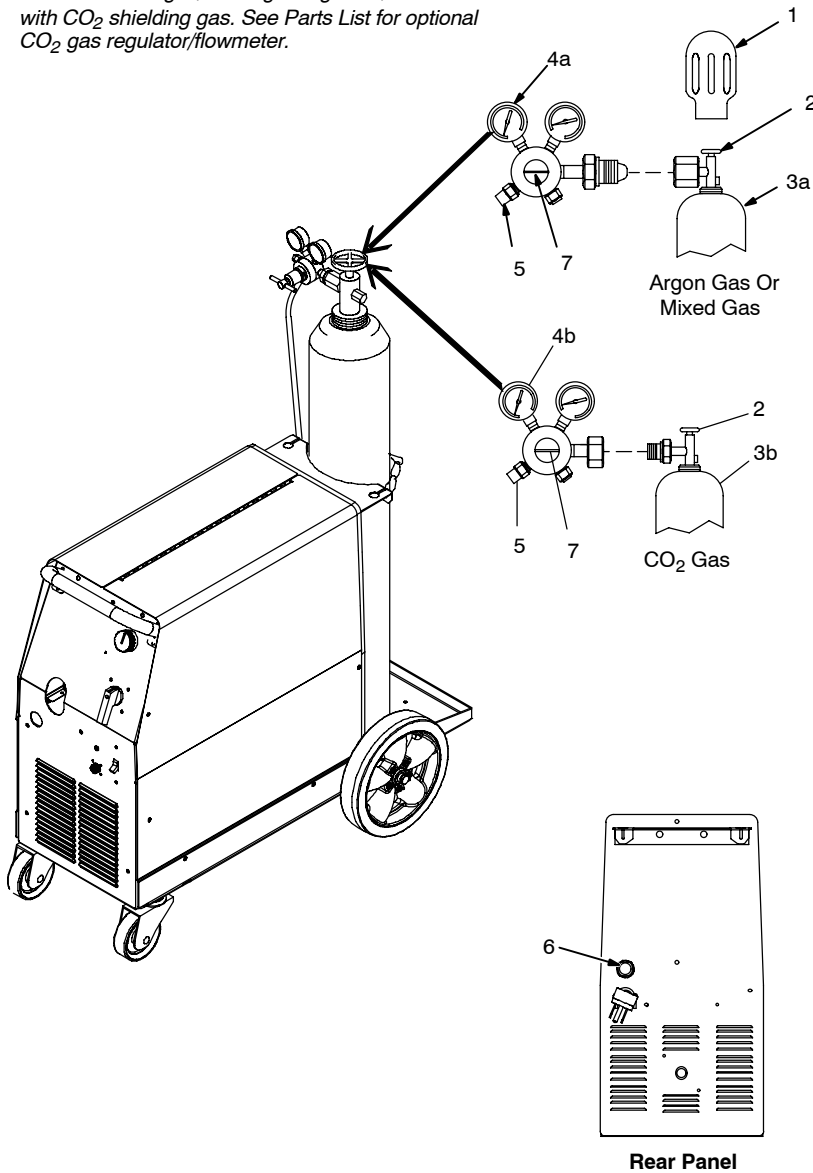

Obtain gas cylinder and chain to running gear, wall, or other stationary support so cylinder cannot fall and break off valve.

- 1 Cap
- 2 Cylinder Valve

Remove cap, stand to side of valve, and open valve slightly. Gas flow blows dust and dirt from valve. Close valve.

- 3 Cylinder
  - a Argon Or Mixed Gas Cylinder
  - b CO<sub>2</sub> Cylinder
- 4 Regulator/Flowmeter
  - a Argon Or Mixed Gas Regulator/Flowmeter
  - b CO<sub>2</sub> Regulator/Flowmeter

 
Install so face is vertical.

- 5 Regulator/Flowmeter Gas Hose Connection
- 6 Welding Power Source Gas Hose Connection For MIG Gun

Connect supplied gas hose between regulator/flowmeter gas hose connection, and fitting on rear of welding power source.


- 7 Gas Flow Adjustment Control
- Typical flow rate is 20 cfh (cubic feet per hour). Check wire manufacturer's recommended flow rate.

Tools Needed:




242 687-A

### 3-12. Positioning Jumper Links

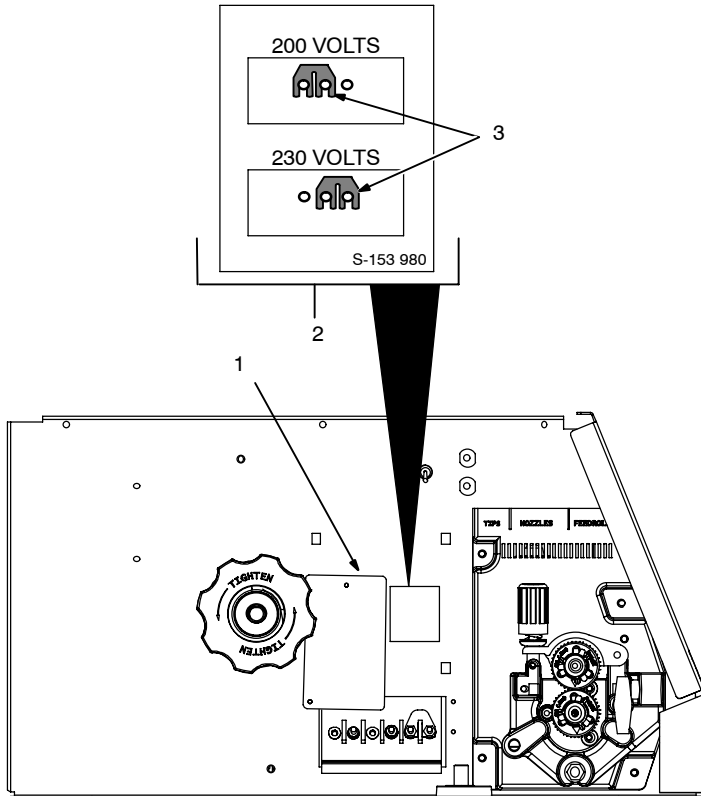

Tools Needed:

 

**⚠ Turn off and disconnect input power.**

Check input voltage available at site.

1 Jumper Links Access Door

Open door.

2 Jumper Link Label

Check label – only one is on unit.

3 Input Voltage Jumper Links

Move jumper links to match input voltage.

Close and secure access door.

242 688-A

### 3-13. Electrical Service Guide



Failure to follow these electrical service guide recommendations could create an electric shock or fire hazard. These recommendations are for a dedicated branch circuit sized for the rated output and duty cycle of the welding power source.

	60 Hz Single Phase	
<b>Input Voltage</b>	200	230
<b>Input Amperes At Rated Output</b>	37.0	32.5
<b>Max Recommended Standard Fuse Rating In Amperes</b>		
<b>Circuit Breaker <sup>1</sup>, Time-Delay <sup>2</sup></b>	45	40
<b>Normal Operating <sup>3</sup></b>	60	50
<b>Min Input Conductor Size In AWG <sup>4</sup></b>	10	10
<b>Max Recommended Input Conductor Length In Feet (Meters)</b>	77 (23)	102 (31)
<b>Min Grounding Conductor Size In AWG <sup>4</sup></b>	10	10





Reference: 2005 National Electrical Code (NEC) (including article 630)

- 1 Choose a circuit breaker with time-current curves comparable to a Time Delay Fuse.
- 2 "Time-Delay" fuses are UL class "RK5".
- 3 "Normal Operating" (general purpose - no intentional delay) fuses are UL class "K5" (up to and including 60 amp), and UL class "H" (65 amp and above).
- 4 Conductor data in this section specifies conductor size (excluding flexible cord or cable) between the panelboard and the equipment per NEC Table 310.16. If a flexible cord or cable is used, minimum conductor size may increase. See NEC Table 400.5(A) for flexible cord and cable requirements.

### 3-14. Selecting A Location And Connecting Input Power



**⚠ Do not move or operate unit where it could tip.**

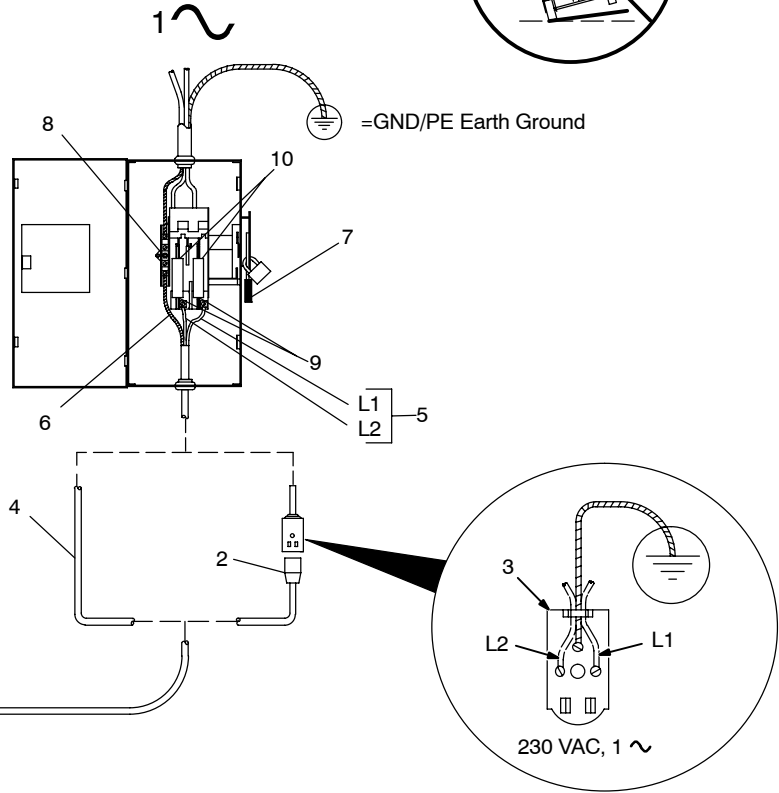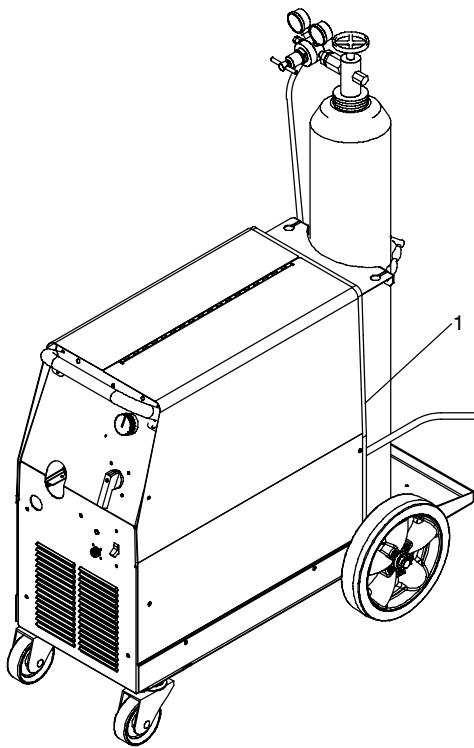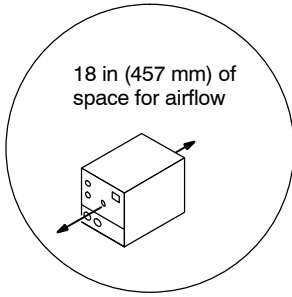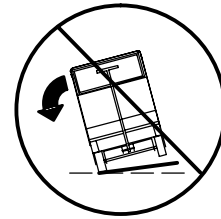

Ref. 242 691-A / 802 286-E

**⚠ Installation must meet all National and Local Codes – have only qualified persons make this installation.**

**⚠ Special installation may be required where gasoline or volatile liquids are present – see NEC Article 511 or CEC Section 20.**

**⚠ Disconnect and lockout/tagout input power before connecting input conductors from unit.**

**⚠ Always connect green or green/yellow conductor to supply grounding terminal first, and never to a line terminal.**

- 1 Rating Label  
Supply correct input power.
- 2 Plug (NEMA Type 6-50P)
- 3 Receptacle NEMA Type 6-50R)  
Connect plug to receptacle.
- 4 Input Power Cord.
- 5 Black And White Input Conductor (L1 And L2)
- 6 Green Or Green/Yellow Grounding Conductor
- 7 Disconnect Device (switch shown in the OFF position)
- 8 Disconnect Device Grounding Terminal

- 9 Disconnect Device Line Terminals  
Connect green or green/yellow grounding conductor to disconnect device grounding terminal first.  
Connect input conductors L1 and L2 to disconnect device line terminals.
- 10 Over-Current Protection  
Select type and size of over-current protection using Section 3-13 (fused disconnect switch shown).  
Close and secure door on disconnect device. Remove lockout/tagout device, and place switch in the On position.




### 3-15. Threading Welding Wire







- 1 Wire Spool
- 2 Welding Wire
- 3 Inlet Wire Guide
- 4 Pressure Adjustment Knob
- 5 Drive Roll
- 6 Outlet Wire Guide
- 7 Gun Conduit Cable


Lay gun cable out straight before threading wire.

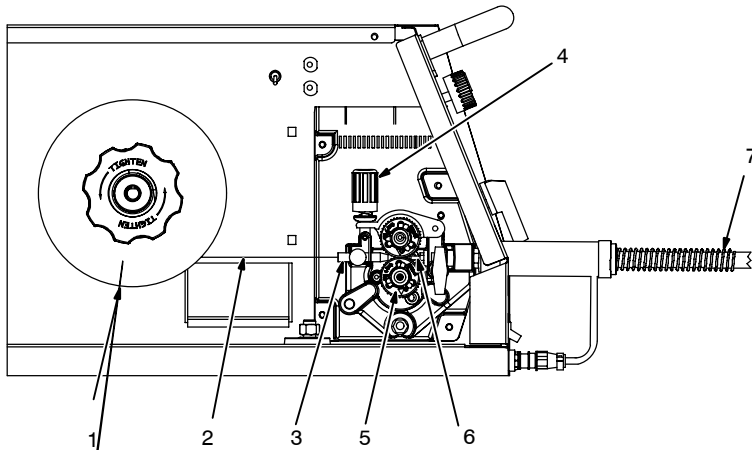

Tools Needed:

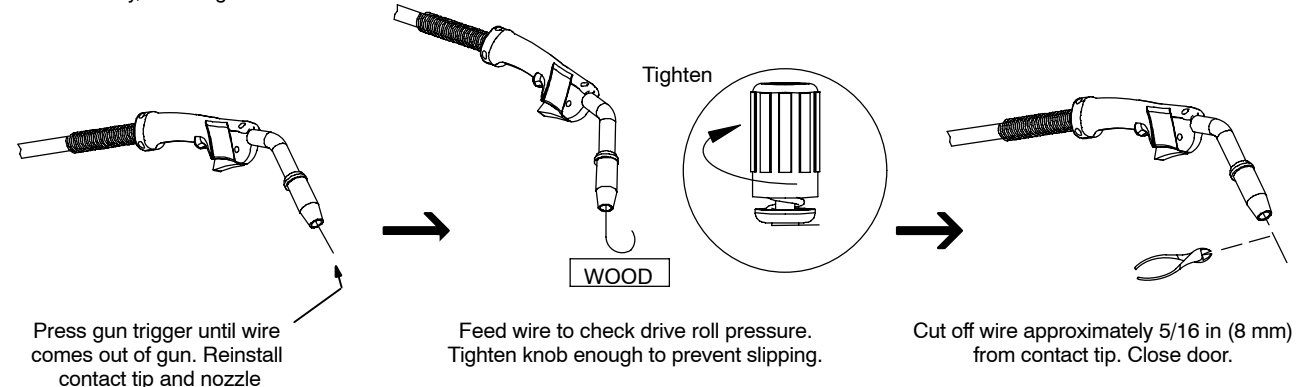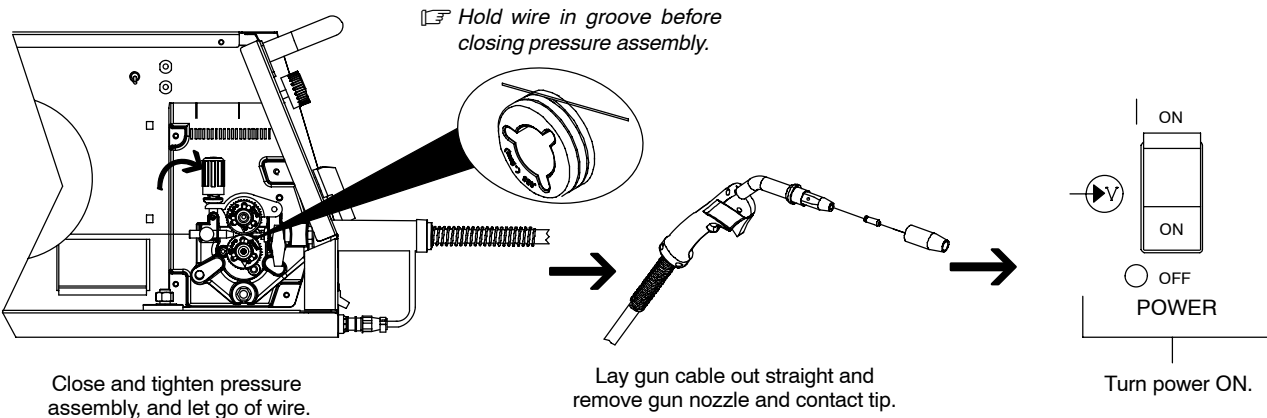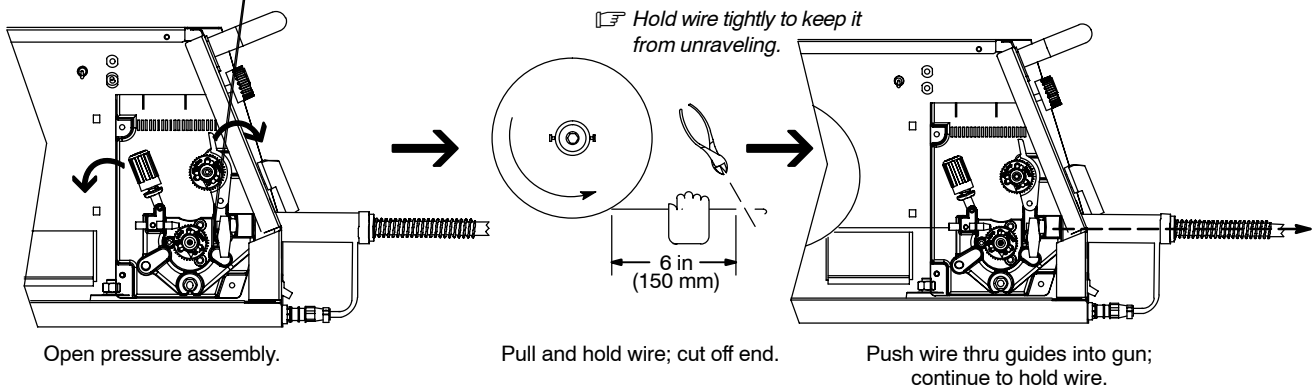 

### 3-16. Installing Optional DP 3545 Spool Gun To Welding Power Source

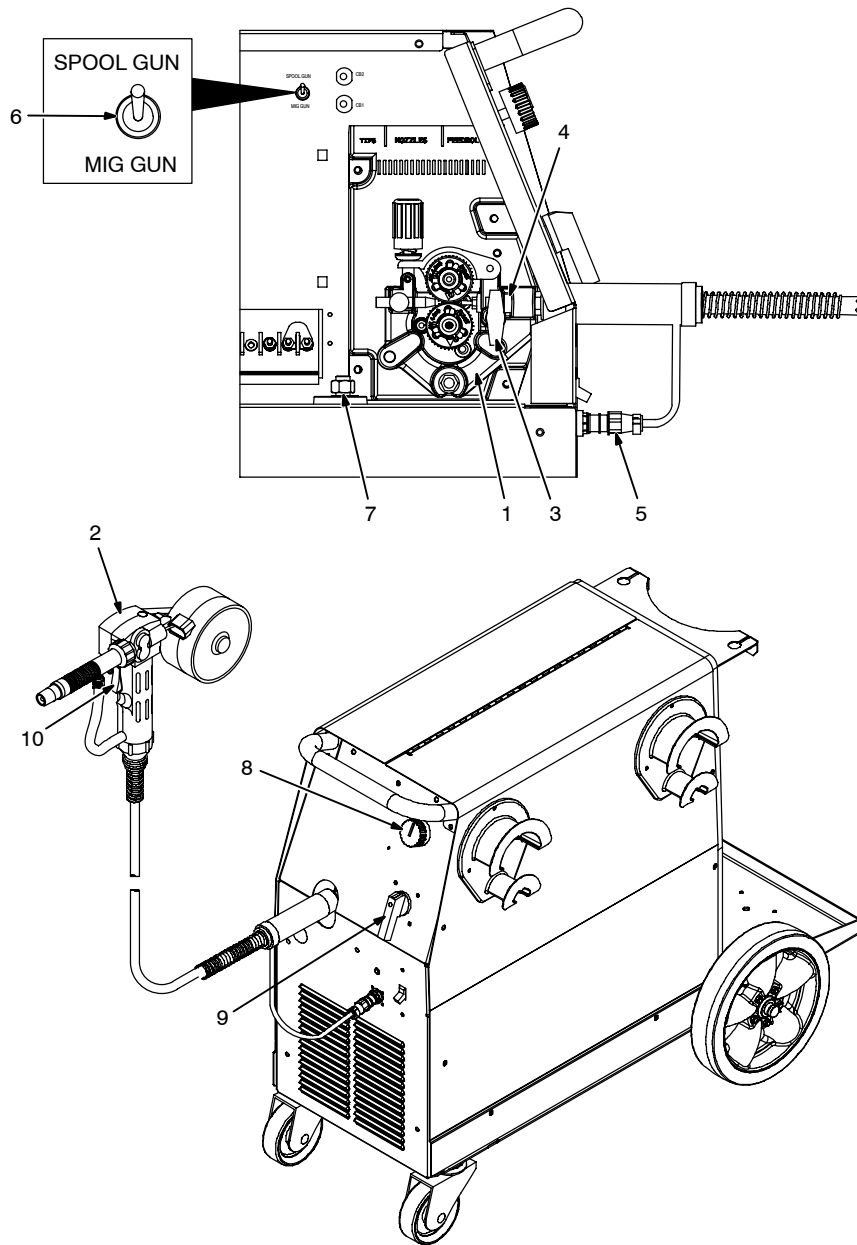

**⚠ Turn Off unit, and disconnect input power.**

- 1 Drive Assembly
- 2 Spool Gun
- 3 Gun Securing Thumbscrew
- 4 Gun End

Loosen thumbscrew. Insert gun end through opening until it bottoms against drive assembly. Tighten thumbscrew.

**ℹ** *Spool gun must be inserted completely to prevent leakage of shielding gas.*

- 5 Gun Trigger Plug

Insert plug into receptacle, and tighten threaded collar.

- 6 Spool Gun/MIG Gun Switch

Place switch in Spool Gun position.

- 7 Polarity Change Over Terminal Block

To make proper polarity connection see Section 3-7.

Close door.

- 8 Wire Feed Speed Control

Wire feed speed is controlled by welding power source Wire Feed Speed control (see Section 4-1).

- 9 Voltage Control

Arc voltage is controlled by welding power source Voltage control (see Section 4-1).

- 10 Trigger

Press trigger to energize welding power source contactor, start shielding gas flow, and begin wire feed.


242 143-A / 242 154-A

# SECTION 4 – OPERATION

## 4-1. Controls



- 1 Wire Speed Control  
Control varies the rate of wire being fed through the welding gun.
- 2 Voltage Control  
Control varies the voltage level of the welding arc. The voltage range is 1 (minimum) to 12 (maximum).
- 3 Power Switch  
The fan is thermostatically controlled and only runs when cooling is needed.
- 4 Power Light
- 5 Gun Trigger Receptacle

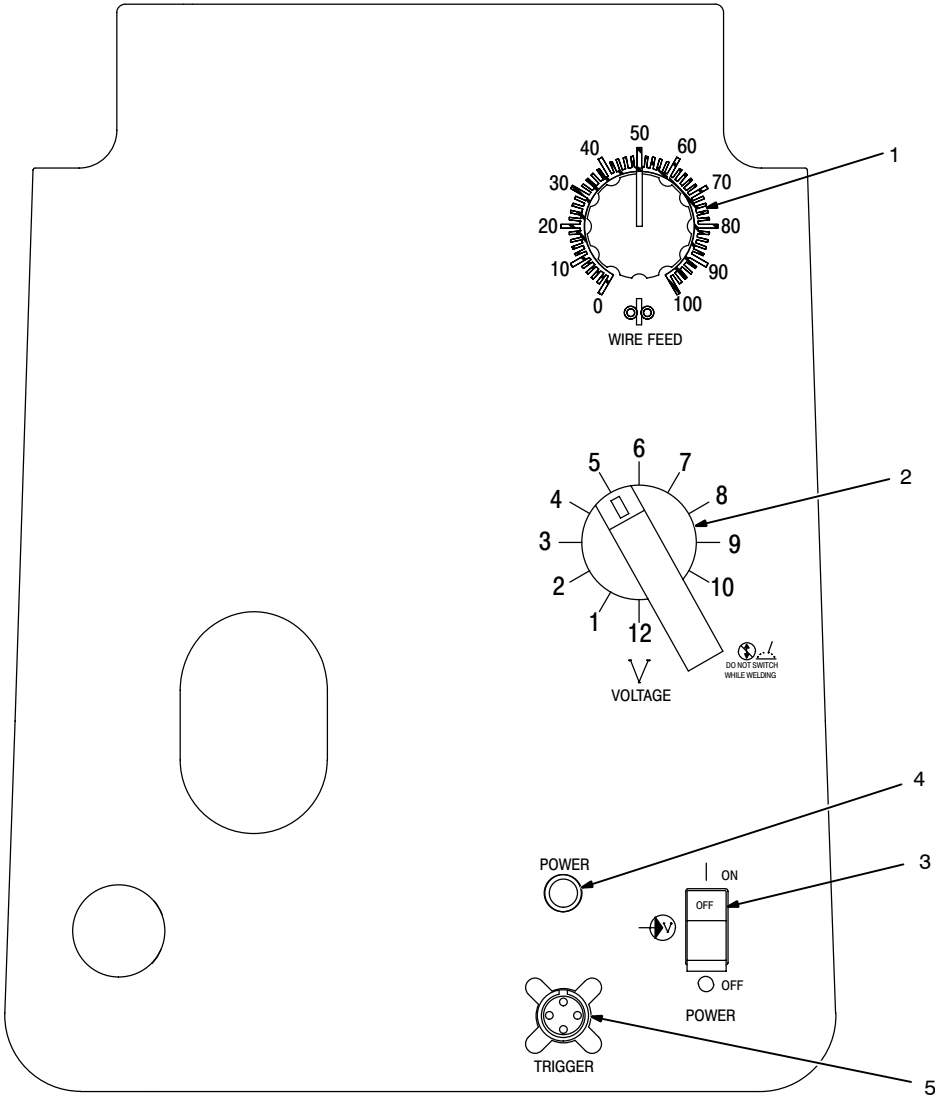

Ref. 242 155-A

## 4-2. Weld Parameters

235288A

### Selecting Wire, Gas and Control Settings


Settings are approximate and are based on a 230 input line voltage. Adjust as required. Thicker materials can be welded using proper technique, joint preparation and multiple passes.

Recommended Voltage and Wire Speed Settings for Thickness of Metal Being Welded  
Number on Left is Voltage Setting / Number on Right is Wire Feed Setting


 
 
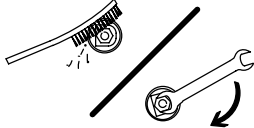

 
Material Being Welded	Wire Type, and Polarity Setting	Suggested Shielding Gases 20-30 cfm Flow Rate	Diameter of Wire Being Used	Recommended Voltage and Wire Speed Settings for Thickness of Metal Being Welded										
				24 gauge .024 inch (0.6mm)	22 gauge .030 inch (0.8mm)	18 gauge .048 inch (1.2mm)	16 gauge .062 inch (1.6mm)	14 gauge .075 inch (2.0mm)	1/8 inch (3.2mm)	3/16 inch (4.8mm)	1/4 inch (6.3mm)	3/8 inch (9.5mm)	1/2 inch (12.7mm)	
Steel	C <sub>25</sub> Gas Mixture 75% Ar / 25% CO <sub>2</sub> Produces less spatter Better Appearance	100% CO <sub>2</sub>	.024" (0.6mm)	1 / 22	2 / 26	3 / 34	3 / 40	3 / 40	4 / 40	5 / 50	6 / 70	7 / 70	8 / 74	9 / 90
			.030" (0.8mm)	1 / 20	1 / 26	3 / 30	3 / 34	4 / 30	5 / 36	6 / 46	7 / 60	8 / 70	9 / 76	
			.035" (0.9mm)	—	—	2 / 30	3 / 26	3 / 30	5 / 34	5 / 40	6 / 44	7 / 50	7 / 50	
			.045" (1.1mm)	—	—	—	2 / 20	3 / 22	4 / 24	5 / 26	6 / 34	6 / 34	6 / 34	
Steel	Solid Wire ER70S-6	100% CO <sub>2</sub>	.024" (0.6mm)	2 / 24	2 / 26	4 / 34	4 / 36	5 / 40	5 / 46	7 / 70	8 / 74	9 / 90	—	—
			.030" (0.8mm)	—	—	3 / 36	4 / 24	4 / 28	5 / 34	6 / 36	6 / 38	6 / 38	6 / 38	
			.035" (0.9mm)	—	—	3 / 24	3 / 18	4 / 18	6 / 26	7 / 30	7 / 30	7 / 30	7 / 30	
			.045" (1.1mm)	—	—	—	3 / 40	4 / 44	—	—	—	—	—	
Stainless Steel	"Set Polarity" for (DCEP)	98% Ar / 2% CO <sub>2</sub>	.024" (0.6mm)	1 / 30	1 / 32	3 / 36	3 / 40	4 / 44	—	—	—	—	—	—
			.030" (0.8mm)	1 / 20	1 / 26	3 / 30	3 / 34	4 / 34	5 / 40	6 / 60	7 / 70	7 / 70	7 / 70	
			.035" (0.9mm)	—	—	2 / 24	3 / 26	3 / 34	5 / 40	6 / 42	7 / 54	7 / 54	7 / 54	
			.045" (1.1mm)	—	—	—	2 / 20	3 / 22	5 / 26	5 / 30	6 / 32	6 / 32	6 / 32	
Stainless Steel	"Set Polarity" for (DCEP)	92% Ar / 8% CO <sub>2</sub> or 90% Ar / 10% CO <sub>2</sub>	.024" (0.6mm)	1 / 30	1 / 32	3 / 36	3 / 40	4 / 40	4 / 40	5 / 58	—	—	—	—
			.030" (0.8mm)	1 / 20	1 / 26	3 / 30	3 / 34	4 / 30	5 / 36	6 / 46	7 / 60	8 / 70	8 / 70	
			.035" (0.9mm)	—	—	2 / 26	3 / 28	3 / 32	5 / 40	6 / 40	7 / 46	7 / 46	7 / 46	
			.045" (1.1mm)	—	—	—	2 / 20	3 / 22	5 / 30	5 / 32	6 / 34	6 / 34	6 / 34	
Stainless Steel	"Set Polarity" for (DCEP)	Tri-Mix 90% HE / 7.5% Ar / 2.5% CO <sub>2</sub>	.024" (0.6mm)	—	2 / 30	4 / 40	4 / 46	5 / 48	6 / 60	—	—	—	—	—
			.030" (0.8mm)	—	2 / 30	4 / 32	4 / 36	5 / 36	7 / 60	8 / 62	8 / 62	8 / 62	8 / 62	
			.035" (0.9mm)	—	2 / 26	3 / 32	4 / 36	5 / 44	6 / 50	7 / 58	8 / 60	8 / 60	8 / 60	
			.045" (1.1mm)	—	—	—	—	—	—	—	—	—	—	—
Steel	Flux Core E71T-GS "Set Polarity" for (DCEN)	No Shielding Gas Required Good for Windy or Outdoor Applications	.024" (0.6mm)	—	1 / 28	2 / 34	2 / 38	3 / 44	6 / 80	—	—	—	—	—
			.030" (0.8mm)	—	1 / 30	2 / 32	2 / 36	3 / 40	4 / 52	6 / 68	6 / 76	7 / 76	8 / 78	
			.035" (0.9mm)	—	2 / 26	3 / 34	3 / 36	4 / 40	7 / 64	9 / 60	9 / 62	10 / 70	10 / 70	
			.045" (1.1mm)	—	—	—	—	—	—	—	—	—	—	—
Aluminum With Optional DP 3545 Spoolgun	Aluminum** 4043 AL (DCEP)	100% Argon**	.030" (0.8mm)	—	—	1 / 24	2 / 26	3 / 34	5 / 44	—	—	—	—	—
			.035" (0.9mm)	—	—	—	2 / 20	3 / 26	5 / 38	6 / 40	7 / 44	8 / 50	8 / 50	
			.045" (1.1mm)	—	—	—	—	3 / 20	5 / 28	6 / 32	7 / 38	8 / 44	9 / 50	
			.030" (0.8mm)	—	—	—	2 / 36	3 / 36	6 / 40	7 / 42	8 / 46	9 / 60	10 / 66	
Aluminum With Optional DP 3545 Spoolgun	Aluminum** 5356 AL (DCEP)	100% Argon**	.035" (0.9mm)	—	—	2 / 24	3 / 30	4 / 34	7 / 34	8 / 40	9 / 50	10 / 52	11 / 60	
			.047" (1.2mm)	—	—	—	—	—	—	—	9 / 24	10 / 26	11 / 30	
			.030" (0.8mm)	—	—	—	2 / 36	3 / 36	6 / 50	8 / 60	9 / 76	10 / 82	12 / 98	
			.035" (0.9mm)	—	—	—	3 / 36	4 / 36	7 / 44	8 / 46	9 / 54	10 / 58	12 / 82	
Aluminum With Optional DP 3545 Spoolgun	Aluminum** (DCEP)	100% Argon**	.047" (1.2mm)	—	—	—	—	—	—	7 / 28	9 / 34	10 / 34	11 / 38	
			.030" (0.8mm)	—	—	—	—	—	—	—	—	—	—	
			.035" (0.9mm)	—	—	—	—	—	—	—	—	—	—	
			.047" (1.2mm)	—	—	—	—	—	—	—	—	—	—	

# SECTION 5 – MAINTENANCE AND TROUBLESHOOTING

 
## 5-1. Routine Maintenance

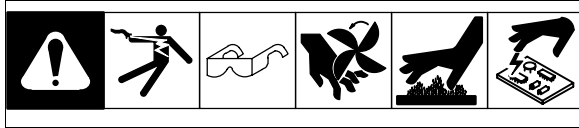

**Disconnect power before maintaining.** *Maintain more often during severe conditions.*

	✓ = Check * To be done by Factory Authorized Service Agent	◇ = Change	● = Clean	☆ = Replace	Reference	
Every 3 Months	 ☆ Damaged Or Unreadable Labels	 ☆ Cracked Parts		 ✓ ☆ Cables	 ✓ ● Tighten Weld Terminal	
Every 6 Months	 ● Inside Unit	 ✓ Remove drive roll and apply light coat of oil or grease to drive motor shaft				


## 5-2. Supplementary Protectors



**Turn Off unit.**


- Supplementary Protector CB1  
CB1 protects main circuit board PC1.
- Supplementary Protector CB2  
CB2 protects the drive motor circuit from overload. If drive motor shorts or fails: check gun liner blockage or kinks, check for jammed wire or binding drive rolls.

Correct problem. Press button to reset supplementary protector.

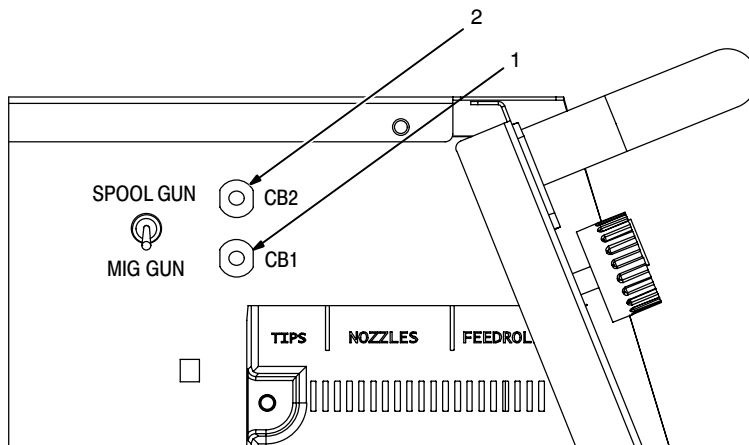

Ref. 242 160-A

### 5-3. Replacing Drive Roll And Wire Inlet Guide

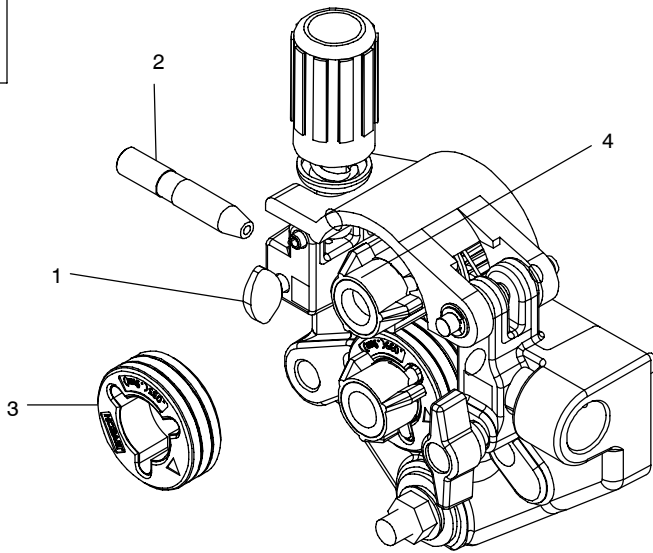

- 1 Securing Screw
- 2 Inlet Wire Guide

Loosen screw. Slide tip as close to drive rolls as possible without touching. Tighten screw.

- 3 Drive Roll


The drive roll consists of two different sized grooves. The stamped markings on the outer surface of the roll refers to the groove on the opposite side of the drive roll. The groove closest to the motor shaft is the proper groove to thread wire (see Section 3-15).

- 4 Drive Roll Securing Nut

Turn nut one click to secure drive roll.

242 533-A

### 5-4. Removing Knob From Front Panel

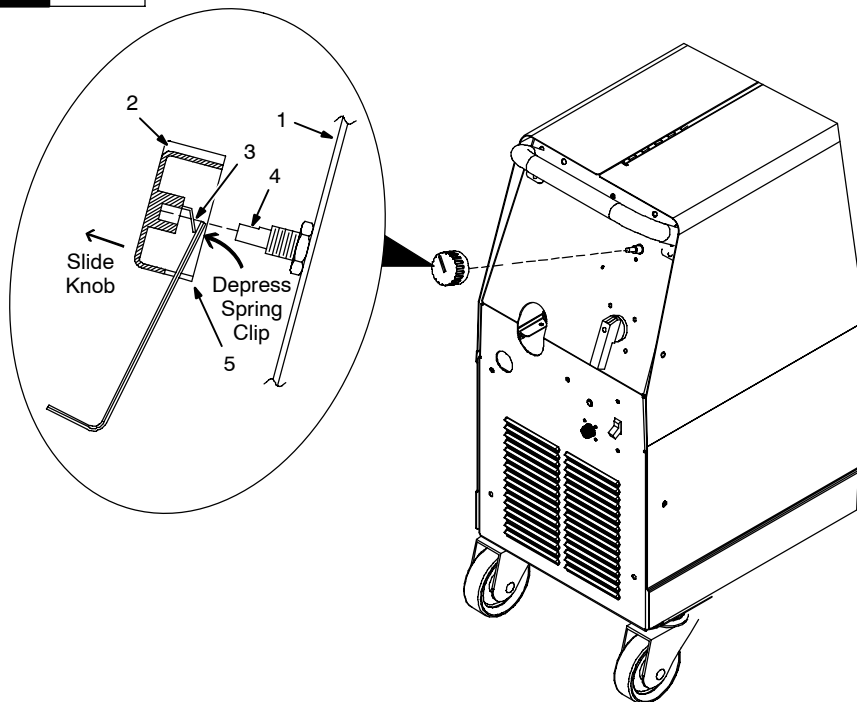

#### Turn Off power.


- 1 Front Panel
- 2 Knob
- 3 Spring Clip
- 4 Control Shaft
- 5 Slot

Rotate knob to allow access to slot. Insert Allen wrench (or stiff piece of wire) into slot, and while depressing spring clip, slide knob off control shaft.

To reinstall, push knob fully onto control shaft.

242 693-A

## 5-5. Aligning Drive Rolls and Wire Guide

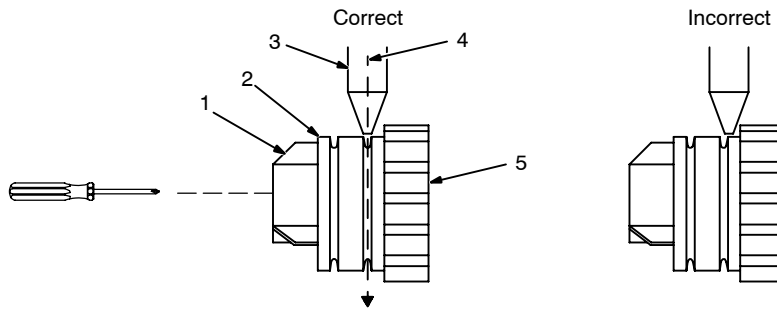

### ▲ Turn Off power.

 
View is from top of drive rolls looking down with pressure assembly open.

- 1 Drive Roll Securing Nut
- 2 Drive Roll
- 3 Wire Guide
- 4 Welding Wire
- 5 Drive Gear

Insert screwdriver, and turn screw in or out until drive roll groove lines up with wire guide.


Close pressure roll assembly.

Tools Needed:



Ref. 800 412-A

## 5-6. Replacing Gun Contact Tip

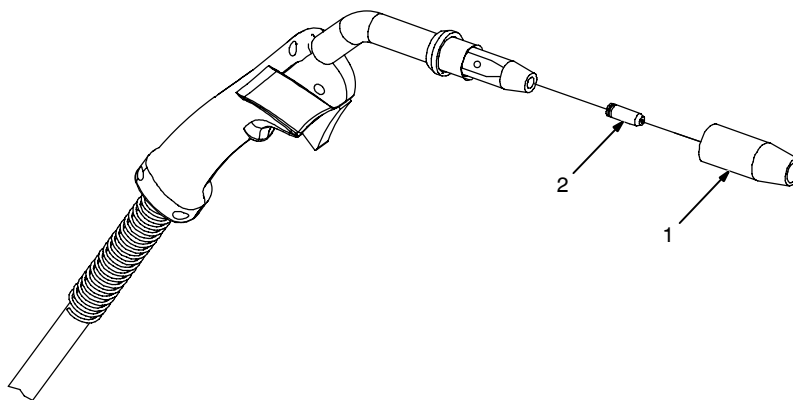


### ▲ Turn Off power before replacing contact tip.

- 1 Nozzle
- 2 Contact Tip

Cut off welding wire at contact tip. Remove nozzle.

Remove contact tip and install new contact tip. Reinstall nozzle.

 Tools Needed:




Ref. 242 164-A

## 5-7. Installing Cable Hangers



**⚠ Turn Off power before installing cable hangers.**

- 1 Cable Hanger
- 2 Screws

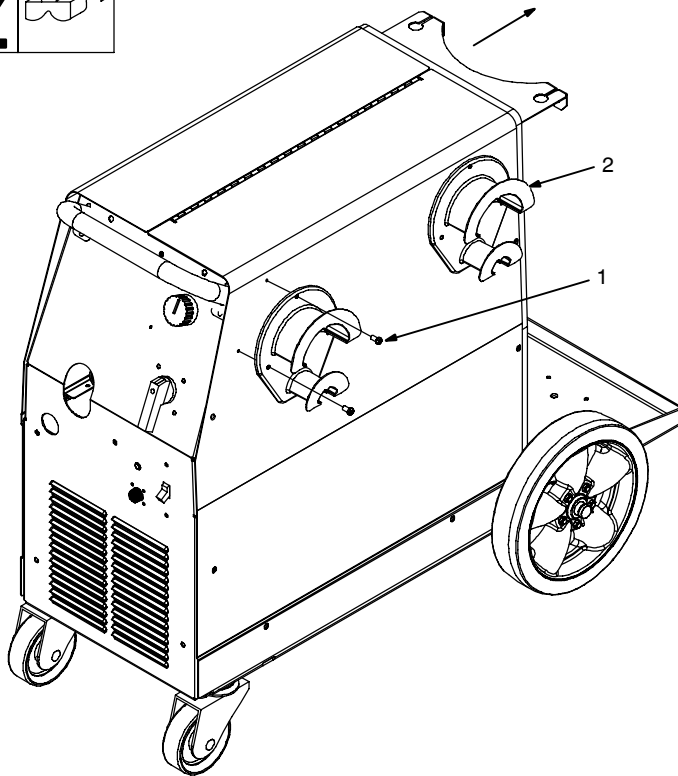


Tools Needed:



Ref. 242 165-A




## 5-8. Removing Nozzle, Contact Tip, And Adapter, Changing Liner, And Cleaning Gun Casing

 

**⚠ Turn off welding power source/wire feeder.**

- 1 Nozzle
- 2 Contact Tip
- 3 Tip Adapter
- 4 Nozzle Adapter

**🔧 Wire size stamped on tip – check and match wire size.**

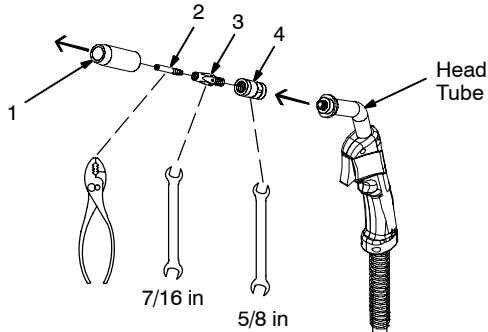

Remove nozzle, contact tip, and adapter.

Cut off wire and disconnect gun from feeder.

Unscrew and remove liner.


Lay gun cable out straight before installing new liner.

Blow out gun casing.


Reassemble gun in reverse order from taking it apart.

Install Liner

**🔧 Thread wire according to welding power source/wire feeder manual.**

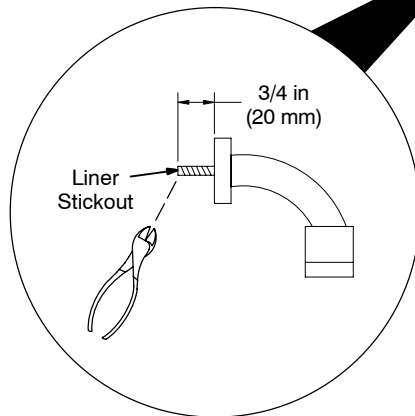

Tools Needed:

 

5/8, 7/16 in

242 207-A

## 5-9. Welding Troubleshooting Table



Welding Trouble	Remedy
No weld output; wire does not feed.	Secure power cord plug in receptacle (see Section 3-14).
	Place Power switch in the ON position.
	Place MIG/Spool Gun switch in the proper position.
	Check and replace Power switch if necessary.
	Check supplementary protectors CB1 and/or CB2, and reset if necessary (see Section 5-2).
	Replace building line fuse or reset circuit breaker if open (see Section 3-14).
	Secure gun trigger plug in receptacle or repair leads, or replace trigger switch (see Sections 3-4 and/or Parts List).
No weld output; wire feeds.	Thermostat open (overheating). Allow fan to run; the thermostat will close when the unit has cooled (see Section 3-2).
	Connect work clamp to get good metal to metal contact.
Low weld output.	Replace contact tip (see Section 5-6).
	Connect unit to proper input voltage or check for low line voltage (see Section 3-14).
Low, high, or erratic wire speed.	Readjust front panel settings (see Section 4-1).
	Change to correct size drive roll (see Section 5-3).
	Readjust drive roll pressure (see Section 3-15).
	Replace inlet guide, contact tip, and/or liner if necessary (see Sections 5-3, 5-6 and/or 5-8).


## 5-10. Wire Drive/Gun Troubleshooting Table

Wire Drive/Gun Trouble	Remedy
Electrode wire feeding stops during welding or wire feeding intermittently.	Straighten gun cable and/or replace damaged parts (see Section 5-8).
	Adjust drive roll pressure (see Section 3-15).
	Readjust hub tension (see Section 3-8).
	Check supplementary protectors CB1 and/or CB2, and reset if necessary (see Section 5-2).
	Replace contact tip if blocked (see Section 5-6).
	Clean or replace wire inlet guide or liner if dirty or plugged (see Sections 5-3 and/or 5-8).
	Replace drive roll if worn or slipping (see Section 5-3).
	Secure gun trigger plug in receptacle or repair leads, or replace trigger switch (see Section 3-4 and/or see Parts List).
	Check and clear any restrictions at drive assembly and liner (see Section 5-8).
	Have nearest Factory Authorized Service Agent check drive motor.


# SECTION 6 – MIG WELDING (GMAW) GUIDELINES




## 6-1. Typical MIG Process Connections

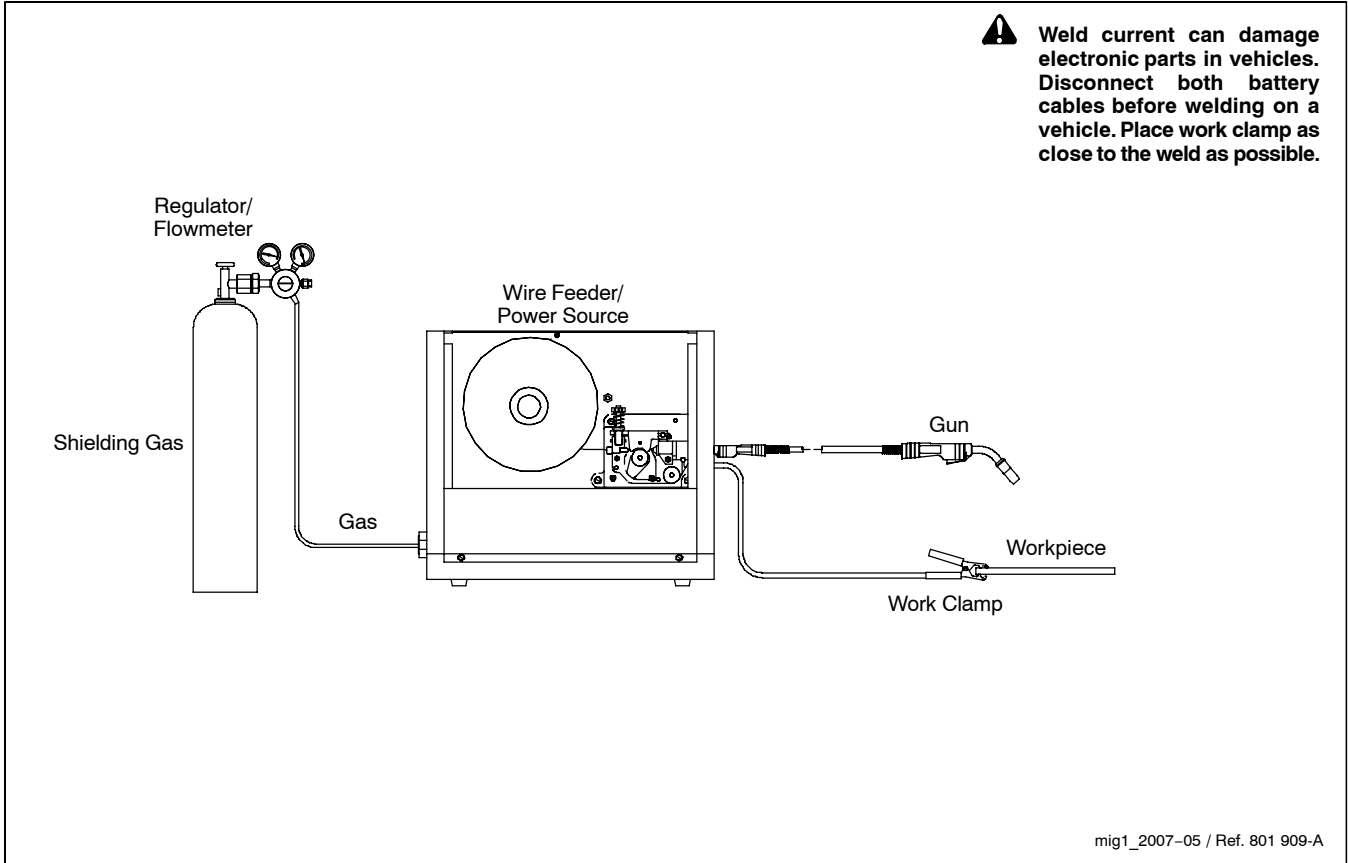


## 6-2. Typical MIG Process Control Settings

  These settings are guidelines only. Material and wire type, joint design, fitup, position, shielding gas, etc. affect settings. Test welds to be sure they comply to specifications.


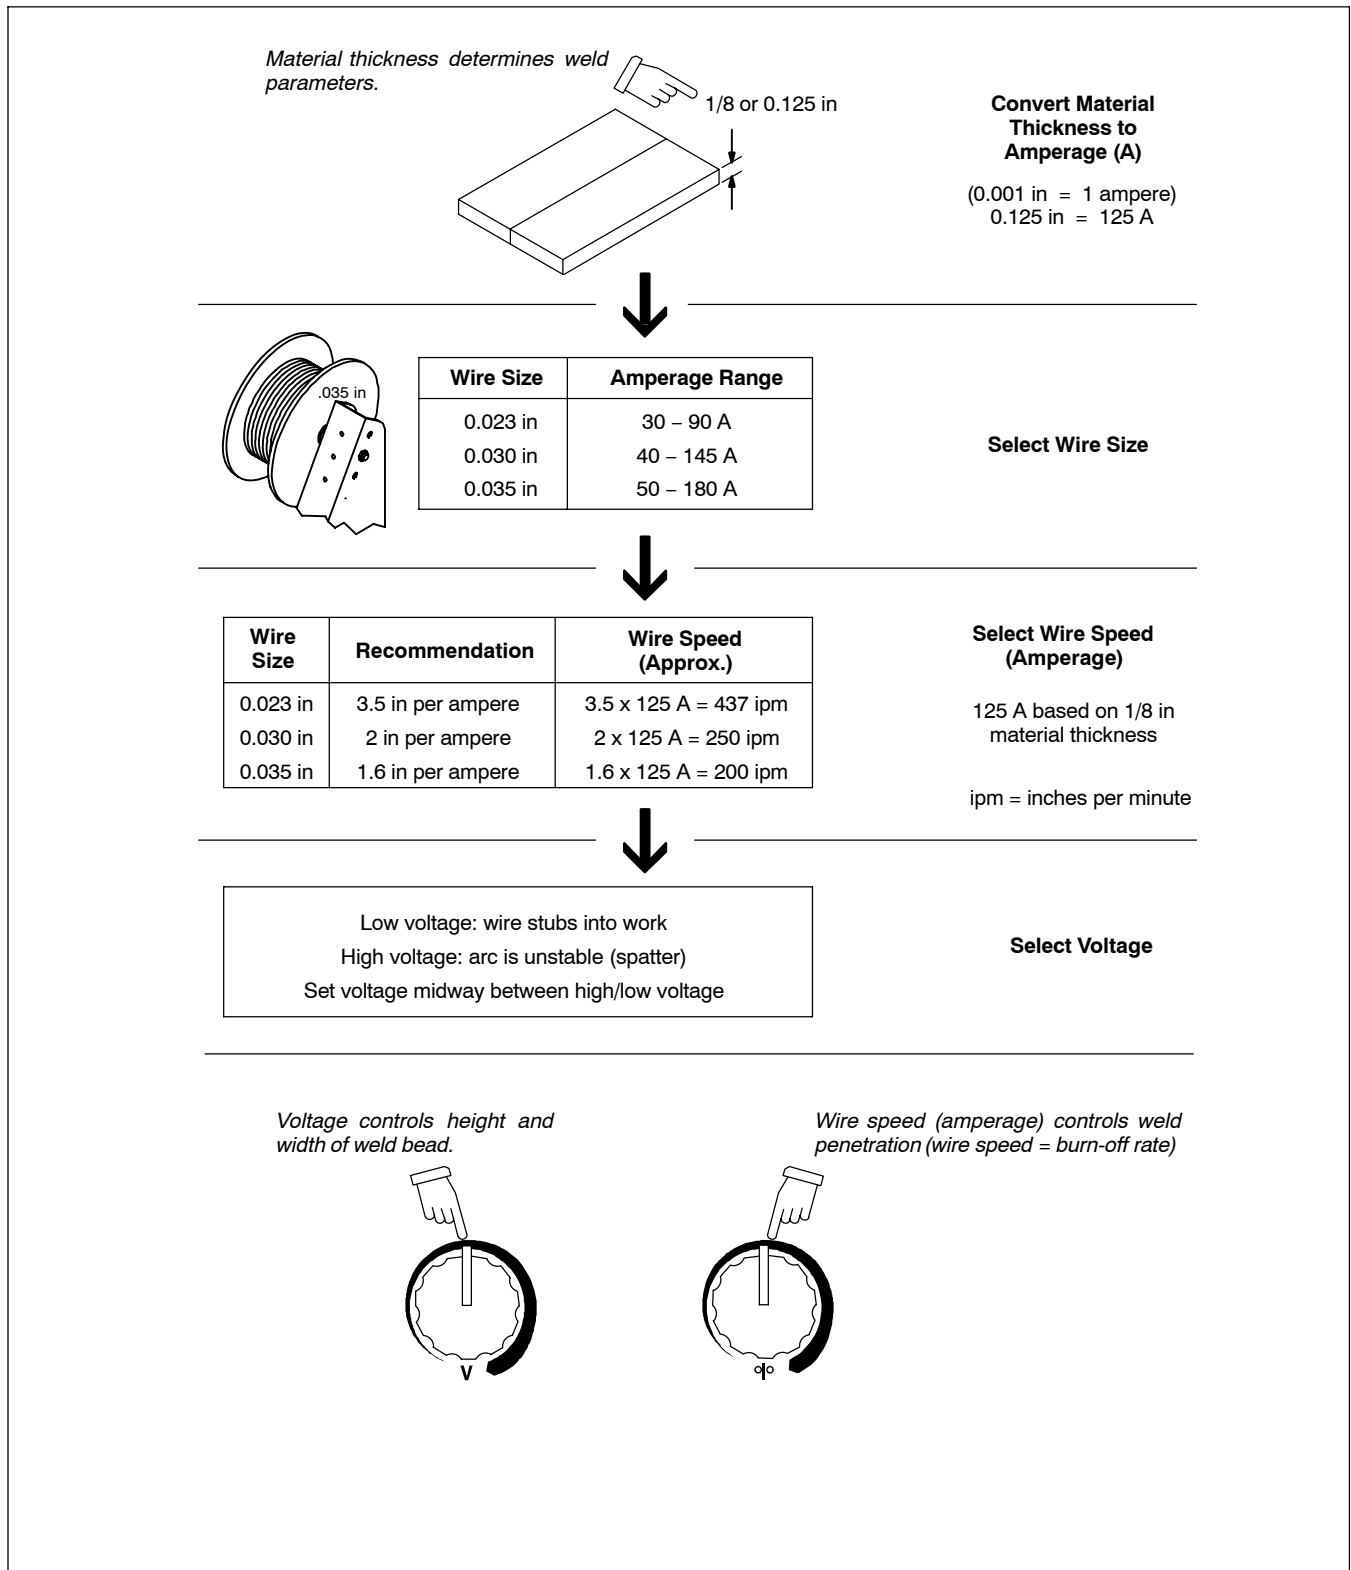


### 6-3. Holding And Positioning Welding Gun



☞ Welding wire is energized when gun trigger is pressed. Before lowering helmet and pressing trigger, be sure wire is no more than 1/2 in (13 mm) past end of nozzle, and tip of wire is positioned correctly on seam.

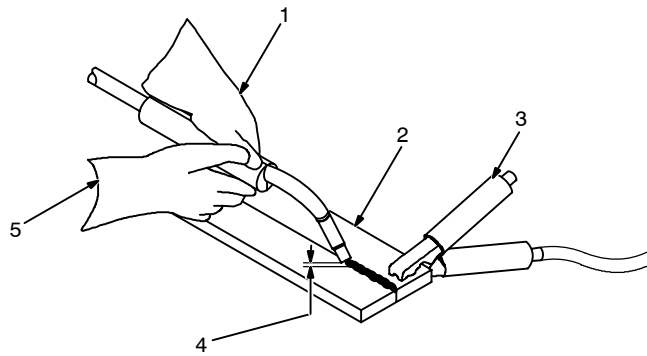

- 1 Hold Gun and Control Gun Trigger
- 2 Workpiece
- 3 Work Clamp
- 4 Electrode Extension (Stickout) 1/4 to 1/2 in (6 To 13 mm)
- 5 Cradle Gun and Rest Hand on Workpiece

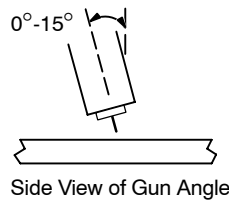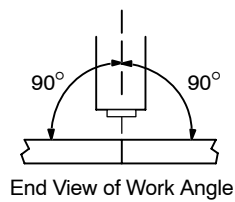

GROOVE WELDS



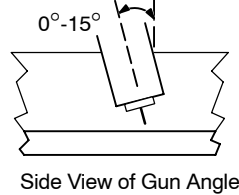
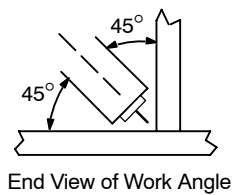


FILLET WELDS

S-0421-A

## 6-4. Conditions That Affect Weld Bead Shape


☞ Weld bead shape depends on gun angle, direction of travel, electrode extension (stickout), travel speed, thickness of base metal, wire feed speed (weld current), and voltage.

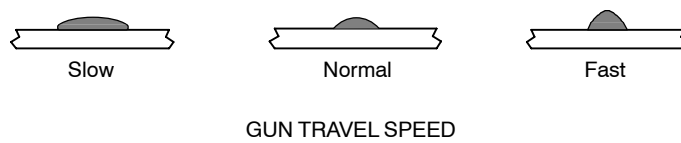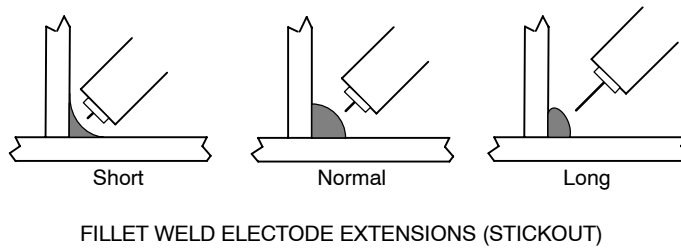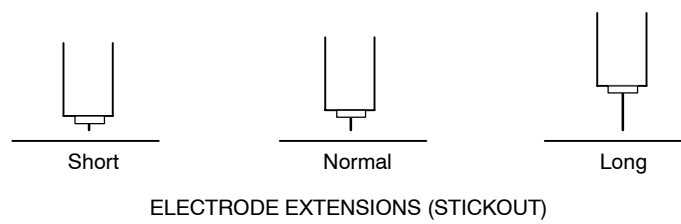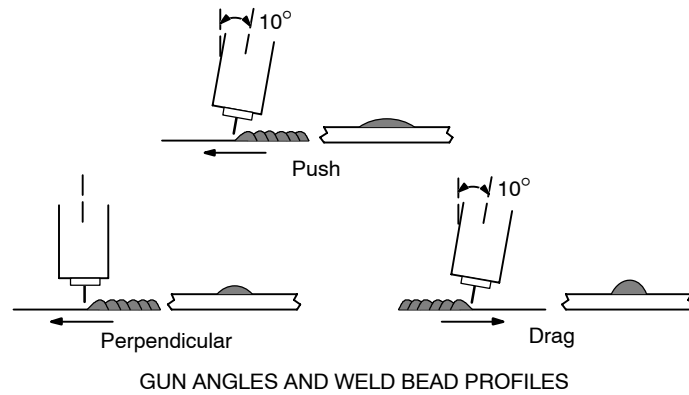


S-0634

## 6-5. Gun Movement During Welding


☞ Normally, a single stringer bead is satisfactory for most narrow groove weld joints; however, for wide groove weld joints or bridging across gaps, a weave bead or multiple stringer beads works better.

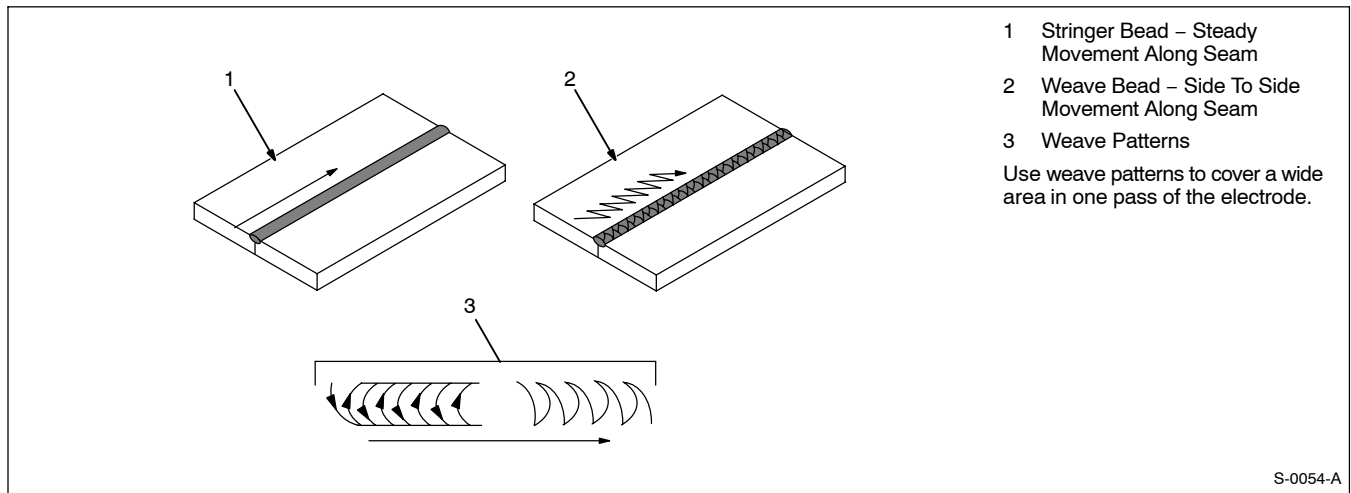


## 6-6. Poor Weld Bead Characteristics

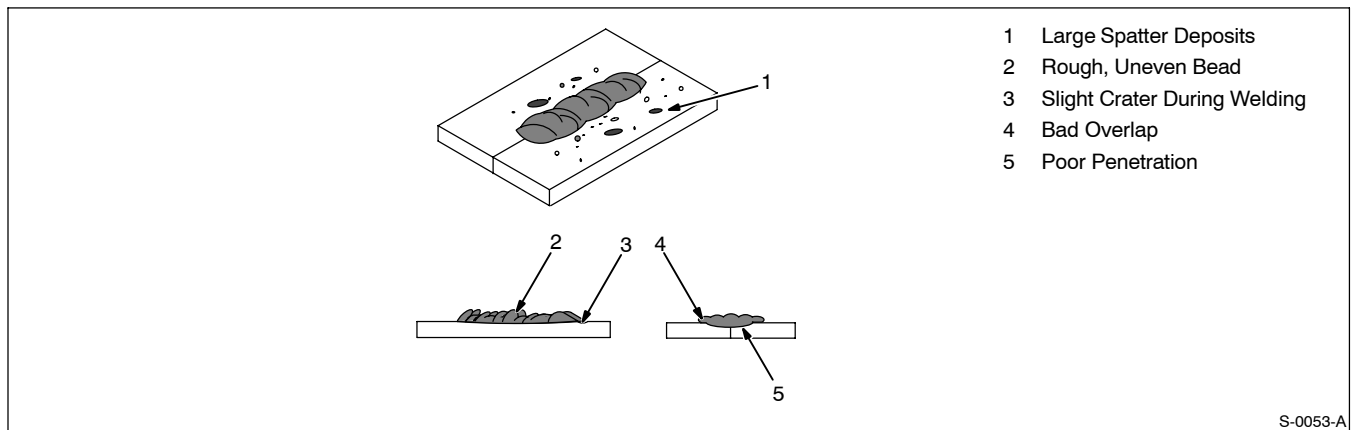

## 6-7. Good Weld Bead Characteristics

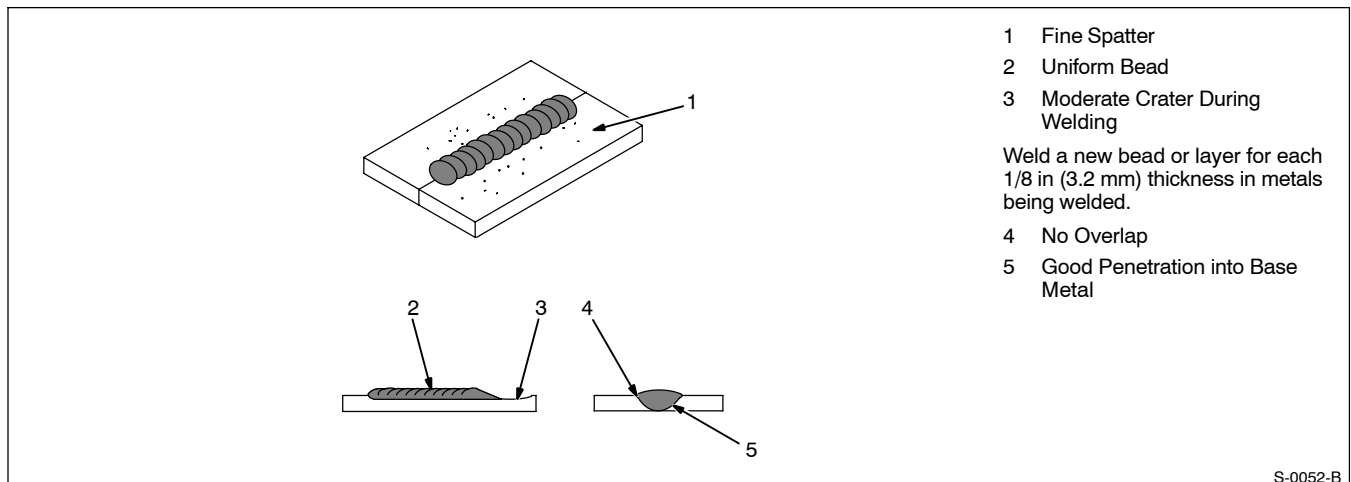

## 6-8. Troubleshooting – Excessive Spatter

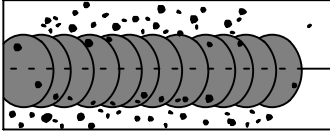


Excessive Spatter – scattering of molten metal particles that cool to solid form near weld bead.

S-0636

Possible Causes	Corrective Actions
Wire feed speed too high.	Select lower wire feed speed.
Voltage too high.	Select lower voltage range.
Electrode extension (stickout) too long.	Use shorter electrode extension (stickout).
Workpiece dirty.	Remove all grease, oil, moisture, rust, paint, undercoating, and dirt from work surface before welding.
Insufficient shielding gas at welding arc.	Increase flow of shielding gas at regulator/flowmeter and/or prevent drafts near welding arc.
Dirty welding wire.	Use clean, dry welding wire.
	Eliminate pickup of oil or lubricant on welding wire from feeder or liner.
Incorrect polarity.	Check polarity required by welding wire, and change to correct polarity at welding power source.

## 6-9. Troubleshooting – Porosity

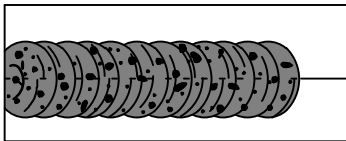


Porosity – small cavities or holes resulting from gas pockets in weld metal.

S-0635

Possible Causes	Corrective Actions
Insufficient shielding gas at welding arc.	Increase flow of shielding gas at regulator/flowmeter and/or prevent drafts near welding arc.
	Remove spatter from gun nozzle.
	Check gas hoses for leaks.
	Place nozzle 1/4 to 1/2 in (6-13 mm) from workpiece.
	Hold gun near bead at end of weld until molten metal solidifies.
Wrong gas.	Use welding grade shielding gas; change to different gas.
Dirty welding wire.	Use clean, dry welding wire.
	Eliminate pick up of oil or lubricant on welding wire from feeder or liner.
Workpiece dirty.	Remove all grease, oil, moisture, rust, paint, coatings, and dirt from work surface before welding.
	Use a more highly deoxidizing welding wire (contact supplier).
Welding wire extends too far out of nozzle.	Be sure welding wire extends not more than 1/2 in (13 mm) beyond nozzle.

## 6-10. Troubleshooting – Excessive Penetration

 

Excessive Penetration Good Penetration


Excessive Penetration – weld metal melting through base metal and hanging underneath weld.

S-0639


Possible Causes	Corrective Actions
Excessive heat input.	Select lower voltage range and reduce wire feed speed.
	Increase travel speed.




## 6-11. Troubleshooting – Lack Of Penetration

  <p>Lack Of Penetration – shallow fusion between weld metal and base metal.</p>		S-0638
Possible Causes	Corrective Actions	
Improper joint preparation.	Material too thick. Joint preparation and design must provide access to bottom of groove while maintaining proper welding wire extension and arc characteristics.	
Improper weld technique.	Maintain normal gun angle of 0 to 15 degrees to achieve maximum penetration.	
	Keep arc on leading edge of weld puddle.	
	Be sure welding wire extends not more than 1/2 in (13 mm) beyond nozzle.	
Insufficient heat input.	Select higher wire feed speed and/or select higher voltage range.	
	Reduce travel speed.	
Incorrect polarity.	Check polarity required by welding wire, and change to correct polarity at welding power source.	


## 6-12. Troubleshooting – Incomplete Fusion

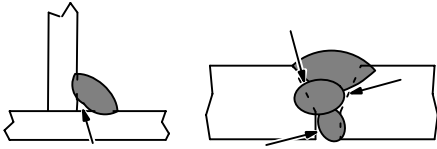 <p>Incomplete Fusion – failure of weld metal to fuse completely with base metal or a preceding weld bead.</p>		S-0637
Possible Causes	Corrective Actions	
Workpiece dirty.	Remove all grease, oil, moisture, rust, paint, undercoating, and dirt from work surface before welding.	
Insufficient heat input.	Select higher voltage range and/or adjust wire feed speed.	
Improper welding technique.	Place stringer bead in proper location(s) at joint during welding.	
	Adjust work angle or widen groove to access bottom during welding.	
	Momentarily hold arc on groove side walls when using weaving technique.	
	Keep arc on leading edge of weld puddle.	
	Use correct gun angle of 0 to 15 degrees.	


## 6-13. Troubleshooting – Burn-Through

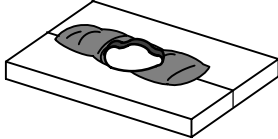 <p>Burn-Through – weld metal melting completely through base metal resulting in holes where no metal remains.</p>		S-0640
Possible Causes	Corrective Actions	
Excessive heat input.	Select lower voltage range and reduce wire feed speed.	
	Increase and/or maintain steady travel speed.	

## 6-14. Troubleshooting – Waviness Of Bead

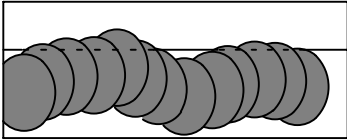		<p>Waviness Of Bead – weld metal that is not parallel and does not cover joint formed by base metal.</p>	S-0641
Possible Causes		Corrective Actions	
Welding wire extends too far out of nozzle.		Be sure welding wire extends not more than 1/2 in (13 mm) beyond nozzle.	
Unsteady hand.		Support hand on solid surface or use two hands.	

## 6-15. Troubleshooting – Distortion

 		<p>Distortion – contraction of weld metal during welding that forces base metal to move.</p>	S-0642
<p>Base metal moves in the direction of the weld bead.</p>			
Possible Causes		Corrective Actions	
Excessive heat input.		Use restraint (clamp) to hold base metal in position.	
		Make tack welds along joint before starting welding operation.	
		Select lower voltage range and/or reduce wire feed speed.	
		Increase travel speed.	
		Weld in small segments and allow cooling between welds.	

## 6-16. Common MIG Shielding Gases

This is a general chart for common gases and where they are used. Many different combinations (mixtures) of shielding gases have been developed over the years. The most commonly used shielding gases are listed in the following table.

Gas	Application			
	Spray Arc Steel	Short Circuiting Steel	Short Circuiting Stainless Steel	Aluminum
Argon				X
Argon + 25% CO <sub>2</sub>		X		
80% or greater Argon + balance CO <sub>2</sub> or Oxygen	X	X <sup>1</sup>		
100% CO <sub>2</sub>		X		
Tri-Mix <sup>2</sup>			X	

1 Limited short circuiting use

2 90% HE + 7-1/2% AR + 2-1/2% CO<sub>2</sub>


## 6-17. Troubleshooting Guide For Semiautomatic Welding Equipment


Problem	Probable Cause	Remedy
Wire feed motor operates, but wire does not feed.	Too little pressure on wire feed rolls.	Increase pressure setting on wire feed rolls.
	Incorrect wire feed rolls.	Check size stamped on wire feed rolls, replace to match wire size and type if necessary.
	Wire spool brake pressure too high.	Decrease brake pressure on wire spool.
	Restriction in the gun and/or assembly.	Check and replace cable, gun, and contact tip if damaged. Check size of contact tip and cable liner, replace if necessary.
Wire curling up in front of the wire feed rolls (bird nesting).	Too much pressure on wire feed rolls.	Decrease pressure setting on wire feed rolls.
	Incorrect cable liner or gun contact tip size.	Check size of contact tip and check cable liner length and diameter, replace if necessary.
	Gun end not inserted into drive housing properly.	Loosen gun securing bolt in drive housing and push gun end into housing just enough so it does not touch wire feed rolls.
	Dirty or damaged (kinked) liner.	Replace liner.
Wire feeds, but no gas flows.	Gas cylinder empty.	Replace empty gas cylinder.
	Gas nozzle plugged.	Clean or replace gas nozzle.
	Gas cylinder valve not open or flowmeter not adjusted.	Open gas valve at cylinder and adjust flow rate.
	Restriction in gas line.	Check gas hose between flowmeter and wire feeder, and gas hose in gun and cable assembly.
	Loose or broken wires to gas solenoid.	Have Factory Authorized Service Agent repair wiring.
	Gas solenoid valve not operating.	Have Factory Authorized Service Agent replace gas solenoid valve.
	Incorrect primary voltage connected to welding power source.	Check primary voltage and relink welding power source for correct voltage.

<b>Problem</b>	<b>Probable Cause</b>	<b>Remedy</b>
Welding arc not stable.	Wire slipping in drive rolls.	Adjust pressure setting on wire feed rolls. Replace worn drive rolls if necessary.
	Wrong size gun liner or contact tip.	Match liner and contact tip to wire size and type.
	Incorrect voltage setting for selected wire feed speed on welding power source.	Readjust welding parameters.
	Loose connections at the gun weld cable or work cable.	Check and tighten all connections.
	Gun in poor shape or loose connection inside gun.	Repair or replace gun as necessary.



# SECTION 8 – PARTS LIST

 Hardware is common and not available unless listed.

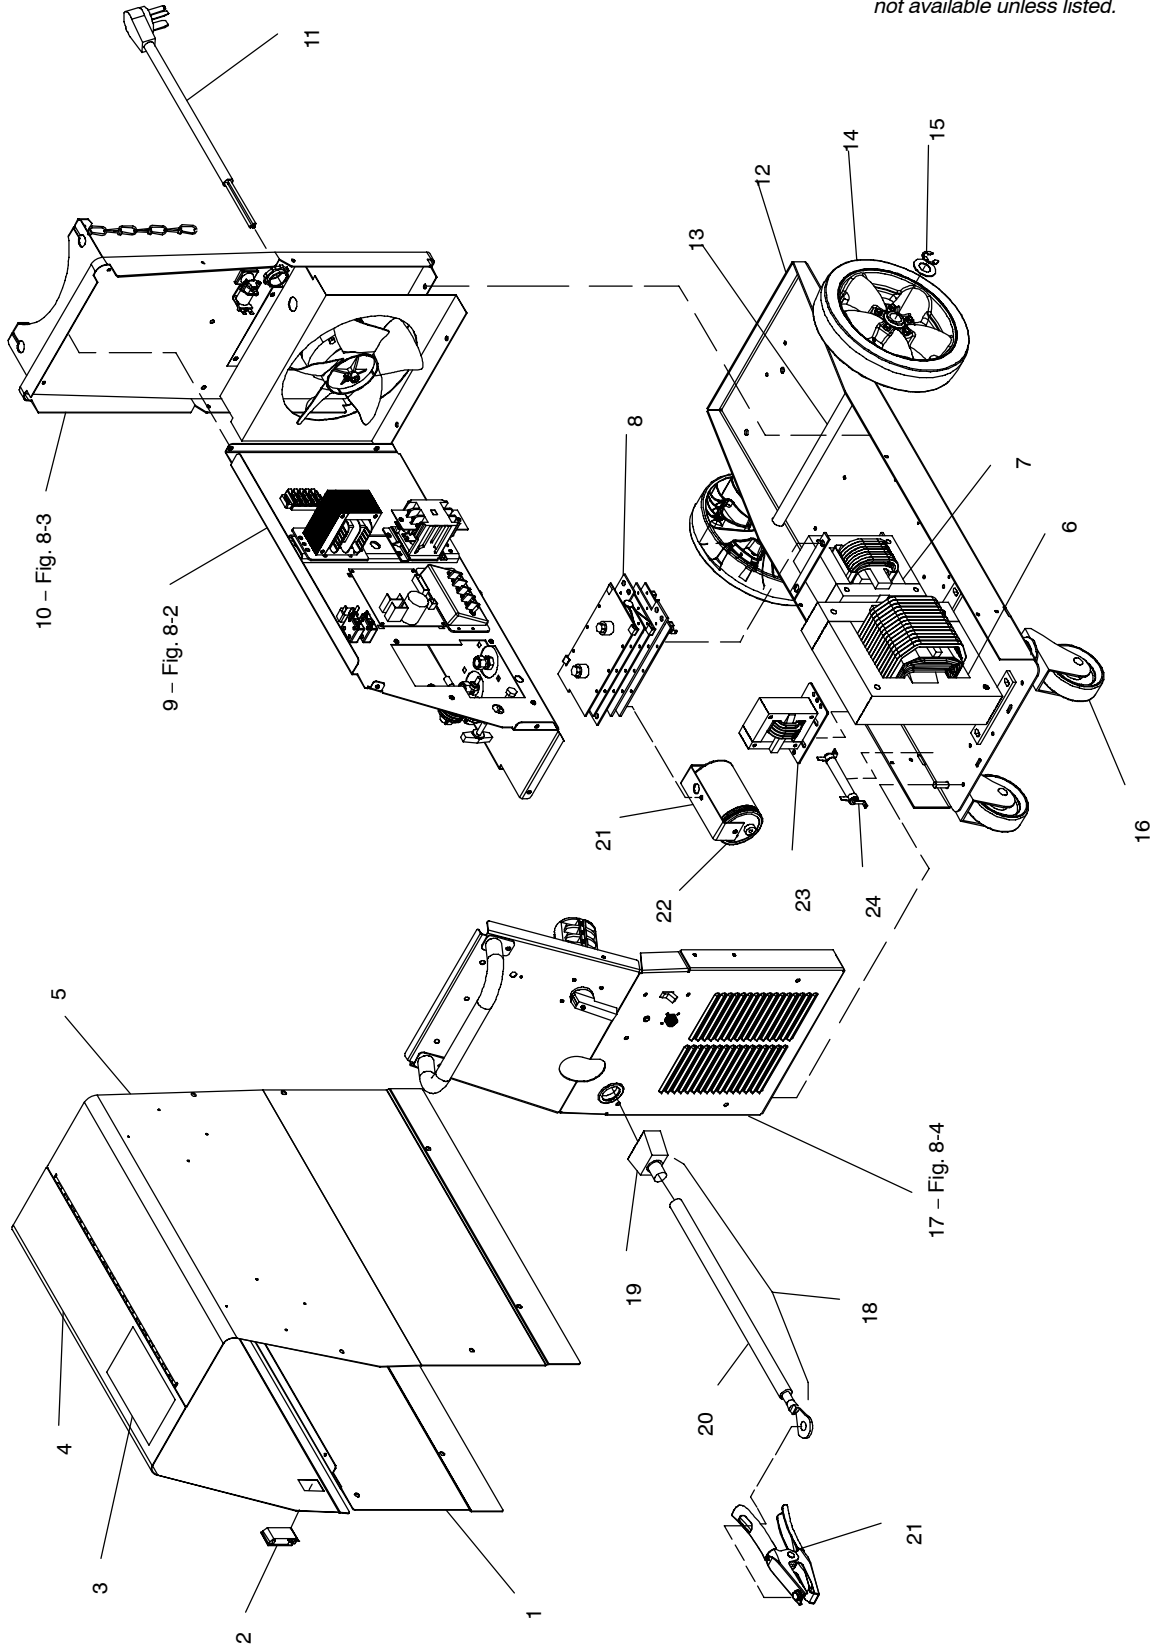

**Figure 8-1. Main Assembly**

242 214-A

Item No.	Dia. Mkgs.	Part No.	Description	Quantity
----------	------------	----------	-------------	----------


**Figure 8-1. Main Assembly**

...	1	234 210	.. PANEL, side	1
...	2	204 711	.. LATCH, side flush	2
...	3	134 464	.. LABEL, warning general precautionary	1
...	4	234 211	.. DOOR ASSY	1
...		235 268	.. LABEL, parameter/consumables/polarity	1
...	5	+234 209	.. WRAPPER	1
...	6	T1 .. 236 760	.. TRANSFORMER, pwr main 200/230	1
...	7	Z1 .. 232 877	.. STABILIZER	1
...	8	SR1 .. 239 529	.. RECTIFIER	1
...	9	Fig 8-2	.. CENTER BAFFLE w/components	1
...	10	Fig 8-3	.. PANEL, rear w/components	1
...	11	PLG1 .. 199 192	.. CORD SET, 6-50p 12ga 3/c	1
...	12	146 161	.. BASE	1
...	13	135 390	.. AXLE	1
...	14	230 799	.. WHEEL	2
...	15	121 614	.. RING, retaining	2
...	16	235 875	.. CASTER, swvl 4.00 in X 1.250 in	2
...	17	Fig 8-4	.. PANEL, front w/components	1
...	18	233 473	.. CABLE, work 10' no. 3 w/clamp & boot (including)	1
...	19	196 318	.. COVER, cable	1
...	20	146 149	.. CABLE	1
...	21	233 452	.. CLAMP, work	1
...	22	235 263	.. BRACKET, capacitor	1
...	23	234 212	.. CAPACITOR, 100,000 uf	1
...	24	233 420	.. CHOKE, 20 uf	1
...	25	091 685	.. RESISTOR, 25 ohm 50 W	1
...		238 759	.. REGULATOR/FLOWGAUGE, 0-50 CFH ARGON/CO2 kit	1
...		144 108	.. HOSE, gas	1
...		238 810	.. HANGER, cable	2
...		239 173	.. H200L4-15 GUN (replacement)	1

+When ordering a component originally displaying a precautionary label, the label should also be ordered.

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**

☐ Hardware is common and not available unless listed.

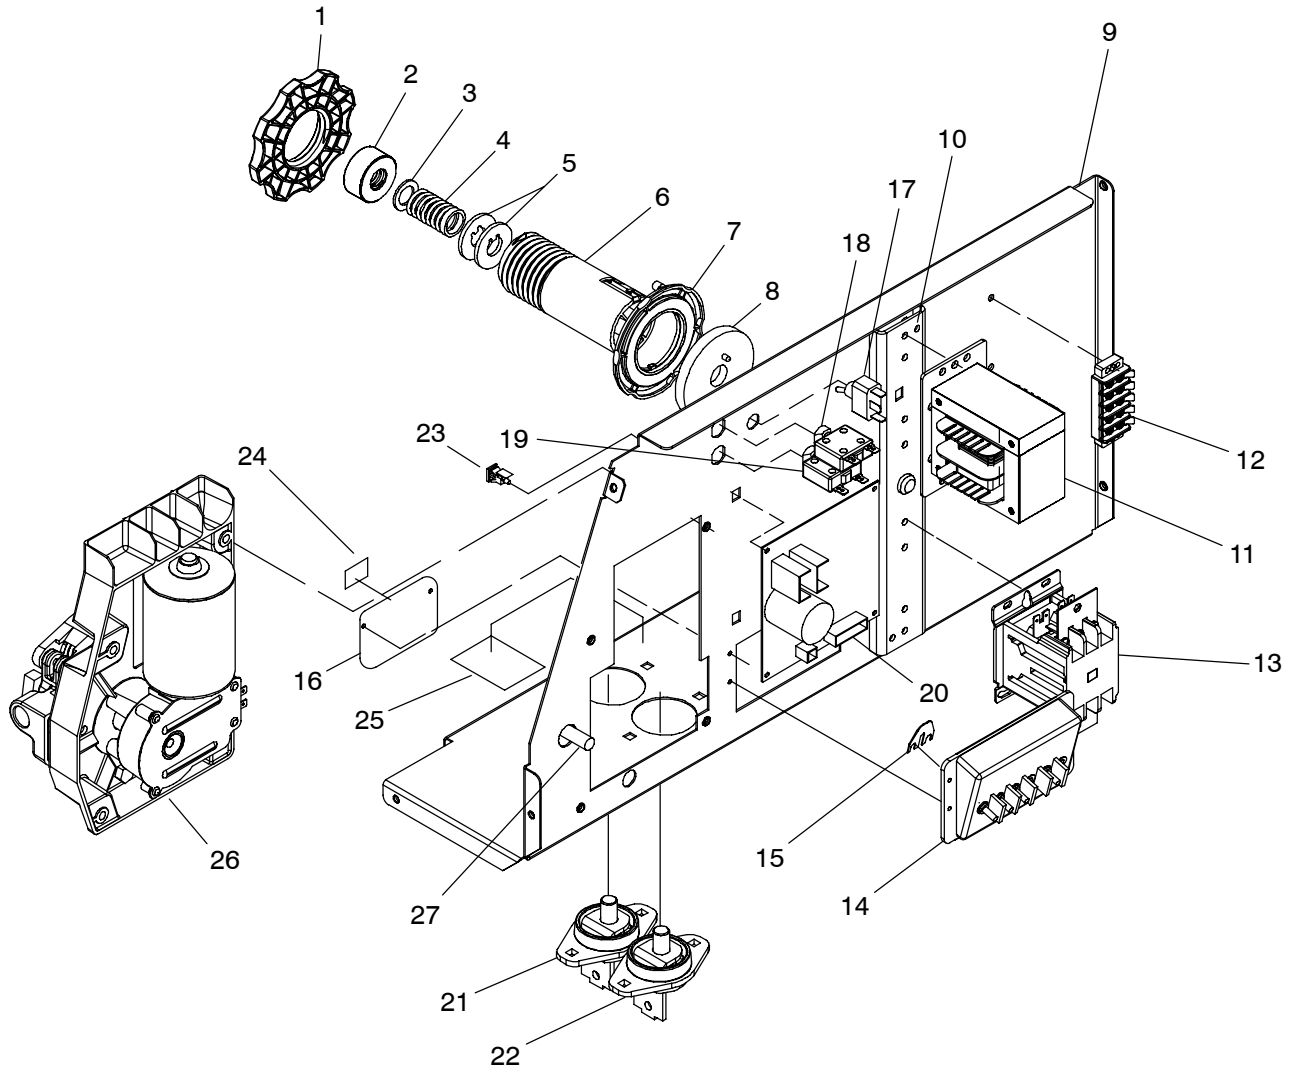

**Figure 8-2. Center Baffle w/Components**

242 215-A



Item No.	Dia. Mkgs.	Part No.	Description	Quantity
----------	------------	----------	-------------	----------


**Figure 8-2. Center Baffle w/Components (Fig 8-1 Item 9)**

...	1	211 877	.. NUT, retaining spool	1
...	2	270 195	.. NUT, tension	1
...	3	605 941	.. WASHER, flat	1
...	4	186 437	.. SPRING, cprsn 2.430 OD x .90 wire x 2.50	1
...	5	057 971	.. WASHER, flat .632 ID x 1.50 OD x .12 (keyed)	2
...	6	238 652	.. HUB, spool	1
...	7	238 653	.. ADAPTOR, spool hub	1
...	8	186 436	.. WASHER, brake	1
...	9	234 207	.. BAFFLE, center	1
...	10	238 445	.. REEL SUPPORT	1
...	11	236 771	.. TRANSFORMER, control	1
...	12	239 923	.. BLOCK, terminal 5 pole	1
...	13	184 946	.. CONTACTOR, def 40A 3P	1
...	14	TE1	.. TERMINAL ASSY, pri 1 PH (200/230) voltage	1
...	15	038 618	.. LINK, jumper term bd pri	1
...	16	188 917	.. DOOR, access changeover	1
...	17	242 743	.. SWITCH, tgl SPST 15A 125VAC on–none–off spd term	1
...	18	180 912	.. SUPPLEMENTARY PROTECTOR, man reset 1P 5A 250V	1
...	19	183 492	.. SUPPLEMENTARY PROTECTOR, man reset 1P 10A 250V	1
...	20	PC1	.. CIRCUIT CARD ASSY, control	1
...	21	039 046	.. TERMINAL, pwr output (black)	1
...	22	039 047	.. TERMINAL, pwr output (red)	1
...	23	134 201	.. STAND–OFF SUPPORT, PC card	4
...	24	021 469	.. LABEL, warning electric shock	1
...	25	216 830	.. LABEL, warning electric shock & moving parts	1
...	26	234 206	.. DRIVE ASSY, wire	1
...	27	146 524	.. HOSE, gas	1

◆OPTIONAL

**To maintain the factory original performance of your equipment, use only Manufacturer’s Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**

☐ Hardware is common and not available unless listed.

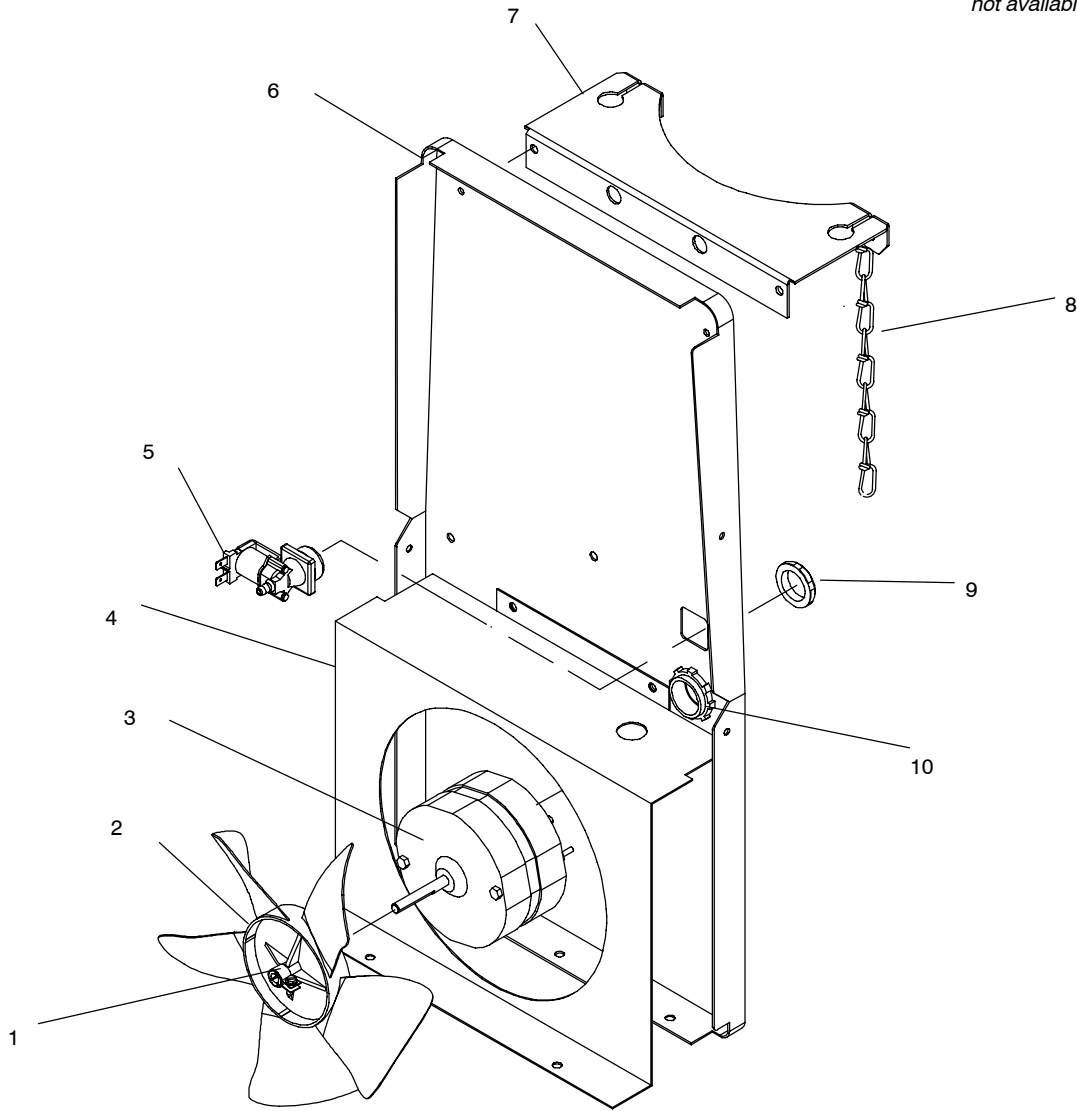

242 510-A

**Figure 8-3. Rear Panel w/Components**


Item No.	Dia. Mkgs.	Part No.	Description	Quantity
----------	------------	----------	-------------	----------

**Figure 8-3. Rear Panel w/Components (Fig 8-1 Item 10)**

...	1	049 399	.. NUT, 312-18 push-on .....	1
...	2	148 809	.. FAN, 9 in 5wg 34 deg .....	1
...	3	FM 188 706	.. MOTOR, fan 230V 50/60 Hz .....	1
...	4	203 711	.. WINDTUNNEL, 9in .....	1
...	5	216 395	.. VALVE, 2 way 35 VDC custom port 1/8 orf w/frict .....	1
...	6	203 478	.. PANEL, rear .....	1
...	7	169 654	.. BRACKET, support tank .....	1
...	8	188 441	.. CHAIN, safety .....	1
...	9	137 761	.. NUT, 750 NPT 1.31 hex .27 H nyl blk .....	1
...	10	604 102	.. CONN, clamp cable .....	1

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**

☐ Hardware is common and not available unless listed.

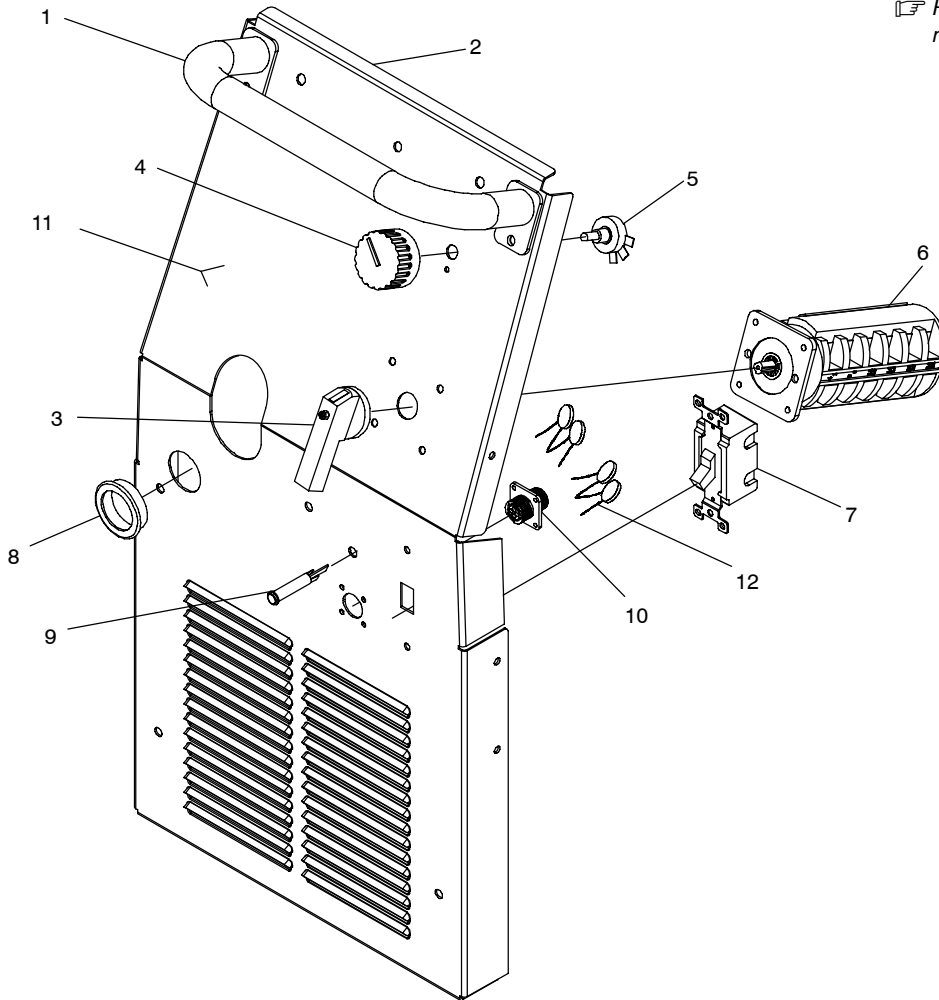

242 216-A


**Figure 8-4. Front Panel w/Components**

Item No.	Dia. Mkgs.	Part No.	Description	Quantity
----------	------------	----------	-------------	----------

**Figure 8-4. Front Panel w/Components (Fig 8-1 Item 17)**

...	1	235 261	.. HANDLE	1
...	2	234 208	.. PANEL, front	1
...	3	207 074	.. HANDLE, switch	1
...	4	207 077	.. KNOB, potentiometer	1
...	5	R2 208 207	.. POTENTIOMETER, CP flat 1/T 2W 1K linear (wire feed speed)	1
...	6	S2 237 378	.. SWITCH, rotary 63A 12 position	1
...	7	S1 124 511	.. SWITCH, tgl DPST 40A 600 VAC	1
...	8	210 389	.. BUSHING, snap-in nyl	1
...	9	PL1 238 764	.. LIGHT, ind wht lens 28V (power on)	1
...	10	RC5 048 282	.. RECEPTACLE W/SOCKETS	1
...	11		.. LABEL, nameplate (order by model and serial no.)	1
...	12	C2,C3 C4,C5 136 735	.. CAPACITOR, cer disc .1uf 500 VDC	4

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**

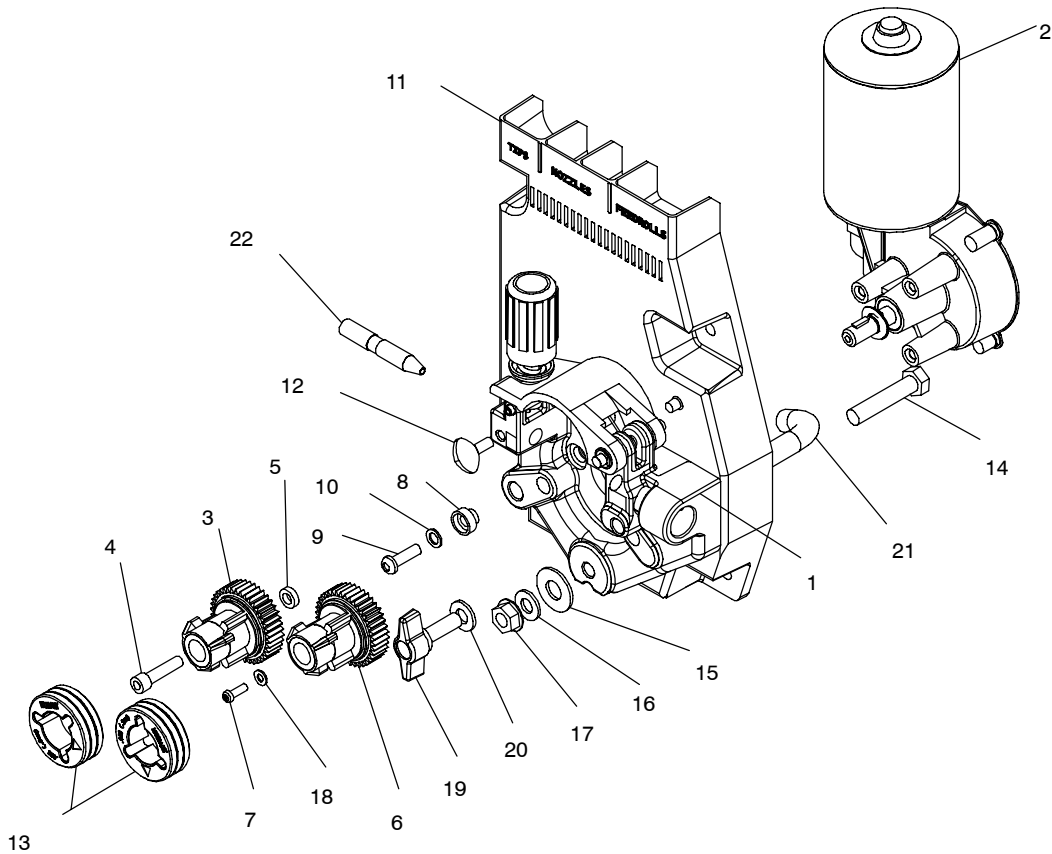


242 526-A

**Figure 8-5. Wire Drive Assembly**

Item No.	Part No.	Description	Quantity
<b>234 206 8-5. Wire Drive Assembly</b>			
... 1	235 282	... HEAD FEED ASSY	1
... 2	M1 235 283	... MOTOR, gear 24VDC 190 RPM	1
... 3	235 284	... CARRIER, drive roll assy	1
... 4	602 209	... SCREW, .250-20 x 1.25 soc hd	1
... 5	166 072	... SPACER, gear	1
... 6	235 285	... CARRIER, drive roll 10mm shaft	1
... 7	174 609	... SCREW, M4-.7 x 12	1
... 8	173 620	... BUSHING, motor mtg	3
... 9	174 610	... SCREW, M6-1.0 x 20 soc hd button cap	3
... 10	192 029	... WASHER, flat .250 ID x .437 OD	3
... 11	235 288	... COVER, motor drive	1
... 12	196 654	... SCREW, thumb 1/4-20	1
... 13	235 286	... ROLL, drive v groove .030-.035 wire	2
... 14	079 240	... SCREW, .375-16 x 1.75 hex hd	1
... 15	602 243	... WASHER, flat .438 ID x 1.00 OD	1
... 16	602 213	... WASHER, lock .380 ID x .691 OD	1
... 17	193 632	... NUT, .375-16 .56 hex .34 h	1
... 18	238 304	... WASHER, flat .170 ID x .375 OD	1
... 19	222 035	... KNOB, T 1.562 bar w/.312-18	1
... 20	604 538	... WASHER, flat .344 ID x .688 OD	1
... 21	146 524	... HOSE, sae .187 ID x .410 OD x 27	1
... 22	242 524	... GUIDE, wire inlet	1

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**

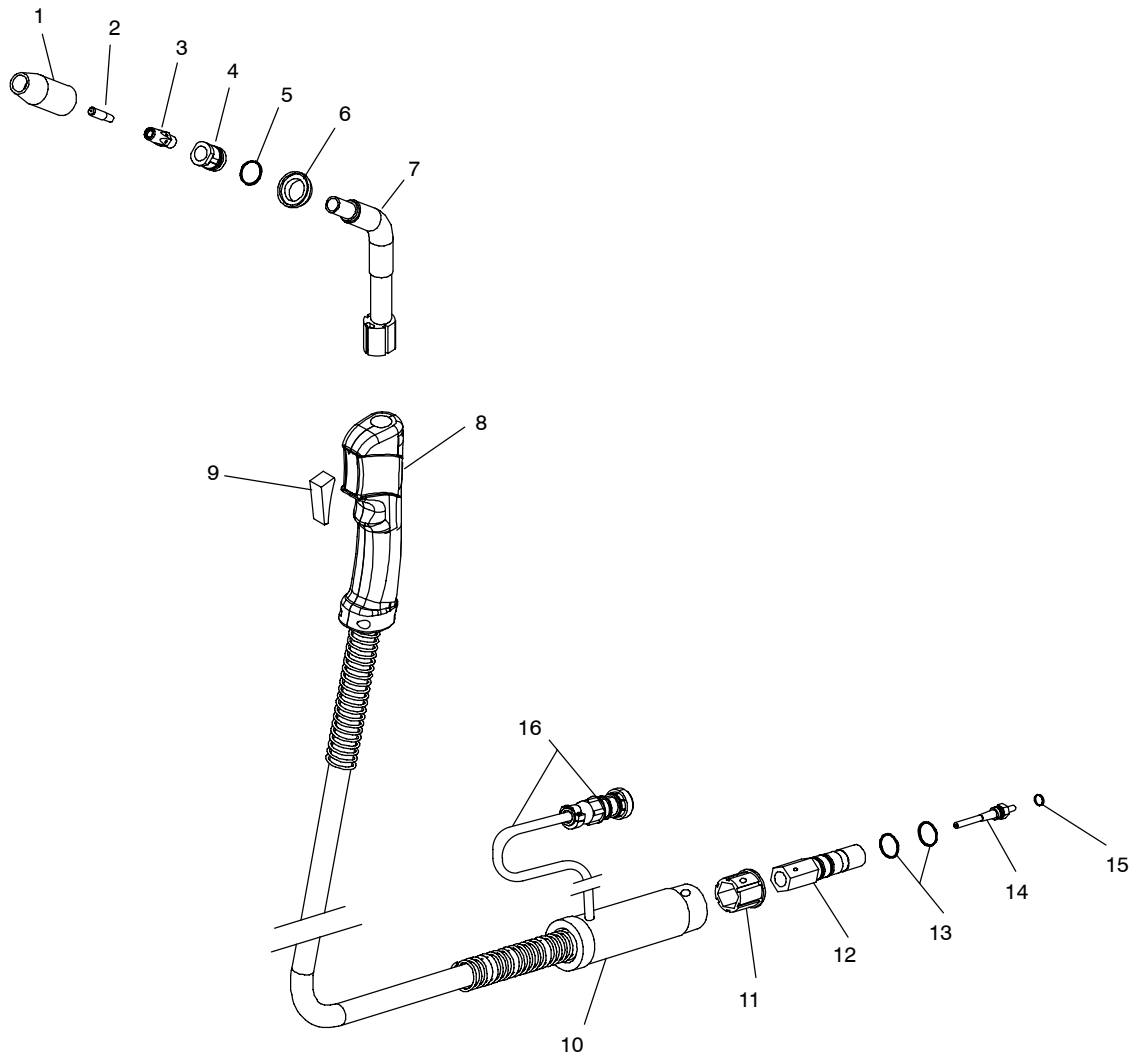

242 630-A

**Figure 8-6. H200L4-15 Gun**

Item No.	Part No.	Description	Quantity
<b>237 374 Figure 8-6. H200L4-15 Gun</b>			
... 1	200 258	.. NOZZLE, slip type .500 orf flush	1
	◆169 724	.. NOZZLE, slip type .500 orf .125 recess	1
	◆169 725	.. NOZZLE, slip type .625 orf .125 recess	1
	◆169 726	.. NOZZLE, slip type .625 orf flush	1
	◆169 727	.. NOZZLE, slip type .625 orf .125 stich out	1
... 2	◆087 299	.. TIP, contact scr .023 wire x 1.125	1
	◆000 067	.. TIP, contact scr .030 wire x 1.125	1
	◆000 068	.. TIP, contact scr .035 wire x 1.125	1
	◆000 069	.. TIP, contact scr .045 wire x 1.125	1
... 3	169 728	.. ADAPTER, contact tip	1
... 4	169 729	.. ADAPTER, nozzle w/retaining ring	1

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**  
 ◆OPTIONAL

Item No.	Part No.	Description	Quantity
<b>237 374 Figure 8-6. H200L4-15 Gun</b>			
... 5	170 468	.. O-RING	1
... 6	169 730	.. WASHER, shock	1
... 7	242 585	.. TUBE HEAD ASSY	1
... 8	242 635	.. HANDLE, front H-20 welding gun	1
... 9	225 410	.. SWITCH, trigger	1
... 10	242 597	.. HANDLE, rear H-20 welding gun	1
... 11	242 597	.. COLLAR, adapter feeder connector	1
... 12	242 604	.. CONNECTOR, feeder H-20 welding gun	1
... 13	079 974	.. O-RING, .500 ID x .103 cs rbr	2
... 14	194 010	.. LINER, monocoil .023/.025 wire x 15ft (consisting of)	1
	194 011	.. LINER, monocoil .030/.035 wire x 15ft (consisting of)	1
	194 012	.. LINER, monocoil .035/.045 wire x 15ft (consisting of)	1
... 15	079 975	.. O-RING, .312 ID x .062 70 Dura BUNA-N	1
... 16	227 800	.. CORD, trigger assy	1

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**

◆OPTIONAL

**Table 8-1. Accessories**

PART NO.	DESCRIPTION	REMARKS
042 758	Dual Bottle Rack Kit	Converts Single Cylinder Rack To Dual Rack
212 492	Regulator/Flowmeter	For Use With 100% CO <sub>2</sub> Shielding Gas
235 287	Dual Drive Roll .024-.045 (0.6 - 1.2 mm)	Allows Use Of .024 Solid Wire And .045 Solid And Flux Cored Wire
132 958	Drive Roll .035 (0.9 mm) VK Groove	V-Knurl Drive Roll For Hard Shell Cored Wires
132 957	Drive Roll .045 (1.2 mm) VK Groove	V-Knurl Drive Roll For Hard Shell Cored Wires
300 349	DP 3545-20 Spool Gun	Provides Excellent Feeding Of Aluminum Wire

# HOBART 5/3/1 WARRANTY

Effective January 1, 2009

## Warranty Questions?

Call

1-800-332-3281

7 AM – 6 PM EST

## Service

You always get the fast, reliable response you need. Most replacement parts can be in your hands in 24 hours.

## Support

Need fast answers to the tough welding questions? Contact your distributor or call 1-800-332-3281. The expertise of the distributor and Hobart is there to help you, every step of the way.

## Assistance

Visit the Hobart website:  
[www.HobartWelders.com](http://www.HobartWelders.com)

5/3/1 WARRANTY applies to all Hobart welding equipment, plasma cutters and spot welders with a serial number preface of LK or newer.

This limited warranty supersedes all previous Hobart warranties and is exclusive with no other guarantees or warranties expressed or implied.

Hobart products are serviced by Hobart or Miller Authorized Service Agencies.

LIMITED WARRANTY – Subject to the terms and conditions below, Hobart/Miller Electric Mfg. Co., Appleton, Wisconsin, warrants to its original retail purchaser that new Hobart equipment sold after the effective date of this limited warranty is free of defects in material and workmanship at the time it is shipped by Hobart. THIS WARRANTY IS EXPRESSLY IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING THE WARRANTIES OF MERCHANTABILITY AND FITNESS.

Within the warranty periods listed below, Hobart/Miller will repair or replace any warranted parts or components that fail due to such defects in material or workmanship. Hobart/Miller must be notified in writing within thirty (30) days of such defect or failure, at which time Hobart/Miller will provide instructions on the warranty claim procedures to be followed.

Hobart/Miller shall honor warranty claims on warranted equipment listed below in the event of such a failure within the warranty time periods. All warranty time periods start on the delivery date of the equipment to the original retail purchaser, and not to exceed one year after the equipment is shipped to a North American distributor or eighteen months after the equipment is shipped to an International distributor.

1. 5 Years — Parts and Labor
  - \* Original Main Power Rectifiers only to include SCRs, diodes, and discrete rectifier modules
  - \* Transformers
  - \* Stabilizers
  - \* Reactors
2. 3 Years — Parts and Labor
  - \* Drive Systems
  - \* PC Boards
  - \* Rotors, Stators and Brushes
  - \* Idle Module
  - \* Solenoid Valves
  - \* Switches and Controls
  - \* Spot Welder Transformer
3. 1 Year — Parts and Labor Unless Specified (90 days for industrial use)
  - \* Motor-Driven Guns
  - \* MIG Guns/TIG Torches
  - \* Relays
  - \* Contactors
  - \* Regulators
  - \* Water Coolant Systems
  - \* Flowgauge and Flowmeter Regulators (No Labor)
  - \* HF Units
  - \* Running Gear/Trailers
  - \* Plasma Cutting Torches
  - \* Remote Controls
  - \* Replacement Parts (No labor) – 90 days
  - \* Accessories
  - \* Field Options  
(NOTE: Field options are covered for the remaining warranty period of the product they are installed in, or for a minimum of one year — whichever is greater.)
4. Engines, batteries and tires are warranted separately by the manufacturer.

Hobart's 5/3/1 Limited Warranty shall not apply to:

1. **Consumable components such as contact tips, cutting nozzles, slip rings, drive rolls, gas diffusers, plasma torch tips and electrodes, weld cables, and tongs and tips, or parts that fail due to normal wear.** (Exception: brushes, slip rings, and relays are covered on Hobart Engine-Driven models.)
2. Items furnished by Hobart/Miller, but manufactured by others, such as engines or trade accessories. These items are covered by the manufacturer's warranty, if any.
3. Equipment that has been modified by any party other than Hobart/Miller, or equipment that has been improperly installed, improperly operated or misused based upon industry standards, or equipment which has not had reasonable and necessary maintenance, or equipment which has been used for operation outside of the specifications for the equipment.

HOBART PRODUCTS ARE INTENDED FOR PURCHASE AND USE BY COMMERCIAL/INDUSTRIAL USERS AND PERSONS TRAINED AND EXPERIENCED IN THE USE AND MAINTENANCE OF WELDING EQUIPMENT.

In the event of a warranty claim covered by this warranty, the exclusive remedies shall be, at Hobart's/Miller's option: (1) repair; or (2) replacement; or, where authorized in writing by Hobart/Miller in appropriate cases, (3) the reasonable cost of repair or replacement at an authorized Hobart/Miller service station; or (4) payment of or credit for the purchase price (less reasonable depreciation based upon actual use) upon return of the goods at customer's risk and expense. Hobart's/Miller's option of repair or replacement will be F.O.B., Factory at Appleton, Wisconsin, or F.O.B. at a Hobart/Miller authorized service facility as determined by Hobart/Miller. Therefore no compensation or reimbursement for transportation costs of any kind will be allowed.

TO THE EXTENT PERMITTED BY LAW, THE REMEDIES PROVIDED HEREIN ARE THE SOLE AND EXCLUSIVE REMEDIES. IN NO EVENT SHALL HOBART/MILLER BE LIABLE FOR DIRECT, INDIRECT, SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES (INCLUDING LOSS OF PROFIT), WHETHER BASED ON CONTRACT, TORT OR ANY OTHER LEGAL THEORY.

ANY EXPRESS WARRANTY NOT PROVIDED HEREIN AND ANY IMPLIED WARRANTY, GUARANTY OR REPRESENTATION AS TO PERFORMANCE, AND ANY REMEDY FOR BREACH OF CONTRACT TORT OR ANY OTHER LEGAL THEORY WHICH, BUT FOR THIS PROVISION, MIGHT ARISE BY IMPLICATION, OPERATION OF LAW, CUSTOM OF TRADE OR COURSE OF DEALING, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR PARTICULAR PURPOSE, WITH RESPECT TO ANY AND ALL EQUIPMENT FURNISHED BY HOBART/MILLER IS EXCLUDED AND DISCLAIMED BY Hobart/Miller.

Some states in the U.S.A. do not allow limitations of how long an implied warranty lasts, or the exclusion of incidental, indirect, special or consequential damages, so the above limitation or exclusion may not apply to you. This warranty provides specific legal rights, and other rights may be available, but may vary from state to state.

In Canada, legislation in some provinces provides for certain additional warranties or remedies other than as stated herein, and to the extent that they may not be waived, the limitations and exclusions set out above may not apply. This Limited Warranty provides specific legal rights, and other rights may be available, but may vary from province to province.

hobart\_warr 2009-01





# Owner's Record

Please complete and retain with your personal records.

Model Name	Serial/Style Number
Purchase Date	(Date which equipment was delivered to original customer.)
Distributor	
Address	
City	
State	Zip



# Resources Available

Always provide Model Name and Serial/Style Number.

### To locate a Distributor, retail or service location:

Call 1-877-Hobart1 or visit our website at [www.HobartWelders.com](http://www.HobartWelders.com)

### For technical assistance:

Call 1-800-332-3281

### Contact your Distributor for:


- Welding Supplies and Consumables
- Options and Accessories
- Personal Safety Equipment
- Service and Repair
- Replacement Parts
- Training (Schools, Videos, Books)
- Technical Manuals (Servicing Information and Parts)
- Circuit Diagrams
- Welding Process Handbooks

### Contact the Delivering Carrier to:

File a claim for loss or damage during shipment.

For assistance in filing or settling claims, contact your distributor and/or equipment manufacturer's Transportation Department.

### Protect Your Investment!

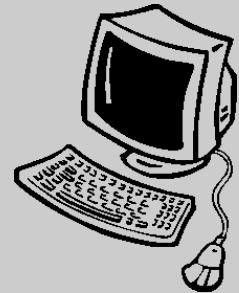

Register your product at:  
[HobartWelders.com](http://HobartWelders.com)

### Hobart Welding Products

An Illinois Tool Works Company  
600 West Main Street  
Troy, OH 45373 USA

### For Technical Assistance:

Call 1-800-332-3281  
For Literature Or Nearest Dealer:  
Call 1-877-Hobart1

