View Safety Info

aView Safety Info

LN-7 GMA Wire Feeder

SVM 106-A

February, 1995

For use with machines having Code Numbers: 9168

9386

9643


9796

9928

9931

Safety Depends on You

Lincoln arc welding equipment is designed and built with safety in mind. However, your overall safety can be increased by proper installation ... and thoughtful operation on your part. DO NOT INSTALL, **OPERATE OR REPAIR THIS EQUIPMENT** WITHOUT READING THIS MANUAL AND THE SAFETY PRECAU-**TIONS CONTAINED** THROUGHOUT. And, most importantly, think before you act and be careful.

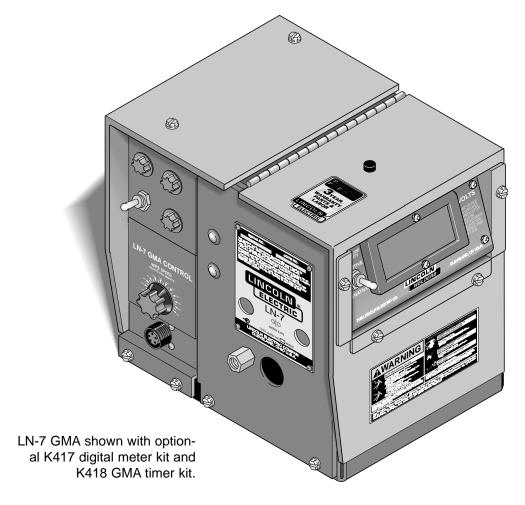

SERVICE MANUAL



World's Leader in Welding and Cutting Products

Premier Manufacturer of Industrial Motors

WARNING

ARC WELDING can be hazardous.

PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY, PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.

Read and understand the following safety highlights. For additional safety information, it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2-1974. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE AND REPAIR PROCEDURES ARE PER-FORMED ONLY BY QUALIFIED INDIVIDUALS.



ELECTRIC SHOCK can kill.

- 1.a. The electrode and work (or ground) circuits are electrically "hot" when the welder is on. Do not touch these "hot" parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.
- 1.b. Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.

In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpieceor ground) use the following equipment:

- Semiautomatic DC Constant Voltage (Wire) Welder.
- DC Manual (Stick) Welder.
- AC Welder with Reduced Voltage Control.
- 1.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically "hot".
- 1.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
- 1.e. Ground the work or metal to be welded to a good electrical (earth) ground.
- 1.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
- 1.g. Never dip the electrode in water for cooling.
- 1.h. Never simultaneously touch electrically "hot" parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
- 1.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
- 1.j. Also see Items 4.c. and 6.



ARC RAYS can burn.

- 2.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87. I standards.
- 2.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 2.c. Protect other nearby personnel with suitable, non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.



FUMES AND GASES can be dangerous.

3.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases. When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep fumes and gases away from the breathing zone. When welding with

electrodes which require special ventilation such as stainless or hard facing (see instructions on container or MSDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and below Threshold Limit Values (TLV) using local exhaust or mechanical ventilation. In confined spaces or in some circumstances, outdoors, a respirator may be required. Additional precautions are also required when welding on galvanized steel.

- 3.b. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- 3.c. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 3.d. Read and understand the manufacturer's instructions for this equipment and the consumables to be used, including the material safety data sheet (MSDS) and follow your employer's safety practices. MSDS forms are available from your welding distributor or from the manufacturer.
- 3.e. Also see item 7b.







WELDING SPARKS can cause fire or explosion.

4.a. Remove fire hazards from the welding area. If this is not possible, cover them to prevent the welding sparks from starting a fire. Remember that welding sparks and hot

materials from welding or cutting can easily go through small cracks and openings to adjacent areas. Avoid welding or cutting near hydraulic lines. Have a fire extinguisher readily available.

- 4.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 4.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 4.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned". For information, purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- 4.e. Vent hollow castings or containers before heating, cutting or welding. They may explode.
- 4.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding or cutting area.
- 4.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.
- 4.h. Also see item 7c.



CYLINDER may explode if damaged.

5.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and

pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition.

- 5.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- 5.c. Cylinders should be located:
 - Away from areas where they may be struck or subjected to physical damage.
 - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.
- 5.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.
- 5.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- 5.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.
- 5.g. Read and follow the instructions on compressed gas cylinders, associated equipment, and CGA publication P-I, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association 1235 Jefferson Davis Highway, Arlington, VA 22202.



FOR ELECTRICALLY powered equipment.

- 6.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.
- 6.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.
- 6.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.



iii SAFETY



FOR ENGINE powered equipment.

7.a. Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.



 Operate engines in open, well-ventilated areas or vent the engine exhaust fumes outdoors.



7.c. Do not add the fuel near an open flame welding or cutting arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.



7.d. Keep all equipment safety guards, covers and devices in position and in good repair. Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.

- 7.e. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.
- 7.f. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.
- 7.g. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.



To avoid scalding, do not remove the radiator pressure cap when the engine is hot.



ELECTRIC AND MAGNETIC FIELDS may be dangerous

- 8.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines.
- 8.b. EMF fields may interfere withsome pacemakers, and welders having a pacemaker should consult their physician before welding.
- 8.c. Exposure to EMF fields in welding may have other health effects which are now not known.
- 8d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:
 - 8.d.1. Route the electrode and work cables together Secure them with tape when possible.
 - 8.d.2. Never coil the electrode lead around your body.
 - 8.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.
 - 8.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.
 - 8.d.5. Do not work next to welding power source.



SAFETY iv

PRÉCAUTIONS DE SÛRETÉ

Pour votre propre protection lire et observer toutes les instructions et les précautions de sûreté specifiques qui parraissent dans ce manuel aussi bien que les précautions de sûreté générales suivantes:

Sûreté Pour Soudage A L'Arc

- 1. Protegez-vous contre la secousse électrique:
 - a. Les circuits à l'électrode et à la piéce sont sous tension quand la machine à souder est en marche. Eviter toujours tout contact entre les parties sous tension et la peau nue ou les vétements mouillés. Porter des gants secs et sans trous pour isoler les mains.
 - b. Faire trés attention de bien s'isoler de la masse quand on soude dans des endroits humides, ou sur un plancher metallique ou des grilles metalliques, principalement dans les positions assis ou couché pour lesquelles une grande partie du corps peut être en contact avec la masse.
 - c. Maintenir le porte-électrode, la pince de masse, le câble de soudage et la machine à souder en bon et sûr état defonctionnement.
 - d.Ne jamais plonger le porte-électrode dans l'eau pour le refroidir.
 - e. Ne jamais toucher simultanément les parties sous tension des porte-électrodes connectés à deux machines à souder parce que la tension entre les deux pinces peut être le total de la tension à vide des deux machines.
 - f. Si on utilise la machine à souder comme une source de courant pour soudage semi-automatique, ces precautions pour le porte-électrode s'applicuent aussi au pistolet de soudage.
- Dans le cas de travail au dessus du niveau du sol, se protéger contre les chutes dans le cas ou on recoit un choc. Ne jamais enrouler le câble-électrode autour de n'importe quelle partie du corps.
- Un coup d'arc peut être plus sévère qu'un coup de soliel, donc:
 - a. Utiliser un bon masque avec un verre filtrant approprié ainsi qu'un verre blanc afin de se protéger les yeux du rayonnement de l'arc et des projections quand on soude ou quand on regarde l'arc.
 - Porter des vêtements convenables afin de protéger la peau de soudeur et des aides contre le rayonnement de l'arc.
 - c. Protéger l'autre personnel travaillant à proximité au soudage à l'aide d'écrans appropriés et non-inflammables.
- 4. Des gouttes de laitier en fusion sont émises de l'arc de soudage. Se protéger avec des vêtements de protection libres de l'huile, tels que les gants en cuir, chemise épaisse, pantalons sans revers, et chaussures montantes.

- Toujours porter des lunettes de sécurité dans la zone de soudage. Utiliser des lunettes avec écrans lateraux dans les zones où l'on pique le laitier.
- Eloigner les matériaux inflammables ou les recouvrir afin de prévenir tout risque d'incendie dû aux étincelles.
- 7. Quand on ne soude pas, poser la pince à une endroit isolé de la masse. Un court-circuit accidental peut provoquer un échauffement et un risque d'incendie.
- 8. S'assurer que la masse est connectée le plus prés possible de la zone de travail qu'il est pratique de le faire. Si on place la masse sur la charpente de la construction ou d'autres endroits éloignés de la zone de travail, on augmente le risque de voir passer le courant de soudage par les chaines de levage, câbles de grue, ou autres circuits. Cela peut provoquer des risques d'incendie ou d'echauffement des chaines et des câbles jusqu'à ce qu'ils se rompent.
- Assurer une ventilation suffisante dans la zone de soudage.
 Ceci est particuliérement important pour le soudage de tôles galvanisées plombées, ou cadmiées ou tout autre métal qui produit des fumeés toxiques.
- 10. Ne pas souder en présence de vapeurs de chlore provenant d'opérations de dégraissage, nettoyage ou pistolage. La chaleur ou les rayons de l'arc peuvent réagir avec les vapeurs du solvant pour produire du phosgéne (gas fortement toxique) ou autres produits irritants.
- Pour obtenir de plus amples renseignements sur la sûreté, voir le code "Code for safety in welding and cutting" CSA Standard W 117.2-1974.

PRÉCAUTIONS DE SÛRETÉ POUR LES MACHINES À SOUDER À TRANSFORMATEUR ET À REDRESSEUR

- Relier à la terre le chassis du poste conformement au code de l'électricité et aux recommendations du fabricant. Le dispositif de montage ou la piece à souder doit être branché à une bonne mise à la terre.
- 2. Autant que possible, l'installation et l'entretien du poste seront effectués par un électricien qualifié.
- 3. Avant de faires des travaux à l'interieur de poste, la debrancher à l'interrupteur à la boite de fusibles.
- Garder tous les couvercles et dispositifs de sûreté à leur place.



MASTER TABLE OF CONTENTS FOR ALL SECTIONS

	Page
Safety	i-iv
Installation	Section A
Technical Specifications	A-2
Mounting Location	A-3
Machine Grounding	A-3
Input Cable Connections	A-3
Work Cable	A-21
Gun and Cable Assemblies	A-21
Gun Cable Connections	A-21
Water Conections (For Water Cooled Guns)	A-22
Shielding Gas Hookup	A-23
Operation	
Operating Instructions	B-2
Safety Precautions	B-2
General Description	B-2
Recommended Processes and Equipment	B-2
Controls and Settings	B-3
Circuit Protection	B-4
Avoiding Ground Lead Protector (GLP) Activation	B-4
Drive Roll Installation	B-4
Idle Roll Pressure Setting	B-8
Wire Loading	B-9
Acceleration Setting	B-13
Wire Speed and Voltage Adjustment	B-13 B-14
Making a Weld	
Wire Reel Changing	B-14
Optional K416 Analog and K417 Digital Voltmeter Kits	B-14 B-15
Accessories	Section C
General	C-2
Auxiliary Equipment Connection	C-3
Options/Accessories	C-3
Attaching the Wire Reel Stand	C-7
Maintenance	Section D
Routine Maintenance	D-2
Periodic Maintenance	D-2
Theory of Operation	Section E E-2
Control Circuit Operation	E-2
Protective Circuits	E-6
	E-7
SCR Operation	
Troubleshooting and Repair	
How To Use Troubleshooting Guide	F-2
PC Board Troubleshooting Procedures	F-3
Troubleshooting Guide	F-4
Test Procedures	F-12
Component Replacement Procedures	F-18 F-50
Retest After Repair	
Electrical Diagrams	
Parts Manual	P-283



TABLE OF CONTENTS - INSTALLATION SECTION -

Installation	. Section A
Technical Specifications	. A-2
Mounting Location	
Machine Grounding	
Input Cable Connections	. A-3
Work Cable	. A-21
Gun and Cable Assemblies	. A-21
Gun Cable Connections	. A-21
Water Connections (for Water Cooled Guns)	. A-22
Shielding Gas Hookup	



TECHNICAL SPECIFICATIONS - LN-7 GMA

INPUT VOLTAGE

Supplied by power source: 115 VAC, 50/60 Hz, 2.5 Amps

WIRE FEED SPEED

75 in. to 700 in. per minute (1.90 to 17.8 m/min)

WIRE DIAMETERS

0.023 in. through 1/16 in. (0.6 through 1.6 mm)

0.045 in. through 5/64 in. (1.2 through 2.0 mm)

solid electrode

cored electrode

PHYSICAL DIMENSIONS						
		LENGTH	WIDTH	HEIGHT	TOTAL WEIGHT LESS ELECTRODE	
TWO	WITHOUT	9.62 in.	9.76 in.	10.89 in.	24 lbs	
	WIRE STAND	(244 mm)	(247 mm)	(277 mm)	(10.9 kg)	
ROLL	WITH WIRE	20.68 in.	9.76 in.	17.00 in.	36 lbs	
FEEDER	STAND (K377)	(525 mm)	(247 mm)	(432 mm)	(16.3 kg)	
FOUR	WITHOUT	9.70 in.	11.60 in.	11.11 in.	30.5 lbs	
ROLL	WIRE STAND	(246 mm)	(295 mm)	(282 mm)	(13.8 kg)	
FEEDER	WITH WIRE	20.76 in.	11.60 in.	17.00 in.	42.5 lbs	
	STAND (K377)	(527 mm)	(295 mm)	(432 mm)	(19.3 kg)	

Return to Master TOC

Return to Master TOC

MOUNTING LOCATION

The LN-7 GMA wire feeders can be mounted directly on top of the power source providing that it is secure and level. The LN-7 can be mounted to an undercarriage when portability is required.

A K178-1 swivel platform is available for mounting the LN-7 GMA to a power source. Refer to the accessories section for details.

MACHINE GROUNDING

The LN-7 GMA wire feeders are ground to the power source through the input cable. The power source grounding terminal must be properly connected to electrical ground per the power source operating manual.

INPUT CABLE CONNECTIONS

Refer to Section C, Accessories, for descriptions of the various input cable assemblies available for the LN-7 GMA wire feeder.

WARNING

Turn input power off before connecting the LN-7 GMA wire feeder.

For connecting an LN-7 GMA to a specific Lincoln power source follow steps 1 through 6, and refer to the connection diagrams in Figure A.3 through A.17 for the specific power source. Table A.1 lists each figure number with its corresponding power source.

TABLE A.1 - LN-7 GMA CONNECTION DIAGRAMS

Figure #	Power Source
A.3	LN-7 GMA To DC-400, DC-250 and CV/CVI Power Sources With Terminal Strip - Connection Diagram
A.4	LN-7 GMA To Pulsed Power 500 - Connection Diagram
A.5	LN-7 GMA To CV/CVI Power Sources With 14 Pin Amphenol Connector - Connection Diagram
A.6	LN-7 GMA To CV/CVI Power Sources With Twist-Mate Connector and 14 Pin Amphenol/Remote Control - Connection Diagram
A.7	LN-7 GMA To CV/CVI Power Source (K867/K775) - Connection Diagram
A.8	LN-7 GMA To R3S-250 or R3S-325 - Connection Diagram
A.9	LN-7 GMA To SAM Motor Generator or Engine Welder - Connection Diagram
A.10	LN-7 GMA To DC-600 - Connection Diagram
A.11	LN-7 GMA To R3S-400, 600, or 800 - Connection Diagram
A.12	LN-7 GMA To Most Lincoln Motor Generators - Connection Diagram
A.13	LN-7 GMA To WP250 or G9 PRO - Connection Diagram
A.14	LN-7 GMA To Ranger 9 - Connection Diagram
A.15	LN-7 GMA To Ranger 10-LX - Connection Diagram
A.16	LN-7 GMA To Power Sources With No Output Contactor - Connection Diagram
A.17	LN-7 GMA To Power Sources With Contactor and No Terminal Strip - Connection Diagram



1. For K291 and K404 cables, connect the end of the control cable with the lugged leads to the power source. If lead #21 is extended to work, do

INSTALLATION

not connect leads to terminal #21 on terminal strip. Include any jumpers called for on the connection diagram. Do not add any other jumpers or connections.


WARNING

Never operate a Lincoln power source that has a jumper from #2 to #4 on the terminal strip, or a power source without a contactor, with this wire feeder. To do so would defeat the purpose of the grounding lead protector circuit and could result in the overheating of the electrical ground circuit to the wire feeder.

- 2. For constant voltage power sources with an output contactor but no terminal strip or 14-pin control receptacle, see Figure A.14. For constant voltage power sources without an internal output contactor, and requiring a K240 Contactor Kit, see Figure A.13.
- 3. If input cables longer than the standard length must be used, K292 extension cables (50 ft/15.2 m) can be installed. These have polarized plugs on each end of the control cable and include a 4/0 (107 mm²) electrode cable. Install the extensions between the standard input cable and the wire feeder. Total input cable length should not exceed 400 ft (122 m). When using longer lengths of extension cables, it may be necessary to add parallel electrode cables to minimize the voltage drop in the cable.

4. Referring to Figure A.1, route the end of the electrode cable through the large hole in the back panel of the LN-7 case. Connect the electrode cable to the brass conductor block on the front of the gearbox using the 1/2-13 x .75 bolt provided. Be sure the cable is placed to allow easy access and clearance for the idle roll arm pressure adjustment and to allow the drive roll section cover to close.

FIGURE A.1 - INPUT CONTROL CABLE AND **ELECTRODE CABLE CONNECTIONS.**

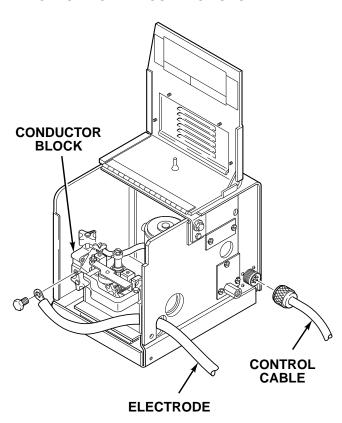




Return to Master TOC

- 5. Connect the input control cable polarized Amphenol plug into the mating 6-pin receptacle on the rear of the control section.
- 6. Referring to Figure A.2, install the input cable under the wire reel mounting stand strain relief

clamp. Remove the screws holding the clamp to the base of the wire reel mounting assembly, put the input cable assembly under the clamp and reinstall the screws.

FIGURE A.2 - STRAIN RELIEF CLAMP.

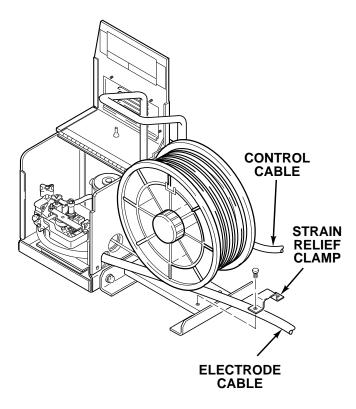



TOC ler Mast


9

Master

9

INSTALLATION

FIGURE A.3 – LN-7 GMA TO DC-400, DC-250 AND CV/CVI POWER SOURCES WITH **TERMINAL STRIP - CONNECTION DIAGRAM.**

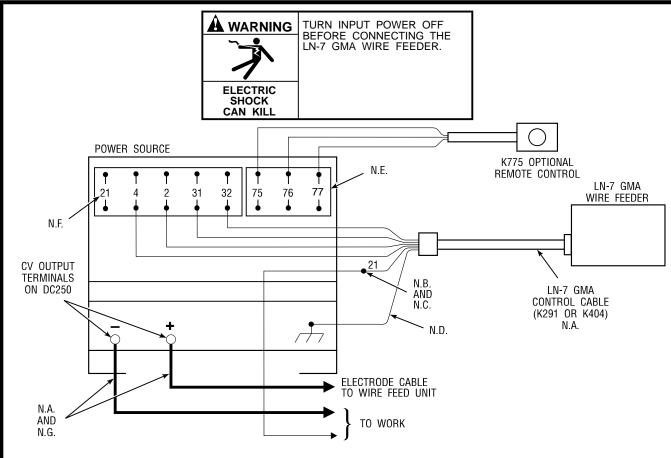

- WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- I.B. IF LEAD #21 IS EXTENDED TO THE WORK PIECE, DO NOT CONNECT LEADS TO TERMINAL #21 ON TERMINAL STRIP. IF LN-7 GMA IS EQUIPPED WITH A METER KIT, EXTEND LN-7 GMA CONTROL CABLE LEAD #21 USING 14 AWG OR LARGER INSULATED WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD MAY BE ORDERED FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE INDEPENDENT OF THE WELDING WORK CABLE CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (IF THE LENGTH OF WELDING WORK CABLE IS SHORT, LESS THAN 25 FEET (7.6 M), AND CONNECTIONS CAN BE EXPECTED TO BE RELIABLE, THEN CONTROL CABLE LEAD #21 DOES NOT NEED TO BE EXTENDED AND CAN BE DIRECTLY CONNECTED TO TERMINAL #21 ON THE TERMINAL STRIP. NOTE THAT THIS IS NOT THE PREFERRED CONNECTION BECAUSE IT ADDS ERROR TO THE LN-7 GMA VOLTMETER
- N.C. TAPE UP BOLTED CONNECTION IF LEAD #21 IS EXTENDED.
- N.D. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED → NEAR THE POWER SOURCE TERMINAL STRIP. THE POWER SOURCE GROUNDING TERMINAL (MARKED ⇒ AND LOCATED NEAR THE POWER SOURCE INPUT POWER CONNECTIONS) MUST BE PROPERLY CONNECTED TO ELECTRICAL GROUND PER THE POWER SOURCE OPERATING MANUAL.
- N.E. IF AN OPTIONAL REMOTE VOLTAGE CONTROL IS USED, CONNECT IT TO THIS TERMINAL STRIP.
- .F DC-400 CODE 9200 AND LATER: IF LEAD #21 OF THE CONTROL CABLE IS TO BE CONNECTED TO THE TERMINAL STRIP, CONNECT IT TO THE #21 TERMINAL THAT MATCHES THE WORK POLARITY. THIS CONNECTION MUST BE CHANGED WHENEVER THE ELECTRODE POLARITY IS CHANGED.
- N.G. DIAGRAMS SHOW ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER OFF AND REVERSE ELECTRODE AND WORK CABLE LEADS AT POWER SOURCE.






Master

9

TOC Master 9

FIGURE A.4 – LN-7 GMA TO PULSED POWER 500 - CONNECTION DIAGRAM.

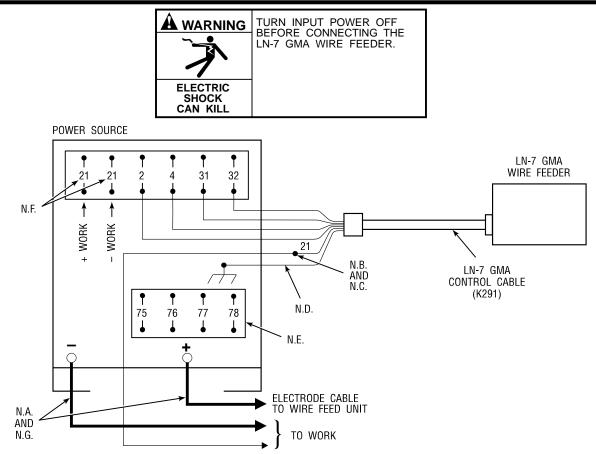

- N.A. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- I.B. IF LEAD #21 IS EXTENDED TO THE WORK PIECE, DO NOT CONNECT LEADS TO TERMINAL #21 ON TERMINAL STRIP. IF LN-7 GMA IS EQUIPPED WITH A METER KIT, EXTEND LN-7 GMA CONTROL CABLE LEAD #21 USING 14 AWG OR LARGER INSULATED WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD MAY BE ORDERED FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE INDEPENDENT OF THE WELDING WORK CABLE CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (IF THE LENGTH OF WELDING WORK CABLE IS SHORT, LESS THAN 25 FEET (7.6 M), AND CONNECTIONS CAN BE EXPECTED TO BE RELIABLE, THEN CONTROL CABLE LEAD #21 DOES NOT NEED TO BE EXTENDED AND CAN BE DIRECTLY CONNECTED TO TERMINAL #21 ON THE TERMINAL STRIP. NOTE THAT THIS IS NOT THE PREFERRED CONNECTION BECAUSE IT ADDS ERROR TO THE LN-7 GMA VOLTMETER
- N.C. TAPE UP BOLTED CONNECTION IF LEAD #21 IS EXTENDED.
- N.D. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED
 → NEAR THE POWER SOURCE TERMINAL STRIP. THE POWER SOURCE GROUNDING TERMINAL (MARKED
 → AND LOCATED NEAR THE POWER SOURCE INPUT POWER CONNECTIONS) MUST BE PROPERLY CONNECTED TO ELECTRICAL GROUND PER THE POWER SOURCE OPERATING MANUAL.
- N.E. IF AN OPTIONAL REMOTE VOLTAGE CONTROL IS USED, CONNECT IT TO THIS TERMINAL STRIP.
- F IF LEAD #21 OF THE CONTROL CABLE IS TO BE CONNECTED TO THE TERMINAL STRIP, CONNECT IT TO THE #21. TERMINAL THAT MATCHES THE WORK POLARITY. THIS CONNECTION MUST BE CHANGED WHENEVER THE ELECTRODE POLARITY IS CHANGED.
- N.G. DIAGRAMS SHOW ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER OFF AND REVERSE ELECTRODE AND WORK CABLE LEADS AT POWER SOURCE.





to Master


TOC

Master

Return to

INSTALLATION

FIGURE A.5 – LN-7 GMA TO CV/CVI POWER SOURCES WITH 14 PIN AMPHENOL **CONNECTOR - CONNECTION DIAGRAM.**

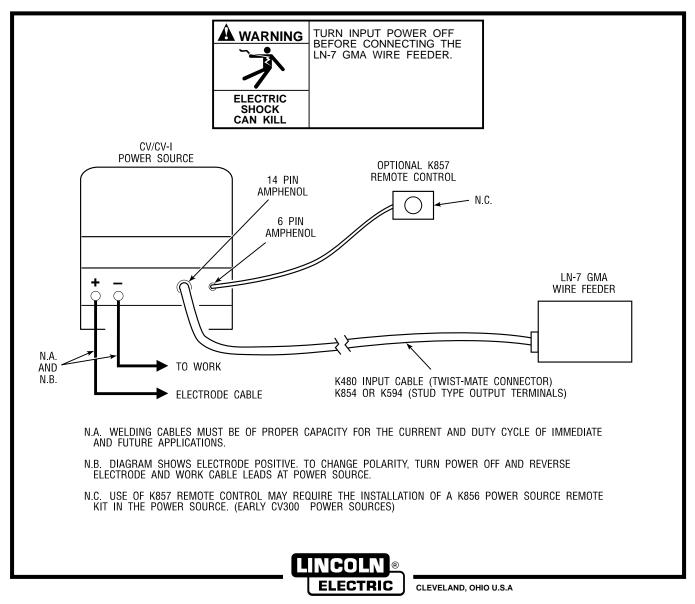




Master

9

Return to Master

TOC

FIGURE A.6 – LN-7 GMA TO CV/CVI POWER SOURCES WITH TWIST-MATE CONNECTOR AND 14 PIN AMPHENOL/REMOTE CONTROL - CONNECTION DIAGRAM.

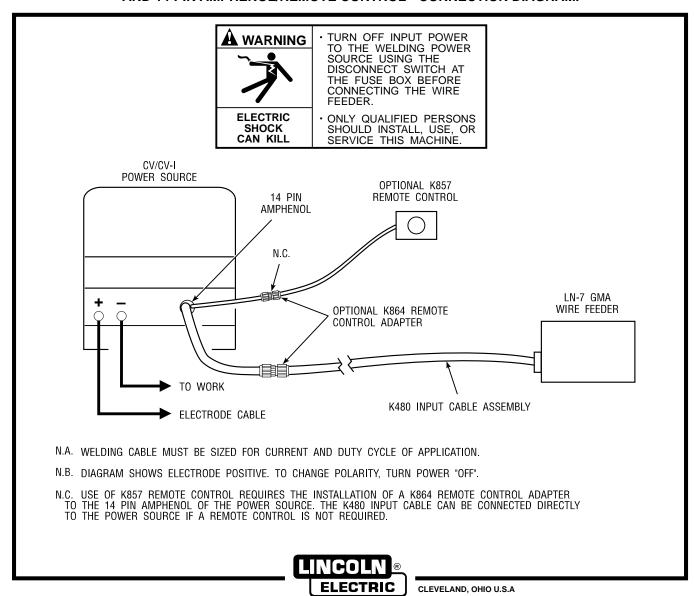




Master

9

TOC

Return to Master

FIGURE A.7 – LN-7 GMA TO CV/CVI POWER SOURCE (K867/K775) - CONNECTION DIAGRAM.

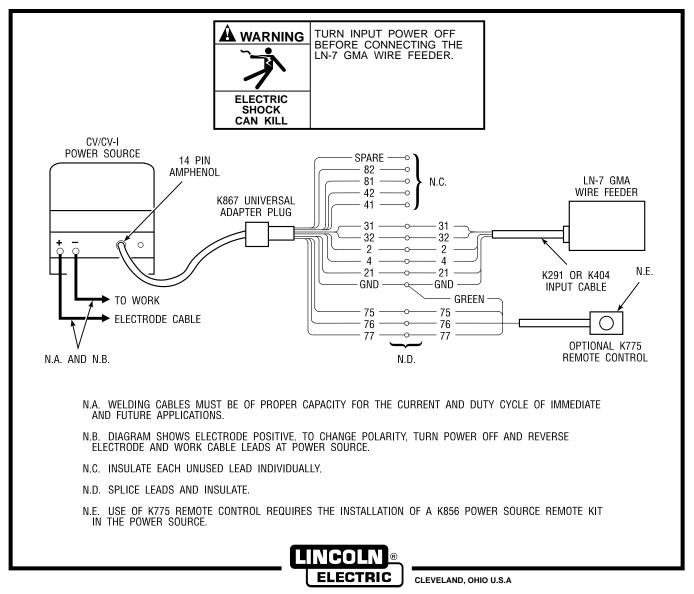




Master

9

FIGURE A.8 – LN-7 GMA TO R3S-250 OR R3S-325 - CONNECTION DIAGRAM.

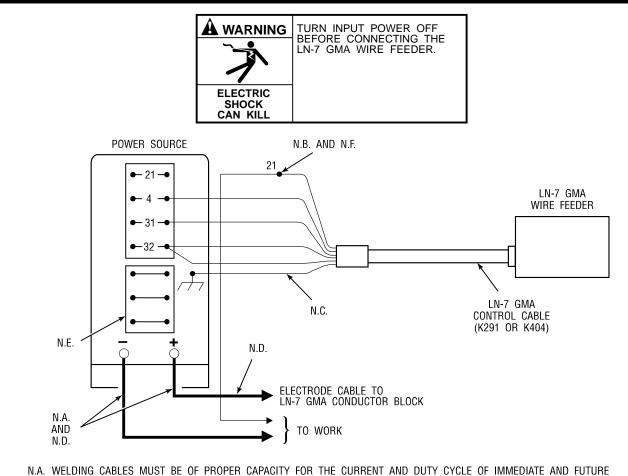

- APPLICATIONS.
- N.B. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD IS AVAILABLE FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE KEEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)
- .C. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED \not NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.
- N.D. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER OFF AND REVERSE ELECTRODE AND WORK CABLE LEADS AT POWER SOURCE.
- N.E. IF AN OPTIONAL REMOTE VOLTAGE CONTROL IS USED, CONNECT IT TO THIS TERMINAL STRIP.
- N.F. TAPE UP BOLTED CONNECTION IF LEAD #21 IS EXTENDED.






Master

9

INSTALLATION

FIGURE A.9 – LN-7 GMA TO SAM MOTOR GENERATOR OR ENGINE WELDER - CONNECTION DIAGRAM.

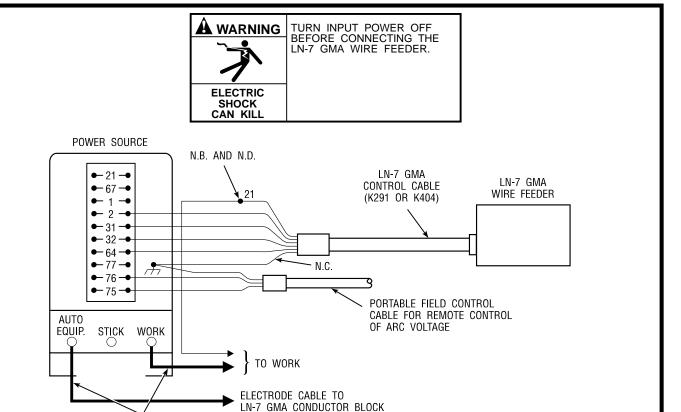

- N.A. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- N.B. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD IS AVAILABLE FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE KEEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)
- N.C. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED \not NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.
- N.D. TAPE UP BOLTED CONNECTION IF LEAD #21 IS EXTENDED.

N.A.




Master

9

Return to Master TOC

FIGURE A.10 - LN-7 GMA TO DC-600 - CONNECTION DIAGRAM.

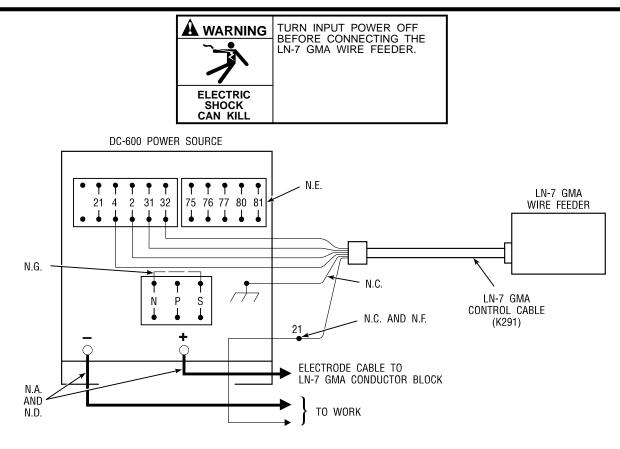

- N.A. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- N.B. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD IS AVAILABLE FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE KEEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)
- N.C. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED 👉 NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.
- N.D. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER OFF AND REVERSE ELECTRODE AND WORK CABLE LEADS AT POWER SOURCE.
- N.E. IF AN OPTIONAL REMOTE VOLTAGE CONTROL IS USED, CONNECT IT TO THIS TERMINAL STRIP.
- N.F. TAPE UP BOLTED CONNECTION IF LEAD #21 IS EXTENDED.
- N.G. FOR DC-600 CODES BELOW 8200: CONNECT A JUMPER FROM "N" TO "S". THERE IS NO N.P.S. TERMINAL STRIP ON CODES ABOVE 8200.






Master

Return to

INSTALLATION

FIGURE A.11 - LN-7 GMA TO R3S-400, 600, OR 800 - CONNECTION DIAGRAM.

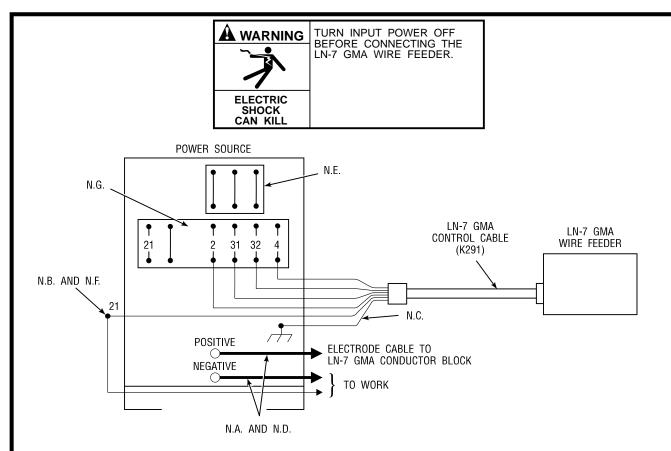

- N.A. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- N.B. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD IS AVAILABLE FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE KEEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)
- .C. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED \not NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.
- N.D. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER OFF AND REVERSE ELECTRODE AND WORK CABLE LEADS AT POWER SOURCE.
- N.E. IF AN OPTIONAL REMOTE VOLTAGE CONTROL IS USED, CONNECT IT TO THIS TERMINAL STRIP.
- N.F. TAPE UP BOLTED CONNECTION IF LEAD #21 IS EXTENDED.
- N.G. ON EARLIER R3S-400, 600, AND 800 MACHINES, #1 TERMINAL WAS ALSO ON THE TERMINAL STRIP.





Master


t

TOC

Master

Return to

FIGURE A.12 - LN-7 GMA TO MOST LINCOLN MOTOR GENERATORS - CONNECTION DIAGRAM.

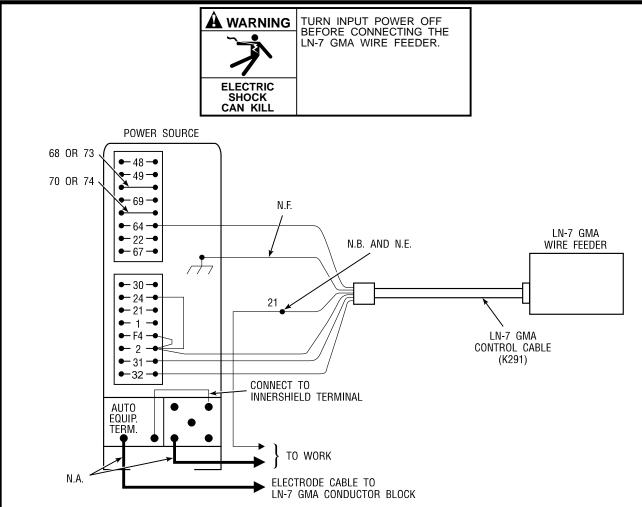

N.A. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.

N.B. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD IS AVAILABLE FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE KEEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)

- N.C. REMOVE LEAD JUMPER BETWEEN #4 AND #244. NO EXTERNAL LEAD IS CONNECTED TO #244.
- N.D. USE WELDANPOWER POLARITY SWITCH TO SET FOR DESIRED ELECTRODE POLARITY. POSITION THE OUTPUT SELECTOR SWITCH ON THE WELDANPOWER TO A CV POSITION.
- N.E. TAPE UP BOLTED CONNECTIONS.
- N.F. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED 👉 NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.





Master

9


TOC

Master


9

INSTALLATION

FIGURE A.13 – LN-7 GMA TO WP250 OR G9 PRO - CONNECTION DIAGRAM.

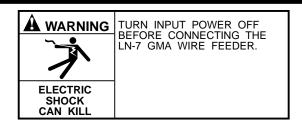

LN-7 GMA TO WP250 G9 PRO: ANY INCREASE OF THE A CAUTION HIGH IDLE ENGINE RPM BY CHANGING THE GOVERNOR CHANGING THE GOVERNOR SETTING OR OVERRIDING THE THROTTLE LINKAGE WILL CAUSE AN INCREASE IN THE AC AUXILIARY VOLTAGE. IF THIS VOLTAGE GOES ABOVE 140 VOLTAGE THE LINT CAMA CONTROL GOES ABOVE 140 VOLTS,
THE LN-7 GMA CONTROL
CIRCUIT WILL BE DAMAGED.
THE ENGINE GOVERNOR
SETTING IS PRE-SET AT THE
FACTORY - DO NOT ADJUST
ABOVE RPM SPECIFICATIONS
LISTED IN ENGINE WELDER
OPERATING MANUAL **AUXILIARY VOLTAGE MUST** NOT EXCEED 140 VOLTS. OPERATING MANUAL.

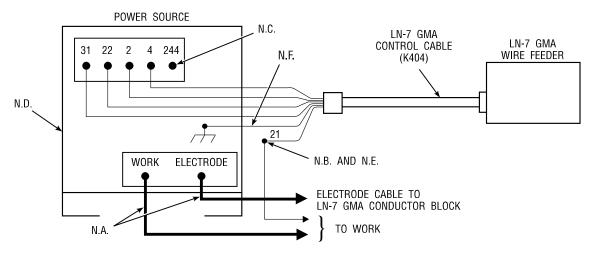

- N.A. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- N.B. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN WORK PIECE KEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CONNECT IT DIRECTLY TO THE WORK PIECE KEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)
- N.C. REMOVE LEAD JUMPER BETWEEN #4 AND #244. NO EXTERNAL LEAD IS CONNECTED TO #244.
- N.D. USE WELDANPOWER POLARITY SWITCH TO SET FOR DESIRED ELECTRODE POLARITY. POSITION THE OUTPUT SELECTOR SWITCH ON THE WELDANPOWER TO A CV POSITION.
- N.E. TAPE UP BOLTED CONNECTIONS.
- N.F. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED / NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.





FIGURE A.14 - LN-7 GMA TO RANGER 9 - CONNECTION DIAGRAM.




SHOCK CAN KILL

- DO NOT OPERATE WITH PANELS OPEN.
- DISCONNECT NEGATIVE (-) BATTERY LEAD BEFORE SERVICING.
- DO NOT TOUCH ELECTRICALLY LIVE PARTS.



- · KEEP GUARDS IN PLACE.
- KEEP AWAY FROM MOVING PARTS.
- ONLY QUALIFIED PERSONS SHOULD INSTALL, USE, OR SERVICE THIS MACHINE.

MOVING PARTS CAN INJURE

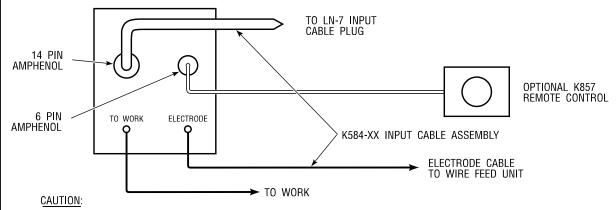

ANY INCREASE OF THE HIGH IDLE ENGINE RPM BY CHANGING THE GOVERNOR SETTING OR OVERRIDING THE THROTTLE LINKAGE WILL CAUSE AN INCREASE IN THE AC AUXILIARY VOLTAGE. IF THIS VOLTAGE GOES OVER 140 VOLTS, WIRE FEEDER CONTROL CIRCUITS MAY BE DAMAGED. THE ENGINE GOVERNOR SETTING IS PRE-SET AT THE FACTORY - DO NOT ADJUST ABOVE RPM SPECIFICATIONS LISTED IN THE ENGINE WELDER OPERATING MANUAL.

- N.A. USE POLARITY SWITCH TO SET FOR DESIRED ELECTRODE POLARITY. POSITION THE OUTPUT SELECTOR SWITCH TO A CV POSITION. PLACE WELDING TERMINALS SWITCH TO "REMOTELY CONTROLLED" POSITION.
- N.B. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS. SEE OPERATING MANUAL.
- N.C. IF OPTIONAL REMOTE OUTPUT CONTROL IS USED, PLACE OUTPUT CONTROL SWITCH IN "OUTPUT CONTROL REMOTE" POSITION.
- N.D. PLACE IDLER SWITCH IN "HIGH" IDLE POSITION.





Master

t

INSTALLATION

FIGURE A.15 - LN-7 GMA TO RANGER 10-LX - CONNECTION DIAGRAM.




CAN KILL

- DO NOT OPERATE WITH PANELS OPEN.
- DISCONNECT NEGATIVE (-) BATTERY LEAD BEFORE SERVICING.
- DO NOT TOUCH ELECTRICALLY LIVE PARTS.



- KEEP GUARDS IN PLACE.
- KEEP AWAY FROM MOVING PARTS.
- ONLY QUALIFIED PERSONS SHOULD INSTALL, USE, OR SERVICE THIS MACHINE.

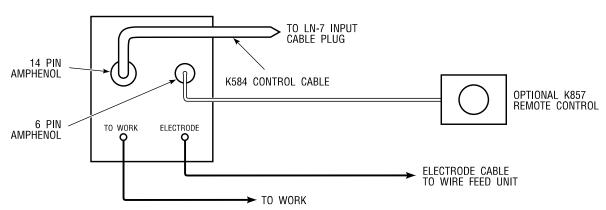

CAUTION:

ANY INCREASE OF THE HIGH IDLE ENGINE RPM BY CHANGING THE GOVERNOR SETTING OR OVERRIDING THE THROTTLE LINKAGE WILL CAUSE AN INCREASE IN THE AC AUXILIARY VOLTAGE. IF THIS VOLTAGE GOES OVER 140 VOLTS, WIRE FEEDER CONTROL CIRCUITS MAY BE DAMAGED. THE ENGINE GOVERNOR SETTING IS PRE-SET AT THE FACTORY - DO NOT ADJUST ABOVE RPM SPECIFICATIONS LISTED IN THE ENGINE WELDER OPERATING MANUAL.

- A. USE POLARITY SWITCH TO SET FOR DESIRED ELECTRODE POLARITY. POSITION THE OUTPUT SELECTOR SWITCH TO A CV POSITION. PLACE WIRE FEEDER SWITCH TO "WIRE FEEDER WITH CONTROL CABLE" POSITION.
- N.B. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS. SEE OPERATING MANUAL.
- C. IF OPTIONAL REMOTE OUTPUT CONTROL IS USED, PLACE OUTPUT CONTROL SWITCH IN "OUTPUT CONTROL REMOTE" POSITION.




Master

t

Return to Master TOC

FIGURE A.16 – LN-7 GMA TO POWER SOURCES WITH NO OUTPUT CONTACTOR - CONNECTION DIAGRAM.

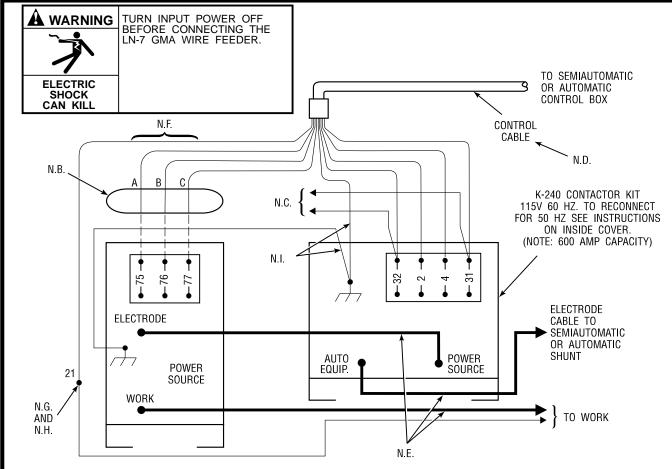

- N.A. 115V AC WILL NOT BE TURNED OFF WHEN POWER SOURCE IS TURNED OFF. CONTACTOR KIT AND SEMIAUTOMATIC OR AUTOMATIC EQUIPMENT WILL STILL HAVE 115V CONTROL POWER SUPPLIED UNTIL POWER SUPPLIED TO TERMINALS #31 AND #32 IS TURNED OFF.
- N.B. ON LINCOLN POWER SOURCES WITHOUT A REMOTE CONTROL TERMINAL STRIP HAVING THESE NUMBERS, OR WHEN USING NON-LINCOLN POWER SOURCES, TAPE UP THESE LEADS SEPARATELY.
- N.C. TO 115V AC 500 V.A. PLUS 250 V.A. ADDITIONAL IF LINCOLN TRAVEL CARRIAGE IS USED
- N.D. LEADS #75, #76, #77, A, B, AND C DO NOT APPEAR ON LN-7 GMAS WITH CODES ABOVE 7026.
- N.E. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- N.F. IF USING AN OLDER CONTROL CABLE: CONNECT LEAD #75 TO #75 ON TERMINAL STRIP, CONNECT LEAD #76 TO #76 ON TERMINAL STRIP, CONNECT LEAD #77 TO #77 ON TERMINAL STRIP.
- N.G. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD IS AVAILABLE FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE KEEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)
- N.H. TAPE UP BOLTED CONNECTION.
- N.I. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED $dotsymbol{ o}$ NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.





Master

9

Return t

TOC


Master

9

Return 1

INSTALLATION

FIGURE A.17 – LN-7 GMA TO POWER SOURCES WITH CONTACTOR AND NO TERMINAL STRIP - CONNECTION DIAGRAM.

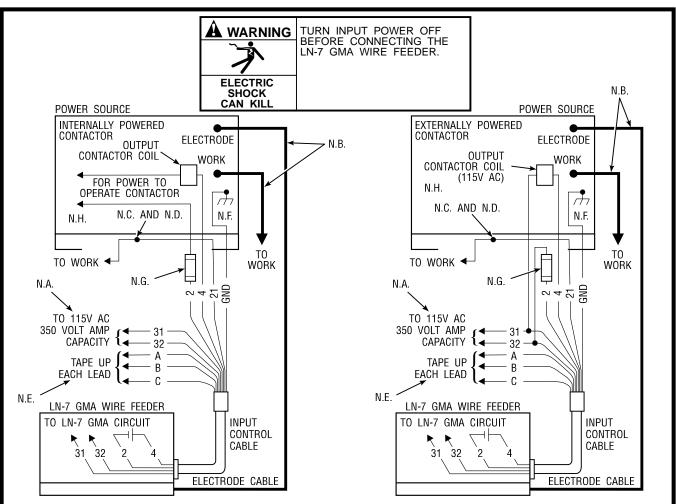

- .A. 115V AC WILL NOT BE TURNED OFF WHEN POWER SOURCE IS TURNED OFF. CONTACTOR KIT AND SEMIAUTOMATIC OR AUTOMATIC EQUIPMENT WILL STILL HAVE 115V CONTROL POWER SUPPLIED UNTIL POWER SUPPLIED TO TERMINALS #31 AND #32 IS TURNED
- N.B. WELDING CABLES MUST BE OF PROPER CAPACITY FOR THE CURRENT AND DUTY CYCLE OF IMMEDIATE AND FUTURE APPLICATIONS.
- N.C. EXTEND LEAD #21 USING 14 AWG OR LARGER INSULATING WIRE PHYSICALLY SUITABLE FOR THE INSTALLATION. AN S-16586-[LENGTH] REMOTE VOLTAGE SENSING WORK LEAD IS AVAILABLE FOR THIS PURPOSE. CONNECT IT DIRECTLY TO THE WORK PIECE KEEPING IT ELECTRICALLY SEPARATE FROM THE WELDING WORK LEAD CIRCUIT AND CONNECTION. FOR CONVENIENCE, THIS EXTENDED #21 LEAD SHOULD BE TAPED TO THE WELDING WORK LEAD. (THIS EXTENDED #21 LEAD CONNECTION REPLACES THE NEED TO EMPLOY THE REMOTE WORK LEAD ACCESSORY ON LN-7 GMA METER KITS WHICH HAVE A DIRECT WORK LEAD JACK. AN LN-7 GMA NOT EQUIPPED WITH A METER KIT DOES NOT REQUIRE LEAD #21 TO BE EXTENDED.)
- N.D. TAPE UP BOLTED CONNECTION
- N.E. LEADS A, B, AND C DO NOT APPEAR IN THE LN-7 GMA CONTROL CABLE.
- N.F. CONNECT THE CONTROL CABLE GROUND LEAD TO THE FRAME TERMINAL MARKED \not NEAR THE POWER SOURCE TERMINAL STRIP OR AN UNPAINTED FRAME SCREW. THE POWER SOURCE, OF COURSE, MUST BE GROUNDED PROPERLY.
- N.G. INSTALL A 5 AMP OR SMALLER FUSE IN LEAD #2 TO PROTECT THE 2-4 CIRCUIT IN WIRE FEEDER.
- N.H. MAXIMUM RATING OF LN-7 GMA #2 TO #4 CIRCUIT IS:
 - 5 AMP 115V AC 5 AMP 28V AC
 - 1/2 AMP 115V AC



Return to Master

WORK CABLE

Connect a work lead of sufficient size and length (Table A.2) between the proper output stud on the power source and the work. Be sure the connection to the work makes tight metal-to-metal electrical contact. Poor work lead connections can result in the grounding lead protector being activated.

TABLE A.2 – WORK LEAD SPECIFICATIONS

	Copper Work Cable Size, AWG		
Current 60%	Up To 50 Ft	50 Ft-100 Ft	
Duty Cycle	(15.2 m²)	(15.2-30.4 m ²)	
300 Amps	0 (53 mm²)	00 (67 mm²)	
400 Amps	00 (67 mm²)	000 (85 mm²)	
500 Amps	00 (67 mm²)	000 (85 mm²)	
600 Amps	000 (85 mm²)	0000 (107 mm²)	

GUN AND CABLE ASSEMBLIES

The LN-7 GMA can be used with several guns. In most cases, Lincoln guns and cables are shipped assembled, ready to weld. Use the gun and cable assembly for the electrode type (solid, Outershield , or Innershield) and electrode size to be used. Refer to the Accessories Section for different gun types.


GUN CABLE CONNECTIONS

Lay the cable out straight. Insert the connector on the welding conductor cable through the large hole in the front panel of the LN-7 GMA and into the brass conductor block on the front of the gearbox. Refer to Figure A.18. Make sure it is all the way in and tighten the hand wheel. Keep this connection clean and bright.

Connect the control cable amphenol plug into the mating 5-cavity receptacle on the front of the control section below the nameplate.

If using the K489-1 Fast-Mate Adapter, install per the S19389 instructions included with the kit.

FIGURE A.18 - GUN CABLE CONNECTIONS.

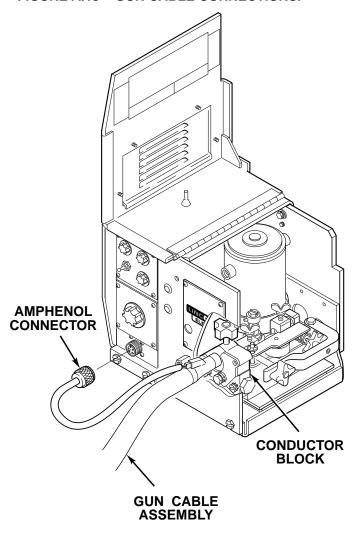



Return to Section TOC

Return to Master TOC

Return to Master TOC

INSTALLATION


WATER CONNECTIONS (FOR WATER COOLED GUNS)

The LN-7 GMA must have a K527 Water Solenoid Kit installed (see the Accessories Section). The K440-1 LN-7 GMA model already has a water solenoid installed. Refer to Figure A.19 and perform the following steps:

NOTE: If not using a Lincoln water cooler (such as the K877-1), and if your water cooling device is not designed for use with a waterline solenoid valve, you may remove the solenoid and screw the male fitting (after applying sealant) directly into the brass manifold block.

- Using male 5/8-18 UNF left-hand thread fittings, connect appropriate water hoses to the coolant inlet and outlet on the back of the LN-7 GMA. Connect the other ends of these hoses to the appropriate ports on your water cooling units.
- 2. In the event the water line fittings on your water cooled gun are incompatible with the female quick connects on the front of the LN-7 GMA, male quick connects are provided for installation on 3/16 in. I.D. hose (customer to provide appropriate clamps). The feeder connectors self seal when disconnected.

FIGURE A.19 - WATER CONNECTIONS.

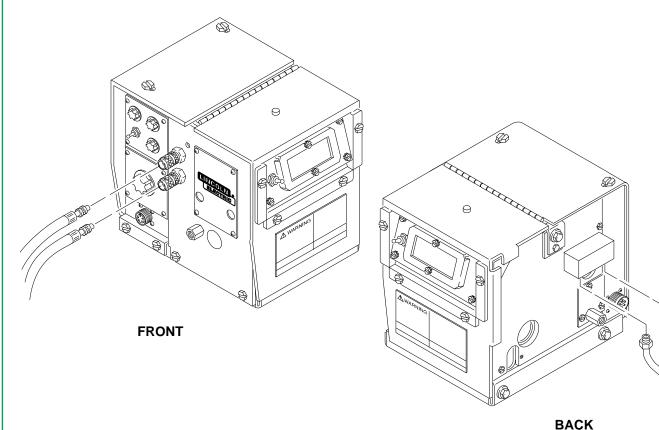



Return to Master TOC

SHIELDING GAS HOOKUP

WARNING

Gas under pressure is explosive. Always keep gas cylinders in an upright position and to the undercarriage or a stationary support. See American National Standard Z-49.1, "Safety In Welding And Cutting", published by the American Welding Society.


Customer must provide a cylinder of shielding gas, a pressure regulator, a flow control valve, and a hose from the flow valve to the gas inlet fitting of the LN-7

GMA or the K494 Gas Solenoid Valve Kit installed on the LN-7 GMA. Install per Figure A.20 and the following:

- 1. Connect the supply hose from the gas cylinder flow valve outlet to the 5/8-18 female inert gas fitting on the back panel of the LN-7 GMA.
- 2. Install the barbed fitting and union nut to the 5/8-18 female inert gas fitting on the front of the LN-7 GMA. Connect 3/16 in. (4.8 mm) I.D. gas hose from the gun to the barbed fitting.

When the gun is to be removed, this fitting can be easily detached by loosening the union nut.

FIGURE A.20 - SHIELDING GAS HOOKUP.

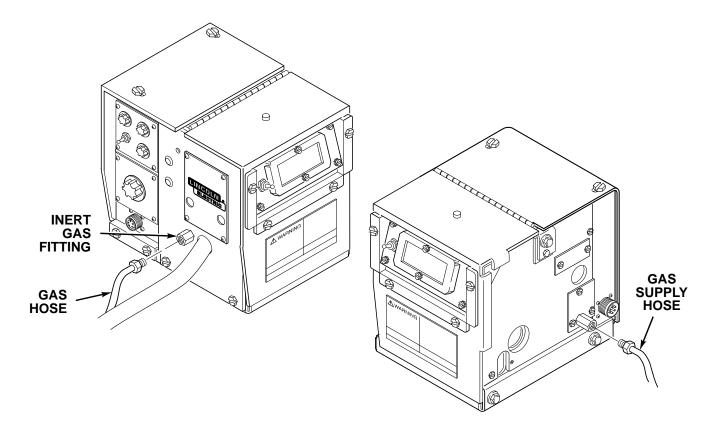



A-24 NOTES

Return to Section TOC Return to Master TOC

Return to Section TOC

Return to Section TOC

Return to Section TOC
Return to Master TOC

Return to Master TOC

Return to Master TOC





TABLE OF CONTENTS - OPERATION SECTION -

Operation	Section B
Operating Instructions	B-2
Safety Precautions	B-2
General Description	B-2
Recommended Processes and Equipment	B-2
Controls and Settings	B-3
Circuit Protection	B-4
Avoiding Ground Lead Protector (GLP) Activation	B-4
Drive Roll Installation	B-4
Changing Drive Rolls For Two-Roll Wire Feeders	B-4
Changing Drive Rolls For Four-Roll Wire Feeders	B-6
Idle Roll Pressure Setting	B-8
Wire Loading	B-9
Wire Reel Loading - Readi-Reels and Spools	B-9
Wire Reel Loading - 50 and 60 lb Coils	B-11
Wire Loading - 13-14 lb Innershield Coils	B-12
Acceleration Setting	B-13
Wire Speed and Voltage Adjustment	B-13
Making a Weld	B-14
Wire Reel Changing	B-14
Optional K416 Analog and K417 Digital Voltmeter Kits	B-14
Flux Tank Loading	B-15
K320 Flux Tank (Optional)	B-15
K310 Flux Screen (Optional)	B-15
K58 Magnetic Separator (Optional)	B-15



Return to Master

OPERATION

OPERATING INSTRUCTIONS

Read and understand the entire Operation Section prior to operating the machine.

SAFETY PRECAUTIONS

WARNING



ELECTRIC SHOCK can kill.

- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work or ground.
- insulating Always wear dry gloves.



FUMES AND GASES can be dangerous.

- Keep your head out of fumes.
- Use ventilation or exhaust to remove fumes from breathing zone.



WELDING SPARKS can cause fire or explosion.

- Keep flammable material away.
- Do not weld on containers that have held combustibles.



ARC RAYS can burn.

Wear eye. body ear, protection.

Observe additional Safety Guidelines detailed in the beginning of this manual.

GENERAL DESCRIPTION

The K440 LN-7 GMA semiautomatic constant speed wire feeder is specifically equipped for gas metal arc welding using flux-cored Outershield electrodes and solid wire. The LN-7 GMA is also suitable for selfshielded flux-cored Innershield electrodes, submerged arc welding (if constant voltage is satisfactory), and other open arc welding. It has been factory assembled with the following features:

- Calibrated wire feed dial [75 to 700 in./min (1.9 to 17.8 m/min)].
- Factory installed gas solenoid valve and gas fittings.
- Wire drive uses a permanent magnet motor and includes tool-less "quick- release" idle roll pressure arm, outgoing guide tube and gun cable fastening.
- Optional factory installed water solenoid and fittings for use with water cooled welding guns.

The K567-1 LN-7 GMA 4-Roll is designed to provide the additional feeding force required when using gun cables over 15 ft (4.6 m) long or when the wire is pulled long distances (such as when bulk packages are used). Because the four-roll feeder has twice the contact surface, it can also help when feeding softer wires by delivering the same or more feeding force as the two-roll with less overall wire deformation. Wire size range, speed and features are the same as other LN-7 GMA models.

RECOMMENDED PROCESSES AND **EQUIPMENT**

The LN-7 GMA is recommended for use in MIG and Innershield welding applications with constant voltage power sources such as the Idealarc DC-250, 400, or 600, or CV types. The LN-7 is capable of feeding wires ranging from 0.023 in. through 1/16 in. (0.6 through 1.6 mm) solid, 0.045 in. through 5/64 in. (1.2 through 2.0 mm) Innershield, and 0.062 in. through 5/64 in. (1.6 through 2.0 mm) Outershield electrodes.



TOC

Return to Master

CONTROLS AND SETTINGS

Operator controls are illustrated in Figure B.1. Refer to the figure and the following explanations of the controls.

WIRE FEED SPEED CONTROL. This control sets the feed speed of the wire feeder. Turn the knob to the left for slower speeds and to the right for higher speeds. The control is calibrated. The nameplate shows the wire speed for the given setting of the control.

BURNBACK CONTROL (OPTIONAL). This control, located on the optional K419 Burnback Timer and K418 GMA Timer Kits, provides a precise time delay that allows the wire to be burned off at the end of the weld. This is useful for those applications where higher speed, fine wire feeding is used and there is a tendency for the electrode to overrun at the end of the weld and cause "sticking" in the crater. The delay is adjustable for optimum burnback depending on wire size, process, procedure, etc.

PREFLOW CONTROL (OPTIONAL). This control, located on the optional K418 GMA Timer Kit, provides flow of shielding gas to the work before the arc is established. The gas solenoid valve is energized


immediately when the gun trigger is closed, but the time delay before the wire feeder is energized is adjustable from 0 to 1.5 seconds. Turn the knob to the left for shorter delays and to the right for longer delays.

POSTFLOW CONTROL (OPTIONAL). This control, located on the optional K418 GMA Timer Kit, provides flow of shielding gas to the work after welding has stopped. Delay for the gas solenoid valve shutoff is adjustable from 0 to 1.5 seconds. Turn the knob to the left for shorter delays and to the right for longer delays.

PURGE - COLD INCH SWITCH (OPTIONAL). This control, located on the optional K418 GMA Timer Kit, provides control of some wire feeder functions without energizing the welding power source. The momentary up position energizes the gas solenoid but not the wire feeder or welding power source. The momentary down position energizes the wire feeder but not the gas solenoid or the welding power source.

ELECTRODE POLARITY SWITCH (OPTIONAL). This switch, located on the optional K416 Digital and K417 Analog Meter Kits, controls the polarity of the meter. Set this switch to the same polarity as the electrode lead to allow correct operation of the meter.



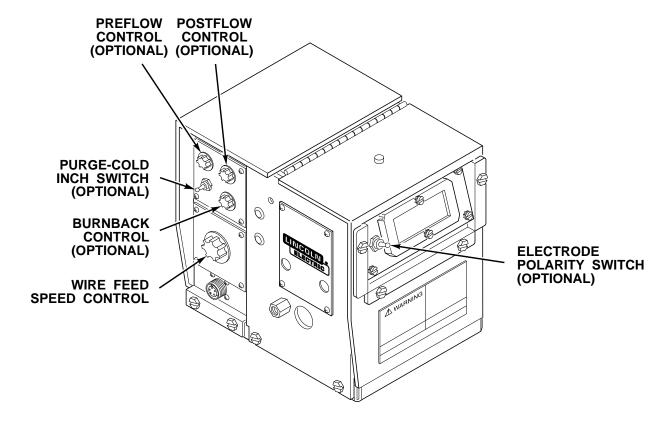



Return to Master TOC

Return to Master TOC

CIRCUIT PROTECTION

A manual reset circuit breaker protects the AC supply line and the wire feeder from overloads, usually caused by excessive wire drag or other wire feed problems. To reset the circuit breaker, raise the cover of the wire drive compartment and push the white button on the side of the control box above the drive rolls. If the circuit breaker trips again, refer to the Troubleshooting Section.

The LN-7 GMA also includes a Ground Lead Protector (GLP) circuit and fuse in the 2-4 contactor circuit. See the Theory of Operation Section for a description of these circuits.

AVOIDING GROUND LEAD PROTECTOR (GLP) ACTIVATION

DO NOT allow the electrode to contact the case of the wire feeder or the uninsulated part of the wire reel stand when the gun trigger is activated.

Be sure that all work lead connections to the work make tight metal-to-metal contact.

DO NOT allow excess input cable or work cable to be placed closer than three feet from the wire feeder.

DO NOT coil excess input cable assembly or use a coiled assembly as shipped from the factory. Instead, loop the excess cable length back and forth in three to six foot straight lengths. Coiling the input cable results in a transformer action between the electrode conductor cable and the ground lead in the multiconductor control cable. This transformer action can cause a current to flow in the ground lead which will falsely activate the GLP circuit.

To reset the GLP circuit, press the red button above the drive rolls and to the left of the circuit breaker.

DRIVE ROLL INSTALLATION

OPERATION

CHANGING DRIVE ROLLS FOR TWO-**ROLL WIRE FEEDERS:**


To change drive rolls on a two-roll wire feeder, refer to Figure B.2 and perform the following steps:


- 1. Rotate the latch knob on the quick release arm.
- 2. Remove the hex head screw and clamping collar. Remove the drive roll from the shaft. On new machines, remove the tape and the drive key.
- 3. The new roll to be installed is stamped for the size to be fed. An "A" after the size indicates aluminum wire. Remove the rolls from the kit and wipe them clean. Wipe the output shaft and locating shoulder clean.
- 4. Use the drive key, clamping collar, and hex head screw to install the roll on the output shaft. Certain size drive rolls consist of two roll halves, and may contain a spacer. If the drive roll you are installing contains a spacer, the spacer fits between the two halves of the drive roll. Tighten the hex head screw.
- 5. Back out the guide tube clamping screws. Remove the old guide tubes, if installed.
- 6. Insert the outgoing guide tube (the one with the plastic insert) into the front hole. If the guide tube has a non-symmetrical chisel end, the larger radius must face the drive roll. See Figure B.2. Push the guide tube back as far as it will go and tighten the clamping screw. Insert the incoming guide tube as far back as it will go and tighten the clamping screw. The clamping screws are dog points. When the guide tubes are properly installed these dog points will lock into the annular grooves in each of the guide tubes.
- 7. Set the idle roll pressure as detailed in the Idle Roll Pressure Setting procedure detailed later in this section.



Return to Master TOC

FIGURE B.2 – INSTALLING DRIVE ROLLS ON A TWO-ROLL FEEDER.

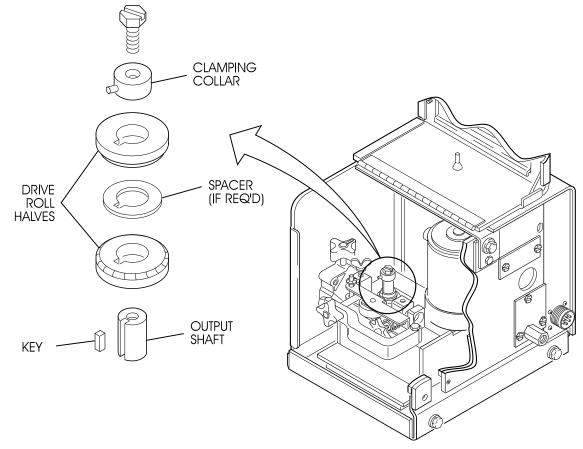

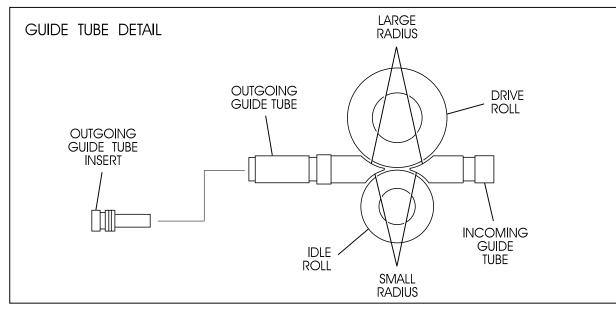



Return to Section TOC

CHANGING DRIVE ROLLS FOR FOUR-

ROLL WIRE FEEDERS:

OPERATION


To change drive rolls on a four-roll wire feeder, refer to Figure B.3 and perform the following steps:


- Remove the gun and cable from the conductor block on the feeder by loosening the hand screw and pulling the gun straight out of the block.
- 2. Open both quick release levers by moving the levers outward and pulling them toward you.
- Loosen the thumb screws holding the guide tubes in place. Remove the incoming and outgoing guide tubes, if installed.
- Remove the hex head screws and clamping collars from the output shafts. Remove the drive rolls and middle guide tube, if installed. On new feeders remove the tape and drive keys.
- 5. The new rolls to be installed are stenciled with the wire size that will be fed. An "A" after the number indicates aluminum wire. Remove the rolls from the kit and wipe them clean. Wipe the output shafts and locating shoulders clean.
- 6. Install one roll onto either output shaft using the drive key, clamping collar, and hex head screw. Certain size drive rolls consist of two roll halves, and may contain a spacer. If the drive roll you are

- installing contains a spacer, the spacer fits between the two halves of the drive roll. Tighten the hex head screw.
- 7. Install the middle guide tube, but do not tighten at this time. When installing a 0.035" middle guide tube the larger radius should be aligned towards the drive roll. Slide the guide tube up against the drive roll.
- Install the second drive roll on the remaining shaft the same way as the first. Center the middle guide tube between the rolls and tighten the thumbscrews holding it in place.
- 9. Close and latch both quick release levers.
- 10. Slide the incoming guide tube into the rear hole of the gearbox until it almost touches the drive roll and guide tube. Tighten the thumbscrew to hold it in place.
- 11. Install the outgoing guide tube into the front hole of the gearbox (through the conductor block) and tighten the thumb screw. The 0.035 in. outgoing guide tube should have the larger radius oriented toward the drive roll. For proper installation of the outgoing guide tube insert, refer to Figure B.3.
- 12. Be certain that the guide tubes do not touch the drive rolls or idle rolls. If they do touch, readjust them and tighten in place.



FIGURE B.3 - INSTALLING DRIVE ROLLS ON A FOUR-ROLL FEEDER.

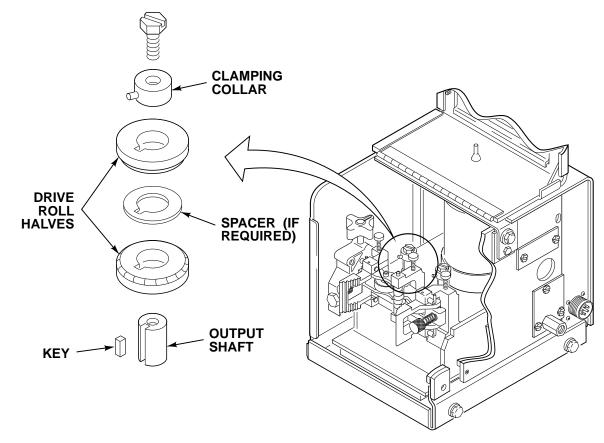

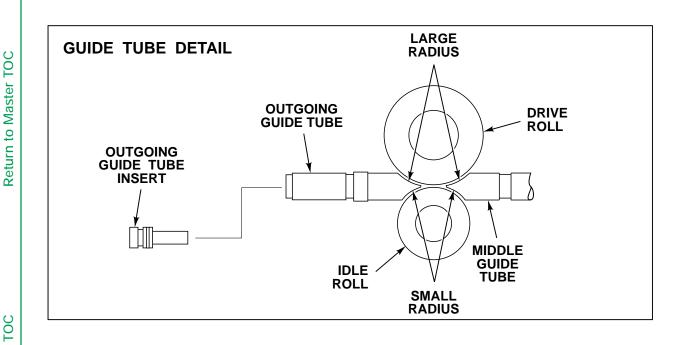



Return to Section TOC

Return to Master TOC

OPERATION

IDLE ROLL PRESSURE SETTING

The idle roll pressure is set at the factory. Two-roll feeders are set with the pressure adjustment knob backed out two turns from full pressure, and four-roll feeders are set backed out three turns. This is an approximate setting. For small wire sizes and aluminum wire the optimum idle roll pressure varies with type of wire, surface condition, lubrication, and hardness. The optimum idle roll setting can be determined as follows:

Two-roll wire feeders:


- Press the end of the gun against a solid object that is electrically isolated from the welder output and press the trigger for several seconds.
- 2. If the wire "birdnests", jams, or breaks at the drive roll, the idle roll pressure is set too high. Back the pressure adjustment knob, Figure B.4, out 1/2 turn. Run new wire through the gun and repeat step 1.
- 3. If the only result is drive roll slippage, loosen the gun cable clamping screw on the conductor block and pull the gun cable forward about six inches. There should be a slight waviness in the exposed wire. If there is no waviness, the pressure is too low. Increase the pressure setting 1/4 turn. Lock the gun cable in place and repeat steps 1 and 2.

Four-roll wire feeders:

1. Release the incoming idle roll and perform the pressure setting procedure for two roll feeders to set outgoing idle roll pressure.

- 2. After outgoing pressure is set, determine how many turns away from full pressure the setting is.
- Set both idle roll tensions to this setting. Engage both idle rolls before welding. For most applications, best wire feeding will occur when both idle roll pressures are set the same.

FIGURE B.4 - IDLE ROLL PRESSURE SETTING.

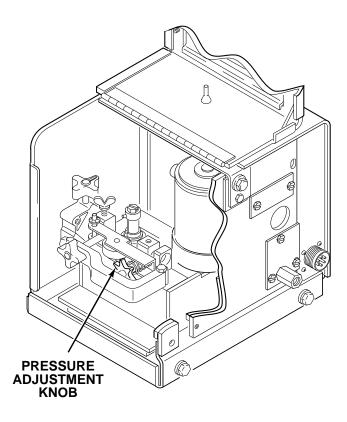



WIRE LOADING

WIRE REEL LOADING - READI-REELS AND SPOOLS

TO MOUNT A 30 LB READI-REEL PACKAGE USING THE MOLDED PLASTIC K363-P TYPE ADAPTER:

- Make certain that the threaded locking collar is tight and securely locks the adapter on the spindle. See Figure B.5.
- 2. Rotate the spindle and adapter so the retaining spring is at the 12 o'clock position.
- Position the Readi-Reel so that it will rotate in a clockwise direction when feeding (wire is to be dereeled from the bottom of the coil).
- 4. Set one of the Readi-Reel inside cage wires on the slot in the retaining spring tab.


- Lower the Read-Reel to depress the retaining spring and align the other inside cage wires with the grooves in the adapter.
- 6. Slide the cage all the way onto the adapter until the retaining spring "pops up" fully.

WARNING

Check to be sure the retaining spring has been fully returned to the locking position and has SECURELY locked the Readi-Reel cage in place. Retaining spring must rest on the cage, not the welding electrode.

7. To remove the Readi-Reel from the adapter, depress the retaining spring with thumb while pulling the Readi-Reel cage from the adapter with both hands. Do not remove the adapter from the spindle.

FIGURE B.5 – INSTALLING A 30 LB READI-REEL PACKAGE.

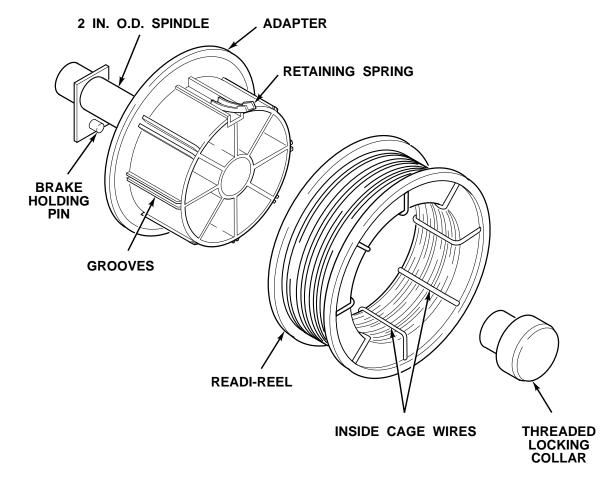



B-10

Return to Section TOC

OPERATION

TO MOUNT 10 TO 30 LB SPOOL (12" DIAMETER): (For 8 in. spools a K468 spindle adapter must be used.)

- Remove the locking collar and Read-Reel adapter shipped on the 2 in. diameter spindle (adapter is not required).
- 2. Place the spool on the spindle making certain the brake holding pin enters one of the holes in the back side of the spool. Be certain the wire comes off the reel in a clockwise direction when dereeled form the bottom of the coil.
- 3. Replace and tighten the locking collar.

ELECTRODE FEEDING AND BRAKE ADJUSTMENT

- 1. Turn the Readi-Reel or spool until the free end of the electrode is accessible.
- 2. While tightly holding the electrode, cut off the bent end and straighten the first six inches. Cut off the first inch. (If the electrode is not properly straightened, it may not feed or may not go into the outgoing guide tube, causing a "birdnest".)

- 3. Insert the free end through the incoming guide tube.
- 4. Press the gun trigger and push the electrode into the drive roll.

WARNING



ELECTRIC SHOCK can kill.

- Do not touch electrically live parts such as output terminals or internal wiring.
- When inching with the gun trigger, electrode and drive mechanism are "hot" to work and ground.
- 5. Inch the electrode through the gun.
- 6. Adjust the brake tension with the thumbscrew on the spindle hub until the reel turns freely but with little or no overrun when wire feeding is stopped. Do not overtighten.



WIRE REEL LOADING - 50 AND 60 LB COILS (K303 OR K376 WIRE REEL STAND)

ADJUSTABLE WIRE REEL BRAKE

The mount for standard 50 and 60 pound electrode coils includes a two-position brake assembly. Generally the brake should be at the inner position (nearest to the wire reel shaft) for wire feed speeds below 400 in./min (10 m/min). It should be at the outer position for the faster wire speeds often used when feeding smaller diameter electrode.

To adjust the brake position, remove the wire reel. Pull the cotter pin that holds the brake shoe to the arm, move the shoe and replace the cotter pin. Do not bend the cotter pin - it is held in place by a friction fit.

TO MOUNT A 50 OR 60 LB COIL:


- 1. To remove the wire reel from its shaft, grasp the spring loaded knob and pull out. This straightens the knob so it seats into the shaft when released. Remove the reel.
- 2. Lay the reel flat on the floor. Loosen the spinner nut and remove the cover plate. See Figure B.6.
- 3. Place the coil of electrode on the reel so it unwinds as the reel rotates clockwise. DO NOT cut the tie wires at this time.
- 4. Be sure the coil is placed so the spring loaded arms will not interfere with the later removal of the coil tie wires.
- 5. When loading 0.030, 0.035, and 0.045" electrode, be certain the coil is placed on the reel so the spring loaded arms are at the center of the slots in the cardboard coil liner. This provides the positive compression of the coil sides needed for troublefree wire feeding.
- 6. Put the cover plate on the reel so the four arms of the cover plate straddle and are in line with the spring loaded arms of the reel.
- 7. Tighten the cover as much as possible by hand. DO NOT hammer on the spinner nut arms.

A CAUTION

Always be sure the free end of the coil is securely held while the tie wires are being cut and until the wire is feeding through the drive rolls. Failure to do this will result in "back lashing" of the coil, which may tangle the wire. A tangled coil will not feed. It must be untangled or discarded.

- 8. Cut and remove **only** the tie wire holding the free end of the coil. Insert the free end into one of the holes in the cover and secure it by bending it back. Cut and remove the remaining tie wires.
- 9. Replace the reel on the wire feeder. Grasp the shaft knob, pull it out and swing it across the reel hub, locking the reel in place.

FIGURE B.6 - LOADING A 50 OR 60 LB COIL.

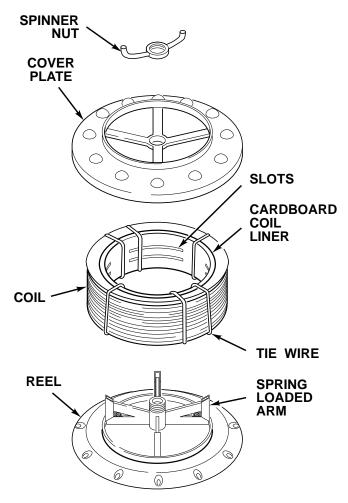



Return to Section TOC

Return to Master TOC

OPERATION

FEEDING ELECTRODE

- Turn the reel until the free end of the electrode is accessible.
- While tightly holding the electrode, cut off the bent end and straighten the first six inches. Cut off the first inch. (If the electrode is not properly straightened, it may not feed or may not go into the outgoing guide tube causing a "birdnest".)
- 3. Insert the free end through the incoming guide tube.
- Press the gun trigger and push the electrode into the drive roll.

WARNING



ELECTRIC SHOCK can kill.

- Do not touch electrically live parts such as output terminals or internal wiring.
- When inching with the gun trigger, electrode and drive mechanism are "hot" to work and ground.
- 5. Inch the electrode through the gun.

WIRE LOADING – 13-14 LB INNERSHIELD COILS

The K378 small mounting stand for the 14 lb Innershield coil does not have an adjustable brake. It has a fixed drag built into the reel spindle.

To load a 14 lb coil:

- 1. Remove the snap-on lid from the plastic canister.
- 2. Remove the center clamping nut and the cover plate from the wire reel.
- Unpack the 14 lb coil of wire. Be sure not to bend the side tangs of the liner. Straighten any tangs that may have been bent.
- 4. Remove the start end of the coil from its holding slot in the coil liner. Cut off the bent end, straighten the first six inches, and cut off the first inch. (If the electrode is not properly straightened, it may not feed or may not enter the outgoing tube, causing a "birdnest".)
- Thread the end through the canister wire feed liner until about four inches of electrode are exposed.
- 6. Place the coil onto the disc support.
- Replace the front reel cover and center clamping nut. Keep the reel from turning and tighten the center clamping nut securely.
- Thread the exposed end of the electrode into the wire feeder until it touches the drive rolls. Actuate the gun trigger and feed the electrode through the system.




Return to Master

ACCELERATION SETTING

The LN-7 GMA can be configured for optimum starting for different procedures by selecting between two speeds of controlled wire acceleration. As shipped from the factory, the LN-7 GMA models are set for fast acceleration. Fast acceleration is typically the best for most smaller wire procedures. Slow acceleration may be more desirable for long stickout applications, or if a larger diameter electrode is being used.

Acceleration is set on the control PC board. To gain access to the control PC board, make certain the input power is off and remove the side cover on the control side of the LN-7 GMA. To change the acceleration on earlier control PC boards, reconnect the jumper to "F" (Fast) or "S" (Slow). Later control PC boards use a DIP switch (S101). S101 has 8 circuits (switches); only circuit #1 is used. Set circuit #1 in the "F" position for fast acceleration or in the "S" position for slow acceleration. See Figure B.7.

FIGURE B.7 – ACCELERATION SETTING (LATER CONTROL PC BOARDS).

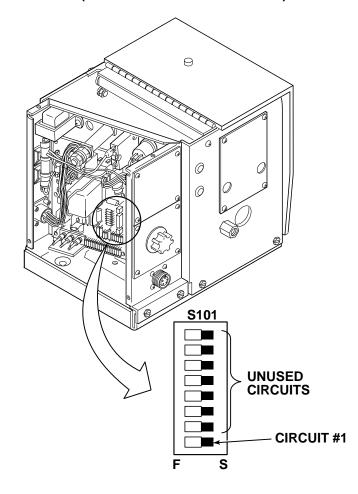

WIRE SPEED AND VOLTAGE **ADJUSTMENT**


Use only constant voltage power type sources. If using a multiple process power source, be sure it is set for constant voltage output per instructions in the manual for the power source.

Set the power source polarity switch or properly connect the electrodes and work leads for the correct electrode polarity. If the wire feeder is equipped with an optional meter kit, set the meter polarity switch to the proper working polarity.

Set the voltage using the control on the power source or the optional remote voltage control, if used. Set the open circuit voltage to approximately 2 volts higher than the desired procedure voltage. The final setting must be made according to the arc voltage while welding.

The wire speed control on the front of the wire feeder, Figure B.8, has a dial that is calibrated directly in inches per minute. Set the control for the desired procedure wire speed.

FIGURE B.8 - SETTING WIRE SPEED.

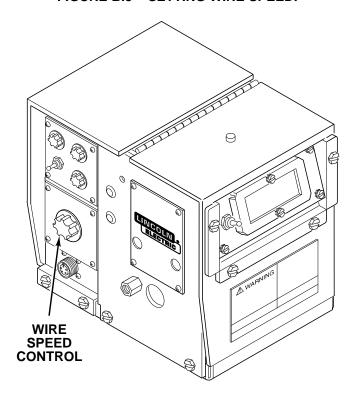



Return to Section TOC

MAKING A WELD

- 1. Inch the electrode through the gun and cable. For solid wire, cut the electrode within approximately 3/8 in. of the end of the contact tip. If using cored wire, cut the electrode within 3/4 in. of the extension guide.
- 2. Connect the work cable to the metal to be welded. The work cable must make good electrical contact with the work. The work must also be grounded.

WARNING

When using an open arc process, it is necessary to use correct eye, head, and body protection.

- Position the electrode over the joint. The end of the electrode may be lightly touching the work.
- 4. Lower your welding helmet. Close the gun trigger and begin welding. Hold the gun so the contact tip to work distance gives the correct electrical stickout as required for the procedure being used.
- 5. To stop welding, release the gun trigger and then pull the gun away from the work after the arc goes out.

WIRE REEL CHANGING

At the end of a coil, remove the last of the old electrode from the conductor cable. Either pull it out at the nozzle, or use the following procedure.

- 1. Cut off the end of the electrode at the gun end. Do not break it off by hand. Breaking by hand puts a slight bend in the wire, making it difficult to pull it back through the nozzle.
- 2. Uncouple the gun conductor cable from the conductor block on the wire feeder drive unit and lay the gun cable out straight.
- 3. Using pliers, grip the wire and pull it out of the cable from the connector end.
- 4. After the electrode has been removed, connect the gun conductor back to the wire feeder.
- Load a new reel of electrode per the instructions for the specific reel type given previously in this section.

OPTIONAL K416 ANALOG AND **K417 DIGITAL VOLTMETER KITS**

OPERATION


Lincoln Specified Procedures give voltmeter readings taken between the work and the gun cable brass connection block inside the LN-7 GMA. To match these voltage readings, the #21 lead should be extended directly to the work per the instructions on the wire feeder to power source connection diagrams given in the Installation Section.

To read volts, set the "Electrode Polarity" switch, Figure B.9, to the same polarity as the electrode lead connection to the power source.

The K417 Digital Voltmeter Kit has a hold feature that will freeze the last arc voltage reading at the moment the trigger is released to stop welding. This feature allows the welding operator to easily check the arc voltage and make adjustments if necessary to match procedures. For accuracy, it is important to release the gun trigger and the lift the gun away from the work.

The hold circuit automatically releases about six seconds after the gun trigger is released. It is also released when the trigger is closed again to begin welding.

FIGURE B.9 - ELECTRODE POLARITY SWITCH.

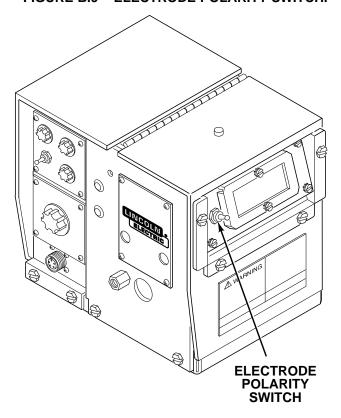



Return to Master TOC

FLUX TANK LOADING

K320 FLUX TANK (OPTIONAL)

Either turn off the incoming air line or remove the quick disconnect if one has been installed. Slightly loosen the tank cap and let the air in the tank escape in the holes in the side of the cap. After pressure has been released, remove the cap from the tank. Using the funnel provided, put 100 pounds of flux in the tank. It is very important that only new or properly reclaimed flux be put in the tank. Coarse particles and/or magnetic particles will stop the flux feeding process. New Lincoln flux is properly screened at the factory. All reclaimed flux must be separately screened through a vibrating screen with 0.065 in. to 0.075 in. openings and be put through a magnetic separator. The K310 vibrated screen and K58 magnetic separator are available for this purpose. The screen in the funnel supplied with the tank has much larger openings and its only purpose is to keep paper and slag out of the tank.

There will always be a small amount of air and possible drops of water coming out of the end of the tube coiled under the tank. This is an automatic disposal system in case the plant air has water and dirt in it.

K310 FLUX SCREEN (OPTIONAL)

The unit was designed to fit the top of either the standard fill funnel or a K58 magnetic separator. The

unit has a steel screen with 0.065 to 0.075 in. openings and an air vibrator attached to the frame. The vibrator can be used with air line pressures ranging from 20 through 100 psi.

For ease of handling, the user should connect the incoming air line to the 1/8 in. pipe elbow with the aid of a quick disconnect type air coupling.

It is very important that reclaimed flux to be used in the continuous flux feeding system be passed through the K310 screen or its equivalent.

K58 MAGNETIC SEPARATOR (OPTIONAL)

The K58 is a permanent magnet type separator designed to fit the top of the standard fill funnel of the continuous flux feeding system.

The purpose of the separator is to remove magnetic materials such as mill scale and any other extraneous magnetic materials which may have been recovered along with the flux to be processed.

It is important to remove these magnetic particles from the flux which is to be used in the continuous flux feeding systems. If the magnetic material is not removed it will gather around the nozzle of the gun and impede or shut off the flux flow when making relatively long welds or welding continuously. The magnetic particles can also cause porosity in the weld.



B-16 NOTES

Return to Section TOC Return to Master TOC



TABLE OF CONTENTS - ACCESSORIES SECTION -

Accessories	Section C
General	C-2
Auxiliary Equipment Connection	C-3
K178-1 Mounting Platform	
K162H Spindle	C-3
K163 Undercarriage	
K419 Burnback Timer Kit	C-3
K418 GMA Timer Kit	C-4
K416 Analog Voltmeter Kit	C-4
K417 Digital Voltmeter Kit	C-4
K775 or K857 Remote Voltage Control Kit	C-4
K320 Flux Tank	
Wire Reel Dust Shield for K376 50 to 60 Lb Wire Reel	
Mounting Stand	C-5
Wire Reel Dust Shield Door for K303 and K376	C-5
K377 Small Mounting Stand for Readi-Reel Coils	
or 10 to 30 lb Spools with 2 in. I.D	C-5
K378 Small Mounting Stand for 13 to 14 Lb Innershield Coils	C-5
K292 Power Input Extension Cable (600 Amps)	C-5
Power Input Cables	C-5
K291 Input Cable	C-5
K404 Input Cable	C-5
K480 Input Cable	C-6
K584 and K594 Input Cables	
Welding Guns	
Innershield Guns	C-6
Submerged Arc Guns	C-7
GMAW Guns	
K527 Water Solenoid Kit	
K376 and K303 50-60 lb Wire Reel Mounting Stands	
Attaching the Wire Reel Stand	C-7



Return to Master TOC

GENERAL

The following is a list of the accessories that can be used with the LN-7 GMA wire feeder.

A detailed description of each item is given later in this section.

TABLE C.1 - LN-7 GMA ACCESSORIES.

ACCESSORIES

Product Number	Name
K178-1	Mounting platform
K162H	High capacity spindle
K163	Undercarriage
K419	Burnback timer kit
K418	GMA Timer Kit
K416	Analog voltmeter kit
K417	Digital voltmeter kit
K775/K857	Remote voltage control kit
K320	Flux tank
K376/K303	50-60 lb Wire reel mounting stand
S-14543	Wire reel dust shield for K376
M-11514	Wire reel dust shield door for K303/K376
K377	Mounting stand for Readi-Reels and 10-30 lb spools
K378	Mounting stand for 13-14 lb Innershield coils
K292	Power input extension cables
K291	Power input cable - 600 Amps
K404	Power input cable - 350 Amps
K480	Power input cable - 400 Amps
K126	Innershield welding gun - 350 Amps
K115	Innershield welding gun - 450 Amps
K112	Submerged arc welding gun - 500 Amps
K113	Submerged arc welding gun - 600 Amps
K497	Magnum GMA welding gun - 200 Amps*
K470	Magnum GMA welding gun - 300 Amps*
K471	Magnum GMA welding gun - 400 Amps*
K527	Water solenoid kit

^{*} Magnum GMA welding guns require a K466-1 connector for use with the LN-7 GMA wire feeder.



AUXILIARY EQUIPMENT CONNECTION

The LN-7 GMA has the factory installed gas solenoid valve leads attached to terminals 7 and 32A. Additional auxiliary equipment connection is not recommended. If the gas solenoid is NOT connected to terminals 7 and 32A, other auxiliary equipment may be connected but the current draw must NOT exceed 1/4 ampere.

A CAUTION

Do not connect the power source contactor to these terminals.

NOTE: The auxiliary equipment contacts open when the trigger is released. When the optional K418 GMA Timer Kit is installed, the auxiliary contacts open after the postflow time delay.

K178-1 MOUNTING **PLATFORM**

This is a turntable type platform for mounting the LN-7 GMA to the top of Idealarc power sources. Bolt the platform to the lift bail per the instructions (M16260) supplied with the platform.

K162H SPINDLE

The K162H spindle is used for mounting Readi-Reels and 2 in. I.D. spools with a 60 lb capacity on a K303 or K376 Wire Reel Stand. When used with Read-Reels, a Read-Reel Adapter is required. For 8 in. O.D. spools, a K468 Spindle Adapter is available.

The K162H is a high capacity design which replaces the original K162 30 lb spindle. The K162H spindle has a white spacer and has part no. M-14587-1 molded on. The original K162 spindle has a black spacer and the part no. M14587. Parts may not be exchanged from one design to the other.

WARNING

Do not use coils or spools heavier than 30 lbs on the original K162 spindle.

To mount the 2 in. spindle kit for Readi-Reels and 10 through 60 lb spools, remove the shaft for the standard 50-60 pound wire coils from the mounting framework. Install the spindle per the instructions (M15241) shipped with the spindle kit.

K163 UNDERCARRIAGE

The undercarriage includes casters, wheels, a handle, and related hardware. Casters are mounted at the front and wheels at the rear of the platform. The handle is bolted to the front of the platform so the wire feeder can be tilted back and wheeled like a two-wheel truck. Installation sheet M13424 is provided with the undercarriage.

K419 BURNBACK TIMER KIT

The kit is available for those applications where the LN-7 GMA is used for higher speed, fine wire feeding (0.023 in. to 0.045 in. wire sizes) where there is a tendency for the electrode to overrun at the end of the weld causing "sticking" in the crater. The kit provides a precise time delay that allows the wire to be burned off at the end of the weld. The delay is adjustable for optimum burnback depending on wire size, process, procedure, etc. This kit also includes a cold inch switch.

The K419 Burnback Kit is also useful for those installations where the gun is clamped in a fixture and cannot be lifted from the work at the end of the weld.

Installation and operation instructions (M15060) are included with the kit.



Return to Master

K418 GMA TIMER KIT

This kit is available to provide the following functions:

- 1. Preflow Control Provides flow of shielding gas to the work before the arc is established. The solenoid valve is energized immediately when the gun trigger is closed, but the time delay before the wire feeder is energized is adjustable to between 0 and 1.5 seconds.
- Postflow Control Provides flow of shielding gas to the work after welding is stopped. Solenoid valve shutoff delay after the trigger is released is adjustable from 0.5 to 4.5 seconds.
- Burnback Control Provides a precise time delay that allows the wire to be burned off at the end of the weld. The delay is adjustable for optimum burnback depending on the wire size, process, procedure, etc.
- 4. Purge Cold Inch Switch Momentary Up position energizes the gas solenoid but not the wire feeder or welding power source. Momentary down position energizes the wire feeder but not the welding power source or the gas solenoid valve.

Installation and operation instructions (M15059) are included with the kit.

K416 ANALOG VOLTMETER KIT

Includes a 0 to 60 volt DC analog meter and a polarity switch. It mounts in the hinged wire drive section cover. Installation instructions (M15080) are included with the kit.

K417 DIGITAL VOLTMETER KIT

Includes a three digit LED display and a polarity switch. Also includes a hold feature

that freezes the display for approximately six seconds at the reading just prior to stopping welding. This feature allows the operator to easily check his procedure at the end of the weld and make adjustments if required. Installation instructions (M15080) are included with the kit.

K775 OR K857 REMOTE VOLTAGE CONTROL KIT

Either control installs on the side of the LN-7 GMA control box cover and gives voltage control at the wire feeder.

K775 can be installed on the LN-7 GMA when it is used with R3S, DC-250, DC-400, CV-400, OR DC-600 power sources. A control cable from the K775 attaches to the power source terminal strip. See the instructions (S14267) included with the kit.

K857 can be installed on the LN-7 GMA when it is used with newer Lincoln power sources such as the CV-300 with K856 remote kit installed. These power sources are equipped with a 6-socket ms-type receptacle for connection of the plug on the 28 ft (8.5 m) control cable of the K857. See the instructions (S19103) included with the kit.

A remote output is also available for use with SAM power sources. See the SAM Operating Manual.

K320 FLUX TANK

The K320 flux tank is available to permit the LN-7 GMA to be used for submerged arc welding.

Install per the instructions shipped with the kit.



WIRE REEL DUST SHIELD **FOR K376 50 TO 60 LB WIRE REEL MOUNTING STAND**

A shield is available to cover the wire and reel to protect the wire from falling dirt and dust. Order part no. S-14543. Instructions are provided with the kit.

WIRE REEL DUST SHIELD DOOR FOR K303 AND K376

In extremely dusty and dirty locations this door kit can be added to those units having the dust shield kit (S-14543). This door kit includes a hinged door and sliding bottom seal. When these parts are attached to the reel support per the instructions included, the unit becomes a completely enclosed housing. Order part no. M11514.

MOUNTING K377 SMALL **FOR READ-REEL** STAND COILS OR 10 TO 30 LB SPOOLS WITH 2 IN. I.D.

This assembly includes a wire reel spindle (similar to the K162 spindle) attached to a small frame. The unit is supplied with the K363 Readi-Reel Adapter for using the Lincoln "Readi-Reel Electrode Coils". Without the adapter the unit is capable of handling spools with a 2 in. I.D., a 12 in. maximum O.D., and a 4 in. width. For spools with an 8 in. O.D., a K468 spindle adapter is available. The spindle has an adjustable braking system. See Attaching the Wire Reel Stand procedure at the end of this section for installation procedures.

K378 SMALL MOUNTING STAND FOR 13 TO 14 LB INNERSHIELD COILS

This assembly includes the same smaller frame as used in the K377 and the fully enclosed canister system for dereeling of the 14 lb coil. This system has a fixed brake for the 14 lb coil. See Attaching the Wire Reel Stand Procedure at the end of this section for installation procedures.

K292 POWER INPUT EXTENSION CABLE (600 AMPS)

Can be used to a maximum of 400 ft (122 m).

See Input Cable Connections section in the Installation Section for a description of this cable.

POWER INPUT CABLES

A variety of power input cable assemblies are available for various current ratings and power source connection types. All provide a polarized control cable plug (MS-3106A-18-12S) and a lugged electrode cable for connection to the wire feeder.

K291 INPUT CABLE

The K291 input cable assembly consists of a six-conductor control cable and a 3/0 (85 mm²) electrode cable. It is rated at 600 amps, 60% duty cycle and is available in lengths of 10, 25, 50, 75, and 100 feet (3.0, 7.6, 15.2, 22.9, and 30.4 m).

K404 INPUT CABLE

The K404 input cable is similar to the K291 but includes a 1/0 (53 mm²) electrode cable. It is rated at 350 amps, 60% duty cycle. It is available in lengths of 10, 25, and 50 feet (3.0, 7.6, and 15.2 m). These control cables have lugged leads for power sources with stud output terminals and terminal strip control lead connections.



ACCESSORIES

K480 INPUT CABLE

The K480 input cable includes a 2/0 (67 mm²) weld cable with a Twist-Mate™ connector and a 14-pin (MS-3106A-20-27PX) plug to be compatible with the smaller Lincoln power sources (such as the CV-300). The K480 is rated at 400 amps, 60% duty cycle and is available in 10, 25, and 50 foot (3.0, 7.6, and 15.2 m) lengths.

K584 AND K594 INPUT CABLES


The K584 input cable includes a 1/0 (53 mm²) electrode cable rated at 350 amps, 60% duty cycle, and the K594 input cable includes a 3/0 (85 mm²) electrode cable rated at 600 amps, 60% duty cycle. Both are for power sources with stud output terminals and a 14-pin control receptacle, and are available in 10, 25, and 50 foot (3.0, 7.6, and 15.2 m) lengths.

WELDING GUNS

INNERSHIELD GUNS

The K126 gun and cable assembly is recommended for most welding with 0.062 in. through 3/32 in. Innershield electrodes at up to 350 amps. Install the insulated nozzle extension (or thread protector) and the nozzle contact tip for the stickout and electrode size being used. (See Figure C.1.)

FIGURE C.1 - THE K126 GUN.

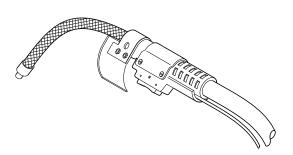



For heavy duty welding at up to 450 amps and with 0.068 in. through 3/32 in. Innershield electrode, use an appropriate K115 or K115-45 gun and cable assembly (See Figure C.2). Install the proper insulated nozzle extension and contact tip for the stickout and electrode size being used.

For welding with 7/64 in. Innershield electrode, use a K115-3/32 with an M11474-120 nozzle or a K115-45-3/32 with an M11510-120 nozzle. Also install a 7/64 in. contact tip and install the insulated nozzle extension for the stickout being used.

NOTE: Linconditioner™ are guns recommended for locations where smoke accumulation is a problem and conventional exhaust systems are ineffective. The available smoke removal type Innershield guns and vacuum units can be used in these locations. Instructions are shipped with the equipment.

FIGURE C.2 - THE K115 AND K115-45 GUNS.

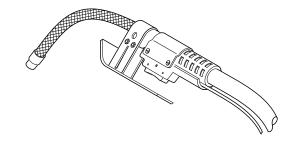

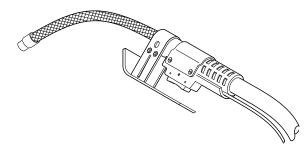



SUBMERGED ARC GUNS

The K112 gun and cable assembly is recommended for welding with 1/16 in. solid steel electrode at up to 500 amps. The K113 gun and cable is recommended for 5/64 in. and 3/32 in. (2.0 and 2.4 mm) solid steel electrodes (types L50, L60, L61, and L70) for use up to 600 amps.

GMAW GUNS

An expanding line of Magnum GMA gun and cable assemblies are available to allow welding with solid and cored electrodes using the GMAW process. See the appropriate Magnum literature for descriptions of the 100-500 ampere air cooled gun and cables that are available. Gun cable lengths range from 10 to 25 ft. (3.0 to 7.5 m) and feed electrode sizes 0.023 in. to 3/32 in. (0.6 to 2.4 mm).

NOTE: Magnum GMA welding guns require a K466-1 connector for use with an LN-7 GMA wire feeder.

K527 WATER SOLENOID KIT

Install and connect per the instructions (M16261) shipped with the kit.

This kit is factory installed on the K440-1 LN-7 GMA.

K376 AND K303 50 TO 60 LB WIRE REEL MOUNTING STANDS

The K376 50 to 60 lb Wire Reel Mounting Stand and the K303 Wire Reel Mounting Stand are the same with the exception that the K303 stand includes a dust shield. The assembly includes a framework to which is attached the 50 to 60 lb wire reel, a mounting spindle, a lift bale, and a cable clamp for fastening the input cable assembly. It is easily mounted to the basic wire feed unit by following the Attaching the Wire Reel Stand procedure at the end of this section.

ATTACHING THE WIRE REEL STAND

The mounting hardware for mounting the stands is included with the LN-7 GMA. Screws and washers are inserted in their respective mounting holes. To connect:

- Remove the three 3/8 in. hex head bolts from the back of the wire feed unit.
- Place the wire reel mounting stand mounting bracket in position against the back of the wire feed unit.
- 3. Replace and tighten the hex head bolts. The long screw and plain washer go into the top hole.



C-8 NOTES

Return to Section TOC Return to Master TOC



TABLE OF CONTENTS - MAINTENANCE SECTION -

Maintenance	Section D
Routine Maintenance	D-2
Drive Rolls and Guide Tubes	D-2
Wire Reel Mounting	D-2
Periodic Maintenance	D-2
Wire Drive Motor and Gearbox	D-2
Gun and Cable Maintenance	D-2



Return to Section TOC

TOC

Return to Master

Return to Master TOC

MAINTENANCE

ROUTINE MAINTENANCE

DRIVE ROLLS AND GUIDE TUBES

After feeding every coil of wire, inspect the drive roll section. Clean the assembly as necessary. Do not use solvent to clean the drive roll assembly as it may wash the lubricant out of the bearings. The drive rolls and guide tubes are stamped with the wire sizes they will feed. If a wire size other than that stamped on the rolls is to be used, the rolls and guide tubes must be changed.

The drive rolls for 0.045 and 0.052 cored electrode and 1/16, 0.068, 5/64, 3/32, and 7/64 electrode have a double set of teeth so they can be reversed for additional life. Between the two knurled rolls (except 1/16 and smaller rolls) is a shim washer which limits the damage to the electrode if wire feeding problems occur. Drive rolls for 0.023 through 0.052 solid electrodes have no teeth.

Refer to the instructions included with the drive roll kit for installation and replacement of the drive rolls on the wire feeder.

WIRE REEL MOUNTING

To prolong the life of the reel shaft on the 50 to 60 lb coils, periodically coat it with a thin layer of grease. No maintenance to the two position brake is required. If the brake shoe wears through to metal, replace the brake assembly.

No routine maintenance is required for Readi-Reels and 10 to 30 lb spools. Do not lubricate the 2 in. spindles.

PERIODIC MAINTENANCE

WIRE DRIVE MOTOR AND **GEARBOX**

Every year inspect the gearbox and coat the gear teeth with a moly-disulfide filled grease. Do not use graphite grease.

Every six months check the motor brushes. Replace them if they are less than 1/4 in. long.

GUN AND CABLE MAINTENANCE

For instructions on periodic maintenance for the welding gun and cables, refer to the manual for your specific model of welding gun.



TABLE OF CONTENTS - THEORY OF OPERATION SECTION -

Theory of Operation	Section E
General	E-2
Control Circuit Operation	E-2
Power Input Circuits	E-2
Trigger Circuit	
Control Relay Circuit	
Auxiliary Circuits	E-5
Protective Circuits	E-6
Overload Protection	E-6
Current Limiting Circuit	E-6
Ground Lead Protection	
SCR Operation	E-7



Master

Return to


TOC Return to Master

THEORY OF OPERATION

GENERAL

The LN-7 GMA wire feeder is available in two versions, a two-roll and a four-roll wire feeder. The operation of the two versions is virtually identical. The following description of the operation of the wire feeders applies equally to both versions of the LN-7 GMA.

FIGURE E.1 – INPUT LINE VOLTAGE AND TRIGGER TRANSFORMER.

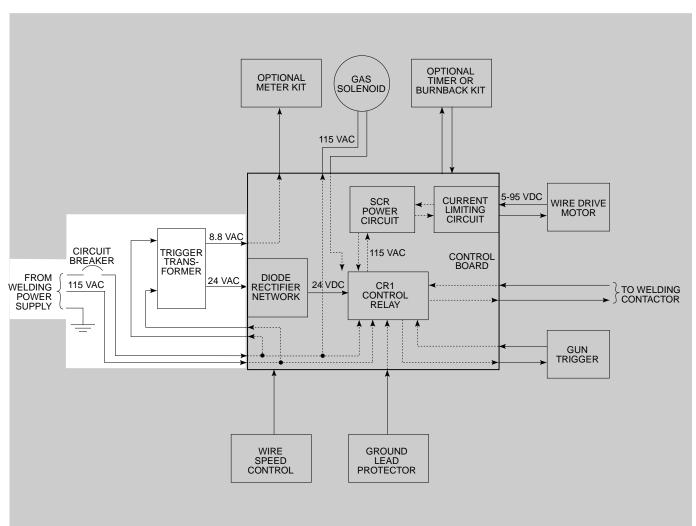

CONTROL CIRCUIT **OPERATION**

POWER INPUT CIRCUITS

The LN-7 GMA receives 115 VAC power from the welding supply. This power is

applied to the trigger transformer which reduces the voltage for use by the LN-7 electronics. The voltages produced are 24 VAC, used by the electronics and the trigger circuit, and 8.8, VAC used by the optional digital meter kit. The 115 VAC input power is also sent to the SCR circuitry which powers the wire feed motor. See Figure E.1.




Return to Master

TOC

Return to Master

FIGURE E.2 - TRIGGER CIRCUIT.

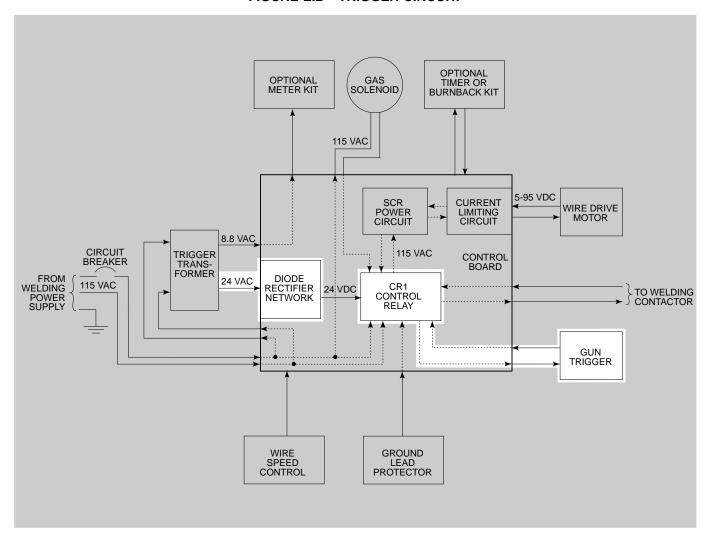

TRIGGER CIRCUIT

The 24 VAC output of the trigger transformer is sent to the control PC board and rectified by a diode network. When the gun trigger is pulled, a circuit is closed which energizes the control relay. The three sets of contacts in the relay close and energize the multiple functions of the wire feeder. See Figure E.2.




Master

Return to

THEORY OF OPERATION

FIGURE E.3 – CONTROL CIRCUITS.

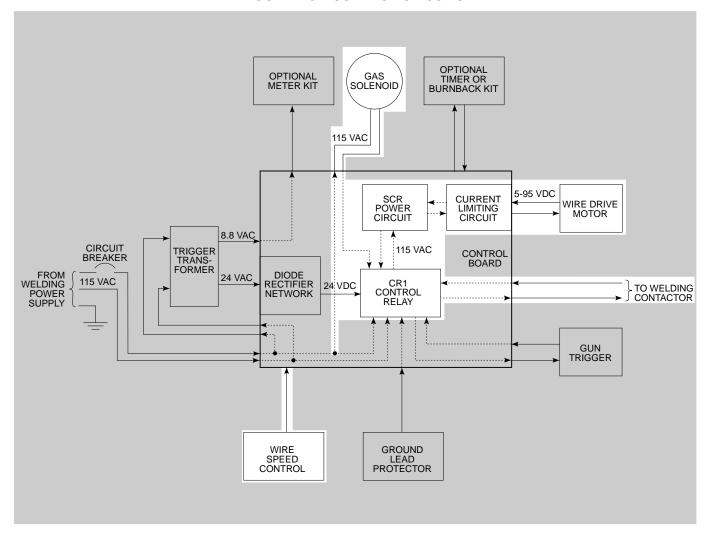

CONTROL RELAY CIRCUIT

The first contact closes to allow 115 VAC to energize the gas solenoid. This allows shielding gas to flow to the gun. The second contact of the control relay closes the circuit in the welding power source contactor circuit. This signals the welding power source to provide power to the gun. The last set of contacts on the control relay disables the motor dynamic braking circuit and closes the motor power supply circuit. See Figure E.3.

When the control relay closes the motor contacts, the SCR power circuit supplies a DC voltage to the wire drive motor. This voltage is dependent on the setting of the

wire speed control. The faster the speed setting, the higher the voltage that is applied to the wire drive motor. The gearbox transfers the power of the rotating motor to the drive roll. On a four-roll wire feeder, the gearbox also splits the drive power to two separate drive rolls.

When the trigger is released, the control relay is de-energized. This opens the contacts which de-energize the gas solenoid, open the welding power source contactor circuit, and stop the wire drive motor. The dynamic braking circuit engages to rapidly stop the wire drive motor and prevent wire overrun.




Master

Return to

TOC

Return to Master

FIGURE E.4 – AUXILIARY CIRCUITS.

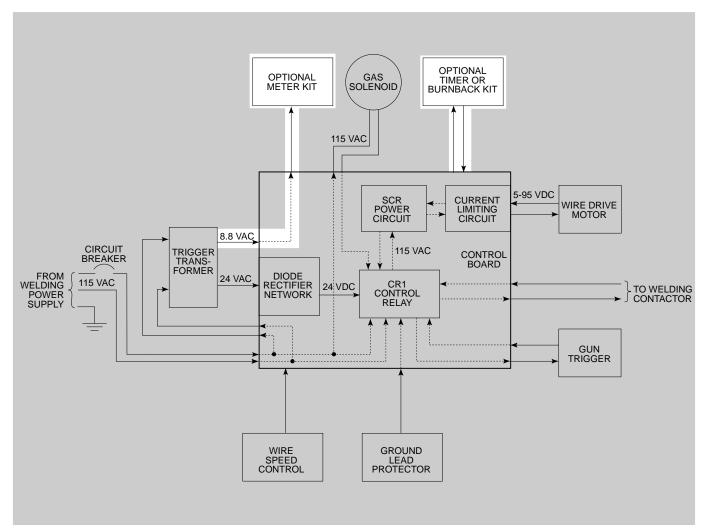

AUXILIARY CIRCUITS

TIMER KITS

The optional GMA Timer and Burnback kits can be added to provide time delays for these functions. Both kits provide a burnback control which maintains the welding power source contacts closed for a short time after the trigger is released. The timer kit also has controls which can provide a gas preflow and postflow by controlling the timing of the gas solenoid. See Figure E.4.


METER KITS

The optional meter kit indicates the welding voltage from the electrode to the work. This voltage is measured from the contact block in the wire drive compartment to the work. While the analog meter kit does not require any additional power, the digital meter kit is powered by an 8.8 VAC signal from the trigger transformer. See Figure E.4.



Return to Master

FIGURE E.5 - PROTECTIVE CIRCUITS.

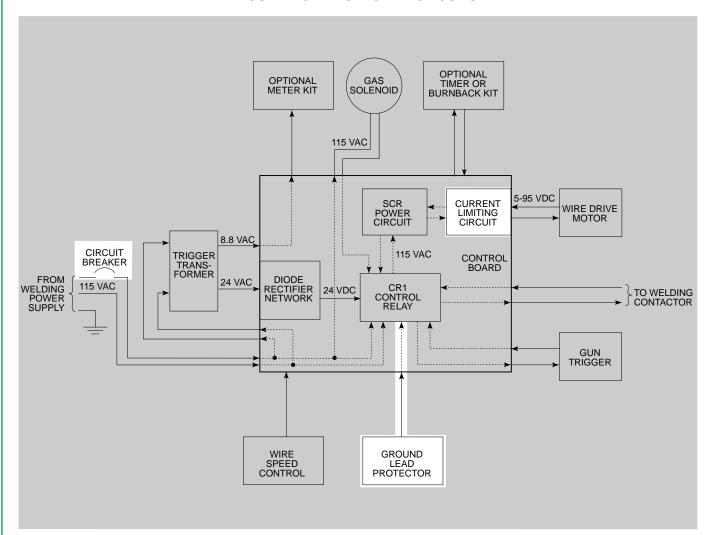

PROTECTIVE CIRCUITS

Protective circuits are designed in to the LN-7 GMA to detect trouble and shut down the wire feeder before any damage to the feeder can result. The wire feeder contains overload protection for the entire machine, a current limiting circuit for the feed motor, and a ground lead protection circuit.

OVERLOAD PROTECTION

The wire feeder is equipped with a circuit breaker in the 115 Vac input power circuit to protect the feeder in the event of an electrical fault. Refer to Figure E.5. If the feeder draws more than 2.5A, the circuit breaker will trip to prevent any damage to the wire feeder.

CURRENT LIMITING CIRCUIT

The current limiting circuit limits the current that is sent to the feed motor. A precision resistor in line with the feed motor produces a voltage drop that is directly proportional to the current draw of the motor. If the signal exceeds 10VDC, which equates to a 10A draw from the feed motor, the current limiter sends a signal to the SCR power circuit to limit feed motor current to 10A. Refer to Figure E.5.



GROUND LEAD PROTECTION

The Ground Lead Protector (GLP) circuit protects the ground lead that connects the wire feeder to the welding power source. When the circuit detects any current flow in the ground lead, a contact closes in the control circuit which de-energizes the control relay. Refer to Figure E.5. This opens the circuit for the welding relay in the welding power supply to remove power from the welding gun, shuts the gas and water solenoids, and stops the wire feed motor. The GLP circuit remains in this tripped state until the reset button on the wire feeder is pressed, or power is removed from the wire feeder.

SCR OPERATION


Since the wire speed of the LN-7GMA is controlled by SCR circuitry, a basic understanding of how an SCR functions is important. Refer to Figure E.6 and the following explanation. A silicon controlled rectifier (SCR) is a three terminal semiconductor device used to control currents to a load. An SCR acts very much like a switch. When a gate signal is applied to the SCR it is turned on and there is current flow from anode to cathode. In the on state the SCR acts like a closed switch. When the SCR is turned off there is no current flow, thus the device acts like an open switch. As the name

suggests, the SCR is a rectifier, so it passes current only during positive half cycles of the AC supply, The positive half cycle is the portion of the sine wave in which the anode of the SCR is more positive than the cathode.

When an AC supply voltage is applied to the SCR, the device spends a certain portion of the AC cycle time in the on state and the remainder of the time in the off state. The amount of time spent in the on state is controlled by the gate.

An SCR is fired by a short burst of current into the gate. This gate pulse must be more positive than the cathode voltage. Since there is a standard pn junction between the gate and cathode, the voltage between these terminals must be slightly greater than 0.6 VDC. Once the SCR has fired it is not necessary to continue the flow of gate current. As long as current continues to flow from anode to cathode the SCR will remain on. When the anode to cathode current drops below a minimum value, called holding current, the SCR will shut off. This normally occurs as the AC supply voltage passes through zero into the negative portion of the sine wave. If the SCR is turned on early in the positive half cycle, the conduction time is longer, resulting in greater SCR output. If the gate firing time is later in the cycle the conduction time is less, resulting in lower SCR output.

FIGURE E.6 - SILICON-CONTROLLED RECTIFIER OPERATION.

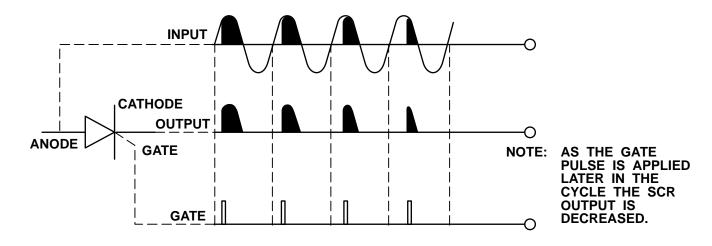



Return to Section TOC Return to Master TOC





TABLE OF CONTENTS - TROUBLESHOOTING AND REPAIR SECTION -

Troubleshooting And Repair	Section F
How To Use Troubleshooting Guide	F-2
PC Board Troubleshooting Procedures	F-3
Troubleshooting Guide	F-4
Test Procedures	F-12
Control Relay Test	F-12
Trigger Transformer Test	F-14
Control Cable Continuity Test	F-16
Component Replacement Procedures	F-18
Wire Feed Speed Potentiometer Replacement	F-18
Circuit Breaker Replacement	F-21
Ground Lead Protector Push Button Switch Replacement	F-23
Trigger Transformer Replacement	F-25
Ground Lead Protector Reed Switch Replacement	F-27
Control PC Board Replacement	F-29
Main Power Resistor (R ₁) Replacement	F-32
Control Relay Replacement	F-35
Wire Drive Assembly and Components Replacement	F-37
Swing Arm Assembly Replacement for Two-Roll Wire Feeders	F-41
Swing Arm Assembly Replacement for Four-Roll Wire Feeders	F-44
Gas Solenoid and Connections Replacement	F-47
Retest After Repair	F-50

M WARNING



ELECTRIC SHOCK can kill.

 Never work on the inside of the machine without turning off the input power. You can receive a life threatening electrical shock if you fail to do this. Only qualified technicians should perform installation, maintenance, and troubleshooting work on the machine.



Return to Master

TOC

Return to Master

How To Use Troubleshooting Guide

WARNING

Service and Repair should only be performed by Lincoln Electric Factory Trained Personnel. Unauthorized repairs performed on this equipment may result in danger to the technician and machine operator and will invalidate your factory warranty. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed throughout this manual.

This Troubleshooting Guide is provided to help you locate and repair possible machine malfunctions. Simply follow the three step procedure below.

Step 1. LOCATE PROBLEM (SYMPTOM). Look under the column labeled "PROBLEM (SYMPTOMS)". This column describes possible symptoms that the machinery may exhibit. Find the listing that best describes the symptom that the machine is exhibiting. Symptoms are grouped according to: functional problems and wire feeding problems.

Step 2. PERFORM EXTERNAL TESTS. The second column labeled "POSSIBLE AREAS OF MISADJUSTMENT(S)" lists the obvious external possibilities that may contribute to the machine symptom. Perform these tests/checks in the order listed. In general, these tests can be conducted without removing the case wrap-around cover.

Step 3. PERFORM COMPONENT TESTS. The last column labeled "RECOMMENDED COURSE OF ACTION" lists the most likely components that may have failed in your machine. It also specifies the appropriate test procedure to verify that the subject component is either bad or good. If there are a number of possible components, check the components in the order listed to eliminate one possibility at a time until you locate the cause of your problem.

All the necessary test specifications and repair procedures are described in detail following the troubleshooting guide. All electrical test points, terminal strips, junctions, etc., can be found on the electrical wiring diagrams and schematics in the Electrical Diagram Section.

A CAUTION



Return to Master TOC

PC BOARD TROUBLESHOOTING PROCEDURES

WARNING



ELECTRIC SHOCK can kill.

Have electrician install and service this equipment. Turn input power OFF at the

fuse box before working on equipment. Do not touch electrically hot parts.

A CAUTION

Sometimes machine failures appear to be due to PC board failures. These problems can sometimes be traced to poor electrical connections. To avoid problems when troubleshooting and replacing PC boards, please use the following procedure:

- 1. Determine to the best of your technical ability that the PC board is the most likely component causing the failure symptom.
- 2. Check for loose connections at the PC board to assure that the PC board is properly connected.
- 3. If the problem persists, replace the suspect PC board using standard practices to avoid static electrical damage and electrical shock. Read the warning inside the static resistant bag and perform the following procedures:



ATTENTION Static-Sensitive **Devices** Handle only at Static-Safe Workstations

Reusable Container Do Not Destroy

P.C. Board can be damaged by static electricity.

- Remove your body's static charge before opening the staticshielding bag. Wear an anti-static wrist strap. For safety, use a 1 Meg ohm resistive cord connected to a grounded part of the equipment frame.
- If you don't have a wrist strap, touch an unpainted, grounded, part

of the equipment frame. Keep touching the frame to prevent static build-up. Be sure not to touch any electrically live parts at the same time.

- Tools which come in contact with the P.C. Board must be either conductive, anti-static or static-dissipative.
- Remove the P.C. Board from the staticshielding bag and place it directly into the equipment. Don't set the P.C. Board on or near paper, plastic or cloth which could have a static charge. If the P.C. Board can't be installed immediately, put it back in the staticshielding bag.
- If the P.C. Board uses protective shorting jumpers, don't remove them until installation is complete.
- If you return a P.C. Board to The Lincoln Electric Company for credit, it must be in the static-shielding bag. This will prevent further damage and allow proper failure analysis.
 - 4. Test the machine to determine if the failure symptom has been corrected by the replacement PC board.

NOTE: It is desirable to have a spare (known good) PC board available for PC board troubleshooting.

NOTE: Allow the machine to heat up so that all electrical components can reach their operating temperature.

- Remove the replacement PC board and substitute it with the original PC board to recreate the original problem.
 - a. If the original problem does not reappear by substituting the original board, then the PC board was not the problem. Continue to look for bad connections in the control wiring harness, junction blocks, and terminal strips.
 - b. If the original problem is recreated by the substitution of the original board, then the PC board was the problem. Reinstall the replacement PC board and test the machine.
- 6. Always indicate that this procedure was followed when warranty reports are to be submitted.

NOTE: Following this procedure and writing on the warranty report, "INSTALLED AND SWITCHED PC BOARDS TO VERIFY PROBLEM," will help avoid denial of legitimate PC board warranty claims.



Troubleshooting Guide – See Wiring Diagrams for location of specified components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
	FUNCTIONAL PROBLEMS	
Major physical or electrical damage is present.	Contact Lincoln Electric Service Department (216-383-2531) or 1-800-833-9353 (WELD).	
When gun trigger is pulled there is no wire feed, no gas flow, and no arc voltage from power source.	 Make sure power source is on and supplying 115 VAC to the wire feeder. Check the 2.5 Amp circuit breaker. Reset if tripped. Check the Ground Lead Protector - reset if necessary. Check the gun trigger circuit. The control cable may be faulty. Repair or replace. If a burnback or timer kit is used, unplug J104 from the control PC board and install the jumper plug. See wiring diagram. If the problem is solved then the timer or burnback kit may be defective. 	 Check for the presence of 115 VAC at the input control cable receptacle. Pin "D" (#31) to Pin "C" (#32). Test the R1 resistor. 2 Ohms - 25 Watts. Perform the Control Relay Test. Perform the Trigger Transformer Test. Check leads #524 and #525 for continuity (zero Ohms) from the gun control cable receptacle to the control board plug J102.

A CAUTION



Troubleshooting Guide — See Wiring Diagrams for location of specified components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
FUNCTIONAL PROBLEMS (Continued)		
When the gun trigger is pulled there is no wire feed, but gas flows and arc voltage is present.	 Check to see if the motor drive rolls are turning when the gun trigger is pulled. If the drive rolls are turning then check for clogged gun liner or a mechanical restriction in the wire feeding path. If the drive rolls do not turn when the gun trigger is pulled then contact your Local Lincoln Authorized Field Service Shop. 	 With the trigger activated check for the presence of drive motor armature voltage. 5 to 95 VDC at leads #539 to #541. Note: The armature voltage will be dependent on the wire speed setting. If the correct armature voltage IS present at leads #539 and #541 and the drive motor is NOT turning, then the drive motor may be defective. Also check the brushes in the drive motor; replace if less than 1/4 in. in length. If the correct armature voltage is NOT present at leads #539 and #541 then the CR1 control relay may be defective. Replace per Control Relay Replacement procedure. If the armature voltage is not restored then the control PC board may be defective. Replace per Control PC Board Replacement procedure.

A CAUTION



Return to Master

Troubleshooting Guide — See Wiring Diagrams for location of specified components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)

POSSIBLE AREAS OF MISADJUSTMENT(S)

RECOMMENDED COURSE OF ACTION

FUNCTIONAL PROBLEMS (Continued)

When the gun trigger is pulled the wire feeds, the gas flows, but there is NO arc voltage. (The wire does not arc on the work piece.)

- Check the welding cable for loose or faulty connections.
- Check or replace the gun.
- 3. If a burnback or timer kit is used, unplug J104 from the control PC board and install the jumper plug. See wiring diagram. If the problem is solved then the timer or burnback kit may be defective.
- 4. Check to see if OCV (open circuit voltage) is present at the power source welding output terminals. If the OCV IS present at the power source output terminals then the problem is external to the power source. (The problem is in the welding cables, wire feeder, or gun.)
- 5. If the OCV is NOT present at the power source output terminal then contact your Local Lincoln Authorized Field Service Facility.

- 1. Jumper the trigger leads at the power source. (Either #2 to #4 if on a terminal strip, or "C" to "D" if on a 14 pin amphenol type connector.) If the power source produces the correct open circuit voltage then the power source is functioning correctly. (The problem is with the control cable, the wire feeder, the welding cables, or the gun.) If the power source does not produce OCV, then the power source is faulty.
- The F101 fuse in the wire feeder may be faulty. Test or replace.
- 3. Perform the Control Cable Continuity Test.
- 4. Perform the Control Relay Test.
- 5. Check the continuity of leads #2 and #4 from the control cable receptacle to the control board plug J101. See wiring diagram.
- 6. The control PC board may be faulty. Replace per Control PC Board Replacement procedure.

CAUTION



Return to Master TOC

Troubleshooting Guide — See Wiring Diagrams for location of specified components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
FUN	CTIONAL PROBLEMS (Contin	ued)
When the gun trigger is pulled there IS wire feed and arc voltage but there is NOT any gas flow.	 Check the shielding gas source for proper connections and pressures. Check for kinked or loose gas hose connections. If a timer kit is used, unplug J104 from the control PC board and install the jumper plug. See wiring diagram. If the problem is solved then the timer kit may be defective. 	 When the gun trigger is pulled check for the presence of 115 VAC at leads #7 and #32A. If 115 VAC is present and the gas solenoid does not activate then the solenoid may be defective. Replace per Gas Solenoid and Connections Replacement procedure. If the 115 VAC is NOT present at #7 and #32A then perform the Control Relay Test. The control board may be faulty. Replace per the Control PC Board Replacement procedure.
Meter kit does not function.	 Ensure lead #567 is connected to the conductor block in the wire drive compartment. Check lead #21 for proper connection. See Connection Diagrams in the Installation Section. 	 Check meter kit cable connector in the control box for a tight connection. For digital meter kit: ensure wires #508 and #509 are connected on the control PC board. Perform the Trigger Transformer Test.

A CAUTION



Return to Master TOC

Troubleshooting Guide - See Wiring Diagrams for location of specified

components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
FUN	CTIONAL PROBLEMS (Contin	ued)
Wire feed speed adjustment is rough. Works only at certain portions of the speed range.	 Ensure setscrew on the potentiometer knob is tight. Check for a clogged gun liner or a mechanical restriction in the wire feeding path. 	 Check the resistance of the potentiometer over the entire range of travel. The potentiometer should adjust from 0 to 10K Ohms. If adjustment is not smooth and linear, replace per Wire Feed Speed Potentiometer Replacement procedure. The motor or motor brushes may be faulty. Check the motor brushes length, and replace them if they are less than 1/4 in
		them if they are less than 1/4 in. in length.
Ground Lead Protector circuit tripping.	 Ensure all work lead connections to the work make tight metal-to-metal contact. Ensure that excess work and input cables are stored more than 3 ft (1 m) from the wire feeder. Is input cable coiled next to the work cable? Uncoil and loop back and forth in 3 to 6 ft (1 to 2 m) straight lengths to eliminate the coil. 	Check for grounded leads in the wiring harness. Pay particular attention to the leads connecting the input cable connector (J101) to the Control PC board. See Wiring Diagrams in the Electrical Diagrams Section.

TROUBLESHOOTING AND REPAIR

A CAUTION



Return to Master TOC

Troubleshooting Guide — See Wiring Diagrams for location of specified components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
FUN	CTIONAL PROBLEMS (Contin	ued)
Wire feeder circuit breaker tripping when the gun trigger is pulled.	Check for jammed wire or "birdsnest" inside wire drive compartment.	Check the current draw for the wire feed motor. Insert a DC ammeter in series with lead #539 or #541 and the control PC board.
		2. If current draw IS excessive, greater than 2 Amps, check for rough turning gearbox by turning by hand. If gearbox turns roughly or grinds, replace per Wire Drive Assembly and Component Replacement procedure.
		If the gearbox is OK and the motor current draw IS excessive, then the motor or motor brushes may be defective. Check or replace.
		4. If motor current draw is NOT excessive, disconnect gas solenoid leads from control PC board terminals #7 and #32A. If circuit breaker no longer trips, solenoid may be defective. Replace solenoid per Gas Solenoid and Connections Replacement Procedure.
		The Control PC Board may be faulty. Replace the Control PC Board.

A CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact the Lincoln Electric Service Department for technical troubleshooting assistance before you proceed. Call 216-383-2531 or 1-800-833-9353.



Return to Master TOC

Return to Master TOC

TROUBLESHOOTING AND REPAIR

Troubleshooting Guide - See Wiring Diagrams for location of specified components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
WIRE F	FEEDING AND WELDING PRO	BLEMS
Wire feeding rough or not feeding, but drive rolls turning.	 Check for kinked or twisted gun cable. Check for jammed wire in gun or cable. Check for worn nozzle or flashed or melted contact tip. 	 Check for correct size and installation of drive rolls and guide tubes. Refer to the Operation Section - Drive Roll Installation for correct drive roll and guide tube installation. Check idle roll pressure, brake tension, and drive roll cleanliness. Set drive roll tension per Operation Section - Idle Roll Pressure Setting.
Variable or "hunting" arc.	 Check for worn or melted contact tip. Inspect for worn work cable, poor work connection, or loose electrodes. Is electrode polarity correct? Check for rusty electrode wire. Check power source for proper operation. 	Possible problem with the weld procedure. Contact Lincoln Electric at 216-383-2531 or 1-800-833-9353.
Weld bead is narrow or ropey. May have porosity with electrode stubbing into plate.	 Make sure the weld procedure and electrode polarity is correct for the process being used. Make sure shielding gas is correct and flow is proper. Make sure the weld joint is not "contaminated". 	The welding power source may be faulty. Check or replace.

A CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact the Lincoln Electric Service Department for technical troubleshooting assistance before you proceed. Call 216-383-2531 or 1-800-833-9353.



Return to Master TOC

Troubleshooting Guide — See Wiring Diagrams for location of specified components. See Wiring Diagrams for troubleshooting of specific circuits.

Observe Safety Guidelines detailed in the beginning of this manual.

PROBLEMS (SYMPTOMS)	POSSIBLE AREAS OF MISADJUSTMENT(S)	RECOMMENDED COURSE OF ACTION
WIRE FEEDIN	NG AND WELDING PROBLEMS	(Continued)
The wire feeds but starts and stops intermittently.	 The gun trigger may be faulty. Check or replace. Check for mechanical restrictions in the wire feed path. 	 The drive motor brushes may be faulty. Check and replace if less than 1/4 in. in length. The wire feed speed potentiometer may be faulty. Check the resistance of the potentiometer over the entire range of travel. The potentiometer should adjust from 0 to 10K Ohms. If adjustment is not smooth and linear, replace per Wire Feed Speed Potentiometer Replacement procedure. The Control PC Board may be faulty. Replace.

A CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact the Lincoln Electric Service Department for technical troubleshooting assistance before you proceed. Call 216-383-2531 or 1-800-833-9353.



TOC

Return to Master

TOC

Return to Master

TEST PROCEDURES

WARNING

TROUBLESHOOTING AND REPAIR

CONTROL RELAY TEST

Service and repair should only be performed by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric service department for technical troubleshooting assistance before you proceed. Call 216-383-2531 or 1-800-833-9353(WELD).

TEST DESCRIPTION

This test will determine if the control relay is functioning properly by measuring resistance across the contacts when the relay is energized and de-energized.

MATERIALS NEEDED

24 VDC power supply Volt/Ohmmeter (Multimeter) Table of Control Relay Contact Positions (Table F.1)




Return to Master TOC

Return to Master TOC

CONTROL RELAY TEST (continued)

FIGURE F.1 - CONTROL RELAY TEST POINTS.

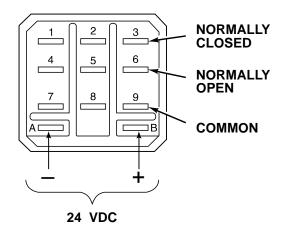

TEST PROCEDURE

- Remove the control relay from the control box per the Control Relay Replacement procedure.
- 2. Connect a 24 VDC supply to terminals A and B on the control relay. See Figure F.1. Do not energize the power supply at this time.
- Connect a multimeter across the first set of terminals shown in the table below.

TABLE F.1 – CONTROL RELAY CONTACT POSITIONS.

Terminals	Terminals A&B Energized	Terminals A&B De-energized
7-1	Open	Closed
7-4	Closed	Open
8-2	Open	Closed
8-5	Closed	Open
9-3	Open	Closed
9-6	Closed	Open

- 4. Measure resistance across the contacts. A resistance of less than one Ohm indicates that the contacts are closed. An infinite resistance indicates that the contacts are open. Energize the 24 VDC power supply and measure the resistance again. Compare to the values given in the table for a good relay. If the readings do not match the table, the relay is faulty and should be replaced.
- 5. De-energize the 24 VDC power supply and connect the multimeter to the next set of contacts in the table. Repeat step 4 for all sets of contacts listed.
- Install the control relay per the Control Relay Replacement procedure.



TROUBLESHOOTING AND REPAIR

TRIGGER TRANSFORMER TEST

WARNING

Service and repair should only be performed by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric service department for technical troubleshooting assistance before you proceed. Call 216-383-2531 or 1-800-833-9353(WELD).

TEST DESCRIPTION

This test will determine if the correct voltages are being induced in the secondary windings of the trigger transformer.


MATERIALS NEEDED

115 VAC power supply Volt/Ohmmeter (Multimeter) 5/16 in. wrench or straight blade screwdriver Wiring Diagrams, Figure G.1 - G.3.



TRIGGER TRANSFORMER TEST (continued)

FIGURE F.2 - TRIGGER TRANSFORMER TEST POINTS.

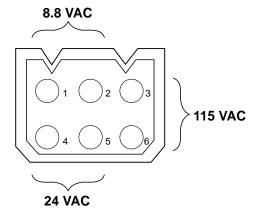

TEST PROCEDURE

- 1. Remove the cover from the control box by removing the four 5/16 in. screws from the top and sides of the unit.
- 2. Unplug the transformer wire connector (J103) from the control PC board.
- 3. Connect 115 VAC to pins 3 and 6 on the transformer plug. See the Wiring Diagrams in Section G and Figure F.2.

NOTE: Transformer secondary voltages are given for a primary voltage of 115 VAC. The transformer secondary voltage will vary if the primary voltage varies.

4. Measure the voltage across pins 4 and 5 of the transformer plug. The voltage for a good transformer is 24 VAC.

- Measure the voltage across pins 1 and 2 of the transformer plug. The voltage for a good transformer is 8.8 VAC.
- 6. If the voltages measured are not correct, the transformer is faulty and should be replaced.
- 7. Plug the transformer wire connector into the socket on the control PC board.
- 8. Reinstall the cover on the control box using four hex head screws.



Return to Master TOC

CONTROL CABLE CONTINUITY TEST

TROUBLESHOOTING AND REPAIR

WARNING

Service and repair should only be performed by Lincoln Electric factory trained personnel. Unauthorized repairs performed on this equipment may result in danger to the technician or machine operator and will invalidate your factory warranty. For your safety and to avoid electrical shock please observe all safety notes and precautions detailed throughout this manual.

If for any reason you do not understand the test procedures or are unable to perform the test/repairs safely, contact the Lincoln Electric service department for technical troubleshooting assistance before you proceed. Call 216-383-2531 or 1-800-833-9353(WELD).

TEST DESCRIPTION

This test will determine if the control cable from the welding power supply to the wire feeder is functioning properly. The test checks for continuity of each cable and for shorts between cables.


MATERIALS NEEDED

Volt/Ohmmeter (Multimeter) Wiring Diagrams, Figure G.1 - G.3.



CONTROL CABLE CONTINUITY TEST (continued)

FIGURE F.3 - CONTROL CABLE CONTINUITY TEST POINTS.

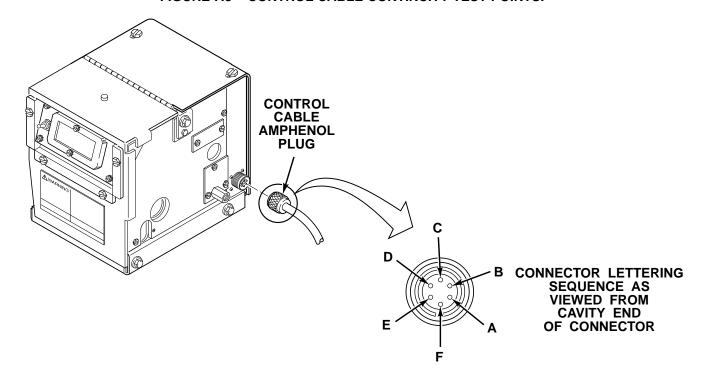

TEST PROCEDURE

- 1. Disconnect the control cable amphenol plug from the welding power source and the wire feeder.
- 2. Using a multimeter, measure the resistance of the control cable wiring from the amphenol plug on the wire feeder end to the terminal connectors or amphenol plug on the welding power
- source end. Refer to the Wiring Diagrams in Section G, Table F.2, and Figure F.3 for wire designations.
- 3. If the conductor resistance measures greater than 1.0 Ohm, the cable is faulty and should be replaced. If the resistance between conductors is less than 0.5 MOhm, the cable is faulty and should be replaced.

TABLE F.2 - CONTROL CABLE PIN AND LEAD DESIGNATIONS

SIX PIN AMPHENOL	LEAD NUMBERS	FOURTEEN PIN
WIRE FEEDER END	MACHINE END	AMPHENOL MACHINE END
A	4	D
B	2	C
C	32	A
D	31	J
E	CASE GROUND	B
F	21	H



TROUBLESHOOTING AND REPAIR

COMPONENT REPLACEMENT PROCEDURES WIRE FEED SPEED POTENTIOMETER REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED


5/16 in. wrench Straight blade jeweler's screwdriver Adjustable wrench Soldering iron and solder Schematic Diagram for Troubleshooting, Figure G.4.



Return to Master TOC

WIRE FEED SPEED POTENTIOMETER REPLACEMENT (continued)

FIGURE F.4 – REMOVING WIRE FEED SPEED POTENTIOMETER.

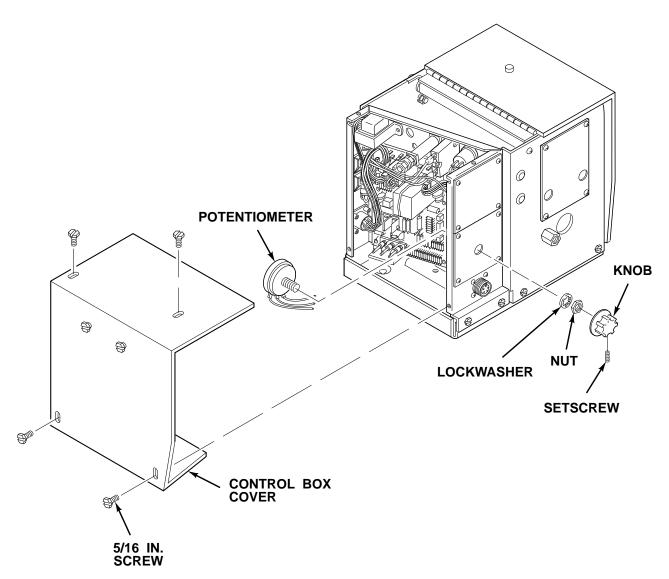

REPAIR PROCEDURE

- 1. Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit. See Figure F.4.
- Loosen the setscrew on the potentiometer knob and remove the knob from the potentiometer.
- Remove the nut and lockwasher holding the potentiometer to the case of the wire feeder. Remove the potentiometer through the inside of the case.
- 4. Tag the three wires on the potentiometer so that they can be reattached in the same location from which they were removed. Also refer to the wiring diagrams in Section G, Electrical Diagrams. Unsolder the three wires from the potentiometer.
- 5. Solder the three wires to the new potentiometer on the corresponding terminals from which they were removed.



Return to Master TOC

TROUBLESHOOTING AND REPAIR

WIRE FEED SPEED POTENTIOMETER REPLACEMENT (continued)

- 6. Place the new potentiometer through the case from the inside. Ensure that the index pin on the potentiometer fits in the locating hole on the case of the wire feeder. Install the lockwasher and nut on the potentiometer. Tighten until snug.
- 7. Install the knob onto the potentiometer and tighten the setscrew to lock the knob in place.
- 8. Reinstall the cover onto the control box using the four hex head bolts.
- 9. Measure the wire feed speed using a K283 Hand Held Wire Feed Speed Meter. To measure the wire feed speed if a K283 is not available, feed the wire for six seconds, measure the length of wire fed, and multiply by ten. The measured wire speed should approximately equal that shown on the potentiometer name plate. If the wire feed speed is not correct then check the motor brushes. Also, the motor or the control board may be faulty.



CIRCUIT BREAKER REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

5/16 in. wrench Adjustable wrench




Return to Master TOC

TROUBLESHOOTING AND REPAIR

CIRCUIT BREAKER REPLACEMENT (continued)

FIGURE F.5 - CIRCUIT BREAKER AND PUSH BUTTON REPLACEMENT.

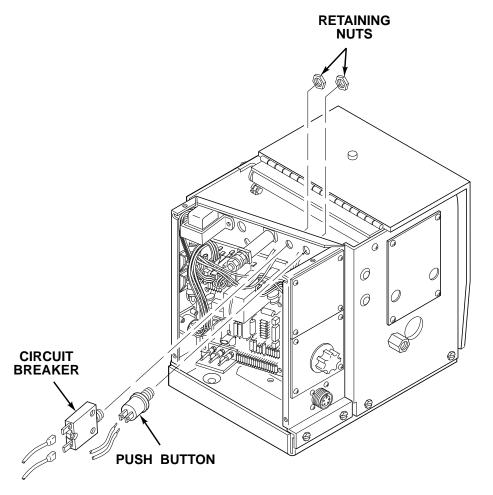

REPAIR PROCEDURE

- 1. Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit.
- 2. Remove the two wires from the back of the circuit breaker. See Figure F.5.
- 3. Remove the retaining nut that secures the circuit breaker to the panel of the wire feeder. Remove the circuit breaker from the wire feeder.

- 4. Install the new circuit breaker through the panel of the control box. Secure the circuit breaker with the retaining nut.
- 5. Connect the two wires to the back of the circuit breaker.
- 6. Reinstall the cover on the wire feeder using four hex head screws.



GROUND LEAD PROTECTOR PUSH BUTTON SWITCH REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

5/16 in. wrench Adjustable wrench Soldering iron and solder



TOC

Return to Master

Return to Master TOC

Return to Master TOC

TROUBLESHOOTING AND REPAIR

GROUND LEAD PROTECTOR PUSH BUTTON SWITCH REPLACEMENT (continued)

REPAIR PROCEDURE

- 1. Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit.
- 2. Remove the retaining nut from the front of the push button and remove the push button from the control box. See Figure F.5.
- 3. Unsolder the two leads from the back of the push button.

- 4. Solder the two leads onto the new push button.
- 5. Install the new push button through the case of the control box.
- 6. Install the retaining nut onto the front of the push button.
- 7. Reinstall the cover on the control box using four hex head screws.



TRIGGER TRANSFORMER REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

5/16 in. wrench Phillips screwdriver




Return to Master TOC

TROUBLESHOOTING AND REPAIR

TRIGGER TRANSFORMER REPLACEMENT (continued)

FIGURE F.6 - TRIGGER TRANSFORMER REPLACEMENT.

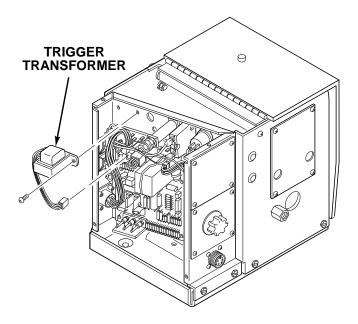

REPAIR PROCEDURE

- 1. Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit.
- 2. Unplug the transformer wire connector from the control PC board. See Figure
- 3. Remove the two phillips head screws that attach the transformer to the case

of the control box. Remove the old transformer from the wire feeder.

- 4. Install the new transformer in the wire feeder and attach it to the case with two phillips head screws.
- 5. Plug the transformer wire connector into the socket on the control PC board.
- 6. Reinstall the cover on the control box using four hex head screws.



GROUND LEAD PROTECTOR REED SWITCH REPLACEMENT

▲ WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual.
 Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

5/16 in. wrench Wire cutters Tie wraps



TOC

Return to Master


TOC

Return to Master

TROUBLESHOOTING AND REPAIR

GROUND LEAD PROTECTOR **REED SWITCH REPLACEMENT** (continued)

FIGURE F.7 - REED SWITCH REPLACEMENT.

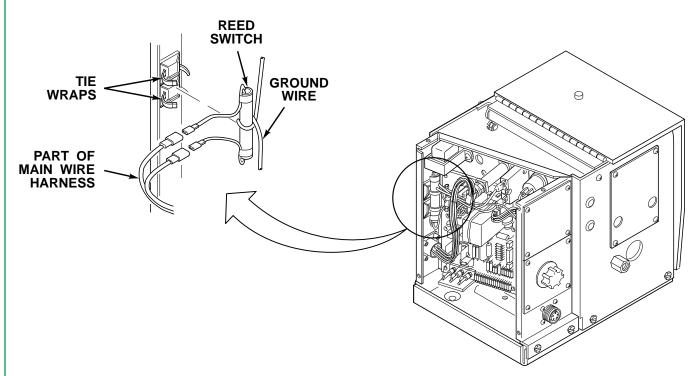

REPAIR PROCEDURE

- Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit.
- 2. Unplug the two wire connectors that connect the reed switch to the wire feeder main wire harness. See Figure F.7.
- 3. Cut the two tie wraps that attach the reed switch to the case of the wire feeder, and the tie wrap that attaches the reed switch leads to the main wire harness.
- 4. Slide the reed switch out of the loop formed by the ground wire and remove the reed switch from the wire feeder. Do not undo the loop in the ground wire.

- 5. Slide the new reed switch into the loop of the ground wire. Ensure that the loop in the wire is snug around the reed switch.
- 6. Attach the reed switch to the plastic mounts on the case of the wire feeder using two tie wraps. The tie wraps should also secure the ground lead in place.
- 7. Connect the two wire connectors on the reed switch to the wire feeder main harness. Tie wrap the leads to the main wire harness.
- 8. Reinstall the cover on the wire feeder using four hex head screws.



Return to Master TOC

CONTROL PC BOARD REPLACEMENT

M WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual.
 Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

5/16 in. wrench Pliers



TOC


Return to Master

TOC

Return to Master

CONTROL PC BOARD REPLACEMENT (continued)

FIGURE F.8 - DISCONNECTING THE CONTROL PC BOARD.

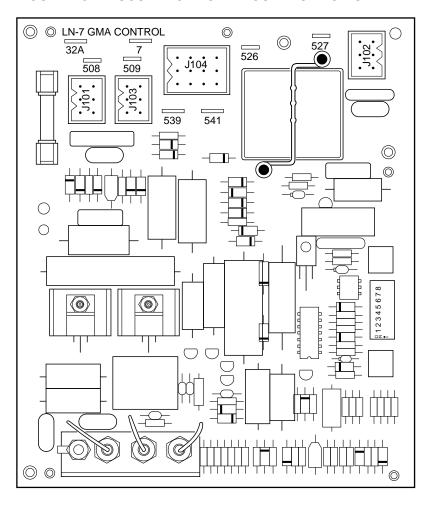

REPAIR PROCEDURE

- 1. Observe static precautions detailed in PC Board Troubleshooting Procedures at the beginning of this section.
- Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit.


Label all wires and connectors prior to removal. All wires and connectors must be reconnected to the same terminals from which they were removed. Improper connection may lead to component damage or machine misoperation.

- Disconnect J102, input cable connector J101, and transformer connector J103 from the PC board. Refer to Figure F.8.
- 4. If the unit is equipped with a timer or burnback kit, disconnect J104 From the PC board.
- 5. Disconnect GLP reed switch wires from PC board terminals #526 and #527.
- 6. Disconnect feed wire motor leads from PC board terminals #539 and #541.
- 7. Disconnect the gas solenoid wires from PC board terminals #7 and #32A.
- 8. Disconnect meter kit wires from PC board terminals #508 and #509.



CONTROL PC BOARD REPLACEMENT (continued)

FIGURE F.9 - REMOVING THE CONTROL PC BOARD.

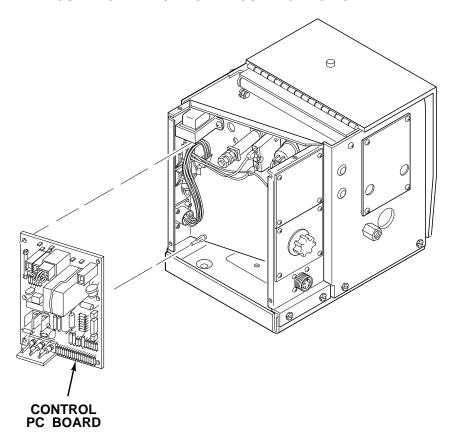

- 9. Pry the retaining clip from the control relay. Remove the control relay from the control PC board.
- 10. Disengage the PC board supports by squeezing each support in turn with a pair of pliers and gently pulling out on the board next to the support. When all seven supports have been disconnected, remove the control PC board from the control box. See Figure F.9.
- 11. Prepare to mount the new PC board by lining up all the mounting holes with the PC board supports. Then, press the PC board into place on the supports. Make sure that the control PC board snaps onto all seven supports.

CAUTION

Do not use excessive force when inserting control relay. Excessive force can damage the control PC board. If the control relay does not fit, remove it and try again.

- 12. Install the control relay onto the new PC board by pressing firmly and rocking side to side. Secure the relay in place with the relay retaining clip.
- 13. Connect the meter kit wires to PC board terminals #508 and #509. See Figure F.8.
- 14. Connect the gas solenoid wires to PC board terminals #7 and #32A.
- 15. Connect the feed wire motor leads to the PC board terminals #539 and #541.
- 16. Connect the GLP reed switch wires to the PC board terminals #526 and #527.
- 17. If the unit is equipped with a timer or burnback kit, connect the kit wire connector to J104 on the PC board.
- 18. Connect J101, J102, and J103 to the PC board.
- 19. Reinstall the cover on the wire feeder using four hex head screws.



Return to Master TOC

MAIN POWER RESISTOR (R₁) REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED


5/16 in. wrench 3/8 in. wrench Soldering iron and solder



MAIN POWER RESISTOR (R₁) REPLACEMENT (continued)

FIGURE F.10 - MAIN POWER RESISTOR REPLACEMENT.

FOR UNITS EQUIPPED WITH AN OPTIONAL METER KIT

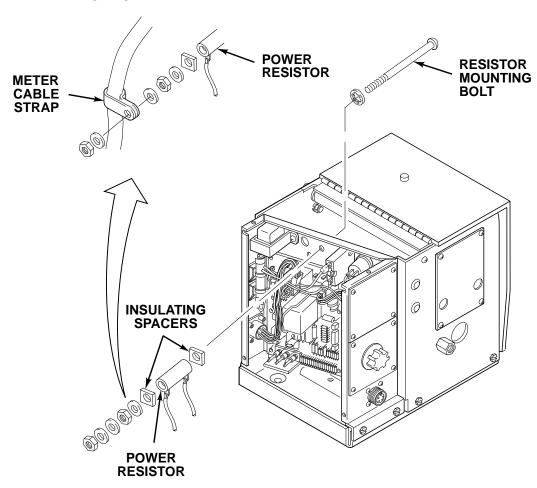

REPAIR PROCEDURE

- 1. Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the wire feeder.
- 2. Remove the first hex nut and washer from the end of the resistor mounting bolt. See Figure F.10.
- 3. If the wire feeder is equipped with a meter kit, remove the meter cable strap from the resistor mounting bolt.

- 4. Remove the second washer, hex nut, and third washer from the resistor mounting bolt.
- 5. Remove the two insulating spacers and the power resistor from the mounting bolt. It may be necessary to push the mounting bolt back through the case of the control box to allow clearance to remove the resistor.
- 6. Unsolder the two wires from the resistor. Remove the resistor from the wire feeder.



Return to Master TOC

TROUBLESHOOTING AND REPAIR

MAIN POWER RESISTOR (R₁) REPLACEMENT (continued)

- 7. Solder the two wires onto the new power resistor.
- 8. Install one insulating spacer onto the resistor mounting bolt. Install the power resistor and the second spacer onto the mounting bolt. Secure in place with a flat washer and hex nut.
- 9. If the wire feeder is equipped with a meter kit, install a second washer and

- the meter cable strap. If a meter kit is not equipped, install only the second washer.
- 10. Install a third washer and a hex nut.
- Reinstall the cover on the control box using four hex head screws.



Return to Master TOC

CONTROL RELAY REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

5/16 in. wrench




Return to Master TOC

TROUBLESHOOTING AND REPAIR

CONTROL RELAY REPLACEMENT (continued)

FIGURE F.11 - CONTROL RELAY REPLACEMENT.

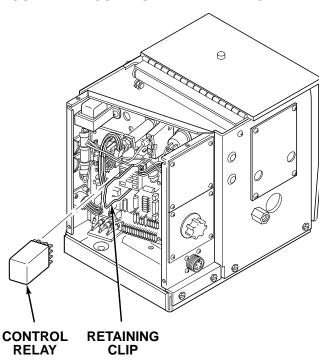

REPAIR PROCEDURE

- 1. Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit.
- 2. Slide the retaining clip off the side of the control relay. See Figure F.11.
- 3. Remove the control relay by pulling out wile gently rocking from side to side.

CAUTION

Do not use excessive force when inserting control relay. Excessive force can damage the control PC board. If the control relay does not fit, remove it and try again.

- 4. Insert the new control relay by pressing in and rocking side to side. Do not press too hard on the relay as this may damage the control PC board.
- 5. Slide the retaining clip over the end of the control relay.
- 6. Reinstall the cover on the control box using four hex head screws.



WIRE DRIVE ASSEMBLY AND COMPONENTS REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

5/16 in. wrench Wire cutters 3/8 in. wrench 7/16 in. wrench Straight blade screwdriver 3/16 in. Allen wrench Lubricant (part no. E2322) Grease (part no. E2164) Sealant (part no. E2225) Torque wrench




TOC

Return to Master

TROUBLESHOOTING AND REPAIR

WIRE DRIVE ASSEMBLY AND COMPONENTS REPLACEMENT (continued)

FIGURE F.12 - MOTOR LEAD REMOVAL.

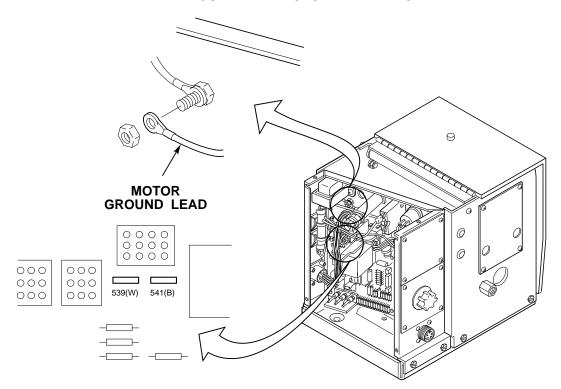

REPAIR PROCEDURE

- 1. Remove the cover from the control by removing the four 5/16 in. screws from the top and side of the unit.
- 2. Cut the two tie wraps securing the feed motor leads to the main wire harness and disconnect the two motor leads from terminals #539 and #541 on the control PC board. Refer to Figure F.12.
- Remove the hex nut securing the motor ground lead to the case of the control box. Refer to Figure F.12. Remove the motor ground lead and reinstall the hex nut. Do not remove the second ground wire from the terminal. Feed the three motor leads through the case of the control box to the wire drive compartment.
- 4. Remove the swing arm assembly per the Swing Arm Assembly Replacement procedure.

- Remove the hex head bolt in the bottom of the control box which holds the wire drive assembly to the case. Remove the two hex head bolts in the bottom of the wire drive compartment. On the four-roll feeders, these bolts also have flat washers and lockwashers.
- 6. Remove the straight head screw that secures lead #567 to the contact block. See Figure F.13.
- 7. Remove the wire drive assembly from the wire feeder.
- 8. On two-roll feeders, remove the two hex head bolts, lockwashers, and flat washers that secure the contact block to the wire drive assembly. Remove the contact block, and locator bushing. On four-roll wire feeders, remove the hex head bolt, lockwashers, and flat washer. Remove the hex lockwasher, and flat washer from the bent J-bolt. Remove the contact block, locator bushing, and bent J-bolt.



WIRE DRIVE ASSEMBLY AND COMPONENTS REPLACEMENT (continued)

- 9. On two-roll feeders, remove the three hex head bolts, lockwashers, and flat washers from the bottom of the wire drive assembly. On four-roll feeders, remove the two straight head screws from the bottom of the wire drive assembly. Remove the gearbox mounting plate and the two insulating sheets.
- 10. Remove the covers from the side of the gearbox by removing the hex head bolts and lockwashers on each side.
- 11. Remove the two button head cap screws and lockwashers from the bottom of the gearbox. Remove the three motor mounting screws, bushings, flat washers and lockwashers securing the motor to the gearbox. The two screws on the inside of the gearbox may be removed by inserting a screwdriver through the holes that the button head capscrews were removed from.
- 12. Remove the motor and motor insulator from the gearbox.
- 13. Remove the roll pin and slide the pinion gear off the motor shaft.
- 14. To reassemble the wire drive assembly, slide the pinion gear onto the motor shaft and secure in place with the roll pin. Lubricate the pinion gear with an even coating of lubricant (part no. E2322).
- 15. Apply a thin coating of grease (part no. E2164) to the mating surfaces of the motor and motor insulator. Install the motor and motor insulator on the gearbox. Secure in place with three motor mounting screws, lockwashers, flat washers and bushings. Tighten the screws to 10 to 12 in-lbs.
- 16. Install the two button head cap screws and lockwashers in the bottom of the gearbox.
- 17. Coat the sealing surfaces of the gearbox covers with sealant (part no. E2225) and install the covers on the gearbox. Secure in place with two hex head screws and lockwashers.

- 18. Install the two insulating sheets and the gearbox mounting plate and secure in place with three flat washers, lockwashers, and hex head bolts. On four-roll feeders use two straight head screws.
- 19. Install the locator bushing and contact block. Secure in place with two lockwashers, flat washers, and hex head bolts. On four-roll feeders, install the locator bushing, bent J-bolt, and contact block.
- 20. Place the wire drive assembly in the wire drive compartment of the wire feeder. Ensure the bottom insulating sheet wraps under the gearbox mounting plate on both ends.
- 21. Install lead #567 on the contact block using the straight head screw.
- 22. Position the wire drive assembly in the center of the wire drive compartment and line up the mounting holes in the wire drive mounting plate.
- 23. Install one hex head bolt in the mounting plate in the control box. For four-roll feeders, also install a lockwasher and a flat washer.
- 24. Install two hex head bolts in the mounting plate in the wire drive compartment. For four-roll feeders, also use two lockwashers and flat washers.
- 25. Install the swing arm assembly per the Swing Arm Assembly Replacement procedure.
- 26. Feed the three motor leads through the hole in the case of the control box.
- 27. Remove the hex nut from the ground terminal and install the ground wire. Secure in place with the hex nut.
- 28. Install the black motor lead on terminal #541 of the control PC board, and the white motor lead on terminal #539. Secure the motor leads to the main harness using two tie wraps.
- 29. Reinstall the cover on the control box using four hex head screws.




TOC Master Return to TOC

Return to Master

WIRE DRIVE ASSEMBLY AND COMPONENTS REPLACEMENT (continued)

FIGURE F.13 - WIRE DRIVE ASSEMBLY REMOVAL (FOUR-ROLL FEEDER).

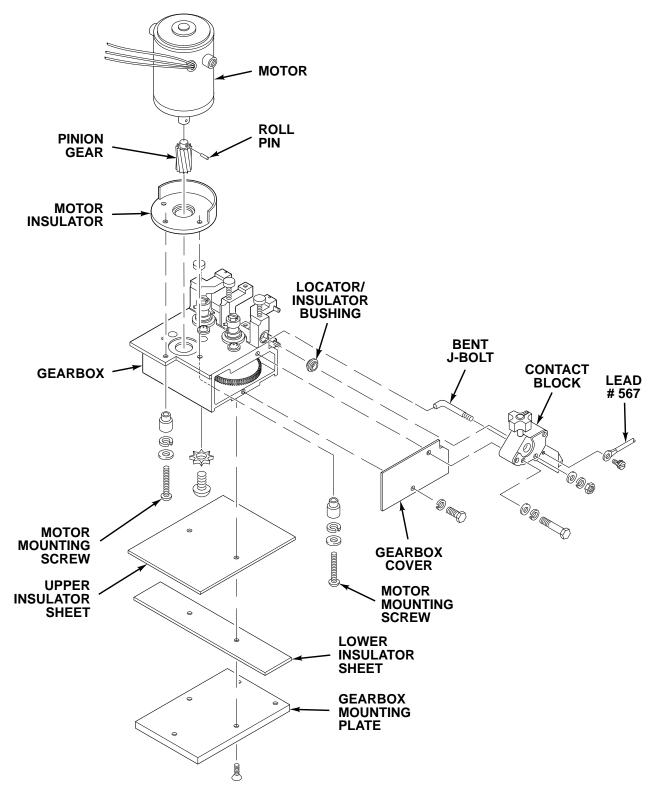



Return to Master TOC

SWING ARM ASSEMBLY REPLACEMENT FOR TWO-ROLL WIRE FEEDERS

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED

7/16 in. wrench Straight blade screwdriver




Return to Master TOC

TROUBLESHOOTING AND REPAIR

SWING ARM ASSEMBLY REPLACEMENT FOR TWO-ROLL WIRE FEEDERS (continued)

FIGURE F.14 - SWING ARM REMOVAL FOR TWO-ROLL FEEDERS.

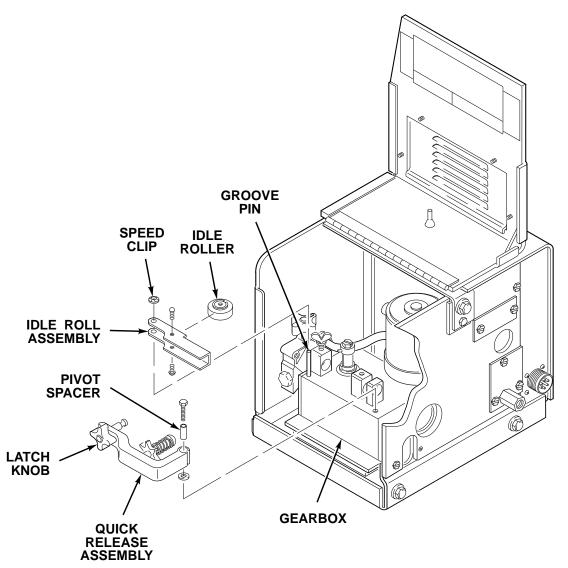

REPAIR PROCEDURE

- 1. Rotate the latch knob on the guick release assembly to the open position and swing the arm away from the gearbox. See Figure F.14.
- 2. Remove the hex head bolt that attaches the swing arm to the gearbox. Remove the swing arm and flat washer from the wire feeder. Remove the pivot spacer from the swing arm.
- 3. Pry the speed clip off of the groove pin and lift the idle roll assembly from groove pin.
- 4. Remove the two screws that hold the idle roller in the idle roll assembly. Remove the idle roller.
- 5. Install the new idle roller in the idle roll assembly and secure with two screws. Tighten the two screws until the sides of the idle roll assembly are snug against the idle roller.



Return to Master TOC

SWING ARM ASSEMBLY REPLACEMENT FOR TWO-ROLL WIRE FEEDERS (continued)

- 6. Place the idle roll assembly into the groove pin. Secure in place with a speed clip.
- 7. Slide the pivot pin into the swing arm assembly. Place the flat washer and swing arm assembly on the gearbox
- assembly. Fasten in place with the hex head bolt.
- 8. Swing the swing arm assembly in toward the gearbox. Latch the swing arm assembly by rotating the latch knob towards the conductor block.



SWING ARM ASSEMBLY REPLACEMENT FOR FOUR-ROLL WIRE FEEDERS

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual. Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED


3/32 in. Allen wrench 9/64 in. Allen wrench Rubber mallet



Return to Master TOC

SWING ARM ASSEMBLY REPLACEMENT FOR **FOUR-ROLL WIRE FEEDERS** (continued)

FIGURE F.15 – SWING ARM REMOVAL FOR FOUR-ROLL FEEDERS.

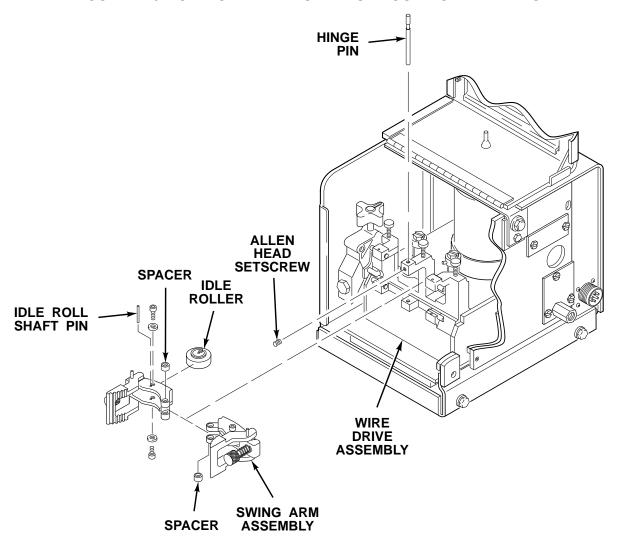

REPAIR PROCEDURE

- 1. Remove the allen head setscrew from the center post of the wire drive assembly. See Figure F.15.
- 2. Using a pair of pliers, pull the hinge pin up and out of the wire drive assembly.
- 3. Note the position of the two spacers. Carefully pull the two swing arms out of the wire drive compartment. Ensure that the two spacers are not lost.
- 4. Remove the two socket head cap screws and flat washers from the swing arm assembly. Remove the idle roll shaft pin. Slide the idle roll from the swing arm.
- 5. Slide a new idle roll into the swing arm. Install one socket head cap screw and flat washer.
- 6. Install the idle roll shaft pin and the second socket head cap screw and flat washer.



Return to Master TOC

TROUBLESHOOTING AND REPAIR

SWING ARM ASSEMBLY REPLACEMENT FOR FOUR-ROLL WIRE FEEDERS (continued)

7. Place the two swing arms and spacers in the center post of the wire drive assembly. Ensure the holes in the pieces line up to accept the hinge pin.

CAUTION

Do not use excessive force when installing the hinge pin. If hinge pin does not go in, remove it and try again.

- 8. Slide the hinge pin into the hinge pin opening in the center post. Use a rubber mallet to drive the hinge pin in if necessary. Drive the hinge pin in until the detente in the pin is visible in the setscrew hole.
- 9. Install the setscrew and tighten until snug.



GAS SOLENOID AND CONNECTIONS REPLACEMENT

WARNING



ELECTRIC SHOCK can kill.

Observe all safety precautions detailed throughout this manual.
 Turn off input power to the wire feeder. Only qualified technicians should perform installations, maintenance, and troubleshooting work on the machine.

TOOLS REQUIRED


5/16 in. wrench Wire cutters 3/4 in. wrench 7/16 in. wrench Phillips screwdriver Knife Thread sealant (part no. E-2442) Tie wraps



Return to Master TOC

GAS SOLENOID AND CONNECTIONS REPLACEMENT (continued)

FIGURE F.16 - GAS SOLENOID DISASSEMBLY.

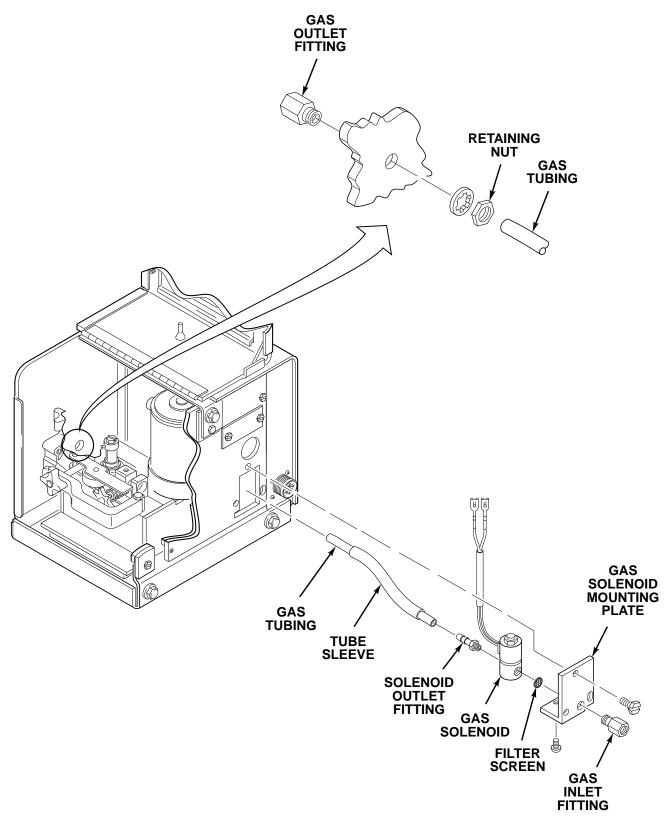



Return to Master TOC

GAS SOLENOID AND CONNECTIONS REPLACEMENT (continued)

REPAIR PROCEDURE

- Remove the cover from the control box by removing the four 5/16 in. screws from the top and side of the unit.
- 2. Remove the tie wraps that secure the gas solenoid wires to the wire feeder main harness.
- 3. Disconnect the gas solenoid wires from the control PC board at terminals #7 and #32A. Refer to Section G - Wiring Diagrams. Feed the wires back through wall of the control box and into the wire drive compartment.
- 4. Remove the retaining nut from the gas outlet fitting. Refer to Figure F.16. Remove the gas tubing from the gas outlet fitting. If necessary, cut the gas tubing approximately one inch back from the gas fitting and remove the gas fitting. Remove the retaining nut and lockwasher from the wire feeder. Slide the tube sleeve off the gas tubing.
- 5. Remove the three 5/16 in. bolts that attach the gas solenoid mounting plate to the case of the wire feeder. Remove the gas solenoid from the wire feeder.
- 6. Remove the gas inlet fitting and the solenoid outlet fitting from the gas solenoid. Remove the filter screen from the inlet port of the solenoid.
- 7. Remove the solenoid from the solenoid mounting plate by removing the two phillips head screws from the bottom of the mounting plate.
- 8. Remove the tubing from the gas and solenoid outlet fittings. A knife may be required to cut the tubing.

- 9. Mount the new solenoid to the solenoid mounting plate using two phillips head screws.
- 10. Apply thread sealant (part no. E-2442) to the threads of the gas inlet fitting. Place the filter screen in the inlet port of the solenoid. Connect the new gas fittings to the gas solenoid.
- 11. Attach an approximately 10 in. piece of 1/4 in. tubing to the solenoid outlet fitting on the gas solenoid. Slide the tube sleeve over the tubing.
- 12. Feed the gas tubing through the mounting hole for the gas solenoid, behind the wire drive gearbox, and below the feed motor. Install the gas solenoid onto the wire feeder using three 5/16 in. bolts.
- 13. Place the retaining nut and lockwasher on the gas tubing. Extend the gas tubing out the mounting hole for the gas outlet fitting and connect the tubing to the new gas outlet fitting.
- 14. Install the gas outlet fitting into the wire feeder case and secure with the lockwasher and retaining nut.
- 15. Route the wires for the gas solenoid through the hole in the case and into the control box.
- 16. Connect the wires to terminals #7 and #32A on the control PC board.
- 17. Secure the solenoid wires to the wire feeder main harness using two tie wraps.
- 18. Reinstall the cover on the control box using four hex head screws.



TOC

RETEST AFTER REPAIR

If a failed test indicates that any mechanical part which could affect the machine's electrical characteristics must be replaced, or if any electrical components are repaired or replaced, the machine must be retested and meet the following standards.

TROUBLESHOOTING AND REPAIR



LN-7 GMA WIRE FEEDER

Return to Master TOC

TABLE OF CONTENTS - ELECTRICAL DIAGRAMS SECTION -

electrical Diagrams	Section G
G1706 Control PC Board Components	G-1
Wiring Diagrams	
Codes 9168 and 9386	G-3
Codes 9643 and 9796 (4R)	G-4
Codes 9928 and 9931 (4R)	G-5
Schematic Diagram - Control PC Board	G-6



TOC


Master

Return to

TOC

Return to Master

PC BOARD LAYOUT

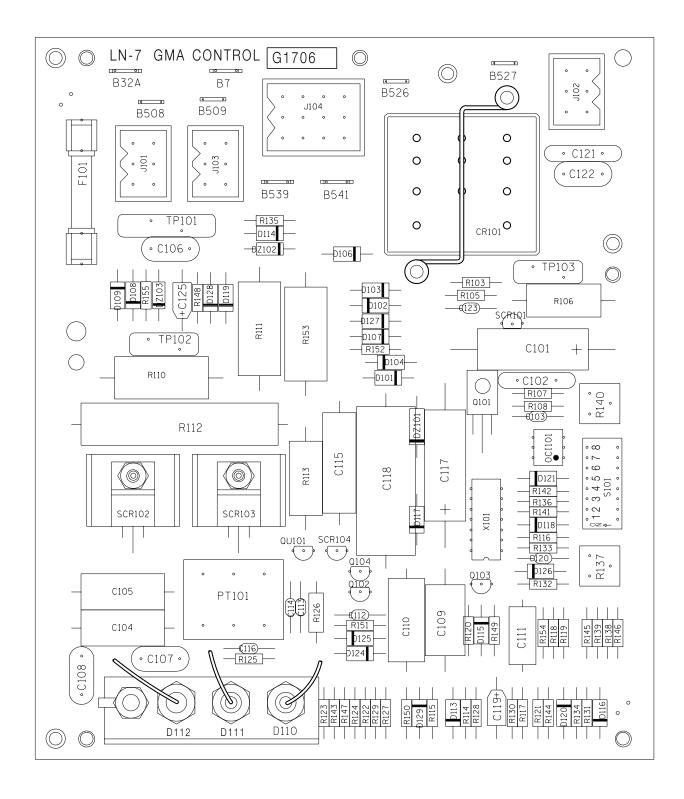

NOTE: Lincoln Electric assumes no responsibility for liablilities resulting from board level troubleshooting. PC Board repairs will invalidate your factory warranty. Individual Printed Circuit Board Components are not available from Lincoln Electric. This information is provided for reference only. Lincoln Electric discourages board level troubleshooting and repair since it may compromise the quality of the design and may result in danger to the Machine Operator or Technician. Improper PC board repairs could result in damage to the machine.



PC BOARD LAYOUT

Item	Identification	Item	Identification
B7,B32A,B539,B541	CONNECTOR, TAB, QC, VERTICAL, 1/4	R105,R108,R144,R147	RESISTOR-MF,1/4W,1.00K,1%
B508,B509,B526,B5	27 CONNECTOR, TAB, QC, VERTICAL, 3/16	R106	RESISTOR-CC,2W,1.5K,5%
C101,C117	CAPACITOR-ALEL,50,50V,+75/-10%	R110,R111	RESISTOR-WW,5W,3.3K,5%,SQ
C102,C121	CAPACITOR-CD,.02,600V,+80/-20%	R112	RESISTOR-WW,10W,1.0,5%
C103,C112,C113,C1	14,	R113	RESISTOR-CC,2W,2.2K,5%
C116,C120,C123	CAPACITOR-CEMO,.022,50V,20%	R114,R141,R149	RESISTOR-MF,1/4W,150K,1%
C104,C105,C110	CAPACITOR-PEF,.047,200V,10%	R115,R117,R128,R129,R13	0 RESISTOR-MF,1/4W,10.0K,1%
C106,C107,C108,C1	22 CAPACITOR-CD,.0047/.005,1400V,20%	R116	RESISTOR-MF,1/4W,1.00M,%
C109	CAPACITOR-PEMF, 0.33, 200 V, 10%	R118	RESISTOR-MF,1/4W,6.81K,1%
C111	CAPACITOR-PEF,.01,200V,10%	R119	RESISTOR-MF,1/4W,100K,1%
C115	CAPACITOR-PEF,0.1,100V,10%	R120,R154	RESISTOR-MF,1/4W,332K,1%
C118	CAPACITOR-PEMF,4.0,50V,10%	R121,R123,R135	RESISTOR-MF,1/4W,2.21K,1%
C119,C125	CAPACITOR-TAEL,4.7,35V,10%	R125,R142,R151	RESISTOR-MF,1/4W,3.32K,1%
CR101	RELAY-3PDT,24VDC,472OHMS	R126	RESISTOR-CC,1/2W,15,5%
D101,D102,D103,D104,D106,		R127,R133,R155	RESISTOR-MF,1/4W,15.0K,1%
D107,D113,D114,D115,D116		R131	RESISTOR-MF,1/4W,332,1%
D117,D118,D119,D120,D121		R132	RESISTOR-MF,1/4W,13.7K,1%
D124,D125,D126,l	D127,D128, D129 DIODE-AXLDS,1A,400V	R134,R138,R139,R146	RESISTOR-MF,1/4W,221K,1%
D108,D109	DIODE-AXLDS,1A,1000V	R136,R148	RESISTOR-MF,1/4W,18.2K,1%
D110	DIODE & HEAT SINK ASBLY	R137	TRIMMER-ST,1/2W,2K,10%,LINEAR
DZ101	ZENER DIODE-5W,20V,5%,1N5357B	R140	TRIMMER-ST,1/2W,10K,10%,LINEAR
DZ102	ZENER DIODE-1W,10V,5%,1N4740A	R143	RESISTOR-MF,1/4W,1.82K,1%
DZ103	ZENER DIODE-1W,20V,5%,1N4747A	R145	RESISTOR-MF,1/4W,133K,1%
F101	FUSE,2A,250V,FB,1.25 X 0.25	R150	RESISTOR-MF,1/4W,47.5K,1%
J101	PC BD PLUG ASBLY	R152	RESISTOR-MF,1/4W,5.11K,1%
J102	CONNECTOR-MOLEX	R153	RESISTOR-WW,5W,2.7,5%,SQ
J103	PC BD PLUG ASBLY	S101	SWITCH, DIP, SPST, 8 CIRCUITS
J104	PC BD PLUG ASBLY	SCR101,SCR104	SCR-T226,0.8A,200V,2N5064
OCI101	OPTOCOUPLER-PHOTO-Q,70V,CNY17-3	SCR102,SCR103	SCR-T220,12A,400V,2N6397
PT101	TRANSFORMER-PULSE,3-WINDING,1:1:1	TP101	MOV-150VRMS,80J,20MM
Q101	TRANSISTOR-N,T225,0.5A,250V,2N5655R126	TP102	MOV-130VRMS,38J,14MM
Q102	TRANSISTOR-N,T226,0.5A,300V,MPS-A42	TP103	MOV-50VRMS,15J,14MM
Q103	TRANSISTOR-N,T226,0.5A,40V,2N4401	X101 I	C-OP-AMP,QUAD,GEN-PURPOSE,224N
Q104	TRANSISTOR-P,T226,0.5A,300V,MPS-A92		
QU101	PUT-2N6027		
R103,R107,R122,R1	24 RESISTOR-MF,1/4W,4.75K,1%	NOTE: Individual parts listed are not available from Lincoln Electric.	

NOTE: Lincoln Electric assumes no responsibility for liablilities resulting from board level troubleshooting. PC Board repairs will invalidate your factory warranty. Individual Printed Circuit Board Components are not available from Lincoln Electric. This information is provided for reference only. Lincoln Electric discourages board level troubleshooting and repair since it may compromise the quality of the design and may result in danger to the Machine Operator or Technician. Improper PC board repairs could result in damage to the machine.




Wiring Diagram — Codes 9168 and 9386 LOW VOLTAGE **GROUND LEAD** N.A. QUICK CONNECT TERMINALS 7 & TRIGGER TRANSFORMER PROTECTOR RESET 2.5 AMP 2 CASE GROUNDING STUD 32A TO GAS SOLENOID VALVE CIRCUIT BREAKER 115 V.A.C. 0.25 AMP RATIING WIRE FEED MOTOR N.B. METER KIT RECEPTACLE. 524 529 N.C. OPTIONAL GMA TIMER OR BURNBACK KIT RECEPTACLE. 25W 32A JUMPER PLUG (P4) IS REMOVED R1 WHEN EITHER KIT IS 531 2 **s** WIRE SPEED INSTALLED. RHEOSTAT 539 N.D. ON LN-7 GMA, JUMPER IS 10KA SHIPPED CONNECTED R2 TO PIN "F" (FAST 526 **6** 527 ACCELERATION). N.E. ACTIVATED BY CURRENT FLOWING IN GROUNDING LEAD. ď J2 32A 32A **→** 1 **>** 542-508 $\rightarrow 5 \rightarrow 524$ 509 **Q →**525 GAS SOLENOID P2 VALVE _::=::=::=::= - 567 -OPTIONAL TIMER KIT PLUG **GUN CABLE** CONNECTION **OPTIONAL** 2 AMP 0 BURNBACK KIT PLUG OPTIONAL DIGITAL **OPTIONAL GUN & CABLE** ANALOG METER METER KIT CONDUCTOR BLOCK KIT PLUG PLUG W 539 541 567 CR1 L INPUT 21**→** 21 ELECTRODE 3 2 1 6 5 4 9 8 7 12 II 10 0 508 CABLE 3 2 I 6 5 4 Р3 509 526 525 -522→: 4 > CONNECTOR CAVITY -509→ 2 ≻ Р5 524 NUMBERING SEQUENCE. -508→ 1 >--SO N.B. (COMPONENT SIDE OF BOARD) -32A→ 3 **>** GLP CR2 -31 → 6 **>** EARLIER MODELS USED C REED LOW 2.0 AMP CIRCUIT BREAKER \leftarrow D SWITCH \prec \leftarrow E D **←** 3 N.E.7 LEAD COLOR CODING C **← INPUT** CONTROL OF -B - BLACK **GUN CONTROL** R - RED CABLE \square R \rightarrow CABLE W - WHITE LN-7 GMA \rightarrow | 1 \rightarrow CONTROL P.C. BOARD Y - YELLOW $\mathsf{E} \prec$ Р1 G - GREEN GND. ELECTRICAL SYMBOLS PER E-1537 □TO CONTACTOR CIRCUIT LN-7 GMA △ 115 V.A.C. WIRING DIAGRAM **O** WORK 4-4-86L **M** 15021

NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels.



Wiring Diagram — Codes 9643 and 9796

Return to Section TOC Return to Master TOC Return to Section TOC Return to Master TOC

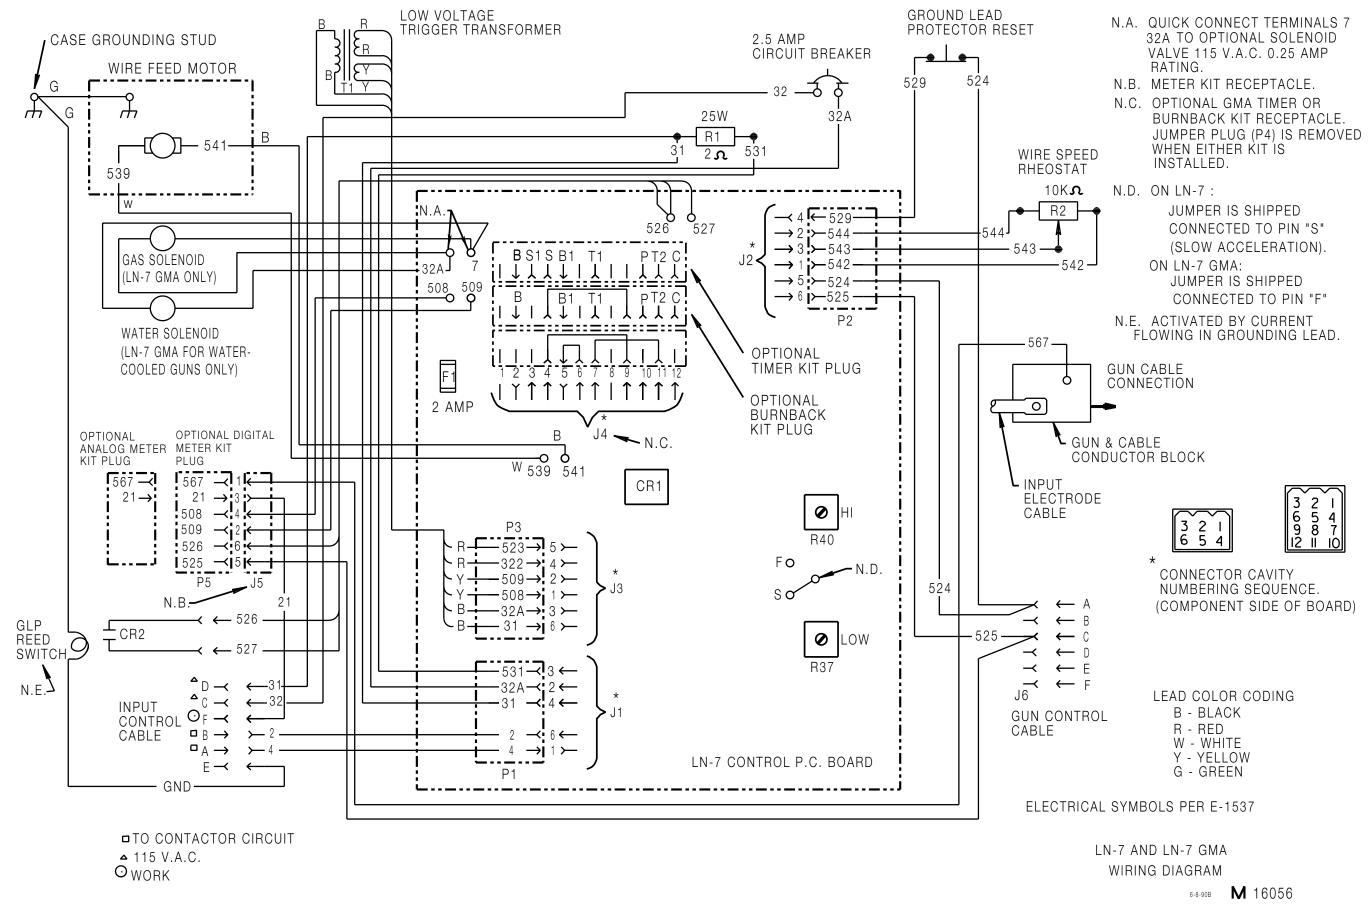


NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels.



N.A. QUICK CONNECT TERMINALS

Return to Section TOC Return to Master TOC


Wiring Diagram — Codes 9928 and 9931

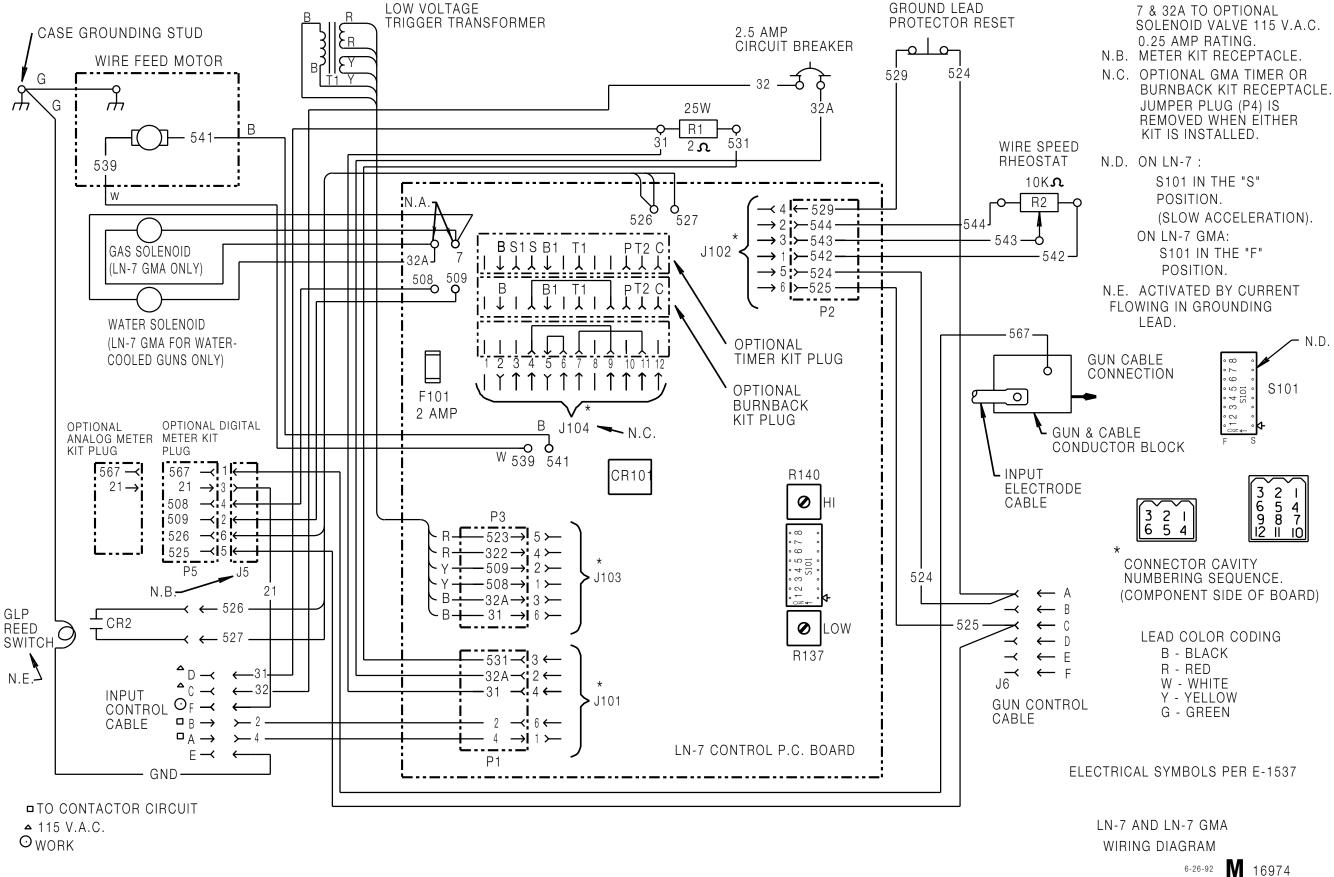

NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels.



Schematic Diagram — CONTROL P.C. BOARD

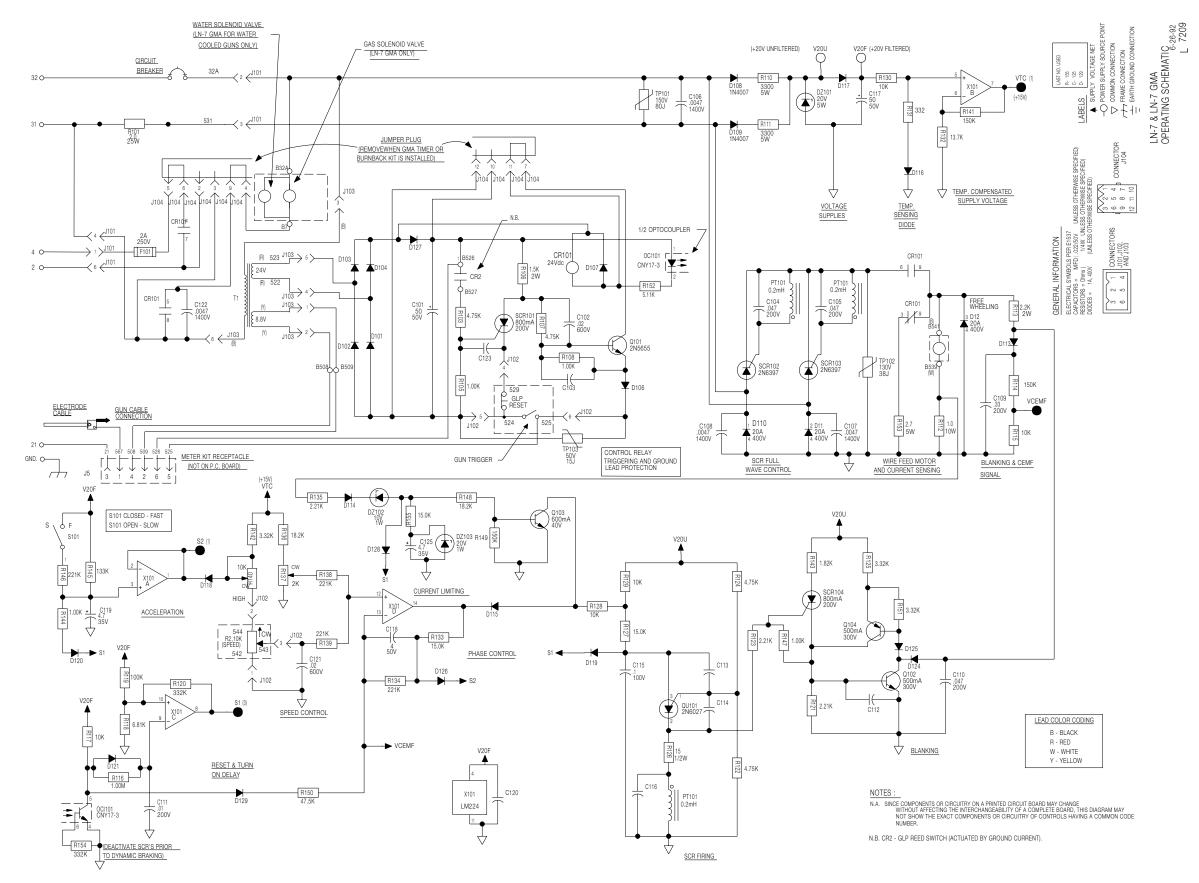

NOTE: Lincoln Electric assumes no responsibility for liabilities resulting from board level troubleshooting. PC Board repairs will invalidate your factory warranty. This Printed Circuit Board schematic is provided for reference only. It may not be totally applications application of the control of the con able to your machine's specific PC board version. This diagram is intended to provide general information regarding PC board function. Lincoln Electric discourages board level troubleshooting and repair since it may compromise the quality of the design and may result in Danger to the Machine Operator or Technician. Improper PC board repairs could result in damage to the machine.

