



### 1. Scope of application

This Installation Manual suits for the Fiber Optic Splice Closure (Hereafter abbreviated as FOSC), as the guidance of proper installation.

The scope of application is: aerial, underground, wall-mounting, duct-mounting, handhole-mounting. The ambient temperature ranges from -40 to 65°C.

### 2. Basic structure and configuration

#### 2.1 Dimension and capacity

Outside dimension (Height x Diameter)	460mm×190mm
Weight (excluding outside box)	2050g—2500g
Number of inlet/outlet ports	4 pieces
Diameter of fiber cable	Φ8mm~Φ16 mm
Capacity of FOSC	Bunchy: 12-96 (cores), Ribbon: 144 (cores)

#### 2.2 Main components

No.	Name of components	Quantity	Usage	Remarks
1	Housing	1 piece on left and right side respectively (total 2 pieces)	Protecting fiber cable splices in whole	Height x Diameter 230mm x 150mm
2	Fiber optic splice tray (FOST)	max. 4 trays (bunchy) max. 4 trays (ribbon)	Fixing heat shrinkable protective sleeve and holding fibers	Suitable for: Bunchy:12, 24 (cores) Ribbon: 3(pieces)
3	Foundation	1set	Fixing internal and connecting external structure	
4	Plastic hoop	1 set	Fixing between left and right housing	
5	Gasket ring	1 set	Big gasket ring is used to seal between left housing and righting housing. Small gasket ring is used to seal inlet/outlet tube	1 piece of big gasket ring, 4 pieces of small gasket ring
6	Pressure testing valve	1 set	After inject air, it is used for pressure testing and sealing testing	Configuration as per requirement

7	Earthing deriving device	1 set	Deriving metallic parts of fiber cables in FOSC for earthing connection	Configuration as per requirement
---	--------------------------	-------	---	----------------------------------

### 2.3 Main accessories and special tools

No.	Name of accessories	Quantity	Usage	Remarks
1	Heat shrinkable protective sleeve		Protecting fiber splices	Configuration as per capacity
2	Nylon tie		Fixing fiber with protective coat	Configuration as per capacity
3	Earthing wire	1 piece	Putting through between earthing devices	
4	Abrasive cloth	1 piece	Scratching fiber cables	
5	Labeling paper	1 piece	Labeling fibers	
6	Special wrench	2 pieces	Installing and tightening nut of reinforced core and nut (plastic) of inlet/outlet tube	
7	Measuring paper	1 piece	To measure perimeter, of which its diameter is enlarged with seal tape	
8	Seal tape	1 ring	Enlarging diameter of fiber cable which fits in with gasket ring.	Configuration as per specification
9	Insulation tape	1 ring	Enlarging diameter of fiber cable for easy fixing	
10	Hanging hook	1 set	For aerial application	
11	Buffer tube	decided by customers	Hitched to fibers and fixed with FOST, managing buffer.	Configuration as per requirement
12	Desiccant	1 bag	Put into FOSC before sealing for desiccating air.	

### 3. Necessary tools for installation

#### 3.1 Supplementary materials (to be provided by operator)

Name of materials	Usage
Scotch tape	Labeling, temporarily fixing
Ethyl alcohol	Cleaning
Gauze	Cleaning

### 3.2 Special tools (to be provided by operator)

Name of tools	Usage
Fiber cutter	Cutting off fiber cable
Fiber stripper	Strip off protective coat of fiber cable
Combo tools	Assembling FOSC

### 3.3 Universal tools(to be provided by operator)


Name of tools	Usage and specification
Band tape	Measuring fiber cable
Pipe cutter	Cutting fiber cable
Electrical cutter	Take off protective coat of fiber cable
Combination pliers	Cutting off reinforced core
Screwdriver	Crossing/Paralleling screwdriver
Scissor	
Waterproof cover	Waterproof, dustproof
Metal wrench	Tightening nut of reinforced core

### 3.4 Splicing and testing instruments (to be provided by operator)

Name of instruments	Usage and specification
Fusion Splicing Machine	Fiber splicing
OT DR	Splicing testing
Provisional splicing tools	Provisional testing

Notice: The above-mentioned tools and testing instruments should be provided by the operators themselves.

## 4. Installation flow chart

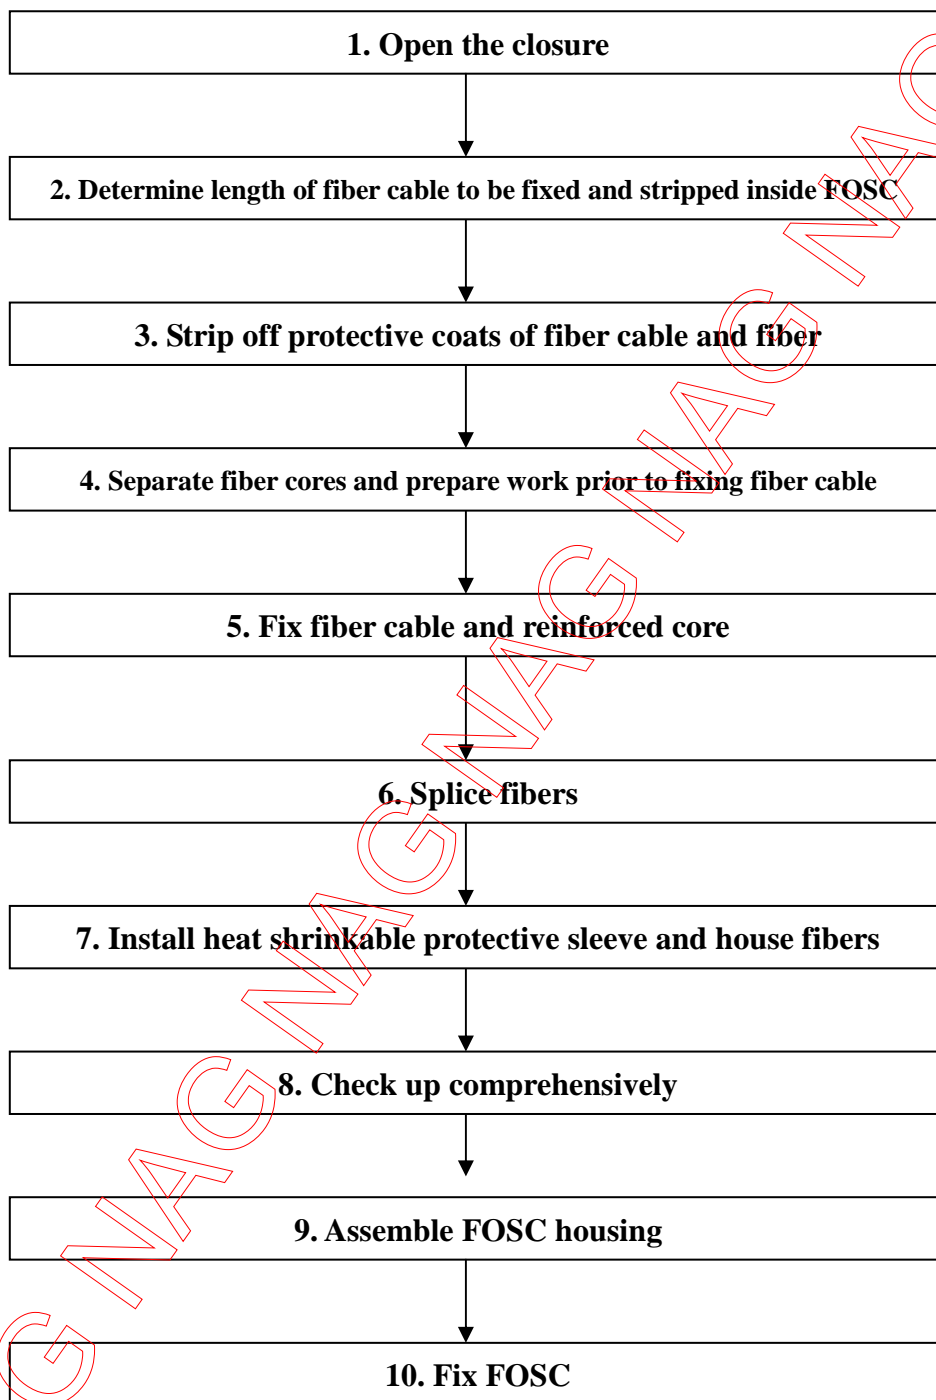


## 5. The process of installing FOSC.

### 5.1 Step One - Open the closure

- 5.1.1 Cleaning the locale and determine where to install the FOSC and then place fiber cables required.
- 5.1.2 Check whether the main components and accessories have been well prepared inside the package.
- 5.1.3 Open the closure
  - ① Demount hoop fixing bolt and pull hoop locking system out, then proceed in demounting the hoop.
  - ② Pull the left and right housings out to two ends, installation could begin.
- 5.1.4 See Drawing 1

**Important issues:** If the weather condition is not good enough, then a tent must be pitched for waterproof and dustproof.

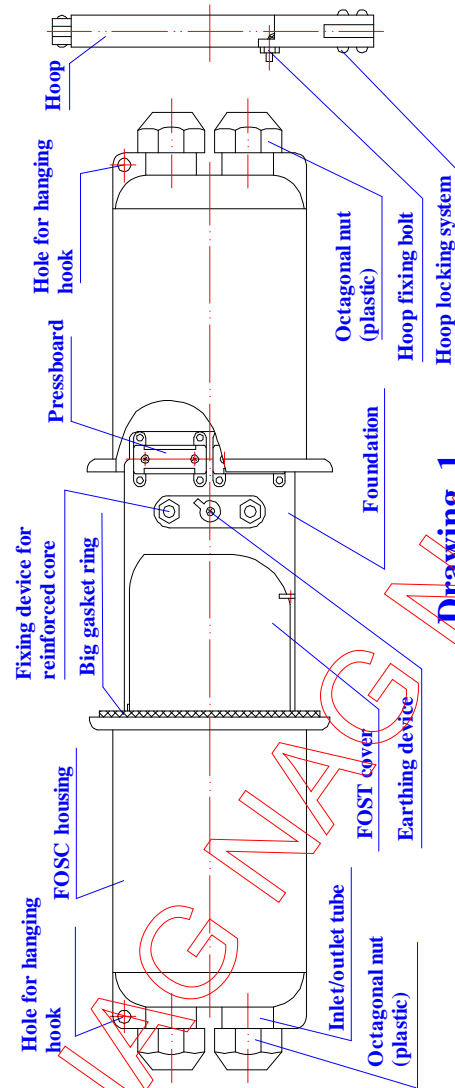


### 5.2 Step Two -Determine length of fiber cable to be fixed and stripped inside FOSC

- 5.2.1
- ①. Fiber cable in 90mm length: the distance from small gasket ring to fiber cable pressboard
  - ②. Fiber cable in 2000mm length: it is used to be winded and spliced after stripping.
  - ③. Fiber with protective coat in 400mm length: the distance from the fixing point of fiber cable to the fixing point of FOST (fiber optic splice tray).
  - ④. Fiber in 1600mm length: after stripping off the protective coat, it is to be winded inside the FOST after splicing with other fibers

5.2.2 See Drawing 2

#### Important issues:

1. Reserve enough length of fiber cable to be spliced.
2. Stripping length also could be decided by customer according to installation requirement.

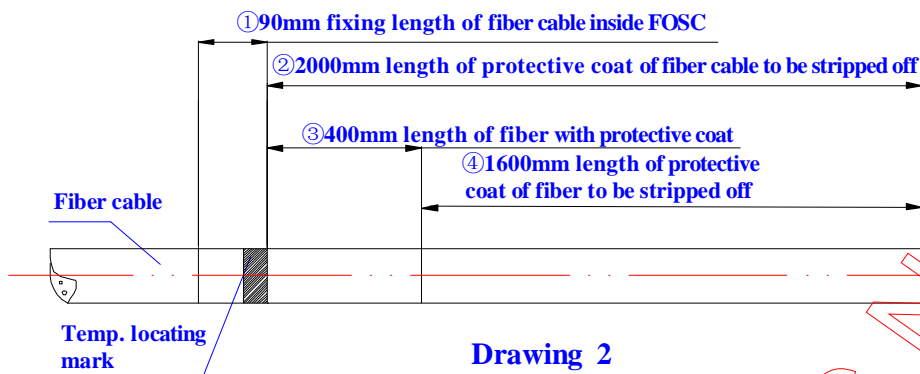


### 5.3 Step Three – Strip off fiber protective coat of fiber cable and fiber

5.3.1 Strip off protective coat of fiber cable from the temp. locating mark with the cutter and the stripper, please refer to Drawing 2 for stripping length. Stripping length also could be decided according to installation requirement

5.3.2 See Drawing 3.

**Important issues:** If it is difficult to strip off all the protective coat of fiber cable at one time, strip it off section by section to avoid fiber breakage.

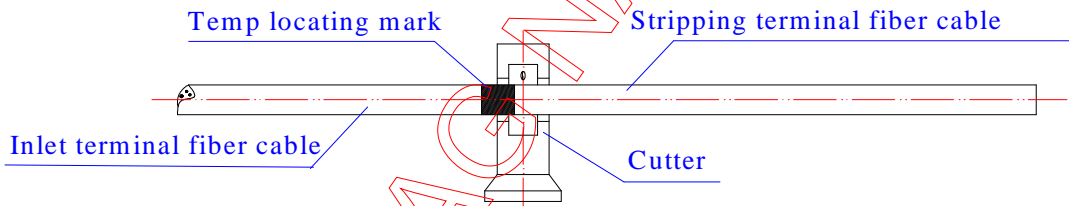

### 5.4 Step Four – Separate fiber cores and prepare work prior to fixing fiber.

5.4.1 Wind 2 layers of insulation tape on protective coat of fiber. Meanwhile, get rid of the stuffing to separate fiber and clean them. Form a ring with the diameter of 100mm or so and fix it on the fiber temporarily by adhesive tape.

5.4.2 This FOSC is provided with 4 inlet/outlet ports. Number of fiber cables is determined by the customers according to their actual requirements and the corresponding number of port plugs should be taken out. The max number of fiber cables to be installed is 4. , The max diameters of fiber cables are all 16mm.

5.4.3 This FOSC is suitable for fiber cables with diameter  $\phi 16\text{mm}$ .


5.4.4 The corresponding inlet/outlet ports are to be selected according to fiber cables actually installed. When the diameter of fiber cable is smaller than that of the inlet/outlet port, then the sealing tape should be used to enlarge the diameter of fiber cable.



5.4.5 Reserve reinforced core in 60mm length and cut off the unnecessary ones.

5.4.6 See Drawing 4.


- Important Issues:**
1. Before the seal tape is used for enlarging the fiber cable diameter, it should be scratched and to be cleaned with abrasive cloth and ethyl alcohol.
  2. Cut off reinforced core with a special cutting plier.

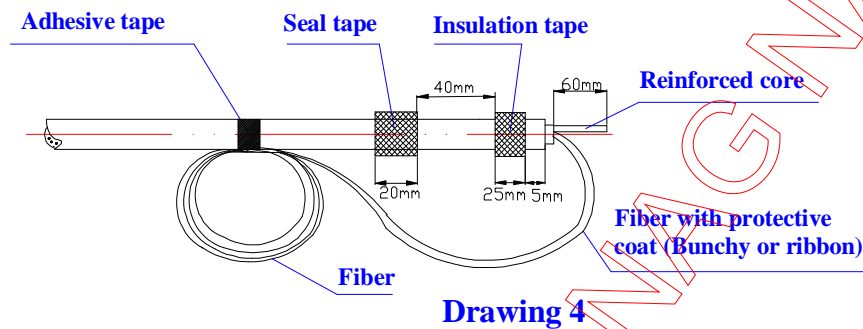

**Drawing 4**

### 5.5 Step Five - Fix reinforced core and fiber cable

- 5.5.1 Upon finishing the above steps, then demount port plugs, pressboard and fixing nut of reinforced core. Make sure to check whether the fiber cable stripped fits in with the fixing ports or not. If not, the adjustment should be done in time. Otherwise it will affect installation quality.
- 5.5.2 Insert fiber cable prepared into the FOSC.
- 5.5.3 Tighten fiber cable pressboard. If the diameter of fiber cable is not long enough, then enlarge it with insulation tape.
- 5.5.4 Tighten nut of reinforced core with the special wrench (plastic) and then retighten it with the metal wrench (the metal wrench should be provided by operator).
- 5.5.5 See Drawing 5

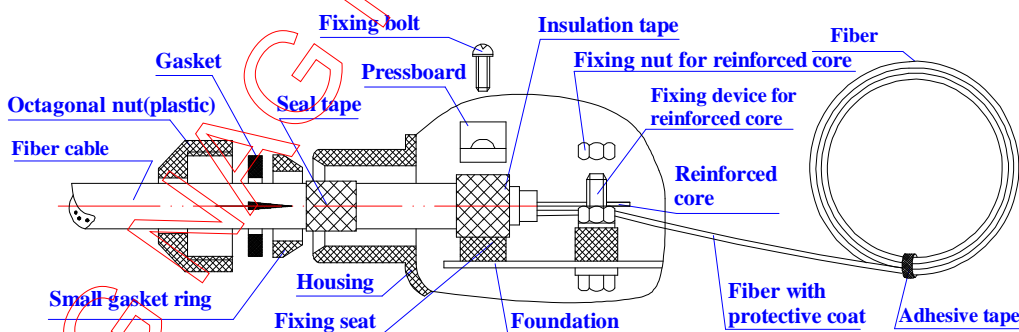

**Drawing 5**

### 5.6 Step Six - Splice fibers

- 5.6.1 Follow user manual of fusion splicing machine to splice fibers.


**Important issue:** pay attention to the twist and bend of fiber.

### 5.7 Step Seven -Install heat shrinkable protective sleeve and house fibers

- 5.7.1 When having completed splicing the fibers, the first fiber ring should be housed on the farthest side of FOST, the remaining fiber should be wound, forming a ring with diameter not less than 80mm. then put it into FOST (Fiber Optic Splice Tray) together with heat shrinkable protective sleeve.  
( Firstly fix heat shrinkable protective sleeve into the slot, then enlarge the diameter of fiber ring properly.)

- 5.7.2 See Drawing 6

**Important issue:** pay attention to the twist and bend of fiber.

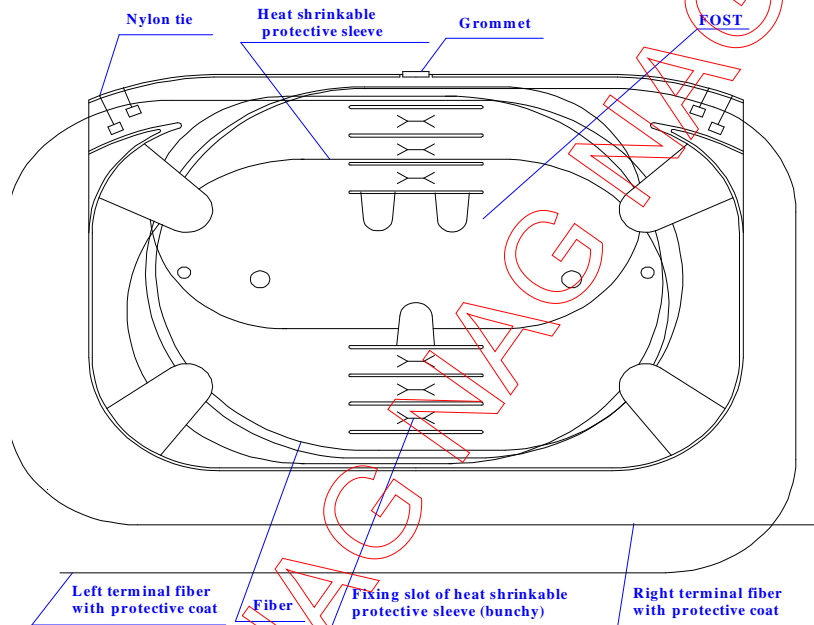

**Drawing 6**

### 5.8 Step Eight - Check up comprehensively


To ensure the technical requirements, the following instructions must be followed:

- 5.8.1 The fibers in the FOST are spliced and installed orderly. The curved diameter of fiber meets with the technical requirements.
- 5.8.2 The internal tighteners are tightened.
- 5.8.3 The inlet/outlet ports without fiber cables must be blocked up with the original port plugs.
- 5.8.4 Control the amount of seal tape within a proper range.
- 5.8.5 Seal fitting is installed neatly and smoothly. If not, level it up with seal tape.
- 5.8.6 See Drawing 7



## 5.9 Step Nine – Assemble FOSC housing

- 5.9.1 Insert one end of foundation into one end of orbit of FOSC, then hitch another end of orbit of FOSC to another end of foundation properly.
- 5.9.2 Install plastic hoop between left and right housing, tighten hoop locking system, which is to be fixed by hoop fixing bolt then.
- 5.9.3 Please refer to Drawing 8.

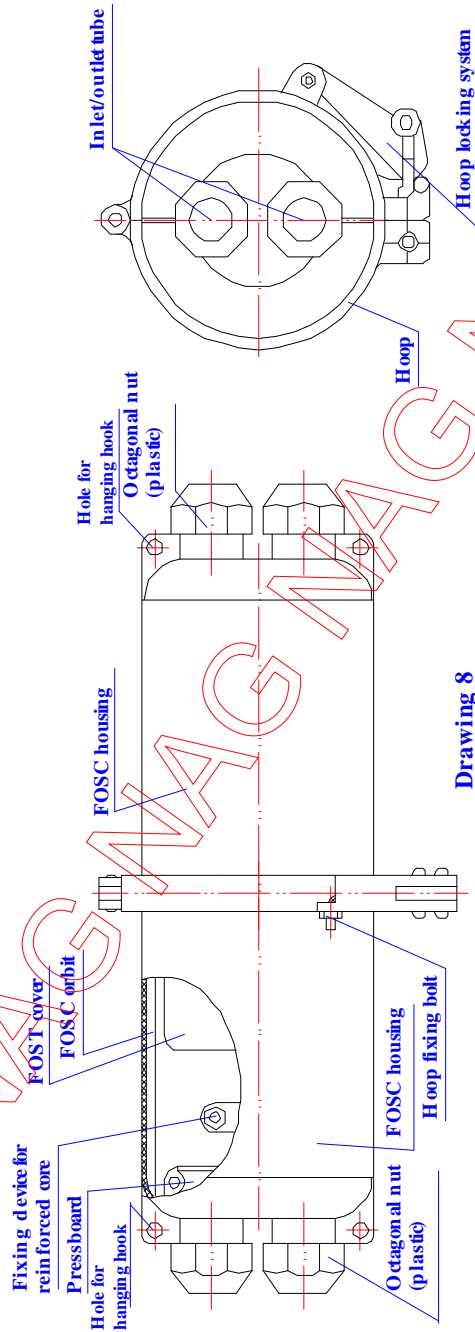


Drawing 8

### 5.10 Step Ten – Fix FOSC

5.10.1 Fix FOSC by tightening octagonal nut.

5.10.2 If for aerial application, hanging hook is to be installed.

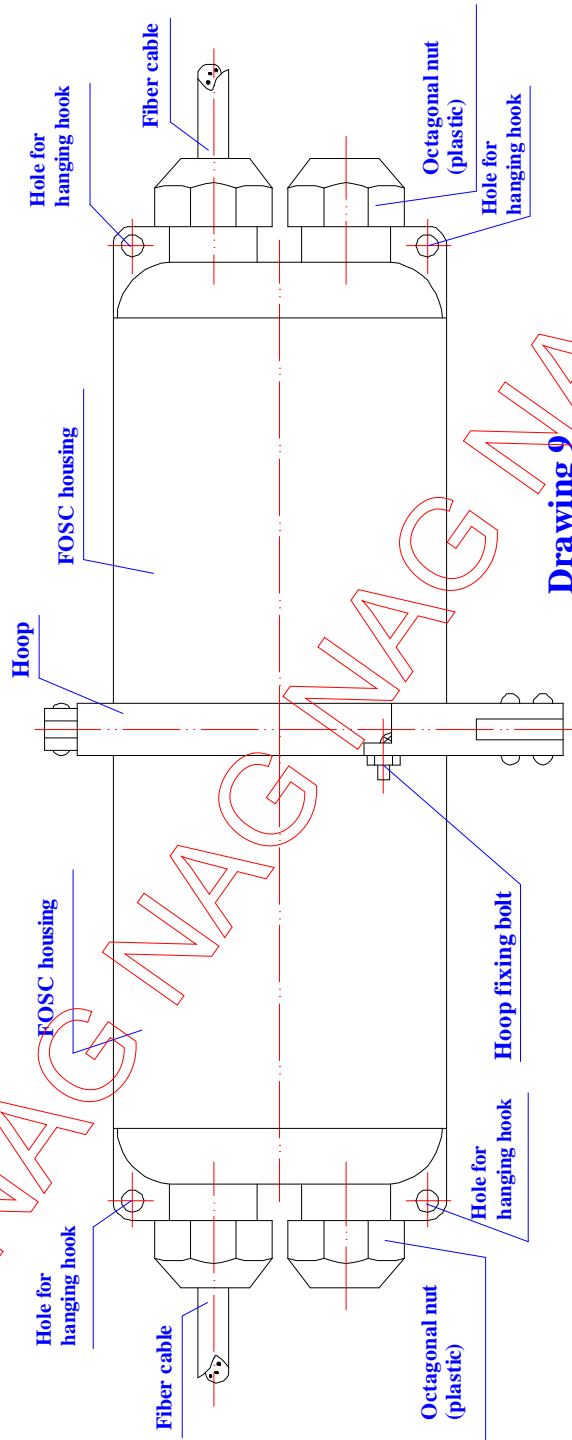

## 6. Fiber Optic Splice Closures (FOSC) inspecting and testing items

Inspecting item	Technical Requirements	Inspecting type	
		Routine test (Before leaving factory)	Type test
<b>Package</b>	Each small package contains one fiber optic splice closure, together with its accessories, tools, installation manual and packing list.	full	At least 3 sets sampled each time
<b>Appearance</b>	Intact in shape, no burrs, bubbles, chaps, pores, warps, impurities and other defects, all background colors should be even and continual.		
<b>Sign</b>	There is a clear sign on the housing, such as name and model of the product, etc.		
<b>Fiber storage device</b>	The fibers reserved are to be winded in fiber optic splice tray (FOST), the length of fibers housed in FOST is >1.6m, the curved radius is >30mm. During the installation and maintenance, there should be no attenuation on fibers.	At least 3 sets sampled each time	
<b>Electrical jointing device</b>	Inside FOSC: metallic components of fiber cables has the functions of electrical putting through, earthing connection and disconnecting. It is possible to install earthing deriving device outside the housing		
<b>Sealing performance</b>	After sealing according to the stipulated operation procedures, the injected air pressure is 100KPa±5Kpa, when immersed in clean water of normal temperature for 15 minutes, there should be no air bubbles, then observed for 24 hours, there should be no change of air pressure.		
<b>Re-sealing performance</b>	After reopening and resealing according to the stipulated operation procedures, the injected air pressure is 100KPa ± 5Kpa, when immersed in clean water of normal temperature for 15 minutes, there should be no air bubbles, then observed for 24 hours, there should be no change of air pressure.		
<b>Pull</b>	Bearing pull is $\cong$ 800N at axle orientation, there should be no breakage on the housing.		
<b>Punching</b>	Bearing pressure of 2000N/10cm for 1 minutes, there should be no breakage on the housing		

<b>Impact</b>	Bearing impact energy of 16N•m, 3 times of impacts there should be not breakage on the housing		
<b>Bending</b>	The spot between the FOSC and seal fitting can bear bending tension of 150N at bending angle of $\pm 45^{\circ}$ for 10 circles, there should be no breakage on the housing		
<b>Torsion</b>	Bearing torsion 50N•m, 10 circle at torsion angle $\pm 90^{\circ}$ . There should be no breakage on the housing.		
<b>Temperature circle</b>	Injected air pressure of 60KPa $\pm$ 5 KPa, the temperature circle ranging from -40 $^{\circ}$ C~+65 $^{\circ}$ C, 10 times of the circular tests (one circular consists of high temperature for 2 hours + indoor temperature for 2 hours + low temperature for 2 hours + indoor temperature for 2 hours ) when the pressure declines, the amplitude is $\leq$ 5Kpa, immerse the swatch in clean water of normal temperature for 15 minutes, there should be no air bubbles.	full At least 3 sets sampled each time	At least 3 sets sampled each time
<b>Voltage resistance strength</b>	After sealing the FOSC according to the stipulated operation procedures, immerse it in clean water of normal temperature in 1.5m depth for 24 hours, there should be no breakdown or arc over between the metallic components of the FOSC, between metallic components and the ground at DC 15KV for 1 minutes.		
<b>Isolating resistance</b>	After sealing the FOSC according to stipulated operation procedure, immerse it in clean water in 1.5m depth for 24h, the isolating resistance between the metallic components of the FOSC, between the metallic components and the ground should be $\geq 2 \times 10^4 M \Omega$ .		

## GUARANTEE:



## CONTACT:

**Address:** Building 118, Vonsovskogo Street 1, Yekaterinburg, Russia

**Tel:** +7(343) 379-98-38

**Fax:** +7(343) 379-98-38

**E-mail:** [info@nag.ru](mailto:info@nag.ru)

**Online shop:** <http://shop.nag.ru>