



*May 1998 Edition*

HP LaserJet Family  
Quick Reference  
Service Guide

---

Volume I



---

# HP LaserJet Family Quick Reference Service Guide

**Volume I**

© Copyright Hewlett-Packard  
Company 1998

All Rights Reserved.

Reproduction, adaptation, or  
translation without prior written  
permission is prohibited, except  
as allowed under the copyright  
laws.

Publication number  
5021-8943

First edition, May 1998

## **Warranty**

The information contained in this  
document is subject to change  
without notice.

Hewlett-Packard makes no  
warranty of any kind with respect  
to this information.

HEWLETT-PACKARD  
SPECIFICALLY DISCLAIMS  
THE IMPLIED WARRANTY OF  
MERCHANTABILITY AND  
FITNESS FOR A PARTICULAR  
PURPOSE.

Hewlett-Packard shall not be  
liable for any direct, indirect,  
incidental, consequential, or other  
damage alleged in connection  
with the furnishing or use of this  
information.

## **Trademark credits**

Adobe and PostScript are registered  
trademarks of Adobe Systems, Inc.,  
which may be registered in certain  
jurisdictions.

Microsoft® is a U.S. registered  
trademark of Microsoft Corporation.

MS-DOS® is a U.S. registered  
trademark of Microsoft Corporation.

UNIX is a registered trademark in the  
United States and other countries,  
licensed exclusively through X/Open  
Company Limited.

# Contents

<b>1</b>	<b>Control panel messages</b>	<b>7</b>
<b>2</b>	<b>Service mode</b>	<b>73</b>
<b>3</b>	<b>Power supply</b>	<b>81</b>
<b>4</b>	<b>Input/Output (I/O)</b>	<b>93</b>
<b>5</b>	<b>Media specifications</b>	<b>107</b>
<b>6</b>	<b>Toner cartridge information</b>	<b>121</b>
<b>7</b>	<b>Printer options and user replaceable parts</b>	<b>131</b>
<b>8</b>	<b>Service parts</b>	<b>147</b>
<b>9</b>	<b>Summary of service notes and technical tips</b>	<b>197</b>
<b>10</b>	<b>Image defects</b>	<b>273</b>
<b>11</b>	<b>Wiring diagrams</b>	<b>313</b>
<b>12</b>	<b>Services, support, and training</b>	<b>335</b>
<b>13</b>	<b>Hewlett-Packard LaserJet Companion</b>	<b>343</b>
	<b>Appendix</b>	<b>347</b>
	<b>Index</b>	<b>351</b>

# Ordering Other Manuals

This *HP LaserJet Family Quick Reference Service Guide* was created to help the LaserJet Service Engineer quickly troubleshoot common printer problems. While this reference is intended to provide all of the information the Service Engineer will need for on-site repair of HP LaserJet products, it is not intended to replace the service manual for any HP LaserJet product. For detailed information about the HP LaserJet products described in this guide, see the user guide or service manual for that product.

Service manuals for HP LaserJet products are available from the HP Support Materials Organization (SMO). The Service Parts Order Desk number is:

**(800) 227-8164 (U.S. Only)**

If you are located outside of the U.S., contact your local HP Sales and Service office.

# Supported Products

This service guide supports the following printers:

Printer Name	Printer Abbreviation
HP LaserJet Companion (minimal support only)	LJ Companion
HP LaserJet 6L	LJ 6L
HP LaserJet 5Si Mopier	LJ 5Si Mopier
HP LaserJet 5Si/5Si MX	LJ 5Si LJ 5Si MX
HP LaserJet 5L	LJ 5L
HP LaserJet 6P/6MP	LJ 6P LJ 6MP
HP LaserJet 5P/5MP	LJ 5P LJ 5MP
HP LaserJet 5/5M/5N	LJ 5 LJ 5M LJ 5N
HP LaserJet 4V/4MV	LJ 4V LJ 4MV
HP LaserJet 4P/4MP	LJ 4P LJ 4MP
HP LaserJet 4L/4ML	LJ 4L LJ 4ML
HP LaserJet 4+/4M+	LJ 4+ LJ 4M+
HP LaserJet 4/4M	LJ 4 LJ 4M
HP LaserJet 4Si/4Si MX	LJ 4Si LJ 4Si MX
HP LaserJet IIISi	LJ IIISi
HP LaserJet IIIP	LJ IIIP
HP LaserJet IIP+	LJ IIP+
HP LaserJet IIP	LJ IIP
HP LaserJet IIID	LJ IIID
HP LaserJet III	LJ III
HP LaserJet IID	LJ IID
HP LaserJet II	LJ II
HP Classic LaserJet (2686D)	LJ 2686D
HP Classic LaserJet (2686A)	LJ 2686A

## Note

The abbreviation for each printer name is used in the text.

Reference Name Used in this Guide	Model Number	Maximum Pages per Month	Service Manual Part Number
LJ 6L	C3990A	6K	C3990-99001
5Si Mopier, LJ5Si MX/5Si*	C3166A/C3167A C4076A/C4077A	100K	C4077-99015
LJ 5L	C3941A	4K	C3990-99001
LJ 6P/6MP* 5P/5MP*	C3150A/C3155A/ C3980A/C3982A	12K	C3980-99001
LJ 5/5M*/5N	C3916A/C3917A/ C3952A	35K	C3916-90984
LJ 4V/4MV	C3141A/C3142A	50K	C3141-90929
LJ 4P/4MP*	C2005A/C2040A	8K	C3980-90956
LJ 4L/4ML*	C2003A/C2015A	8K	C3980-90956
LJ 4+/4M+*	C2037A/C2039A	20K	C3916-90984
LJ 4/4M*	C2001A/C2021A	20K	C3916-90984
LJ 4Si/4SiMX*	C2010A/C2011A	75K	C2010-90939
LJ IIISi	33491	50K	C2010-90939
LJ IIIP	33481	8K	33481-90951
LJ IIP+	C2007A	8K	33481-90951
LJ IIP	33471	6K	33481-90951
LJ IIID	33459	20K	33459-90906
LJ III	33449	16K	33449-90906
LJ IID	33447	16K	33459-90906
LJ II	33440	12K	33449-90906
Classic LJ 2686D	2686D	15K	02686-90920
Classic LJ 2686A	2686A - 2686A+	12K	02686-90920

\*Macintosh-compatible



# 1

# Control panel messages

## Overview






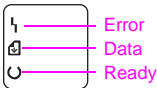









This chapter provides information on the display lights on the HP LaserJet 6L, 5L, 6P, 5P, and 4L printers and includes illustrations and detailed error codes for all printers. Error codes are listed as they appear on the printer display. Not all codes are included as many are self-explanatory.

### Note

Displays shaded in **color** represent primary lights. Displays that are not shaded represent secondary lights. To view the secondary lights on the printer, press **Go** and **Reset/Job Cancel** simultaneously.

# LJ 6L, 5L Printer Light-Emitting Diode (LED) Displays

See the legend that follows for a description of the error and the action to remedy it.

STATUS MESSAGES			
			
1. Error LED is on. (*Unclearable error)	2. Error LED is blinking.	3. All LEDs are blinking.	4. Data LED is blinking.
			
5. All LEDs are off.			
	<p>When all the lights are on, there is a Service error. Press and hold the front panel button to display the LED error code pattern. The code will be shown only while the button is pressed. The following pictures show the possible LED error patterns.</p>		
			
1. Error LED is on. (*Unclearable error)	2. Ready LED is on.	3. Error and Ready LEDs are on.	4. Error and Data LEDs are on.
			
5. Data LED is on.	6. All LEDs are on.	7. Data and Ready LEDs are blinking.	8. Formatter error.

\* An unclearable error is not strictly a service message. It will appear without all three lights being displayed first. See item 1 in the following table.

# Legend (6L, 5L Display Lights)

## Status Messages

Item	Description	Recommended Action
1	Paper out Door open No Electro-photographic (EP) cartridge Paper jam	See page 21 See page 18  See page 32 See page 26
2	Memory error	See page 34
3	Incompatible memory card	See page 49
4	Manual feed	See page 70
5	Sleep mode	See page 69

## Error and Service Messages

Item	Description	Recommended Action
1	Unclearable error Engine error	See item 1, above See page 39
2	ROM/RAM error	See page 50
3	Fuser error	See page 44
4	Beam error	See page 45
5	Scanner error	See page 47
6	Formatter PCA error	See page 57
7	Firmware error	See page 61
8	Formatter PCA error	See page 57

### Note

Before troubleshooting any service error, power cycle the printer to see if the error persists.

# LJ 6P Printer LED Displays

See the legend that follows for a description of the error and the action to remedy it. If both the error and data lights are lit, simultaneously press **Go** and **Reset/Job Cancel** to display the Data Error pattern.

LJ 6P Printer LED Displays											
<b>STATUS</b>											
<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	Tray 1 LED Blinking				<b>Error</b> <b>Data</b> <b>Ready</b> <b>Tray 1</b> <b>Tray 2</b>			
<b>CONTINUABLE ERRORS</b>											
<b>5</b>	<b>5-1</b>	<b>5-2</b>	<b>5-3</b>	<b>5-4</b>	<b>5-5</b>	<b>5-6</b>	<b>5-7</b>	<b>5-8</b>	<b>5-9</b>		
<b>SIMM ERRORS</b>											
<b>6</b>	<b>7</b>										
<b>FATAL ERRORS</b>											
<b>8</b>	<b>8-1</b>	<b>8-2</b>	<b>8-3</b>	<b>8-4</b>	<b>8-5</b>	<b>8-6</b>	<b>8-7</b>	* = Any other combination			
<div style="display: flex; justify-content: space-between;"> <div> <b>Primary</b></div> <div> <b>Secondary</b></div> </div> <p>* To view secondary lights press the <b>Go</b> and <b>Reset/Job Cancel</b> buttons simultaneously.</p>											

# Legend (6P Display Lights)

## Status Messages

Item	Description	Recommended Action
1	Paper out (Tray 1)	See page 21
2	Paper out (Tray 2)	See page 21
3	Printer open No toner cartridge Paper jam	See page 18 See page 32 See page 20
4	Manual feed	See page 70

## Continuable Errors

When the ERROR and DATA LEDs are on, press **Go** and **Reset** simultaneously. Follow the instructions for the secondary light patterns shown.

Item	Description	Recommended Action
5	Primary light pattern	See note on primary and secondary lights, page 13
5-1	Error 20 (memory overflow)	See page 34
5-2	Error 21 (print overrun)	See page 35
5-3	Error 22 (I/O error)	See page 36
5-4	Error 40	See page 38
5-5	Error 41.1, 41.2, 41.3	See page 40
5-6	Error 68, 68.1	See page 64
5-7	Error 51 (beam detect)	See page 45
5-8	Error 52 (scanner malfunction)	See page 47
5-9	Error 55	See page 53

## SIMM Errors

Remove all SIMMs and power cycle the printer. Retry the operation. Replace the SIMMs one at a time to locate the defective module. Refer to the Service Manual for details.

Item	Description	Recommended Action
6	Error 53-0 ROM error	See note below
7	Error 53-1 RAM error	See note below

## Fatal Errors

When the DATA, TRAY 2, TRAY 1, and ERROR LEDs are on, press **Go** and **Reset** simultaneously and follow the instructions for the secondary light patterns shown.

Item	Description	Recommended Action
8	Primary light pattern	See note on primary and secondary lights, page 13
8-1	Error 50 fuser	See page 44
8-2	Error 57/58 (main motor)	See page 54
8-3	Error 61.x (x=1, 2, 3 SIMM)	See page 58
8-4	Error 62.x (x=1, 2, 3 SIMM)	See page 59
8-5	Error 62.0	See page 58
8-6	Error 63, 64, 64, 65	See pages 59–60
8-7	All other errors	See pages 61–72

# LJ 5P Printer LED Displays

1

See the legend that follows for a description of the error and the action to remedy it. If both the error and data lights are lit, simultaneously press **Go** and **Reset** to display the Data Error pattern.

# LJ 5P Printer LED Displays

## STATUS

1

2

3

Error

Tray 1 (MP Tray)

Tray 2 (Paper Cassette)

Data

Ready

## CONTINUABLE ERRORS

4

4-1

4-2

4-3

4-4

4-5

4-6

4-7

4-8

4-9

## SIMM ERRORS

5

6

## FATAL ERRORS

7

7-1

7-2

7-3

7-4

Any Combination

8

Primary

Secondary

\* To view secondary lights press **Go** and **Reset**.

# Legend (5P Display Lights)

## Status Messages

Item	Description	Recommended Action
1	Paper out (Tray 1)	See page 21
2	Paper out (Tray 2)	See page 21
3	Printer open No toner cartridge Paper jam	See page 18 See page 32 See page 20

## Continuable Errors

When the ERROR and DATA LEDs are on, press **Go** and **Reset** simultaneously. Follow the instructions for the secondary light patterns shown.

Item	Description	Recommended Action
4	Primary light pattern	See note on primary and secondary lights, page 13
4-1	Error 20 (memory overflow)	See page 34
4-2	Error 21 (print overrun)	See page 35
4-3	Error 22 (I/O error)	See page 36
4-4	Error 40	See page 38
4-5	Error 41.1, 41.2, 41.3	See page 40
4-6	Error 68, 68.1	See page 64
4-7	Error 51 (beam detect)	See page 45
4-8	Error 52 (scanner malfunction)	See page 47
4-9	Error 55	See page 53



## SIMM Errors

Item	Description	Recommended Action
5	Error 53-0 ROM error	See note below
6	Error 53-1 RAM error	See note below

### Note

Remove all SIMMs and power cycle the printer. Retry the operation. Replace the SIMMs one at a time to locate the defective module. Refer to the Service Manual for details.

## Fatal Errors

When the DATA, TRAY 2, TRAY 1, and ERROR LEDs are on, press **Go** and **Reset** simultaneously. Follow the instructions for the secondary light patterns shown.

Item	Description	Recommended Action
7	Primary light pattern	See note on primary and secondary lights, page 13
7-1	Error 50 fuser	See page 44
7-2	Error 57/58 (main motor)	See page 54
7-3	Error 61.1/62.1	See page 58
7-4	All other errors	See 79 Error, pages 61-71
8	Error 63 service error	See page 59

# LJ 4L Printer LED Displays

## Recoverable Errors

For more details, see the page number provided.

<p><b>LED Legend</b></p>			
<p><b>RECOVERABLE ERRORS</b> (Displayed on single lights)</p>			
<p>Paper Out (See page 23)</p> <p>Paper LED on steady.</p>	<p>Printer Open (See page 24)</p> <p>Error LED on steady.</p>	<p>Paper Jam (See page 26)</p> <p>Paper LED is blinking.</p>	<p>21 Print Overrun (See page 35)</p> <p>Error LED is blinking.</p>
<p><b>SERVICE ERRORS</b> (Displayed while pressing front panel button)</p>			
<p>Service Error</p> <p>All 4 LEDs are on.</p> <p>When all four lights are on, a service error is indicated. Press and hold the front panel button to display the error code. The code will be shown only while the button is pressed. The following pictures show the possible error codes.</p> <p><b>NOTE:</b> If all four lights remain on, yet no error code is displayed when pressing the button, power cycle the printer. If the condition persists, replace the formatter PCA.</p>			
<p>50 Error/Service (See page 42)</p> <p>Ready and Error LEDs are on.</p>	<p>51 Loss of Beam Detect (See page 45)</p> <p>Data and Error LEDs are on.</p>	<p>52 Incorrect Scanner Speed (See page 47)</p> <p>Paper and error LEDs are on.</p>	<p>53 Accessory Memory Error (See page 49)</p> <p>Data LED is on.</p>
<p>55 Engine (See page 53)</p> <p>Error LED is on.</p>	<p>58 Fan (See page 56)</p> <p>Ready, Data, and Error LEDs are on.</p>	<p>61.x Formatter (See page 58)</p> <p>Error LED is off; other LEDs display a pattern.</p>	<p>Blank Display (See page 68)</p> <p>All LEDs are off.</p>

# 4L-Specific Error Configurations

## Priority of Errors

Each error has a priority in relation to the others. If more than one error condition occurs at the same time, the highest priority error will be displayed. The priority of errors is as follows:

### Service Errors

- 1 Formatter PCA
- 2 RAM
- 3 Engine
- 4 Scanner
- 5 Beam
- 6 Fan

### Recoverable Errors

- 1 Door Open/No Toner Cartridge
- 2 Paper Jam
- 3 Paper Out
- 4 Memory Error
- 5 Manual Feed

### Note

Before troubleshooting any Service error, power cycle the printer to see if the error persists.

# Error Codes

## Clear Staple Jam

### 5Si Mopier

- Clear the jam.
- Check the staple cartridge.
- Check the stapler and cabling.
- Check the stapling unit control's printed-circuit assembly (PCA).
- Replace the entire stapling unit as required.

## Close Printer Cover/Printer Open

### All Printers

- The printer door is open.
- Check that the toner cartridge is fully seated and that the covers are firmly closed.
- The direct current (DC) power supply is defective.
- The DC controller is defective.
- The actuator or tab is missing or broken.
- The paper control printed-circuit assembly (PCA) is defective.

## Install Toner Cartridge/No Cartridge

### All Printers

- Reseat or install a new toner cartridge.
- The high voltage contacts are dirty or defective.
- The high voltage power supply is defective.

### LJ 5

- The DC Controller is defective.

## Install Tray 2

### LJ 5

- The lower cassette (Tray 3) is selected and the printer has detected that the paper cassette (Tray 2) is not installed.
  - Install or reseal the paper cassette (Tray 2), which is the paper guide for the lower cassette (Tray 3).
- The paper cassette (PC) is improperly fitted.
  - Firmly reseal the PC.

## Out of Staples Optional Output X

### 5Si Mopier

- Replace the staple cartridge.
  - If the message continues after the cartridge has been replaced, check the stapler, top cover assembly, and cabling.
- Check the stapling unit control PCA.
- Replace the entire stapling unit if required.

## Output Operation Condition x.yy

### 5Si Mopier

x=output device number

yy=condition code

For the multibin mailbox:

01 = face-up tray not installed

### Note

See also the section on troubleshooting the 2,000-sheet input unit and multibin mailbox/mailbox with stapler.

## Remove Paper Jam

### LJ 5

- See 13 Paper Jam—all printers
- The rear door is open.
- The cassette paper out sensor flag is broken or missing.
- The 500-sheet lower cassette is not properly adjusted (see service note C2001A-04).
  - Adjust the tray, using the instructions in the service note.
- Check the transfer roller to ensure that it is properly seated.
- The input sensor (PS1) or fuser exit sensor (PS3) is bad; or with jams from the MP tray (Tray 1), the paper end sensor (PS5) is bad.

## Staple Limit Reached

### 5Si Mopier

- Send print jobs of only 20 pages or fewer to the stapler.

## Stapler Align Error

### 5Si Mopier

- Remove the paper from the stapler and re-send the job.

## Stapler Malfunction

### 5Si Mopier

- Clear the stapler jam and re-send the job.

## Stapler Supply Out

### 5Si Mopier

- Load a new staple cartridge.

## Toner Low

### 5Si, 5

- The toner is uneven in the cartridge.
- The toner cartridge contact points are malfunctioning.
- The high-voltage power supply (HVPS) is defective.

## Tray x Empty/x Load/Paper Out

### All Printers

- The paper tray is empty or is seated incorrectly.
- The sensor arm is stuck or broken.
- The tray-size sensor is defective or configured incorrectly.
  - Verify the tray tabs and switches at the right rear (or right front) of the tray slot, or configure the tray from the control panel.
  - The paper control/sensor PCA is defective.

## Warming Up

### 5Si, 5

- Separate all accessories.
- Power cycle the printer.
- The formatter PCA is defective.
- The DC controller is defective.
- The power supply is defective.

## 02 Warming Up (if 3 Minutes)—See also 50 Error

### 4V

- The Input/Output (I/O) cable is hooked up incorrectly or there is bad I/O in the computer.
  - Remove the I/O cables and power cycle the printer.
- There are defective component(s).
  - Replace the fusing assembly if it is not warming up the DC controller, PCA power supply, or formatter PCA.

### 4Si/IIISi

- The display cable or formatter PCA is defective.

### IID, II

- The I/O cable is hooked up incorrectly or there is bad I/O in the computer.
  - Remove the I/O cables. Replace the formatter PCA.

### 2686A/D

- The DC power supply/main motor drive is defective.



### All Printers

- The paper tray is empty or is seated incorrectly.
- The sensor arm is stuck or broken.
- The tray-size sensing or configuration is defective.
  - Verify the tray tabs and switches are at the right rear (or right front) of the tray slot, or configure the tray from the control panel.
- The paper control/sensor PCA is defective.

### 4L

- The paper cassette is empty or missing.
- The paper cassette is seated incorrectly.
- The paper out flag PS2 is broken or stuck.
- The DC controller PCA is defective.
- Tray 1 (the MP tray) is empty.
  - Add paper to Tray 1; then press **Go** to continue.
- Tray 2 (the paper cassette) is empty.
  - Add paper to the tray if it is on continuously; verify that the sensor flag movement is not hindered.

## 12 Printer Open

### All Printers (Exceptions: 4P, IIIP, IIP Plus, IIP)

- The printer door is open.
  - Check that the toner cartridge is fully seated and that the cover is firmly closed.
- A DC power supply malfunction or DC controller malfunction occurred.
- Tab is missing on the top cover; replace the tab.

### 4V

- Check the front Door Open sensor flag sensor; it could be broken or stuck.
  - PS402 is located on the small Front Door Unit Terminal PCA, on the front door under the transfer roller.
- A toner cartridge microswitch malfunction has occurred.
  - Check the toner cartridge microswitch (SW501) on the high voltage PCA.
- A DC controller PCA malfunction has occurred.

### 4 Plus, 4

- The plunger is missing on the top cover.
- A paper control PCA malfunction has occurred.

### 4Si, IIISi

- A PS1 malfunction has occurred.
  - Check that the PS1 is blocked by the latch flag. Replace the PS1 if it is defective.
- The fuser bulb has burned out.
  - Check to see if the fuser bulb turns on. If the fuser bulb does not turn on, reset SW101 on the AC power supply.
- A DC controller PCA malfunction has occurred.

### 4P

- The top cover is open.
- The toner cartridge is not installed.
- There is a defective interlock switch assembly.

### 4L

- Part of the top door that pushes the plunger down is broken.
- The top door switch (plunger assembly) is broken.

### IIIP, IIP Plus, IIP

- The paper path door or top cover is open.
  - Close the paper path door or top cover.
- A toner cartridge is not installed or it is not seated.
  - Replace or reseat the toner cartridge.
- There is a defective fan, PS4, or PS5.
- The external fuser access door is not closed.

## 13 Paper Jam/Remove Paper Jam

### All Printers

- The media does not meet HP specifications.
- The paper path is dirty or obstructed.
  - Clean the paper path components; ensure that the transfer roller is seated properly.
- The pickup (or other) rollers and/or the separation pad is worn.
- The paper is the wrong length or the paper size is selected incorrectly in the software.
- The exit sensor or flag is defective.
- A defective input (paper-out) sensor does not sense that the printer is out of paper.
- The paper cassettes are not correctly loaded.
- The solenoid operation is bad.
  - Verify proper solenoid operation and replace if necessary.
- The gear(s) is bad or not meshing in the drive train.
  - Replace the bad gear(s) or check the toner cartridge gears for damage.
- The main motor or drive circuit is bad.
- The delivery mechanism or the coupler gear to the main drive is bad.
- The main motor drive circuitry is bad.
- The DC controller is defective.

## 5L, 6P, 5P

- If all of the flags move properly and the connectors are seated, but the error persists, replace the DC controller.

## 6P, 5P

- There are paper fragments under the oblique rollers (top or front).
  - Remove the rollers and the paper fragments.

## 4V

- The toner cartridge gears are worn or damaged.
- The paper path gears are worn or damaged.
- The DC controller PCA is defective.
- The registration guide is defective.

## 4P, 4L

- The rear door of the printer is open.
- The flags/sensors are stuck or broken.
- There are paper fragments under the oblique rollers (top or front).
  - Remove the rollers and clear out the paper.
- The transfer roller guide is not seated.

## 4 Plus, 4

- The rear door is open.
- The cassette paper-out sensor flag is broken or missing.
- The 500-sheet lower cassette is improperly adjusted (see service note C2001A-01A).
  - Adjust the tray according to the service note instructions.
- The transfer roller is seated improperly.
- There is a bad input sensor (PS1) or fuser exit sensor (PS3); or with jams from the MP tray (Tray 1), a bad paper-end sensor (PS5).
- The output rollers (service note C2001A-03A) are defective.

## IIID, III, IID, II

- The registration assembly is defective.
- The fuser is defective.

## IIID, IID

- The duplex paper path is obstructed or contains worn components.
- The switchback assembly is misadjusted or bent.

## III, II

- The sensor cable is defective.
  - Replace the fuser to the DC controller cable (RG1-0907-000CN).

## 2686D/A

- The separation belt is broken.
- The transfer guide assembly is defective.
- The paper pickup clutch is turning more than once.
  - Disassemble the clutch and re-grease. **NOTE:** If one clutch needs re-greasing, it is likely that they all do.
- The registration shutter is stuck.
- The rear paper guide door is worn.
  - Replace the worn paper rollers or readjust the rear door.
- The front paper guide door is worn or misadjusted, preventing paper from getting to the registration assembly on time.
  - Readjust the front paper guide door.

## 13.1 Internal, 13.2 Input, 13.3 Duplex, 13.4 Output

### 4Si, IISi

- Media is not picked up, or media is jammed in the printer.
  - Check and clean the entire paper path.
- Media is in the duplex unit.
  - Check the paper input path and paper re-feed from the sensor PS2 duplex unit.
- A sensor malfunction has occurred.
  - Check the PS4 or PS5 in the duplex or switchback, respectively.
- An output sensor malfunction has occurred.
  - Check the PS7 in the output area Optional Power Stacker.
- Check the registration area: fuser-exit sensor flag and sensor.
  - Install a user maintenance kit (110 V - C2062A, 220 V - C2087A).

## 13.x Paper Jam

### 5Si

#### Note

When troubleshooting the LJ 5Si, always troubleshoot the error log message. See the LJ 5Si service manual for detailed error log information.

X=Location of jam

0=Non-specific jam

1=Paper feed/paper late jam—paper late arriving at PS 2, which is located in the paper pickup unit. Inspect the paper path. Verify flag movement.

2=Paper feed/paper late jam—paper late arriving at PS 2, which is the registration photo sensor. Remove the toner cartridge and lift up the green lever to access the sensor flag. Verify flag movement.

3=Fuser output paper late jam—paper late arriving at PS 1403, which is in the fusing assembly. Verify flag movement.

4=Fuser output, paper jam.

5, 6=Duplex module paper jam. PS 1402 face-down delivery photo sensor is located in the face-down delivery assembly. Inspect the diverter drive assembly. Verify that the paper path from the fuser to the top of the face-down bin is clear and that the flag moves freely.

7-10=Duplex module paper jam. The paper is diverted to the duplex module after leaving the fusing assembly. The paper is turned around in the duplexer and re-fed into the printer's paper path. Reset the duplex module. If the problems persist, replace the complete duplex assembly.



#### 11=External input device paper jam

If the control panel displays a 13.11 paper jam message, the printer will list additional error codes in the error log. These can be printed or viewed.

A 2000-Sheet Input Tray Paper Jam error is related to the first device in the C-Link daisy chain. In the supported configuration, this device should be the 2000-sheet high-capacity tray. Verify that Tray 4 lifts to its feed position. Inspect the flags in the vertical transfer door.

#### 12=External output device paper jam

If the control panel displays a 13.12 Paper Jam message, the printer will list additional error codes in the error log. These can be printed or viewed.

Multibin Mailbox/Stapler paper jam. The error is related to the second or third device on the C-Link daisy chain. In the supported configuration, the second device should be the Multibin Mailbox. Verify that all bins are in position and that the “scan bar” is complete. Verify that the Multibin Mailbox completes its power-up sequence. In the supported configuration, the stapler is the third device in the C-Link daisy chain. Verify that the stapler completes its power-up sequence.

13=Fuser accordion jam. Inspect the paper path before and after the fuser.

14=Printer could not auto-eject the paper. Inspect the entire paper path for paper or debris.

## 14 No EP Cartridge or No Toner Cartridge

### All Printers

- A toner cartridge is not installed or the cartridge is not fully seated.
- The sensitivity tabs are missing (except 4 Plus, LJ 4, and 2686).  
Replace the toner cartridge.

### 4V

- The toner cartridge microswitch (SW501) on the high-voltage PCA is defective.
- The front-door-open sensor flag sensor is malfunctioning. PS402 is located on the small Front Door Unit Terminal PCA, on the front door under the transfer roller.
- The DC controller PCA is defective.

### 4 Plus, 4

- The toner cartridge is defective.
- The HVPS is defective or there are dirty or misaligned contacts.

### 4Si, IIISi

- Check the tabs on the right side of the toner cartridge. At least one of the two tabs must be present.
- The support tab of the switch actuator, which is located on the upper-right corner of the DC controller, is bent or installed incorrectly.
- The HVPS is defective.

### IIID, III, IID, II

- The paper control PCA is defective.

### 2686A/D

- The cassette microswitch is defective.

## 16 Toner Low

### All Printers

- The toner in the toner cartridge is uneven.
- The toner cartridge contact points are malfunctioning.
- The HV power supply is defective.

### 4Si, IISi

- The door-open sensor flag is defective.
  - Replace the PS1.
- The toner level sensor connector is damaged.
  - Replace the toner level sensor.
- The toner cartridge is defective.
- The DC controller PCA is defective.

### III, II

- The cable is defective.
  - Replace the DC controller to the HV power supply cable (part number RG1-0906-000CN).

## 18 MIO Not Ready

### All Printers

- The printer is not connected to an active LAN.
  - Connect the printer to a LAN or terminate the connection, using a BNC T-connector with two 50-ohm resistors.
- The MIO card is misaligned or defective.
  - Reseat or replace the MIO card.

## 18 MIO Initialization

### All Printers

- The error message remains on after 5 minutes.
  - Check the network card or host.

## 20 Error/Memory Overflow

### All Printers

- A large print job exceeds memory capacity.
  - Verify that the SIMMs are seated. Add memory, remove soft fonts, decrease resolution, or simplify the print job. Adjust the settings for Image Adapt and Page Protect, if available.

### 6L/5L

- Set the enhanced input/output (I/O) to auto mode (printer command language [PCL] mode).
  - Re-send the print job. If the auto-continue variable is on within the printer job language (PJM), the printer will continue to print after 10 seconds. If it is off, press the front panel button to continue printing.

### LJ 5

- There is too much data or the data is too complex.
  - Turn Image Adapt and Page Protect to On or Auto. (This can be set within the remote control panel.) Press **Go** to resume printing.

## 21 Error/Print Overrun

### All Printers

- There is too much data or the data is too complex.
  - Simplify the print job or add memory.

### 6L, 5L, 6P, 5P

- Use the remote control panel to turn Page Protect to Auto or On.

### 5Si

- There is too much data or the data is too complex.
  - Enable Page Protect from the control panel and from the software. (This may require additional memory.)

### LJ 5

- There is too much data or the data is too complex.
  - Turn Image Adapt and Page Protect to On or Auto. (This can be set within the remote control panel.) Press **Go** to resume printing.

### 4L

- There is too much data or the data is too complex.
  - Reduce the complexity of the print job.
- The print job is too complex.
  - Turn Image Adapt and Page Protect to On or Auto. (This can be set within the HP Explorer remote control panel.)
- There is not enough memory.
  - Add the optional memory module.

### 4M Plus, 4 Plus, 4M, 4

- There is too much data or the data is too complex.
  - Enable Page Protect from the control panel and from the software. (This may require additional memory.)

### **III, IIID, IIIP**

- There is too much data or the data is too complex.
  - With 1 MB extra memory, enable Page Protect.

## **22 Error/ I/O Configuration Error/Par I/O Error/MIO Error**

### **All Printers**

- The I/O configuration for the computer or printer is incorrect.
  - Refer to the service manual for the proper configuration.
- The I/O Cable is wrong or damaged.
  - Replace the I/O cable with the specified (IEEE-1284) cable.
- The computer is turned off.
  - Turn the computer on.
- The printer I/O port is damaged.
  - Replace the I/O PCA or formatter PCA.

### **5Si**

- A non-HP modular input/output (MIO) device is being used.
  - Replace with an HP MIO device.

### **6P, 5P, 5, 4 Plus**

- The computer and printer are not communicating because of improper signal protocols. This indicates a loose cable connection or a bad or poor-quality cable.
  - Reseat the cable and make sure you are using a high-quality cable (IEEE-1284).

## 23 I/O Not Ready

### All Printers

- The I/O card is unable to accept data or it is not connected to the network.
  - Check the I/O card seating and replace if necessary.

## 24 Job Memory Full

### All Printers

- There is too much data or the data is too complex.
  - Add memory or simplify the print job.

## 25 XXX Memory Full

### All Printers

- There is too much data or the data is too complex.
  - Add memory or simplify the print job.

## 30 PS Error 16

### All Printers

- An I/O timeout or prompt for user interaction (for example, manual feed) has been exceeded.
  - Check the I/O connections; check if media requests are being made.

## 30 PS Error 22 or 25

### All Printers

- An unexpected PostScript firmware error has occurred.
  - Replace the PostScript SIMM.

## 30 PS Error XX (all others)

### All Printers

- A PCL file is being sent to the printer while it is in PostScript mode, or a PostScript file or application error has occurred.
  - Check the configuration, application, and print files.

## 30.1.1 Disk Failure

### 5 Si

- The optional disk failed a self-test.
  - Press **Select** to continue.

## 40 Error (data transfer error)

### All Printers

- The computer and printer may be set to different baud rates.
  - Refer to the service manual to reset the baud rates.
- The computer is turned off.
  - Turn the computer on.
- The MIO card is unseated or defective.
  - Remove, reseal, or replace the MIO card.
- An abnormal connection break occurred while transferring data from the computer.
  - Press **Continue** or **Go** on the printer to clear the error message.



## 40.x MIO Error

### 5Si

- An abnormal connection break in the specified MIO card occurred.  
If x=1; HP MIO port 1 (upper slot)  
If x=2; HP MIO port 2 (lower slot)
  - Press **Select** to continue, or power cycle the printer. If the error persists, replace the MIO card.

## 41 Error (temporary print engine failure)

### All Printers

- A momentary error has occurred.
  - Press **Continue** or **Go** to reset the printer.

### 6L, 5L

- Temporary Error
  - Power cycle the printer. If the error persists, reseal the formatter PCA to the DC controller PCA.
- Engine Error
  - Replace the formatter PCA. If the error persists, replace the DC controller PCA.

### 6P, 5P

- A temporary error occurred while printing.
  - This error most commonly occurs when the printer picks two sheets of paper at once. The page containing the error is reprinted automatically. Remove the page from the output tray and press **Go** on the printer.

### IIIP, IIP Plus, IIP

- Paper feed problems have occurred.
  - Check the paper feed, especially the operation of the PS1.

## **IIIP, IIP Plus, IIID, III, IID, II**

- The fiber optic cable is bent or broken.

## **IIP**

- For service notes between 2925J00000 and 3047J99999:
  - Replace the fusing assembly.

## **IIID, III, IID, II**

- There is a bad laser scanner or a bad laser scanner cable.
  - Replace the cable assembly from the DC controller to the laser scanner.

## **2686D/A**

- The laser power is misadjusted.
  - Refer to the service manual to adjust the laser power.

## **41.1 or 2 Error, 41.3 Error**

### **All Printers**

- There are defective connections.
  - Reseat J205, J206, J207, and laser scanner connections.
- There is a paper multifeed or the wrong size of paper is being used.
  - See service notes C2001A-01 and -02 (for LJ4 and 4+).
- The paper size selection does not match the installed paper.
- One of the cassettes is overfilled or improperly adjusted.
  - Remove the paper from the cassette. Readjust the cassette.
- The paper does not meet HP specifications.

## 41.4 or 5 Error

### All Printers

- The DC controller or formatter PCA is defective.

### IIISi/4Si

- The tab on the toner cartridge is broken.

## 41.x Error

### 5Si, 5

- If x=1: Defective connections:
  - Reseat J205, J206, J207, and the laser scanner connections.
- If x=2: Beam detect malfunction:
  - Reseat the connectors, including the laser scanning assembly.
- If x=3: Paper size selection does not match installed paper or paper multifeed:
  - Check for paper jams, multifeeds, or misfeeds.  
Insert paper that is the correct size.  
One of the cassettes is overfull or improperly adjusted.
- If x=4: Sync error:
  - Reseat the DC controller and the formatter PCA connections.
- If x=5: Video sync or undetermined error:
  - Reseat the DC controller and the formatter PCA connections.

## 50 Error/50 Service (fuser malfunction)

### All Printers

- A temporary error has occurred.
  - Turn the printer off for 20 minutes to clear the temporary 50 Error.
- The power is low or unstable (for example, in a brownout).
  - Locate and verify a stable power source.

### 6L, 5L

- Check the resistance between pins 1 and 2 from connector J102 of the DC controller and the thermistor.
  - If there is no resistance, replace the heating element. If the resistance is correct, replace the DC controller.

### 6P, 5P

- The fuser is defective.
- The DC controller is defective.

### LJ 5, 4 Plus, 4

- The fuser or power supply is defective.
  - if the problem persists, replace the fuser and then replace the power supply.
- A temporary error has occurred.
  - Short the C202 (LJ 4) or C205 (LJ 4 Plus) on the DC controller to bypass the Error 50 time delay.

### 4V, 4L, 4P

- The fuser is improperly seated.
- The fuser is defective.

## 4Si, IIISi

- The fuser is improperly seated.
- The connector J201 is improperly connected.
  - Reseat the connector J201 on the sensor PCA.
- The SW 101 is disengaged.
  - Check the SW101 to make sure it is engaged with the top cover closed.
- A temporary error has occurred.
  - Turn the printer off. Short the DC controller CP005 to bypass the Error 50 time delay.

## IIIP, IIP Plus, IIP

- The fuser assembly is defective.
- A temporary error has occurred.
  - Turn the printer off. Short the C212 on the DC Controller to bypass the Error 50 time delay.
- The power supply is defective.

## IIID, III, IID, II

- The fuser is defective.
- The AC power module is defective.
- A temporary error has occurred.
  - Turn the printer off. LJ II only: Short the C211 on the DC controller to bypass the Error 50 time delay. LJ IID only: Short the C216 on the DC controller to bypass the Error 50 time delay.

### III, II

- There is a defective fuser to the DC controller cable (hot fuser or blown thermoswitch).
  - Replace the cable fuser to the DC controller (part number RG1-0907-000CN).
- Check the fuser to the AC power module cable (cold fuser).
  - Replace the cable DC controller to the AC power module (part number RG1-0912-000CN).
- The +24VA is missing.
  - Check the voltage and replace the DC power supply as necessary.

### 2686A/D

- There is a blown 47 Ohm resistor.
  - Replace the plug-in resistor on the fuser safety PCA (part number FF1-3872-000CN).
- The fuser bulb is defective.
- The fuser safety PCA is defective.

## 50.x Fuser Error

### 5Si

- Fuser malfunction.
  - If x=1: Fuser low temperature failure.
  - If x=2: Warm up failure.
  - If x=3: Over temperature failure.
  - If x=4: Bad fuser.
- Turn the printer off for 20 minutes, and then turn it back on.  
Verify that the fuser is installed correctly and fully seated.  
Reseat or replace the fuser cable assembly.

## 51 Error (loss of beam detect)

### 6L, 5L, 6P, 5P, 4P, 4L

- A temporary error has occurred.
  - Power cycle the printer.
- The laser scanner assembly is not seated.
- The laser scanner assembly is defective.
  - Replace the laser scanner assembly (or cable on the 5L only).
- The DC controller PCA is defective (5L, 5Si only).

### LJ 5, 4Plus, 4

- The laser scanner cable connectors are faulty.
- The laser scanner assembly is defective.

### 4V

- There is a problem with the fiber optic cable.
- The laser scanner assembly is defective.

### 4Si, IIISi

- The toner cartridge is defective.
- There is a problem with the fiber optic cable.
- The connectors are faulty.
  - Reseat the connectors J002 on the DC controller and the J601 on the laser drive PCA.
- The DC voltage is poor.
  - Verify that the 12 VDC is present on the J601-2 of the laser drive PCA.
- The laser scanner assembly is defective.

## IIIP, IIP Plus, IIP

- The toner cartridge is improperly seated.
- The laser shutter operation is functioning improperly.
- The fiber optic cable is damaged.
- The laser PCA is bad.

## IIID, III, IID, II

- The toner cartridge is defective.
- There is a bad cable in the laser scanner to the DC controller.
  - Replace the cable in the laser scanner to the DC controller (RG1-0908-000CN).
- The fiber optic cable has cuts or kinks.
- The laser scanner assembly is defective.

## 2686D/A

- The laser or laser power setting is defective.
- The scanner is defective.

## 51.x Error

### 5Si

- Laser subsystem problem.
  - If x=1: Beam detect malfunction.
  - If x=2: Laser malfunction.
    - Press **Select** to resume operation. If error persists:  
Check the cable from the DC controller to the laser scanner.  
Replace the laser scanner assembly.  
Replace the DC Controller PCA.



## 52 Error (incorrect scanner speed)

### 6L, 5L, 6P, 5P

- A temporary error has occurred.
  - Power cycle the printer.
- The scanning assembly is improperly fitted.
- A problem has occurred with the scanner cable.
- The laser scanner assembly is defective.
- The DC controller PCA is defective.

### LJ 5

- The laser scanner cable is faulty.
- The laser scanner assembly is defective.

### 4V, 4Si, IIISi

- The cable assembly is faulty.
- There is a scanner motor problem.
  - Listen for the scanner motor to start up, and watch for the LED 003 on the DC controller to illuminate (4Si, IIISi).
- The laser scanner assembly is defective.
- The DC controller PCA is defective.

### 4P, 4L

- A temporary error has occurred.
  - Power cycle the printer.
- The scanner assembly is improperly fitted.
- There is a scanner cable problem.
- The laser scanner assembly is defective.
- The DC controller PCA is defective.

## 4 Plus, 4

- The laser scanner cable is faulty.
- The laser scanner assembly is defective.

## IIIP, IIP Plus, IIP

- The scanner motor is bad.
- The DC controller is bad.

## IIID, III, IID, II

- The laser scanner cable to the DC controller is defective.
  - Replace the cable assembly (part number RG1-0908-000CN).
- The laser scanner assembly is defective.

## 2868A/D

- The scanner assembly is defective.

## 52.x Error

### 5Si

- Scanner subsystem problem.
  - If x=1: Scanner startup failure.
  - If x=2: Scanner rotation failure
    - Switch the printer off and then back on.
  - If the error continues:
    - Check the cable from the DC controller to the laser scanner assembly.
    - Replace the laser scanner assembly.
    - Replace the DC controller PCA.

## 53 Error (accessory memory error)

### 4Si, IIISi

- A temporary error has occurred.
  - Power cycle the printer.
- A laser malfunction has occurred.
  - See 51 Error recommendations.

### IIIP, IIP Plus, IIP

- 53 Error Memory Unit 1 (on the top).
- 53 Error Memory Unit 1 (on the bottom).

### IIID, III

- There is a failure in the front memory slot. (53.1 Error)
- There is a failure in the rear memory slot. (53.2 Error)

### IID, II

- An accessory memory failure has occurred.

### 2686D/A

- A laser temperature malfunction has occurred.

## 53.XY.ZZ Error

### 6L/5L

- An error has been found in the RAM or ROM.
  - Power cycle the printer.
- The memory card is defective or incompatible.
  - Turn off the printer, remove any additional memory, then turn the printer back on. If the message clears, replace the memory card.
- The formatter PCA is defective.

### 5Si, 6P, 5P, 5, 4V, 4P, 4Plus, 4, 4Si

- A SIMM malfunction has occurred.
  - Verify that the SIMM board is installed correctly. Replace the SIMM that caused the error.

**Table 1-1 53.XY.ZZ Error for 5, 5Si, 4 P, 4 Plus, 4, 4Si**

<b>x (Hardware Type)</b>	<b>zz (Error Number)</b>
x=0, ROM	0=Unsupported memory 1=Unrecognized memory
x=1, RAM	2=Unsupported memory size 3=Failed RAM test
x=2, Flash	4=Exceeded maximum RAM size
<b>Y (Hardware Device)</b>	5=Exceeded maximum ROM size
y=0 Internal mem. (Formatter PCA)	6=Invalid SIMM speed 7=SIMM reporting information incorrectly
y=1 SIMM Slot 1	8=SIMM RAM parity error
y=2 SIMM Slot 2	9=SIMM ROM mapped to an unsupported address
y=3 SIMM Slot 3	10=SIMM address conflict
y=4 SIMM Slot 4	11=ROM out of bounds 12=Could not make temporary mapping

### Note

An Error 53.1y.08 generates if HP LJ 4P Plus memory is installed in an HP LJ 4.

## 4L

- An error has been found in the RAM (or ROM: 5L only).
  - Power cycle the printer.
- The memory card is defective or incompatible.
  - Turn the printer off; remove any additional memory; then turn the printer back on. If the message clears, replace the memory card.
- The formatter PCA is defective.

## 54 Error

### 5Si

- The duplexer is defective.
  - Replace the duplexer.

### IID, IIID: Duplex Feed Error

- The duplex shift plate is improperly fitted.
  - Check the duplex shift plate for correct position and operation.
- The PS5 or SL4 is bad.
  - Verify proper operation and replace as necessary.
- There is a defect in the main motor.
  - Replace the main motor or the power supply or main drive motor PCA.

### 2686 D/A: Main Motor Stall

- The input tray is too full.
  - Remove some of the paper.
- The fuser drive gears are bent or locked up.
  - Adjust or replace the fuser drive gears.
- The main motor has problems.
  - Replace the main motor.

## 55 Error (internal communication problem)

### All Printers

- The cable is loose or bad.
- The DC controller PCA is defective.
  - Replace the DC controller PCA. **Note:** Error 55 on a LJ Series II requires replacing **both** the DC controller and the Interface PCA at the same time.
- The formatter PCA is defective.
- The paper input PCA is defective.
- The main motor is defective.
- There is inadequate site power (or the problem may be the result of thunderstorms). Examine the surge protector.
  - Replace the DC controller PCA and/or the formatter PCA if necessary.

### 4V

- The laser scanner assembly is defective.

### 4Si, IIISi

- The connectors are improperly fitted.
  - Check and reseat the connectors J4 and J5 on the low-voltage power supply. Check J8, J9, J10, and J15 on the DC controller PCA
- Cable is loose or faulty.
  - Check and reseat the cable between the DC controller and formatter PCAs.
- The DC controller is defective.
- The DC power supply is defective.
- The formatter PCA is defective.
- The paper input PCA is defective.
- The main motor is defective.

## 2686D/A

- The interface or formatter PCA is defective.

## 56 Error

### 4Si, IIISi

- An attempt is being made to print envelopes while the printer is in duplex mode.

### IID, IIID

- The output selector knob is not in duplex position.

## 56.x Error

### 5Si

- An invalid input source or output destination has been selected.  
If x=1: invalid input source.  
If x=2: invalid output destination.
  - Check the input and output devices.  
Reselect a valid device.

## 57 Error

### 6L, 5L

- The memory card is incompatible.
  - Remove the card and replace it with a 1, 2, 4, or 8 MB, 5V, 70 nanosecond (nsec.) or faster card.

### 6P, 5P, 5

- The main motor is not functioning properly.
  - Check for any binding in the motor or gear train. Check the connection to the DC controller, and then replace the main motor or the DC controller as necessary.



## 4L, 4

- The main motor is not functioning properly.

## IIIP, IIP Plus, IIP (57 Error 1)

- An incompatible memory card is in the top slot.
- An incompatible memory card is in the bottom slot.
- The motor cables or connectors are poorly seated.
- The main motor is defective.
- The DC controller PCA is defective.

## IIID, III (57-1 Error)

- An incompatible memory card is in the front slot.
- An incompatible memory card is in the rear slot.

## 57.x Service

### 5Si, 4 Plus, 4Si, IIISi, (x=2, 3, or 4)

- The fan motor x is faulty.
  - Check fan number x, main, or duplexer fan, and replace if necessary.

## LJ 5

- The main motor has failed.

### 4 Plus (x = 1)

- The gears are seized.
- The DC controller or main motor is bad.

### 4Si, IIISi (x = 1)

- The gears are seized.
  - Check and replace the top cover or fuser gears.
- The top cover switch is faulty.

- The AC kill switch operation is faulty.
- The connector J010 is improperly fitted.
- There is a bad main motor PCA or main motor.

## 58 Service

### 6P, 5P, 5, 4V, 4P, 4L, 4

- The fan cable is improperly fitted.
  - Check the fan cable; reseal the fan cable if necessary.
- The fan is defective.

### 4V

- The DC controller PCA is defective.

## 58.1 and 58.2

### 4Si, III Si

- The paper cassette is improperly inserted.

## 58.x Printer Error

### 5Si

- Tray/lifter malfunction.
  - If x=1: Tray 2 lifter malfunction.
  - If x=2: Tray 3 lifter malfunction.
  - If x=3: Tray 1 lifter malfunction.
  - If x=4: Tray 4 lifter malfunction.
  - Press **Select** to continue.  
Repair or replace the tray lifter.

## 59 Add Memory

### 4Si, IIISi

- Not enough optional memory is installed to support the PostScript option for the application being used.
  - Verify that the SIMMs are seated properly; replace any defective SIMMs, or install additional SIMMs.

## 59.x Printer Error

### 5Si

- Main motor malfunction.
  - If x=1: main motor startup failure.
  - If x=2: main motor rotation failure.
  - Turn the printer off, and then turn it back on.
  - If the message persists:
    - Check the cabling between the main motor and the DC controller.
    - Replace the main motor.
    - Replace the DC controller.

## 60 Service

### 4 P, 4 Plus, 4, 2686D/A

- The formatter PCA is defective.

## 60 Memory

### 4V, 4Si, IIISi

- The SIMMs are defective.

## 61 Service

**4P, IIIP, IIID, III, IIP Plus, IIP, IID, II, 2686D/A**

- The formatter PCA is defective.

## 61 Memory

**4V, 4 Si, IIISi**

- The SIMMs are defective.

## 61.x Service

### All Printers

- The SIMM in slot x is improperly fitted.
- The SIMM in slot x is defective.
- The formatter PCA is defective.  
**Note:** If x=0, the SIMM slot could not be determined.

## 62 Service

**4P, IIIP, IIID, III, IIP Plus, IIP, IID, II, 2686D/A**

- The formatter PCA is defective.

## 62 Memory

**4V, 4Si, IIISi**

- The SIMMs are defective.

## 62.x Service/Printer Error, 62.0 Service, 62.1–4 Service, 62.5 Service, 62.6 Service

### All Printers

- The font cartridge or the SIMMs are improperly fitted.
  - Reseat the SIMMs and/or the font cartridge; power cycle the printer.
- The internal memory is defective. (x=0)
  - Replace the formatter PCA.
- The SIMM in slot x is defective.
- The font cartridge (x=5) is defective.

### 4V

- Replace the cache.

## 63 Service

### 6L, 5L

- The formatter PCA is defective.
  - Power cycle the printer. Disconnect the parallel I/O cable and run a self test. If the error persists, replace the formatter PCA.

### 6P, 5P, 5, 4P, 4 Plus, 4, IIIP, IIID, III, IIP Plus, IID, II, 2686A/D

- The formatter PCA is defective.
  - Replace the formatter PCA.

### 4V

- The formatter PCA is defective.
  - Power cycle the printer; replace the formatter PCA.

### 4V, 4Si, IIISi

- The SIMMs are defective.

## 64 Service/Printer Error

### All Printers

- The formatter PCA is defective.

### 5Si

- The DC controller PCA is defective.

## 65 Memory

### 4V, 4Si, IIISi

- The SIMMs are defective.

## 65 Service

### All Printers (except 4Si, IIISi)

- The formatter PCA is defective.

### 4V, 4Si

- A temporary error has occurred.
  - Power cycle the printer.

## 65 Printer Error

### 5Si, 6P, 5P, 5

- A dynamic RAM error is indicated.
  - Turn the printer off, and then turn it back on.  
If the message persists, replace the formatter PCA.

### 5Si

If the control panel displays a 66.x.yy device error message, the printer will list additional error codes in the error log. These can be printed or viewed. A device error message indicates a paper-handling error. The printer is unable to communicate with the external paper handling PCA. Verify that the C-link cables are installed correctly. Print the PCL configuration page and note which installed devices are not present on the configuration page.

x=paper-handling device

0=external paper handling (EPH) PCA

1=first device attached to EPH

2=second device attached to EPH

3=third device attached to EPH

4=fourth device attached to EPH

5=fifth device attached to EPH

- Switch the printer and paper-handling devices off and then on. If the message persists:

yy=paper-handling device error code

If yy=1-22, 24:

- Check the cabling between the printer and the device.  
Check the mechanical interface between the printer and the device.  
Replace the external paper-handling PCA.

If yy=23:

- Check the cabling and mechanical interface between the printer and the device.  
Replace the external paper-handling PCA.  
Repeat steps 1 and 2 to isolate the defective device.  
Repair or replace the defective device.

If yy=31:

The printer is not supported by the paper-handling device 1.

If yy=32:

The printer is not supported by the paper-handling device 2.

If yy=33:

The printer is not supported by the paper-handling device 3.

If yy=34:

The printer is not supported by the paper-handling device 4.

If yy=35:

The printer is not supported by the paper-handling device 5.

For error codes 31-35: Verify that the device is supported.

- If the device is supported, follow the steps under yy=23.

If yy=41:

Device 1 reports an invalid configuration.

If yy=42:

Device 2 reports an invalid configuration.

If yy=43:

Device 3 reports an invalid configuration.

If yy=44:

Device 4 reports an invalid configuration.

If yy=45:

Device 5 reports an invalid configuration.

For error codes 41-45:

- Verify proper configuration for the device.  
If the configuration is correct, follow the steps under yy=23.



## 67 Service/Printer Error

### 5Si

- The field replacement units (FRUs) are not installed properly.
  - Reinstall the FRUs.

### LJ 5

- The formatter PCA is defective.
  - Reseat any accessories. If the error persists, replace the formatter PCA.

### 4V

- A temporary error has occurred.
  - Power cycle the printer.
- The paper guide and plate assembly are defective.

### 4P, 4Plus, 4, IIIP, IIID, III, IIP Plus, IIP, IID, II, 2686D/A

- The formatter PCA is defective.
  - Reseat any accessories. If the error persists, replace the formatter PCA.

### 4Si

- A temporary error has occurred.
  - Power cycle the printer.
- The paper guide and plate assembly are defective.

## 67 Memory

### 4V, 4Si, IIISi

- The SIMMs are defective.

## 68 Error/Service

### All Printers

- The formatter PCA is defective.
- A temporary error has occurred.
  - Press **Continue** and check the control menu settings. Then, power cycle the printer.

### 6P, 5P

- (68 SERVICE) -NVRAM full.
  - Perform a nonvolatile random-access memory (NVRAM) initialization by holding down **Reset** for more than 20 seconds while turning on the printer.

### 5Si, 6P, 5P, 5

- (68 Error) - error in NVRAM.
  - Check the control panel settings. Replace the formatter PCA if the problem persists.

### 5Si, 5

- (68 SERVICE) -NVRAM full.
  - Power cycle the printer. If the problem persists, perform a NVRAM initialization by holding down **Item** or **Job Cancel** on the LJ 5) while turning the printer on. All control panel settings (including service mode settings) must be reset after this procedure.

### 4P, 4 Plus, 4

- (68 Error) There is an error in the NVRAM.
  - Check the control panel settings. Replace the formatter PCA if the problem persists.

## 4P, 4 Plus, 4

- (68 SERVICE) The NVRAM is full.
  - Power cycle the printer. If the problem persists, perform a NVRAM initialization by holding down **Item** while turning on the printer. All control panel settings (including service mode settings) will require resetting following this procedure.

## 68 Memory

### 4V, 4Si, IIISi

- The SIMMs are defective.

## 69 Service

### All Printers

- The I/O PCA is defective.
  - Remove the optional I/O PCA, and then re-test.
- The formatter PCA is defective.
  - Replace the formatter PCA.

## 70–71 Error

### All Printers

- The personality cartridge or the SIMM installed in the font or SIMM slot is incompatible with the printer.
  - Replace with compatible cartridges or the SIMM.

### 5Si

- The MIO cards are faulty.

## 72 Service

### All Printers

- The formatter PCA or the font cartridge is defective.
  - Replace the formatter PCA.
- The font cartridge was removed during formatter PCA access.
  - Power cycle the printer and continue.

## 79 Service

### All Printers

- Check the software; drivers; memory PCAs; font, macro, or personality; cartridges; and optional I/O cards. Check the toner cartridge for defects.
- Remove any accessories (such as font cartridges, memory PCAs, and SIMMs) that are plugged into the formatter PCA; reprint the file. If the problem persists, verify proper setup with the application vendor.
- The formatter PCA is defective.

## 5Si

- An unrecoverable firmware error occurred.
- 1 Power cycle the printer.
  - 2 Reseat or replace the interface cable; power cycle the printer.
  - 3 Remove the SIMMs one at a time and power cycle the printer.
  - 4 Remove the MIO card(s) one at a time and power cycle.
  - 5 Try using the parallel interface, if possible.
  - 6 With the MIO cards out of the printer, perform a cold reset.
  - 7 If the error continues, replace the formatter PCA. Write down the page count and serial number.

## 80 MIO Failure

### All Printers

- The MIO connection is improper.
  - Inspect the pins on the formatter PCA MIO connection.
- The MIO card is defective.
- The formatter PCA is defective.

## 81 Error

### All Printers

- The formatter PCA is defective.

## 89 PostScript ROM Failure

### All Printers (except 6L and 5L)

- The PostScript ROMs have bent or broken pins.
- Inspect the PostScript ROMs/SIMM for bent or broken pins.
- The ROMs/SIMM are improperly located.
  - Check that the ROMs/SIMM are in the correct location and are oriented properly.
- A temporary error has occurred.
  - Power cycle the printer.
- The PostScript ROMs/SIMM are defective.

## Blank Display

### All Printers

- There is no power.
  - Check the AC and DC voltages.
- The display panel, related cabling, or drive circuitry is defective.
  - Check the input voltages that illuminate the display panel.
- The display, cable, formatter PCA, or DC controller is faulty.

### 4V

- There is no power.
  - Verify the input power, and then check CB101 and F101.
- The control panel or formatter PCA is defective.
  - Print an engine test print; if it is satisfactory, replace the control panel and then replace the formatter PCA.

## All LEDs Off (blank display)

### 6L, 5L

- The printer is in sleep mode.
  - Press the front panel button or open the EP door.
- No power is supplied to the printer.
  - Check the power cord connections and the power source.
- Determine if the print engine is functional.
  - Print an engine test; if it is successful, replace the formatter PCA.
- The control panel PCA cable is defective.
- Check the fuses on the DC controller.
- The formatter PCA is defective.
- The DC controller is defective.

### 4L

- The printer is in Intelligent Off mode.
  - Press the front panel button, or open the top door.
- Power is not supplied to the printer.
  - Check the power cord connections and the power source.
- Print an engine test print to determine if the print engine is functional.
  - If the test is successful, replace the formatter PCA.
- Check fuses FU101 and FU201 on the DC controller PCA.
  - Replace if necessary.
- The DC controller PCA is defective.
- The connector between the DC controller and the formatter PCA is defective.
  - Replace the connector.

## All LEDs On (without pressing the front panel button)

### 6L, 5L, 4L

- This is a service error.
  - Hold down the front panel button to display the error LED code. This code will be shown only while the button is pressed.
- All LEDs remain on while pressing the front panel button.
  - Power cycle the printer. If the error persists, replace the formatter PCA.

## Data and Ready LEDs are Blinking

### 6L, 5L

- This indicates a firmware error.
  - Note the LED pattern, bitronics error code, printer condition, data sent, and any other information that may help to isolate the error. Contact HP technical support with this information.

## Data LED is Blinking

### 6L, 5L

- The printer is set to manual feed.
  - Insert paper into the manual feed slot. Ensure that the correct paper is loaded in the printer. Press and release the front panel button. If manual feed is not desired, turn off the setting in the software application.
- The printer is stuck on manual feed.
  - Press the front panel button to override the manual feed request and to feed paper from the paper cassette.
- The input paper sensor (PS1) or the front oblique roller assembly is defective.
  - Replace the PS1 or the front oblique roller assembly.



## Display Is All Block Characters

### All Printers

- The display cable is defective or disconnected.
  - Reseat or replace the display panel cable.
- The control panel is defective.
- The formatter PCA is defective.
  - Check and replace as needed.

## Error LED is On Continuously

### 6L, 5L

- Power cycle the printer.
- There is a bad connection between the formatter PCA and the AC controller.
- The formatter PCA is defective.
- The AC controller is defective.

## Tray 1 LED is Blinking

### 6P

- The printer is set to manual feed. Insert paper into Tray 1 and press **Go**.

## FS Disk Failure

### 4V

- The printer detected a disk failure.
  - Press **Shift** + **Continue** to continue printing.
- A temporary error has occurred.
  - Power cycle the printer.

- The disk drive is improperly fitted.
  - Reseat the disk drive; ensure that the connector pins are fully seated.
- The disk drive is not installed.
  - Run a self-test to verify the presence of the disk drive (look under Installed Options: Disk on the self-test page).
- The disk drive is defective.
  - Replace the disk drive.

## PC Install

### 4V

- The paper size is incorrect.
  - Verify that the correct paper-size label (protruding tab) is installed in the left side of the paper cassette.
- The size-sensor arm is damaged.
  - Check cassette-size sensor arms for bending or damage.
- The DC controller PCA is defective.
  - Replace the control panel. If the problem still exists, replace the formatter PCA.

### 4V, 4 Plus, 4

- The lower cassette (Tray 3) is selected and the printer has detected that the paper cassette (Tray 2) is not installed.
  - Install or reseat the paper cassette (Tray 2). Tray 2 is the paper guide for the lower cassette (Tray 3).
- The paper cassette is improperly fitted.

# 2

## Service mode

### Overview

This chapter provides the procedures used to access service mode and related functions.

# Service Mode Tasks

You can perform the following tasks while in service mode.

- Print a service mode self-test page.
- Verify the page count. (The page count is also displayed on the **standard** self-test page.)
- Set the page count (not available on 4L and IIP).
- See the maintenance count and serial number (4 Si and IIISi).
- Set the cold reset default (LJ5, 4P, 4 Plus, LJ4). This sets the factory default paper size.
- Set the diagnostic function on and off (LJ5, 4P, 4 Plus, LJ4), (for software developers use only).
- Remove the demo page option from the self-test menu:  
Demo Page = On/Off (LJ5, 4 P, 4 Plus, LJ4).

## Note

The tasks listed above are **not** available on the 2686D/A.

# Accessing Service Mode

Use the following procedures to access service mode.

## Note

There is no service mode or NVRAM on LaserJet 6L, 5L, 6P, 5P, or 4L printers. The page counts are retained only while the printer is plugged in; the page count is lost when the printer is unplugged.

## Note

Use PJL commands in the software to access service mode in LJ5P and LJ 4 ML printers. See the service manual for more information.

### LJ5Si Mopier, LJ5 Si

- 1 Turn the printer off.
- 2 Press **Items** and **+** simultaneously while turning the printer on.
- 3 Press **Select**. After a few seconds the printer should display `Service Mode`.

### LJ5

- 1 Turn the printer off.
- 2 Press **Menu +** and **Value+** simultaneously while turning the printer on.  
After a few seconds the printer should display `Service Mode`.

### LJ 4V, 4P, 4Plus, 4, 4Si

- 1 Turn the printer off.
- 2 Press **On Line**, **Form Feed**, and **Enter** simultaneously while turning the printer on.
- 3 Press **Form Feed**, and then press **Enter**.  
After a few seconds the printer should display `Service Mode`.

## LJ IIISi

- 1 Turn the printer off.
- 2 Press **On Line**, **Continue**, and **Enter** simultaneously while turning the printer on.
- 3 Press **Continue**, and then press **Enter**.  
After a few seconds the printer should display `Service Mode`.

## LJ IIIP, IIP+, IIP

- 1 Turn the printer off.
- 2 Press **On Line**, **Menu**, and **Enter** simultaneously while turning the printer on.
- 3 Press **Form Feed**, and then press **Enter**.  
After a few seconds the printer should display `Service Mode`.

## LJ IIID, III, IID, II

- 1 Turn the printer off.
- 2 Press **On Line**, **Continue/Reset**, and **Enter/Reset Menu** simultaneously while turning the printer on.
- 3 Press **Continue/Reset**, and then press **Enter/Reset Menu**.  
After a few seconds the printer should display `Service Mode`.

# Setting the Page Count

(except on the LJ 6L, 6P, 5P, 4L, IIP)

The page count is stored in the printer in non-volatile memory. If it is necessary to replace the formatter PCA, the page count should be reset to the original page count to reflect the age of the print engine. Use the following procedure to set the page count.

- 1 When `00 SMODE` or `SERVICE MODE` is displayed, press **Menu** to modify the page count.  
**4, 4+, and 4P only:** Press **Menu** to access the service menu. Press **Item** to proceed through the menu.  
`PAGES=XXXXXX` is displayed. (XXXXXX represents the page count currently stored in non-volatile memory in the printer. The underlined character denotes the position of the cursor.)
- 2 Press **+** (or **ALT** and **-**) to scroll until the correct value is displayed for the underlined digit.
- 3 Press **Enter** to select the correct value. The cursor automatically moves one place to the right.
- 4 Set each digit in the same manner. When the last digit's value has been selected, the display returns to `00 SMODE` or `SERVICE MODE`.
- 5 Press **On Line** to exit service mode.

# Setting the Page Count and Serial Number

## LJ 4V

- 1 Enter service mode. See page 74 for instructions.
- 2 When `Service Mode` is displayed, press **Menu** to access the service menu.
- 3 Press **Item** to proceed through the menu. `Pages=XXXXXX` is displayed. (XXXXXX represents the page count currently stored in non-volatile memory in the printer. The underlined character denotes the position of the cursor.)
- 4 Press **Enter** to scroll the cursor to underline the desired digit.
- 5 Press **+/-** to select the correct value.
- 6 Press **Enter** to store the new value in NVRAM.
- 7 Set each digit in the same manner.
- 8 Press **On Line** to return the display to `Service Mode`.
- 9 Press **On Line** a second time to exit service mode.

## Setting the Page Count

### LJ 5Si, 4Si, IIISi

- 1 Hold down the **Item-** and **Value-** keys.
- 2 Turn the printer on.
- 3 Wait until `RESET MAINTENANCE COUNT` displays and then release both keys.

### Note

`MAINTENANCE COUNT` in the Service Mode menu sets the page count interval at which the next service is due for the printer. This is set initially at the factory to 200,000 pages (350,000 for 5Si printers). Editing this item is similar to editing the `Pages` item.



# Setting the Default Paper Size for a Cold Reset

The initial default paper size for the formatter PCAs in Europe is A4. When replacing formatters whose default is set for A4 (European Formatters), set the customization variable to A4. When the customization variable is set to A4, the cold reset procedure cannot reset the paper size to Letter.

Use the following procedures to customize the cold reset paper size:

## LJ 5Si

- 1 Enter service mode. See page 74 for instructions.
- 2 Press **Menu** to access the Service Menu.
- 3 Press **Items** to step through the menu until COLD RESET PAPER=LETTER\* is displayed.
- 4 Press **+** to toggle between Letter and A4 paper.
- 5 Press **Select** to activate your choice.
- 6 Press **On Line** to exit service mode.
- 7 Perform a cold reset to activate a new choice.

## LJ 5

- 1 Turn the printer off.
- 2 Hold **Go** down while turning the printer on.  
FACTORY DEFAULTS BEING RESTORED is displayed. The cold reset does not take effect until READY is displayed.  
When READY displays, the default settings have been returned to the factory defaults and the printer is ready to accept new settings.

## LJ 4V

- 1 Enter service mode. See page 74 for instructions.
- 2 Press **Menu** to access the service menu.
- 3 Press **Item** to step through the menu until CR PAPER=LETTER\* is displayed.
- 4 Press **+/-** to toggle between Letter and A4 paper.

- 5 Press **Enter** to save your selection.
- 6 Press **On Line** to return the display to SERVICE MODE.
- 7 Press **On Line** a second time to exit service mode.

### **LJ 4, 4 Plus, and 4P Only**

- 1 Enter service mode as described in this section.
- 2 Press **Menu** to display SERVICE MENU.
- 3 Press **Item** to display CR PAPER=LETTER\*.
- 4 Press **+/-** to toggle between Letter and A4 paper.
- 5 Press **Enter** to save your selection.
- 6 Press **On Line** to exit service mode.

## **Setting the PowerSave Interval**

In service mode, you can add an additional 10-second time interval to the PowerSave function.

### **LJ 4V**

- 1 With Service Mode displayed, press **Menu** until JOB MENU is displayed.
- 2 Press **Item** until PWRSAVE= is displayed.
- 3 Press **+/-** until the desired time interval is displayed.
- 4 Press **Enter** to save your selection.
- 5 Press **On Line** once to return to service mode.
- 6 Press **On Line** again to place the printer back online.

# 3

## Power supply

### Overview

The following schematics will assist in checking and verifying printer systems and functions, including operating voltages, power supplies, and circuitry.

# LaserJet 6L, 5L

The DC controller PCA coordinates all print engine activities, drives the laser, and coordinates print data from the formatter PCA with the image formation process. The DC controller includes both an AC and DC power supply and distribution circuitry.

The DC controller controls the following systems and functions:


## **Print Engine Control**

- Laser and Scanner Drive
- Paper Motion Photosensors (Paper Out, Paper Registration, and Paper Exit Sensors)
- Motor

## **Power System**

- AC Power Distribution
- DC Power Distribution
- Overcurrent/Undervoltage Protection
- SleepMode
- High Voltage Power Distribution

# DC Controller

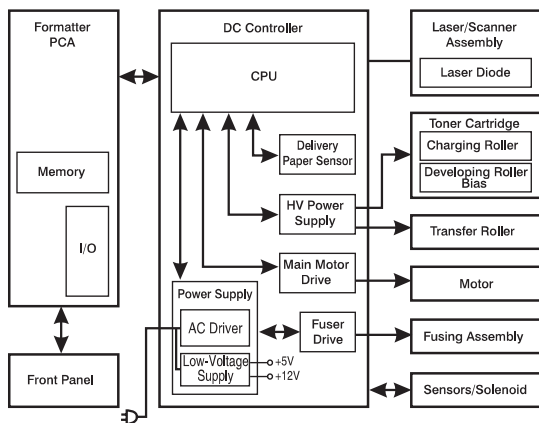


3

**Figure 3-1 DC Controller Loads**

# LaserJet 5Si

The AC and DC power supply circuits are contained in the Low Voltage Power Supply (LVPS). The high voltages required for image formation are generated by the High Voltage Power Supply (HVPS). The Low Voltage Power Supply and Distribution System are illustrated below.

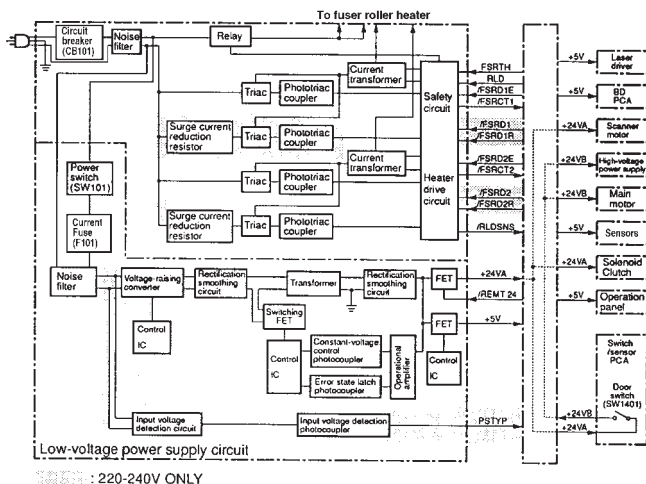

### Figure 3-2 Low Voltage Power Supply and Distribution System

# LaserJet 5P, 4P, and 4L


The DC power supply circuitry, located on the DC controller PCA, generates +5 DC and +12 DC. Uses for each are summarized below.

## +5 DC

- Formatter PCA
- Photosensors
- DC controller circuitry
- Laser scanner assembly


## +12 V DC

- High voltage power supply
- Main motor
- Solenoids
- Fan (through the laser scanner assembly)

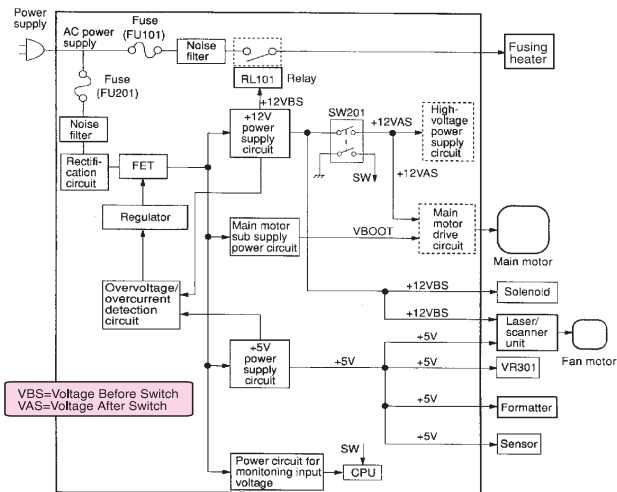

**Figure 3-3 Power System Block Diagram**

## LaserJet 5, 4 Plus, 4

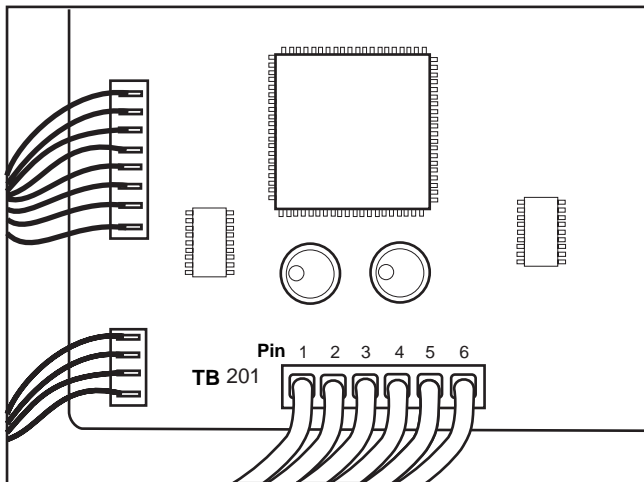

**Figure 3-4 DC Power Supply Checks (LJ5, LJ4 & LJ4+) TB201 on DC controller**

Use this procedure to verify the operating voltages of the LJ5, LJ4, and LJ4+:

- 1 Listen for the exhaust fan. A rotating fan indicates that the +5V DC and the +24 V DC are present. (The fan runs on +24V DC.)
- 2 Listen for the main motor. If the main motor runs, +24V DC is enabled.

### TB201 electrical connector

Voltage	Color	Pin Number
+5V DC	Brown	1, 2
+24V DC	Red	3
Ground	Blue	4, 5, 6



# LaserJet 4V

The DC power distribution circuitry, located on the DC controller PCA, distributes +5 V DC, +12 V DC, and +24 V DC, as shown.

## **+5 V DC**


- Control Panel
- Formatter PCA
- Photosensors (PS 401, PS 402)
- DC Controller Circuitry
- Laser Scanner Assembly
- Exhaust Fans, FM1 and FM2 (low speed)
- Intake Fan, FM3

## **+12 V DC**

- Laser Scanner Assembly

## **+24 V DC**

- Laser Scanner Assembly
- High Voltage Power Supply
- Clutches and Solenoids
- Exhaust Fans, FM1 and FM2 (high speed)

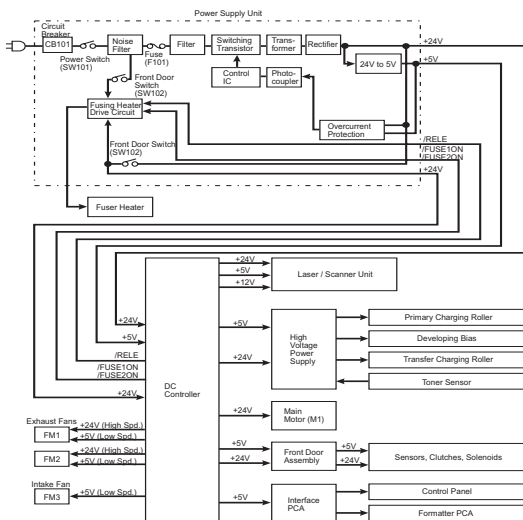

**Figure 3-5 DC Controller Loads**

# LaserJet 4Si, III Si


Follow this procedure to verify the voltages on the LaserJet 4Si and III Si printers:

- 1 Listen for the fans. Running fans indicate that the +5 V DC and the +24 V DC are present.
- 2 Make sure that the 24A V DC is available on pin 1 of J203 on the sensor PCA.
- 3 Listen for the main motor to start. If the main motor runs, 24B V DC is enabled. This means that the 24B V DC is also present.

## LaserJet 4Si, III Si Voltage Test Points

Voltage	Test Point	Notes
+5 V DC	CP031	On DC controller
+24 A	CP028	On DC controller
+24 B	CP023 and top of R 006	On DC controller (off when the top cover is open)
+12 V DC	J14, Pin 5	Present when top cover is closed

# LaserJet IIIp, IIP+, IIP

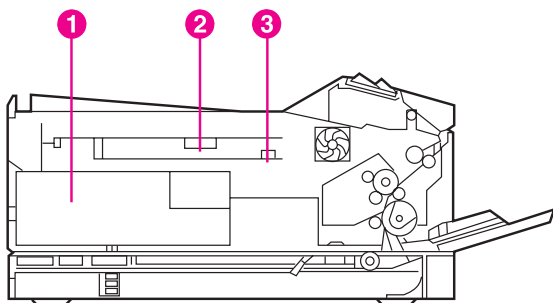

**Figure 3-6 DC Power Supply Checks (IIIP, IIP+, IIP)**

- 1 DC power supply
- 2 J1 on formatter PCA


PIN	1	n/c	2	3	4
SIGNAL	+5	n/c	+5	Ground	Ground
COLOR	Brown		Brown	Blue	Blue

- 3 J212 on DC Controller

Pin Number	Color	Supply
1	BLUE	GROUND
2	BLUE	GROUND
3	RED	+24V *
4	RED	+24V *
5	BLUE	GROUND
6	ORANGE	+12V
7	BLUE	GROUND
8	BROWN	+5V
9	YELLOW	/FSRDRV

\*Requires that the paper path door is closed or the power supply interlock disabled.

## LaserJet IIID, III, IID, II

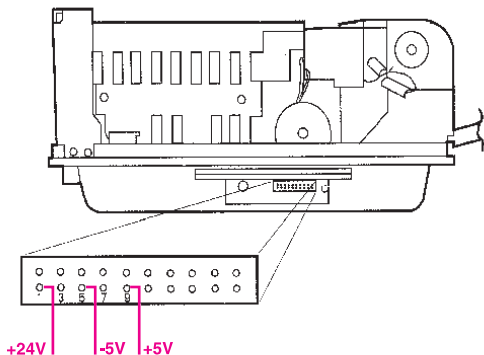

3

### Figure 3-7 DC Power Supply Checks (IIID, III, IID, II)

The LaserJet Service Diagnostic Tool can also be used to check voltages.


#### Test tool III, II: Part number 33440-67905

- Checks DC voltages
- Checks high-voltage bias
- Runs test patterns

#### Test tool IIID, IID: Part number 33447-67906

- Checks DC voltages
- Checks high-voltage bias
- Monitors the status of the paper sensors
- Monitors the status of the solenoids

# LaserJet 2868D/2686A

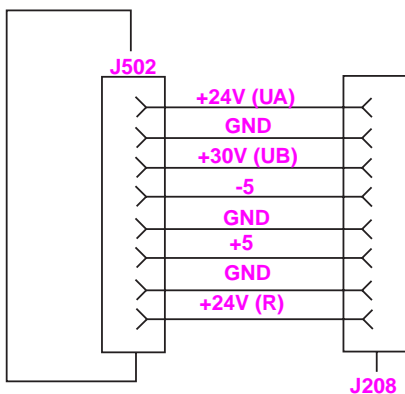

**Figure 3-8** DC Power Voltage Supply Checks (2686D, 2686A)

# 4

## Input/Output (I/O)

### Overview

This section provides information on cabling and the printer interface.

## Bidirectional Parallel Interface (LJ 6L, 5Si, 5L, 6P, 5P, 5, 4V, 4P, 4L, 4 Plus, 4, 4Si, and IIISi)

The bidirectional parallel interface (IEEE-1284 compliant) is compatible with Centronics parallel interfaces. The following items are required to take advantage of the enhanced capabilities provided by bidirectional parallel interfaces, such as bidirectional communication:

- Software application support for these features.
- An IEEE-1284 compliant parallel cable with the correct pin configuration (see below).

Signal Name	Printer Pin #	Parallel Port Pin #
nSTROBE	1	1
DATA 1	2	2
DATA 2	3	3
DATA 3	4	4
DATA 4	5	5
DATA 5	6	6
DATA 6	7	7
DATA 7	8	8
DATA 8	9	9
nACKNLG	10	10
BUSY	11	11
CALL (PE)	12	12
SELECT	13	13
nAUTOFd	14	14
On VDC (GND)	19 THRU 30	18 THRU 25
nFAULT	32	15
nSelIn	36	17



# IEEE-1284 Compliant Parallel Cables

HP helped develop the IEEE-1284 standard and is one of the first companies to introduce products that are compliant with it. HP offers the following IEEE-1284 compliant parallel cables.


Part Number	Length	Connector Type
C2950A	2 meters (7 feet)	Host A to printer B (large) connector
C2951A	3 meters (10 feet)	Host A to printer B (large) connector
C2945A	2 meters (7 feet)	Host A to printer C (small) connector
C2946A	3 meters (10 feet)	Host A to printer C (small) connector
C2947A	10 meters (33 feet)	Host A to printer C (small) connector

# RS-232-C/RS-422-A Serial Interface

## Common Serial I/O Cables


The following serial cabling schematics are typical of IBM (AT/XT) and compatible personal computers that use the standard (9/25) pin serial RS-232C interface.

### Male DB-25 cable to Female DB-25 (17255D)

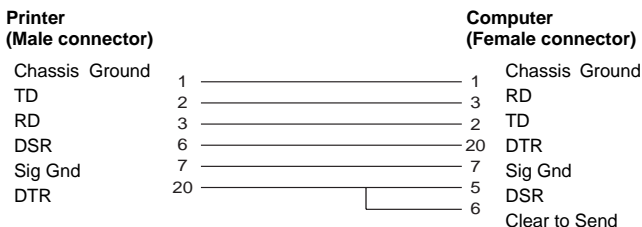

(Pins not shown are not used)

### Male DB-25 cable to Female DB-9 (24542G)

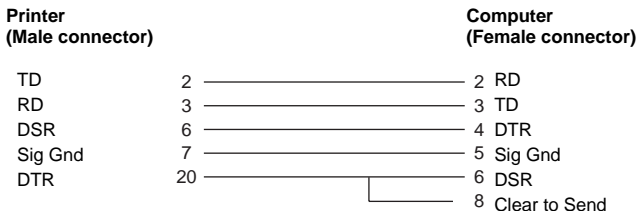

### Male DB-9 cable to Female DB-9 (C2932A)

Printer (Male connector)		Computer (Female connector)	
TD	2	2	RD
RD	3	3	TD
DSR	4	4	DTR
Sig Gnd	5	5	Sig Gnd
DTR	6	6	DSR
DTR	8	8	CTS
HOOD			HOOD
M DB-9			F DB-9
		SHIELD	

### Male DB-9 cable to Female DB-25 (C2933A)

Printer (Male connector)		Computer (Female connector)	
TD	2	3	RD
RD	3	2	TD
DSR	4	20	DTR
Sig Gnd	5	7	Sig Gnd
DTR	6	6	DSR
DTR	8	5	CTS
			Chassis
HOOD		1	Ground
M DB-9			HOOD
			F DB-9

## 25- to 9-pin serial adaptor (P/N C2809A)

The pin-outs for the adaptor are shown below:

### C2809A pin configuration

9-pin Male		25-pin Female
1	—————	4
2	—————	2
3	—————	3
4	—————	6
5	—————	7
6	—————	20
7	—————	not connected
8	—————	not connected
9	—————	not connected
Shell	—————	Shell

# Serial I/O Specifications

<b>Handshaking Protocol</b>	RS-232-C: Xon/Xoff (software) and Data Terminal Ready (hardware) RS-422-A: Xon/Xoff (software) only  The signal logic or “sense” of the data terminal ready (DTR) line is switchable to either active HIGH (the factory default) or active LOW from the printer control panel.
<b>Data Format</b>	Asynchronous with 1 start bit, 8 data bits, and 1 stop bit
<b>Parity</b>	Not used
<b>Supported Baud Rates</b>	300, 600, 1200, 2400, 4800, 9600, 19200, 57600*, 115200**

\*LJ 4 and newer: Supports up to 57,600 Baud

\*\*LJ 4000/LJ 5000: Supports up to 115,200 Baud

## Maximum I/O Cable Lengths

<b>Serial RS-232C RS-22A</b>	15 meters (50 feet) 1200 meters (4,000 feet)
<b>Parallel (non-IEEE 1284)</b>	3 meters (10 feet)
<b>Parallel (IEEE 1284 with “B” type connector)</b>	3 meters (10 feet)
<b>Parallel (IEEE 1284 with “C” type connector)</b>	10 meters (34 feet)

# Configuring the Computer Interface

The following information applies to IBM personal computers (PCs) and compatible computer systems.

Use MS-DOS<sup>®</sup> EDIT or a similar program to enter the appropriate MS-DOS MODE commands in the computer's AUTOEXEC.BAT file. See the getting started guide or set-up manual for the printer for step-by-step instructions.

**For parallel communication, enter:**

```
MODE LPT1 : , , B
```

(Note: Change "B" to "P" if <DOS 4.0.)

**For serial communication, enter:**

```
MODE COMn : 9600 , N , 8 , 1 , B
```

(Note: Change "B" to "P" if <DOS 4.0.)

```
MODE LPT1 : =COMn
```

where n=1, 2, or 3, depending on which COM port is used  
(that is, COM1, COM2, or COM3)

# Verifying Communication

## MS-DOS

Use this procedure to verify communication between an MS-DOS computer and an HP LaserJet printer:

- 1 Turn the computer on.
- 2 Turn the printer on.
- 3 Wait until the printer displays **00 READY**.
- 4 At the DOS prompt, type **DIR >PRN** and press **Enter**. When you do, the printer's Form Feed light should illuminate.
- 5 If necessary, take the printer off line and press **Form Feed** to eject the page.

# Macintosh

Use this procedure to verify communication between a Macintosh computer and an HP LaserJet III printer:

## Note

The LaserJet printer must have PostScript and AppleTalk installed and have at least 1 megabyte of additional memory.

- 1 Turn the computer on.
- 2 Make sure the PostScript cartridge is properly seated.
- 3 Turn the printer on and wait until the printer displays  
POSTSCRIPT READY.
- 4 Verify that the front panel is set to I/O=APPLETK.
- 5 Pull down the **Apple** menu.
- 6 Select **Chooser**.
- 7 Select **Printer Type**.
- 8 Select **Printer** (*AppleTalk* must be active).
- 9 Close Chooser by selecting **box** in the upper-left corner.
- 10 Pull down the **File** menu.
- 11 Select **Print Window** or **Print Desktop**. The **READY** light should start flashing before the page ejects.



# Infrared Communications

## (6P, 5P, 5 Only)

The 6P, 5P, and 5 printers feature an infrared (IR) port that is compliant with the Infrared Data Association (IrDA) standard. (The LaserJet 5 requires an additional transceiver pod.) A status light indicates when the port is active. The light is located just above the port, which is located on the lower-left corner of the LJ 6P and the LJ 5P, and on the pod on the LJ 5.

### Note

The IrDA standard for infrared communications represents an emerging technology. Older portable devices that are not IrDA-compliant may not be compatible with these printers.

## Troubleshooting IR Printing Problems

IR printing problems can be caused by any of the several system components or by a lack of proper configuration. The following checklist will help determine the source of the problem.

- 1 Verify that the user is operating the printer and PC as described in the user guide: less than 1 meter between devices, and not more than +/-15 degrees from the direct center.
- 2 Verify that the host PC or laptop and the printer are IrDA-compliant and have the necessary hardware components for IR communication.
- 3 Verify that the IR software has been loaded on the primary device (system software from the PC manufacturer).
- 4 Verify that the host PC or laptop is properly configured. Check the port assignment, the interrupt request (IRQ) level, and the base address value. Check both the DOS AUTOEXEC.BAT and CONFIG.SYS files, and check the Windows system configuration.

# IR Test Tool

If all these elements are properly installed and configured, use the IR Tester to test the IrDA protocol transmission and device operation. Designed for troubleshooting IR communication problems, this tool was developed by Genoa Technology, Inc., in cooperation with Hewlett-Packard. The part number is **5062-4661**. Order it through HP Parts Direct Ordering (see inside back cover).

To test the peripheral device:

- 1 Put the LaserJet printer in **READY** mode.
- 2 Press the "Peripheral Test" button on the tester. The LEDs on the tester will illuminate in sequence.

If the "PASS" LED lights, the test was successful, which indicates that communication with the printer's IR port is functioning normally. A self-test page will print as a result of the test.

If the "TEST" LED goes out and the "PASS" LED fails to light, the printer's IR port is not functioning correctly.

To test the host computer:

- 1 Place the tester on a table in front of the PC's IR port.
- 2 Press the "Computer Test" button. The tester will sequence the LEDs.

If the "PASS" LED lights, the test was successful, which indicates that communication with the computer's IR port is functioning normally.

If the "TEST" LED goes out and the "PASS" LED fails to light, the host's IR port is not functioning correctly.

# Selecting the I/O Type

Use the front panel menus to select the I/O type and to configure the I/Os. When the formatter PCA is replaced, the I/O type will reset to the default value.

In early LaserJet printers (2686D/A), use the formatter switches to select the I/O configuration, as follows.

## LaserJet 2686D, 2686A Only

### Setting Switch 1 (SW1)

Switch No.	Use	ON	OFF
1 <sup>1</sup>	I/O Type	Parallel	Serial RS 232C/422
2-4 <sup>2</sup>	Baud Rate	See figure 4-1.	See figure 4-1.
5 <sup>1</sup>	Auto Continue	Continues on print and data errors after flashing 10 times.	Flash error occurs until the operator presses <b>Continue</b> .
6 <sup>1</sup>	Robust X-ON	X-ON is repeated every 1 second when the printer is waiting for data.	Only 1 X-ON is sent when the printer needs more data.
7 <sup>3</sup>	Auto Select Mode	Powers up in auto-select mode.	Powers up with auto-select mode off.
8 <sup>2</sup>	DTR Polarity	DTR pin 20 high when the printer is ready.	DTR pin 20 low when the printer is ready.

<sup>1</sup> Refers to HP 2686A+ and HP 2686D models

<sup>2</sup> Refers to all models of HP 2686 printers

<sup>3</sup> Refers to HP 2686D models only

## Baud Rate Switch (SW1)

Switch Number			Baud Rate
2	3	4	
OFF	OFF	OFF	300
OFF	OFF	ON	600
OFF	ON	OFF	1200
OFF	ON	ON	2400
ON	OFF	OFF	4800
ON	OFF	ON	9600
ON	ON	OFF	19200

**Figure 4-1** Baud Rate Switch

# 5

## Media specifications

### Overview

Select media that meets the specifications listed on the following pages. By doing so, you will minimize the incidents of jams, prevent premature wear to the printer, and reduce repair costs. Hewlett-Packard recommends testing print media before buying it in large quantities.

#### Note

For complete paper specifications for all LaserJet printers, see the *HP LaserJet Family Paper Specification Guide*.

# Paper Sizes

## Metric System

Size	Metric Dimensions	U.S. Dimensions
A0	841 x 1189 mm	33.1 x 46.8 in
A3	297 x 420 mm	11.7 x 16.5 in
A4	210 x 297 mm	8.3 x 11.7 in
A5	148 x 210 mm	5.8 x 8.3. in
B4 (ISO)	250 x 353 mm	9.8 x 13.9 in
B5 (ISO)	176 x 250 mm	6.9 x 9.8 in

## Imperial (U.S.) System

Size	U.S. Dimensions	Metric Dimensions
Ledger	11 x 17 in	279 x 432 mm
Legal	8.5 x 14 in	216 x 356 mm
Letter	8.5 x 11 in	216 x 279 mm
Executive	7.25 x 10.5 in	184 x 267 mm
JIS B4**	10.1 x 14.3 in	257 x 364 mm
JIS B5**	7.2 x 10.1 in	182 x 257 mm
J Postcard*	3.9 x 5.8 in	100 x 148 mm
J Double Postcard*	5.8 x 7.9 in	148 x 200 mm
* J - Japanese		
** JIS Japanese Industry Standard		

# Paper Specifications

Category	Specifications
Acid Content	5.5 pH to 8.0 pH
Basis Weight: LJ 5, 6L front output slot LJ 6P Tray 1	60 to 163 g/m <sup>2</sup> (16 to 43 lb)
LJ 5P paper cassette LJ 5L, 6L paper output bin LJ 5 Tray 2 LJ 5Si Tray 2, Tray 3, Tray 4* *(Opt. 2000 sheet feeder) LJ 6P Tray 2	60 to 105 g/m <sup>2</sup> (16 to 28 lb)
LJ 5Si Tray 1	60 to 199 g/m <sup>2</sup> (16 to 63 lb)
LJ 5 Tray 1	60 to 135 g/m <sup>2</sup> (16 to 36 lb) (5P may use media up to 42 lb with Sheffield rating of 100 to 180 in the manual feed slot only)
LJ 5 Tray 3	60 to 90 g/m <sup>2</sup> (16 to 24 lb)
4V, 4MV all paper sources	64 to 105 g/m <sup>2</sup> (17 to 28 lb)
II, III IID, IID upper Tray LJ 4, 4+ MP Tray LJ 4L, 4P manual feed slot	60 to 135 g/m <sup>2</sup> (16 to 36 lb) (4P and 5P may use media up to 42 lb with Sheffield rating of 100 to 180 in the manual feed slot only)
IIP, IIIP, IIP+ IIISi, 4Si simplex LJ 4, 4+ PC Tray LJ 4L, 4P paper cassette	60 to 105 g/m <sup>2</sup> (16 to 28 lb)
IID, IID lower Tray IID, IIID 4+ duplex IIISi, 4Si duplex LJ 4, 4+ LC Tray	60 to 90 g/m <sup>2</sup> (16 to 24 lb)
Caliper	3.0 to 7.0 mils (0.094 to 0.18 mm)
Curl In ream	Flat within 5 mm (0.2 in)
Cut edge conditions	Cut with sharp blades with no visible fray
Fusing compatibility	Must not scorch, melt, offset, or release hazardous emissions when heated to 200° C (392° F) for 0.1 seconds
Grain	Long grain
Moisture content	4% to 6% by weight
Smoothness	100-250 Sheffield

# Paper Weight Equivalences (Approximate)

	Metric Weight (g/m <sup>2</sup> )		U.S. Weight (lb) or Thickness (mm)						
	Europe	Japan	Postcard* thickness	Bond Wt	Text Book Wt	Cover Wt	Bristol Wt	Index Wt	Tag Wt
1	60	60		16	41	22	27	33	37
2	64	64		17	43	24	29	35	39
3	75	75		20	50	28	34	42	46
4	80	80		21	54	30	36	44	49
5	80	80		22	56	31	38	44	49
6	90	90		24	60	33	41	50	55
7	100	100		27	68	37	45	55	61
8	105	105		28	70	39	49	58	65
9	120	120		32	80	44	55	67	74
10	120	120		34	80	44	55	67	74
11	135	135		36	90	50	62	75	83
12	148	148	.18	39	100	55	67	82	91
13	157	157	.19	42	107	58	72	87	97
14	163	163	.20	43	110	60	74	90	100
15**	176	176	.23	47	119	65	80	97	108

\* U.S. postcard measurements are approximate. Use for reference only.

\*\* This media weight (row 15) may perform to your satisfaction but it is beyond the printer's specifications. Printing with this media weight will not damage the printer.



# Troubleshooting Paper Problems

Paper problems can be difficult to detect. The following series of steps will help isolate paper-induced problems versus printer problems:

- Isolate a paper path.
- Isolate a brand of paper.
- Isolate a type of paper.
- Evaluate paper-use practices.
- Evaluate environmental conditions.

Here are some simple tips:

- Turn the paper over and print on the other side. Doing so often corrects excess paper curl.
- Rotate the paper 180° (end-for-end) to feed a different leading edge. This can help correct multi-sheet feeding problems.

## Papers to Avoid

- NCR self-carbon (or “carbonless” paper)
- Paper that has been preprinted (such as letterhead) with ink that will not withstand fuser heat (205° C [400° F] for 0.1 second)
- Plastic-fiber paper
- Embossed paper
- Paper with cutouts or perforations
- Chemically treated paper
- Coated paper
- Synthetic paper
- Multi-part forms
- Odd-sized paper

If your printer is having trouble with paper jams, multi-feeds, or misfeeds, use HP-brand paper: HP 20 lb Multi-Purpose Paper, (part number 9300-2092); HP 24 lb LaserJet Paper, (part number 9300-2091).

# General Tips

## Paper Curl

Paper curl results both from the heating process used to bond the print image (toner) to the paper and from the path the paper must negotiate through the printer.

Take the following actions to help reduce paper curl:

- 1 Turn the paper over in the input tray. Some paper packages (reams) have an arrow indicating the preferred printing side. Experiment to determine which orientation yields the least curl.
- 2 Try a different output paper path (if available for your printer). Using the face-up output path may yield more acceptable results than the standard face-down output bin. Note that the LJ5N, 5M, and 5 printers have no alternative output paper path. Use the LJ 6L/5L Front Output Slot and Paper Input Support if paper is curled or wrinkled.
- 3 Protect the paper from adverse environmental conditions prior to use. Paper designed for laser printing has an initial moisture content of 4-6 percent, which is maintained as long as the paper is stored properly. Once the paper has been removed from its packaging, it will dry out or absorb additional moisture, depending on the environment. Excess moisture in the paper will increase the amount of curl.
- 4 Try a different type or brand of paper. Not all paper is designed for laser printing.

Much of the paper curl that is induced by the laser printer fusing process will tend to relax within the first 24 hours following printing. However, the curl on the leading edge of the page may remain longer because the leading edge tends to remain in contact with the fusing roller for longer periods.

Consult the user guide for the printer and the *HP LaserJet Printer Family Paper Specification Guide*, for more information.

# Envelope Specifications

Category	Specifications
Basis Weight	75 to 90 g/m <sup>2</sup> (20 to 24 lb) single layer
Caliper	3.3 to 5.5. mils (0.084 to 0.14 mm) single layer thickness
Curl	Less than 5 mm (0.2 in) curl across entire surface
Finishing	Accurate, sharply creased folds with no more than two thicknesses of paper at the leading edge
Fusing Compatibility	Must not scorch, melt, offset, or release hazardous emissions when heated to 200° C (392° F) for 0.1 second
Moisture Content	4% to 6% by weight
Paper	Must meet all the normal paper specifications
Smoothness	100 to 250 Sheffield

## Envelope Sizes

### Metric System

Size	Metric Dimensions	U.S. Dimensions
DL	110 x 220 mm	4.3 x 8.6 in
C5	162 x 229 mm	6.4 x 9.1 in
B5	176 x 250 mm	7.0 x 9.9 in

### Imperial (U.S.) System

Size	Metric Dimensions	U.S. Dimensions
Commercial #10	105 x 241 mm	4.1 x 9.5 in
Monarch #7 3/4	98 x 191 mm	39 x 7.5 in

## Envelopes to Avoid

Do not use the following envelopes:

- with clasps, snaps, or tie strings
- with transparent windows, holes, perforations, or cutouts
- having an open flap with adhesive exposed
- having paper, inks, adhesives, or materials that discolor, melt, offset, or release hazardous emissions when exposed to 205° C (400° F)
- having extremely smooth, shiny, rough, textured, or deeply embossed surfaces
- damaged, wrinkled, or irregularly shaped
- constructed with encapsulating adhesives that do not require moistening, but rely instead on pressure to seal them

## Preventing Printer Malfunctions Caused by Envelopes

When you are printing on envelopes, use these preventive measures to avoid printer malfunctions.

- Carefully feed the envelopes into the printer.
- Be aware of the envelope's construction.

# Envelope Feeding

Following these preventive measures when feed envelopes

- Envelopes can be manually fed through the printer or they can be fed automatically through an envelope tray or feeder.
- Closely inspect the leading edge of the envelopes before feeding them into the printer. Ensure the leading edge is flat. Watch for envelope curl. Flatten the leading edge of the envelope before printing.
- Be patient; in manual feed mode the printer displays a message when it is ready to accept the next envelope. Wait for this message to appear before inserting the next envelope.
- Do not allow a large quantity of envelopes to accumulate in the output bin.
- On most printers, use the rear (or front) output bin (if available) when printing envelopes. Do not use the top (face-down) output bin.

## Envelope Construction

- The corner folds need to be well-creased, with no more than two thicknesses of paper.
- The envelopes must lay flat.
- The paper grain should be diagonal to the direction of the feed.
- Adhesives must meet HP specifications for fusing compatibility.
- Basis weight must not exceed 90 g/m<sup>2</sup> (24 pounds).
- Do not use envelopes with clasps, snaps, tie strings, or windows.
- Do not use envelopes made of synthetic materials.

# Label Specifications

Category	Specifications
Adhesive	Must not be on any external surfaces of the label before, during, or after printing. Label construction and die-cutting must not allow labels to peel off during transport, printing, or fusing
Caliper	Must not exceed 0.18 mm (0.007 inches)
Curl	In ream: flat within 13 mm (0.5 inches)
Finishing Precision	Cut sheet within 0.79 mm (0.031 inches) of nominal and 0.20° square
Fusing Compatibility	All adhesions, carrier sheets, top sheets, and other materials used in label construction must be compatible with the heat and pressure of the fusing process. Materials must not discolor, melt, offset, or release hazardous emissions when heated to 200° C (392° F) for 0.1 second
Packaging	Use moisture-proof wrap to preserve properties

# Preventing Printer Malfunctions Caused by Adhesive Labels

As with envelopes, prevention is the best way to avoid printer malfunctions caused by adhesive labels. To prevent paper jams and feed problems, labels must meet the following requirements:

- Be cut long grain (as opposed to short grain)
- Totally cover the carrier sheet (no spaces between labels, no removed labels)
- Contain no excessive glue. (The adhesive should be acrylic-based emulsion and should not come into direct contact with the printer.)
- Meet HP specifications for fusing compatibility
- Meet HP specifications for caliper
- Have a carrier sheet that is not too smooth
- Use the flat paper path (manual feed slot and rear, or front, face-up delivery door), which is the recommended printing method



# Transparency Specifications

Category	Specifications
Caliper	3.9 to 4.3 mils (0.100 to 0.110 mm)
Cutting Angle	90° ± 0.2°
Finishing Precision	Cut sheet to within 0.8 mm (0.03 inches) of nominal and ± 0.2° of square.
Fusing Compatibility	Overhead transparency material must be compatible with the heat and pressure of the fusing process. Materials must not discolor, melt, offset material, or release hazardous emissions when heated to 200° C (392° F) for 0.1 second


## Preventing Printer Malfunctions Caused by Transparencies

To prevent printer malfunctions caused by transparencies:

- Use the straightest paper path to avoid curling and other problems.
- Use transparencies with the correct resistivity.
- Use transparencies that meet HP specifications for fusing compatibility.
- Remove each printed sheet from the tray and place it on a flat surface before printing the next sheet.

# HP Paper Training Video

HP has developed a training video focusing on how paper is manufactured and how the manufacturing process relates to the use of paper in HP LaserJet printers. Part numbers are shown below.

 <p>The Paper Video explains the manufacturing process.</p>	Part No.	Version (VHS Format)
	5961-0711	National Standard Television Committee (NTSC) Version (U.S.)
	5961-0712	PAL Version (Europe, Asia)

# 6

# Toner cartridge information

## Overview

This chapter provides information on toner cartridges and their use. HP recommends using HP toner cartridges, which are designed specifically to enhance the output from the HP LaserJet family of printers.

# Cartridge Weights/Page Counts

<b>HP LaserJet</b>	<b>Product</b>	<b>Cartridge</b>	<b>Full Weight</b>	<b>Empty Weight</b>	<b>Page Count at 5% Coverage</b>
6L, 5L	C3906A	EP-A	730 gm (25.7 oz.)	630 gm (22 oz)	2,500
5Si	C3909A	EP-W	3000 gm (106.7 oz)	2200 gm (80.5 oz)	15,000
6P, 5P	C3903A	EP-V	920 gm (32.8 oz)	740 gm (26 oz)	4,000
5	92298A	EP-E	1500 gm (52.9 oz)	1220 gm (43 oz)	6,800
4V	C3900A	EP-BII	2060 gm (72.5 oz)	1710 gm (60.2 oz)	8,100
4P, 4L	92274A	EP-P	860 gm (30.3 oz)	740 gm (26 oz)	3,350
4Plus, 4	92298A	EP-E	1500 gm (52.9 oz)	1220 gm (43 oz)	6,800
4Si, IIISi	92291A	EP-N	2050 gm (72.2 oz)	1710 gm (60.2 oz)	10,250
IIIP, IIP+, IIP	92275A	EP-L	1050 gm (37 oz)	820 gm (28.9 oz)	3,500
IIID, III, IID, II	92295A	EP-S	1360 gm (47.9 oz)	1130 gm (39.8 oz)	4,000
2686D, 2686A	92285A	EP-C	1590 gm (56 oz)	1320 gm (46.5 oz)	3,000

# Potential Toner Cartridge Issues

## Banding

When printing with a laser printer, the toner is applied across the page in horizontal strips. The page is moved through the printer and toner is continually applied. When printing text or black pages, a large amount of toner is deposited on the page. As the amount of toner deposited on the page decreases, slight speed variations become more apparent. As the resolution (dots per inch) and the speed (pages per minute) increase, a variation in pattern intensity may appear on the page as lines or bands.

The bands are more visible in certain grayscale patterns. High speed printers that are capable of printing high resolution grayscale patterns are more likely to display the pattern variations. Changing the grayscale pattern or reducing the resolution may significantly reduce the amount of banding that occurs.

## Character Voids

Small gaps or voids may appear in some of the characters when printing on media other than standard photocopier paper. These “character voids” occur because some print media does not accept the transfer of toner as well as others.

To minimize the occurrence of character voids, avoid media with a rough finish. Use media that is within the Hewlett-Packard paper specifications listed in the user guide or the *HP LaserJet Family Paper Specification Guide*. If the finish is too rough, the surface will consist of large inconsistencies. If the finish is too smooth, toner will not adhere well. Adjusting the print density may affect the severity of character voids.

# Toner Cracking

When the paper is folded and the crease aligns with a line of text, it is possible with certain types of paper for the text to break along the line, giving the appearance of a white line through the text. Papers that do not meet the smoothness (100-250 Sheffield, 100-500 Bendtsen) and/or wax pick (>11 Dennison) are likely to exhibit this effect more than others.

Toner in the HP LaserJet printers is composed of minute particles of pigmented plastic material (styrene) and iron oxide. When the toner is subjected to the fusing temperature, these individual iron-impregnated plastic particles become part of a larger plastic image on the page. When the printed page is subsequently folded, the plastic image must also give, in some fashion, to accommodate the fold. If the print image has been well-set into the paper, this resulting break in the plastic will not be apparent. However, if the toner is unable to adequately penetrate the paper fibers, or if, in the process of folding the paper, the paper fibers behind the toner break away from the page itself, the result will be a “white line” through the image. There are several ways to minimize this effect:

- Ensure that the paper being used meets ALL of the specifications provided in the *HP LaserJet Printer Family Paper Specification Guide*, in particular the smoothness and wax pick.
- A lighter density setting will ensure that the toner image will be composed of less plastic material, thus minimizing the resulting effect of trying to fold the toner image.
- For the reasons listed earlier, a more narrow character-stroke width might also help.
- Magnetic Ink Character Recognition (MICR) paper may fix toner cracking problems (see also the *HP MICR User's Guide* 5091-3857).

In xerographic (laser) printing, using paper that has a laid finish often causes problems. The surface roughness of the paper is often responsible for the problems.

Paper that is stiffer than xerographic paper also causes problems. Stiff papers do not fold well. When stiff paper is folded and a toner image is applied to the paper's surface, the problems are even worse.

# Transfer of Toner Image

After printing a document on an HP LaserJet printer, folding it, and sending it through the mail, you might observe that a portion of the print image was transferred to opposing surfaces of the folded document.

The laser printing process uses a pigmented plastic powder (toner) to form a print image that is first transferred to a sheet of paper (or other print medium) and then melted (fused) onto the surface of the paper to form a permanent image. Although paper is usually thought of as being soft, it is actually quite abrasive. When the printed page is folded, movement under pressure between a paper surface and the toner image may cause the paper to abrade (scratch) the toner, causing a transfer of the toner material onto the opposing surface of the paper. This can be demonstrated by rubbing a print image against (or into) a clean sheet of paper.

Some machinery, such as that used by the U.S. Postal Service to sort mail, can apply the necessary pressure and agitation to cause this phenomenon of toner image transfer.

To minimize this effect:

- Reduce the amount (or height) of toner used to produce the print image.
- Use a paper that is less abrasive.
- Ensure optimal fusing of the toner (print) image to the paper.

The **amount** of toner used to produce a print image is controlled by the print density dial, slide, or control panel settings in the HP LaserJet printers. The print density should be adjusted for a **lighter** image to reduce the amount (height) of toner prone to abrasive transfer.

The HP LaserJet printers have been designed for optimum results with xerographic (laser) bond papers, such as XEROX 4024 photocopy paper. The properties of this type of paper (for example, surface roughness, composition, moisture content) are such that the other causes of potential toner transfer are minimized. Photocopy papers are typically less abrasive than other types of paper (such as writing bond) and are also formulated to ensure optimal fusing of the toner image. Using other types of paper will generally yield less than optimal results in laser printers. For help in selecting paper suitable for use in the

HP LaserJet printers, refer to the *HP LaserJet Printer Family Paper Specification Guide*. This guide can be ordered by calling HP Parts Direct at 800-227-8164 in the U.S., or HP Distribution at 970-339-7009.

Because of the way that laser printing is accomplished, currently there is no way to entirely eliminate the possibility of toner transfer. However, using these techniques should yield more satisfactory results and will often reduce the problem to imperceptible levels.

## **Gray Background on Envelopes**

Poor print quality is normally the result of using envelopes that are of the incorrect weight or finish. The paper used to construct the envelope may be embossed; or may be too heavy, too rough, or too slick; or may be made in such a way that it is incompatible with the high temperatures encountered in toner fusing. The result is that the toner does not adhere well to the surface. Also, on heavier envelopes, a gray background may appear on the front (or print side) of the envelope. To reduce the gray background, the print density may need to be set to a darker setting. (On the LaserJet 5, “5” is the darkest setting and “1” is the lightest.)



# HP PLANET PARTNERS

The U. S., Canada, Europe, and Australia now have HP toner cartridge recycling programs. The used toner cartridge should be placed in the wrapper and box that held the new cartridge and sent back for recycling.

**U.S.** A brochure explaining the recycling program in the U.S., part number 5091-1325EUS, can be ordered. The customer returns used toner cartridges via UPS at no cost to the customer, using shipping labels included in the brochure. The toner cartridges can be shipped one at a time or in volume shipments. Some of the parts are recycled to make new cartridges. Other parts are melted for re-use as raw materials. If the customer has any questions, and to receive the free recycling brochure, refer them to the Customer Information Center at (800) 752-0900.

**AUSTRALIA** Australian customers can send their toner cartridges to their local HP dealer. If more than 30 cartridges a month are used, contact the local dealer for instructions on how to have the cartridges picked up directly from the customer's site. For further information, contact the dealer or local HP sales office.

**EUROPE** The recycling program in Europe currently includes these countries: Germany, Switzerland, Austria, United Kingdom, the Netherlands, and Sweden. If more than 30 cartridges a month are used, contact the local dealer for instructions on how to have the cartridges picked up directly from the customer's site. For further information, contact the dealer or local HP sales office.

**CANADA** Canada uses Federal Express for their recycling program. At least eight but no more than 40 Toner Cartridges can be shipped at one time. Shipments of fewer than eight cartridges are at the shipper's expense. Call Federal Express at (800) GoFedEx; (800) 463-3339 to arrange for free pickup of the bundled cartridges. Fill out a Federal Express Waybill or obtain a preprinted one from your dealer.

In Alberta, B.C., Manitoba, NWT, Saskatchewan, and the Yukon,  
send the bundles to:  
Hewlett-Packard Toner Cartridge Recycling Program  
6551 Westminister Hwy, Unit 160  
Richmond, B.C. V7C 4V4  
Acct. No.: 1246-1740-5

In the Atlantic provinces, Ontario, and Quebec  
send the bundles to:  
Hewlett-Packard Toner Cartridge Recycling Program  
6600 Goreway Drive, Unit C  
Mississauga, Ontario L4V 1S6  
Acct. No.: 1246-1740-5

**For more information, call:** Canada wide: (800) 387-3867,  
Dept. 129; Toronto: (800) 678-9430, Ext. 4981

## Note

Recycling information is now also included in the toner cartridge package.

For additional information about HP corporate-wide, environmental policies, practices, and awards, visit **[www.hp.com](http://www.hp.com)**.

## Refill Statement

Hewlett-Packard toner cartridges have been designed to maximize the reliability of the HP LaserJet printer by including all of the components that need frequent replacement or adjustment within the cartridge. While we recognize that all parts of this critical printer mechanism will not wear consistently, the HP toner cartridge has been designed to optimize the exceptional print quality that is synonymous with the HP LaserJet printer name. While Hewlett-Packard does not prohibit the use of refilled toner cartridges during the warranty period or under a maintenance contract, we also do not recommend their use for the following reasons:

- 1 The HP LaserJet toner cartridge is not designed to be refilled or remanufactured.
- 2 Hewlett-Packard has no control or process to ensure that a refilled toner cartridge will function at the high level of reliability of a new HP LaserJet toner cartridge. Hewlett-Packard also cannot predict what the long-term effect on the printer's reliability could be from using different toner formulations found in refilled cartridges. Because the HP LaserJet printer has the highest reliability reputation in the industry, we are concerned about any usage that might affect this reputation.
- 3 Hewlett-Packard has no control over the actual print quality of a refilled toner cartridge. The print quality of the HP LaserJet toner cartridge directly influences the customer's perception of the HP LaserJet printer itself. The high print quality of the HP LaserJet printer is one of the primary reasons for the success of the product and we are keenly interested in maintaining that image.

The entire family of HP LaserJet printers is covered under a standard one-year warranty from the date of purchase. Hewlett-Packard offers optional maintenance contracts after the one-year warranty expires. The use of refilled toner cartridges alone does not affect either the warranty or any maintenance contract purchased from HP. **However, if an HP LaserJet printer failure or damage is found to be directly attributed to the use of a refilled toner cartridge, the repair will not be covered under the warranty or by the maintenance contract.** Rather, standard time and material charges will be applied to service the printer for that particular failure or damage.

Hewlett-Packard is constantly striving to provide the highest quality printer products possible. The HP LaserJet printer family was designed for optimum output performance when the printing mechanism is periodically replaced with a new HP toner cartridge. The HP toner cartridge is designed specifically to enhance the output from the HP LaserJet family of printers. We know that the highest quality print results will be obtained when new HP toner cartridges are used with HP LaserJet printers.



# 7

## Printer options and user replaceable parts

### Overview

The following tables list the product, product number, product description, and service part number for each printer. Parts can be ordered through HP Parts Direct Ordering at (800) 227-8164 (U.S. only). For additional product support, see the inside back cover.

Product	Product Number	Product Description	Service Part Number
Memory	C2963A	1 MB SIMM 36 Bit	C2063A
	C2064A	2 MB SIMM 36 Bit	C2064A
	C2065A	4 MB SIMM 36 Bit	C2065A
	C2066A	8 MB SIMM 36 Bit (IIISi S/N 3200 & up)	C2066A
	C3130A	1 MB SIMM 32 Bit	C3130-60001
	C3131A	2 MB SIMM 32 Bit	C3131-69991
	C3132A	4 MB SIMM 32 Bit	C3132-60001
	C3133A	8 MB SIMM 32 Bit	C3133-60001
	C3146A	16 MB SIMM 32 Bit	C3146A
	C3838A	1 MB JEIDA	C3838A
	C3938A	2 MB JEIDA	C3938A
	C3148A	4 MB JEIDA	C3148A
	C3930A	2 MB FLASH SIMM	C39301A
	C3931A	4 MB FLASH SIMM	C3931A
Language Emulation	C3152A	PostScript Level 2 SIMM	C3152-69001*
	C3169A	PostScript Level 2 SIMM	C3169A-69001*
	C3918A	PostScript Level 2 SIMM	C3918-69001*
	C3987A	PostScript Level 2 SIMM	C3987-96001*
Boards I/O	J2550A	JetDirect Card for Ethernet/10Base-T	J2550-69001*
	J2552A	JetDirect Card for 10Base-T/BNC/Ltalk	J2552-69001*
	J2555	JetDirect Card for Token Ring	J2555-69002*
	J2374C	JetDirect Network Software/HP-UX	N/A
	J2375C	JetDirect Network Software/Sun Unix	N/A
	J2382A/B	JetDirect EX for Ethernet/10Base-T/BNC	J2382-69003*
	J2591A	JetDirect EX for Ethernet/10Base-T/BNC	J2591A
Envelope Feeder	C3927A	Envelope Feeder	C3927-69001*
	C3765A	Envelope Feeder	C3765-60501*
Duplex	C3720A	Duplexer Upgrade	
	C3762A	Duplexer Upgrade	C3762-60501
Service Maintenance and PM Kits	C3971A	Service Maintenance Kit with 110V fuser	C3971-69001*
	C3972A	Service Maintenance Kit with 110V fuser	C3972-69001*
		Service Maintenance Kit with 110V fuser	C3916-69001*
		Service Maintenance Kit with 110V fuser	C3916-69002*
Cleaning Tool		5P Cleaning Brush	RF5-0593-000CN
Disk Drive	C2965A	Disk Drive	C2965-69001*
Sheet Feeder/Stacker	C3763A	2000 Sheet Input (Tray 4)	C3763-69501*

\*Rebuilt part, requires exchange

6L	5Si	5L	6P	5P	5
				•	•
				•	•
				•	•
				•	•
	•		•	•	•
	•		•	•	•
	•		•	•	•
	•		•	•	•
	•		•	•	•
•		•			
•		•			
•		•			
					•
					•
	•			•	
			•		•
	•				•
	•				•
	•				•
•	•	•	•	•	•
		•			•
	•				•
	•				
	•				
					•
					•
			•	•	
	•				
	•				

Product	Product or Part Number	Product Description
Paper Trays	R75-4000-000CN	Universal Paper Cassette
	C3921A	Optional Lower Cassette w/Tray 3
	C3924A	250 Sheet Universal Cassette
	R77-0004-000CN	Tray 2
	R77-0003-000CN	Tray 3
	R98-4000-000CN	Universal Paper Cassette
I/O Cables	C2950A	Parallel IEEE-1284 compliant A to B (2.0m)
	C2951A	Parallel IEEE-1284 compliant A to B (3.0m)
	C2946A	Parallel IEEE-1284 compliant A to C (3.0m)
	C2947A	Parallel IEEE-1284 compliant A to C (10.0m)
	C2933A	Serial 25-pin-F/9 pin-M
	C2932A	Serial 9-pin-F/9 pin-M
Toner	92298A	HP Toner Cartridge
	C3903A	HP Toner Cartridge
	C3906A	HP Toner Cartridge
	C3909A	HP Toner Cartridge



6L	5Si	5L	6P	5P	5
				.	
					.
					.
	.				
	.				
			.		
.	.	.	.	.	.
.	.	.	.	.	.
			.	.	
			.	.	
					.
					.
					.
			.	.	
.		.			
	.				

Product	Product Number	Product Description	Service Part Number
Memory	33443A**	1 MB Board (Revision A)	33443-69001*
	33443B**	1 MB Board (Revision B)	33443-69004*
	33444A/B**	2 MB Board	33444-69012*
	33445A/B**	4 MB Board	33445-69012*
	33474A**	1 MB Board (replaced by Revision B)	33474-69004*
	33475A**	2 MB Board (replaced by Revision B)	33475-69011*
	33474B	1 MB Board	33474-69004*
	33475B	2 MB Board	33475-69011*
	C2024A	1 MB Memory Upgrade	C2024-69001*
	C2063A	1 MB SIMM 36 Bit	C2063A
	C2064A	2 MB SIMM 36 Bit	C2064A
	C2065A	4 MB SIMM 36 Bit	C2065A
	C2066A	8 MB SIMM 36 Bit (IIISI S/N 3200 & up)	C2066A
	C3130A	1 MB SIMM 32 Bit	C3130-60001
	C3131A	2 MB SIMM 32 Bit	C3131-60001
	C3132A	4 MB SIMM 32 Bit	C3132-60001
Language Emulation	C3133A	8 MB SIMM 32 Bit	C3133-60001
	C3146A	16 MB SIMM 32 Bit	C3146A
	33438P**	PostScript cartridge	
	33439P**	PostScript cartridge	33439-69001*
	33439Q**	PostScript cartridge	33439-69001*
	33494B**	PS Level 1 ROM (IIISI S/N 3199 & lower)	3349469002*
	33484C**	PS Level 1 SIMM (IIISI S/N 3200 & later)	33494-69004*
	33494D**	PS Level 2 ROM (IIISI S/N 3199 & lower)	33494-69007*
	33494E**	PS Level 2 SIMM (IIISI S/N 3200 & later)	33494-49008*
	C2013A	PostScript Level 2 SIMM (4Si)	C2013-69001*
	C2049A**	PostScript SIMM	C2049-67901
	C2080A	PostScript SIMM	C2080-69001*
	C3159A	PostScript SIMM	C3159-69001*
	C3129A	PostScript SIMM	C3129-69001*
	33498A**	Epson/IBM ProPrinter cartridge	33498-67901
	C2081A**	Epson/IBM ProPrinter Emulated SIMM	n/a
	C2088A**	PCL 5 cartridge	C2088-60101
	C2089A**	PostScript cartridge Plus	C2089-69001*

\*Requires exchange. \*\* No longer available.



Product	Product Number	Product Description	Service Part Number
Boards I/O	33416B**	AppleTalk	33416-67901
	33417C*	AppleTalk	33417-67901
	26013A*	Status Readback card	26013-60001
	C2059A**	Novell Ethernet MIO	28636-69001*
	C2059B**	LAN Server/LAN Manager 802.3	28636-69101*
	C2059C**	Novell Token Ring MIO	28637-69001*
	C2059D**	LAN Server/LAN Manager Token Ring	28637-69201*
	C2059E**	EtherTalk MIO	28636-69301*
	C2059F*	LocalTalk MIO	J2341-69001*
	C2059H*	MPE ESC? MIO card for the HP 3000	28644-60101
	C2059T*	TCP/IP Ethernet	28636-69401*
	J2337A**	Ethernet/802.3 (BNC/RJ-45) Novell	J2337-69001*
	J2338A**	802.3 (BNC/RJ-45) LAN Srvr/LAN Mgr	J2338-69001*
	J2339A**	EtherTalk (BNC/RJ-45) Apple	J2339-69001*
	J23401**	TCP/IP Ethernet (BNC/RJ-45) Unix	J2340-69001*
	J2341B**	LocalTalk (DIN-8)	J2341-69001*
	92270N**	RS-422-A Serial Adapter for LJ IIIP	N/A
	C2071A	Novell/Ethernet/802.3; BNC	27303-69001*
	C2071B	Novell/Ethernet/802.3; RJ45 port	27305-69001*
	C2071C	LAN Manager/Ethernet/802.3 BNC	27303-69101*
	C2071D	LAN Manager/Ethernet/802.3; RJ45	27305-69101*
	C2071E	Novell/Token Ring/802.5	27304-69001*
	C2071F	LAN Manager/Token Ring/ 802.5	27304-69201*
	C2071S	HP JetDirect Card for UNIX/10Base-T	27305-69401*
	C2071T	HP JetDirect Card for UNIX/ThinLan	27303-69401*
	J2371A**	JetDirect Card for Ethernet/Base-T	J2371-69001*
	J2372A**	JetDirect Card for Ethernet/10Base-T/ BNC	J2372-69001*
	J2373A**	JetDirect Card for Token Ring	J2373-69001*
	J2550A	JetDirect Card for Ethernet/10Base-T	J2550-69001*
	J2552A	JetDirect Card for 10Base-T/BNC/Ltalk	J2552-69001*
	J2555A	JetDirect Card for Token Ring	J2555-69002*
	J2374C	JetDirect Network Software/HP-UX	N/A
	J2375C	JetDirect Network Software/Sun Unix	N/A
	J2382A/B	JetDirect EX for Ethernet/10Base-T/ BNC	J2382-69003*
	J2383B	JetDirect EX for Token Ring	J2383-69005*

\*Requires exchange. \*\*No longer available.

4V	4P	4L	4+	4	4Si	IIISi	IIIP	IIP+ IIP	IIID	III	IID	II
							•	•	•	•	•	
									•	•	•	
						•						
						•						
						•						
						•						
						•						
						•						
				•		•						
				•		•						
				•		•						
				•		•						
				•	•	•						
							•					
									•	•	•	•
									•	•	•	•
									•	•	•	•
									•	•	•	•
									•	•	•	•
									•	•	•	•
									•	•	•	•
									•	•	•	•
				•	•	•						
				•	•	•						
•			•	•	•	•						
•			•	•	•	•						
•			•	•	•	•						
•			•	•	•	•						
•			•	•	•	•						
•			•	•	•	•						
•	•	•	•	•	•	•	•	•	•	•	•	•
•	•	•	•	•	•	•	•	•	•	•	•	•

Product	Product Number	Product Description	Service Part Number
Envelope Feeder	33457A**	50 envelope power feeder	33457-69001*
	33458A**	50 envelope power feeder	33458-69001*
	C2060A	100 envelope power feeder	C2060-69001*
	C2082A**	75 envelope power feeder	C2082-69001*
	C2082B	75 envelope power feeder	C2082-69001*
		Separation Pad for IID Env. Feeder	RF1-2660-000CN
		Paper Tray Lid for Envelope Feeder	RG1-2802-000CN
Duplex	C2061A	Duplexer Upgrade	C2061-69001*
	C3157A	Duplexer Upgrade	
Service Maintenance PM Kits		Service Maintenance Kit with 115V fuser	33449-69007*
		Service Maintenance Kit with 240V fuser	33449-69008*
		Service Maintenance Kit with 110V fuser	C2001-69012*
		Service Maintenance Kit with 240V fuser	C-2001-69013*
	C2062A	110V User Maintenance Kit	C2062-69001*
	C2087A	220V PM Kit	C2087-69001*
		Service Maintenance Kit with 110V fuser	C2037-69010*
		Service Maintenance Kit with 240V fuser	C2037-69011*
		Service Maintenance Kit with 110V fuser	33481-69007*
		Service Maintenance Kit with 110V fuser	C1341-69010*
		Service Maintenance Kit with 220V fuser	C1341-69011*
Power Cord		Right Angle 110V power cord	8120-6177
Cleaning Tool		Velcro adhesive cleaning brush holder	RB1-3389-000CN
		Cleaning brush	RF5-0690-000CN
		Cleaning brush	FB1-0733-000CN
Disk Drive	C3295A	Disk Drive	C3295-69101
Sheet Feeder/ Stacker	C2921A	1500 Sheet Feeder (Letter)	C2921-63001
	C2920A	1500 Sheet Feeder (A4)	C2920-63001
	C2810A	2000 Sheet Output Stacker	

\*Requires exchange. \*\*No longer available.

4V	4P	4L	4+	4	4Si	III Si	IIIP	IIP IIP+	IIID	III	IID	II
											•	
					•	•			•			
				•								
			•	•								
					•	•			•			
					•	•						
			•		•	•						
									•	•	•	•
									•	•	•	•
				•								
				•								
					•	•						
					•	•						
			•									
			•									
•							•	•				
•												
		•										
	•											
	•				•	•						
•												
					•	•						
					•	•						
					•	•						

Product	Product or Part #	Product Description
Paper Trays	33472A**	Optional Lower Cassette with letter tray 92275B
	33472A/B**	Optional Lower Cassette with A4 tray 92275D
	92275B	Letter-size tray (8.5 x 11 in)
	92275C	Legal-size tray (8.5 x 14 in)
	92275D	A4-size tray (210 x 297 mm)
	92275E	Executive-size tray (7.25 x 10.5 in)
	92275F	Envelope tray (Com-10, Monarch, DL, C5)
	92295B**	Letter-size tray (8.5 x 11 in)
	92295C**	Legal-size tray (8.5 x 14 in)
	92295D**	A-4 size tray (210 x 297 mm)
	92295E**	Executive-size tray (7.25 x 10.5 in)
	92295F**	Envelope tray (Com-10, Monarch, DL, C5)
	92297B	Letter-size tray (8.5 x 11 in)
	92297C	Legal-size tray (8.5 x 14 in)
	92297D	A-4 size tray (210 x 297 mm)
	92297E	Executive-size tray (7.25 x 10.5 in)
	92297F	Envelope tray (Com-10, Monarch, DL, C5)
	92291B	Letter-size tray (8.5 x 11 in)
	92291C	Legal-size tray (8.5 x 14 in)
	92291D	A-4 size tray (210 x 297 mm)
	92291E	Executive-size tray (7.25 x 10.5 in)
	C2083A**	Optional Lower Cassette with C2084A tray
	C2083B**	Optional Lower Cassette with C2084B tray
	C2083D	Optional Universal Lower Cassette
	C3160A	250 Sheet Cassette (Letter/A4)
	C3161A	250 Sheet Cassette (11x17/A3)
	C3760A	Optional Lower Cassette and Base (500 sheet)
	C2084A	Universal LC tray—all paper except Legal (500 sheet)
	C2084B**	Universal LC tray—all paper except Legal (250-sht)
	C2085A	Universal PC tray—all paper except Legal (250-sht)
	C2085B	PC tray—letter only (250 sheet)
	C2085C	PC tray—A4 only (250 sheet)
	C2085D	250 Sheet Universal Cassette
	R75-0010-000CN	Universal Paper Cassette
	R752010-000CN	Universal Paper Cassette
Paper Tray	92295R	For 92295 B/D/E
Replace-ment	92295S	For 92295C
	92295U	For use with 33457A envelope feeder
	92297R	For 92297 B/D/E
Top Cover	92297S	For 92297C

\*Requires Exchange. \*\*No longer available.





Product	Product or Part Number	Product Description
I/O Cables	92284A**	Parallel 25 pin-M/36 pin-M 2.13 m (7.0 ft)--most PCs
	24542D**	Parallel 25 pin-M/36 pin-M 3.0 m (9.9 ft)
	C2950A	Parallel IEEE-1284 compliant A to B (2.0 m)
	C2951A	Parallel IEEE-1284 compliant A to B (3.0 m)
	C2913A	Serial 25 pin-F/25 pin-M 1.2 m (3.9 ft)
	92219J**	Serial 9 pin-F/25 pin-M 5.0 m (16.7 ft)
	24542G	Serial 9 pin-F/25 pin-M 3.0 m (9.9 ft) (for most PCs)
	92215S	Serial, DIN8 2.0 m (6.6 ft) for Apple Macintosh
	92215N	Phone NET or LocalTalk, Macintosh Network Cable Kit
	C2933A	Serial 25 pin-F/9 pin-M
	C2932A	Serial 9 pin-F/9 pin-M
	92275A	HP Toner Cartridge
	92285A	HP Toner Cartridge (2686A, 2686D)
	92295A	HP Toner Cartridge
	92291A	HP Toner Cartridge
	92298A	HP Toner Cartridge
	92274A	HP Toner Cartridge
	C3900A	HP Toner Cartridge

\*Requires exchange. \*\*No longer available.

4V	4P	4L	4+	4	4Si	IIISi	IIIP	IIP+ IIP	IIID	IID	III	II
		•		•	•	•	•	•	•	•	•	•
		•		•	•	•	•	•	•	•	•	•
•	•	•	•	•	•	•	•	•	•	•	•	•
•	•	•	•	•	•	•	•	•	•	•	•	•
				•	•	•	•	•	•	•	•	•
				•	•	•	•	•	•	•	•	•
				•	•	•	•	•	•	•	•	•
		•					•	•	•	•	•	
				•		•	•	•	•	•	•	
	•		•									
	•		•									
							•	•				
									•	•	•	
					•	•						•
			•	•								
•	•	•										




# 8

## Service parts

### Overview

This chapter provides a list of the hardware found in HP LaserJet printers. In the following tables, the shaded areas refer to the location of the part in the printer, as shown in the corresponding illustration. The tables also provide the part or product number and a description.

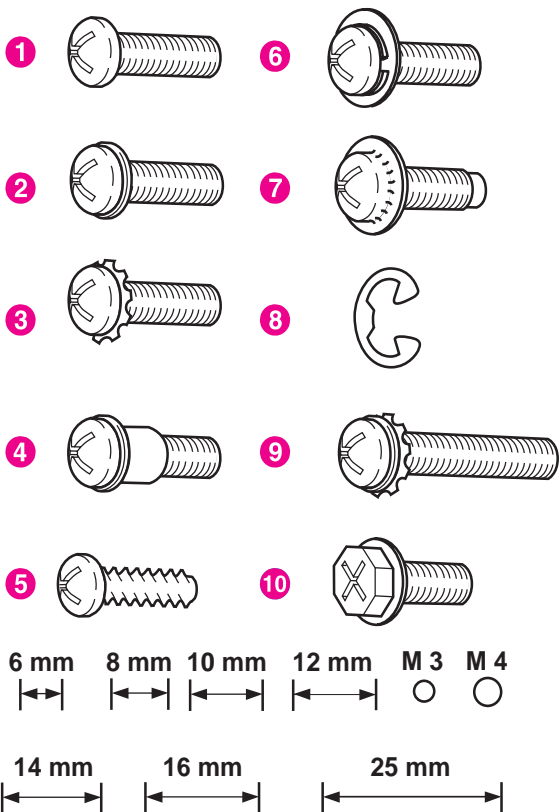

**Figure 8-1 Common Hardware**

# Common Hardware



1	XB1-2300-606CN	M3 x 5mm	Pan-head Phillips
1	XB1-2300-507CN	M3 x 5mm	Pan-head Phillips
1	XB1-2300-607CN	BH3 x 6mm	Pan-head Phillips
1	0515-1895	M3 x 8mm	Pan-head Phillips
1	XB1-2301-407CN	M4 x 14mm	Pan-head Phillips
1	XB1-2400-606CN	M4 x 6mm	Pan-head Phillips
1	XB1-2400-809CN	M4 x 8mm	Pan-head Phillips
1	0515-1912	M4 x 8mm	Pan-head Phillips
1	XB1-1300-807CN	M3 x 8 mm	Pan-head Phillips
2	XA9-0434-000CN	M3 x 4mm	Washer-head Phillips
2	XA9-0267-000CN	M3 x 6mm	Washer-head Phillips
2	XA9-0253-000CN	M3 x 8mm	Washer-head Phillips
2	XA9-0542-000CN	M3 x 10mm	Washer-head Phillips
2	XA9-0540-000CN	M4 x 8mm	Washer-head Phillips
3	XA9-0653-000CN	M3 x 6mm	Star-washer Phillips
3	XA9-0389-000CN	M3 x 8mm	Star-washer Phillips
3	XA9-0654-000CN	M3 x 10mm	Star-washer Phillips
3	XA9-0192-000CN	M4 x 6mm	Star-washer Phillips
3	XA9-0828-000CN	M3 x 6mm	Star-washer Phillips
4	RBI-5552-000CN	M3	Shoulder Screw Phillips
4	RAI-7636-000CN	M3	Shoulder Screw Phillips
4	RBI-5489-000CN	M3 x 4mm	Shoulder Screw Phillips
4	XA9-0342-000CN	M3 x 8mm	Shoulder Screw Phillips
5	XB4-7300-609CN	M3 x 6mm	Self-tapping Phillips
5	XB4-7400-809CN	M4 x 8mm	Self-tapping Phillips
5	XB4-7401-009CN	M4 x 10mm	Self-tapping Phillips
5	XB4-7401-007CN	M4 x 10mm	Self-tapping Phillips
5	XB4-7401-209CN	M4 x 12mm	Self-tapping Phillips
5	XB6-7300-607CN	M3 x 6mm	Self-tapping Phillips

## Common Hardware continued

6	XA9-0253-000CN	M3 x 8mm	Loose Flat/Lock Washer Phillips
6	XA9-0584-000CN	M3 x 12mm	Loose Flat/Lock Washer Phillips
7	FA9-1449-000CN		Star-washer trus-head Phillips
7	XB1-2302-507CN	M3 x 25mm	Trus-head Phillips
7	XB6-7300-809CN	M3 x 8mm	Trus-head Phillips
7	XA9-0326-000CN	M3 x 4mm	Trus-head Phillips
7	XB6-7300-807CN	M3 x 8mm	Trus-head Phillips
8	XD2-1100-242CN	2.4mm	Retaining Ring (e-type)
8	XD2-1100-322CN	3.2mm	Retaining Ring (e-type)
8	XD2-1100-402CN	4.0mm	Retaining Ring (e-type)
8	XD2-1100-502CN	5.0mm	Retaining Ring (e-type)
8	XD2-1100-642CN	6.4mm	Retaining Ring (e-type)
8	XG9-0260-000CN		Retaining Ring (e-type)
8	XD2-2300-507CN	5.0mm	Grip Ring (c-type)
9	XA9-0375-000CN	3m x 25 mm	Loose Flat/Star Washer Phillips
10	XA9-0686-000CN	M3 x 6mm	Hexhead Screw
10	XA9-0724-000CN	M3 x 8 mm	Hexhead Screw
10	XA9-0824-000CN	M3 x 10mm	Hexhead Screw
10	XA9-0813-000CN	M3 x 8mm	Hexhead Screw with washer



## J 6L, 5L Parts

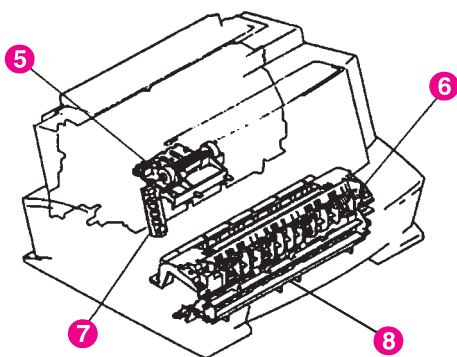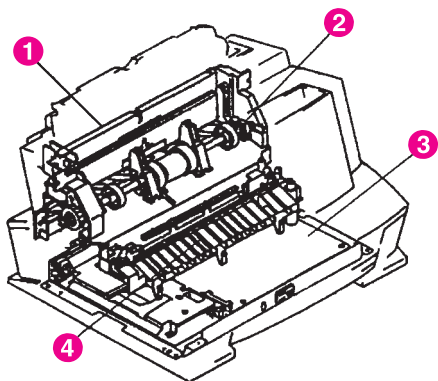


**Figure 8-2** LJ 6L, 5L Parts

<b>LJ 6L, 5L Parts (See figure 8-2)</b>		
1	RB1-7177-000CN	Paper Feed Frame
2	RG5-1940-000CN 5L RG5-3486-000CN 6L	Pick-up Roller Assembly
3	C3941-69001 5L RG5-3506-000CN 6L	DC Controller PCA, exchange (110V)
3	C3941-69002 5L RG5-3509-000CN 6L	DC Controller PCA, exchange (220V)
4	RF5-1534-000CN	Transfer Roller
4	RF5-1530-000CN 5L RF5-2358-000CN 6L	Transfer Roller Guide
5	RG5-1942-000CN 5L RG5-3485-000CN 6L	Feed Assembly
6	RG5-2012-000CN 5L RG5-3474-000CN 6L	Delivery Assembly
7	RG5-2028-000CN	Control Panel PCA
8	RG5-2013-000CN 5L RG5-3475-000CN 6L	Separation Guide Assembly
	C3942-67902 5L C3991-60001 6L	Formatter (new)
	C3942-69002 5L	Formatter (exchange)
	RG5-1964-000CN 5L RG5-3459-000CN 6L	Heating Element (110V)
	RG5-1965-000CN 5L RG5-3463-000CN 6L	Heating Element (220V)
	RH7-1282-000CN 5L RH7-1320-000CN 6L	Main Motor

LJ 6L, 5L Parts (continued) (See figure 8-2)		
	RF5-1516-000CN 5L RF5-2362-000CN 6L	Pressure Roller
	RG5-2000-000CN 5L RG5-3494-000CN 6L	Laser Scanner (new)
	C3941-69003 5L	Laser Scanner (exchange)
	RY7-5005-000CN	Gear Kit #1
	RY7-5006-000CN 5L RY7-5036-000CN 6L	Gear Kit #2
	RY7-5007-000CN	Fuser Release Kit
	RY7-5008-000CN	Separation Pad Kit
	RY7-5009-000CN	Input Sensor Arm Kit
	RG5-2029-000CN	Paper Pickup Cable
	RG5-2031-000CN 5L RG5-3662-000CN 6L	Door Sensor Cable
	RG5-2032-000CN	Thermistor Cable
	RG5-2033-000CN	Motor Cable
	Rg5-2034-000CN 5L RG5-3661-000CN 6L	Scanner Cable
	RG5-2035-000CN 5L	Laser Cable
	RG5-2036-000CN 5L RG5-3499-000CN 6L	Control Panel Cable
	RG5-2037-000CN 5L	Door Switch Cable

# LJ 5Si Mopier Paper Handling

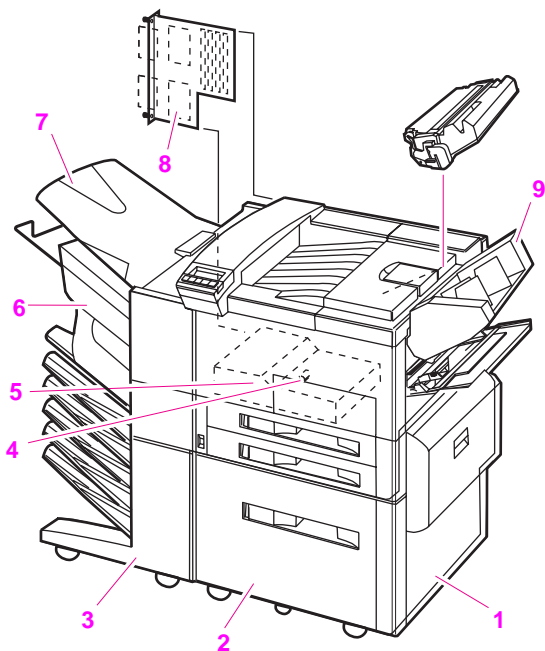

**Figure 8-3** LJ 5Si Mopier Paper Handling Components

**LJ 5Si Mopier Paper Handling Components**

1	C3763A C3763-69501	2000 Sheet Input Unit Assembly (exchange)
2	RG5-2155-000CN	Tray 4 Assembly
3	C3764-69100	Multi-Bin Mailbox (exchange)
3	C3766-69515	Mailbox with Stapler (exchange)
4	RB1-6822-000CN	Duplex Unit Roller 1
5	C3762-60501	Duplex Unit
6	C3766-69500	Stapling Unit (exchange)
7	RB1-6491-000CN	Face Up Bin
8	C3764-60504	External Paper Handling PCA (Multi-Bin Mailbox)
8	C40776-60500	External Paper Handling PCA (Mailbox with Stapler)
9	C3765-60501	Envelope Feeder
	C3764-7000	C-Link Cable (178 cm)
	C3763-7000	C-Link Cable (61 cm)
	C3766-60512	C-Link Cable (97 cm)
	C4077-60102	3-Way Power Adaptor

# LJ 5Si Parts


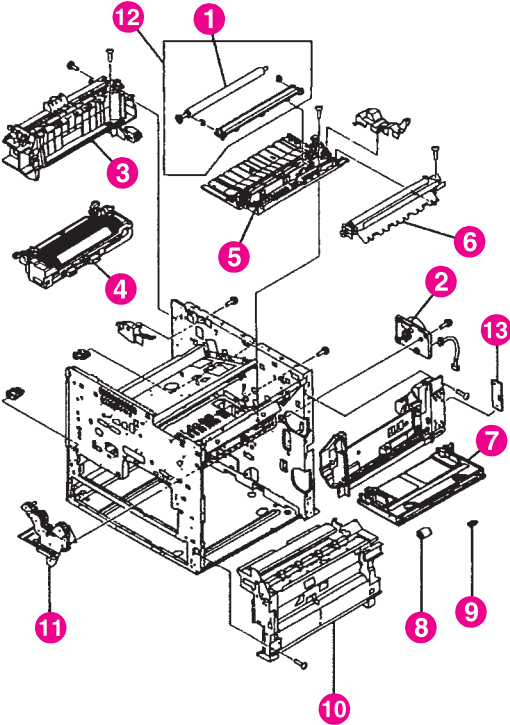


Figure 8-4 LJ 5Si Parts

LJ 5Si Parts		
1	RF5-1412-000CN	Transfer Roller
2	RH7-1260-000CN	Main Motor
3	RG5-1874-000CN	Face-Down Delivery Assembly
4	C3166-69012	Fusing Assembly 100-120V, exchange
4	C3166-69013	Fusing Assembly 220-240V, exchange
5	RG5-1834-000CN	Feeder Assembly
6	RG5-1833-000CN	Registration Assembly
7	RG5-1880-100CN	Tray 1 Pick Up Assembly
8	RB1-6730-000CN	Tray 1 Feed Roller
9	RF5-1455-000CN	Tray 1 Separation Pad
10	C3166-69011	Paper Input Unit (PIU), exchange
11	RG5-1847-000CN	Main Gear Assembly
12	RG5-1887-000CN	Transfer Roller Assembly
13	RG5-1884-000CN	Tray 1 PCA

## LJ 5Si Parts

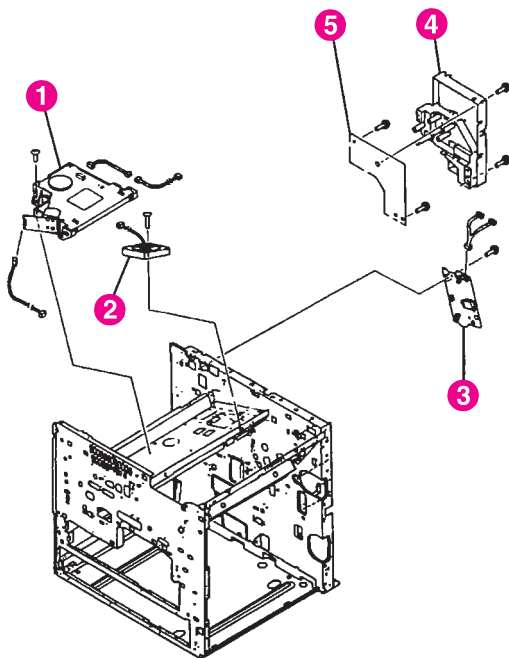


**Figure 8-5** LJ 5 Si Parts



<b>LJ5 Si Parts</b>		
1	C3166-69006	Laser Scanner Assembly, exchange
2	RH7-1266-000CN	Fan 1
3	RG5-1846-000CN	Switch/Sensor PCA
4	C3166-69005	High Voltage Power Supply, exchange
5	C3166-69010	DC Controller PCA, exchange
	RG5-2433-000CN	Front Panel (Control Panel Display) not shown


## LJ 5Si Parts

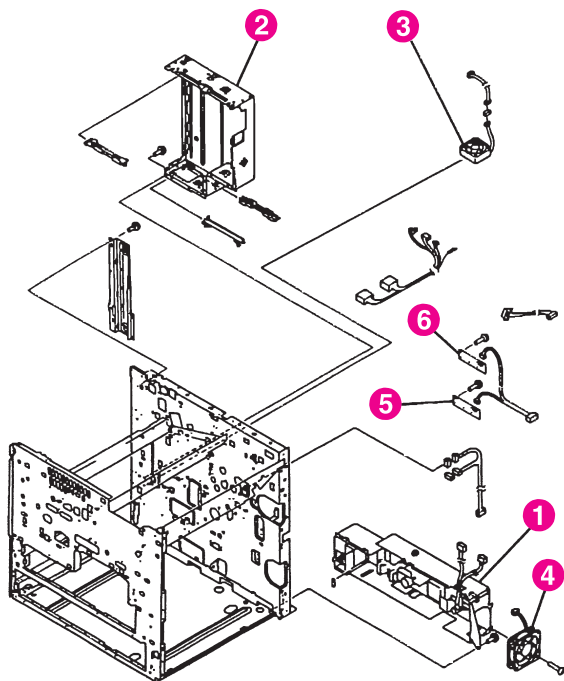


**Figure 8-6** LJ 5Si Parts

<b>LJ 5Si Parts</b>		
1	C3166-69007	Low Voltage Power Supply, 110-120, exchange
1	C3166-69008	Low Voltage Power Supply, Universal, exchange
2	C3168-69005	Formatter, exchange
3	RH7-1271-000CN	Fan 3
4	RH7-1266-000CN	Fan 2
5 & 6	RG5-1845-000CN	Paper-Size Sensing PCA, Trays 2 and 3

# LJ 6P, 5P Parts

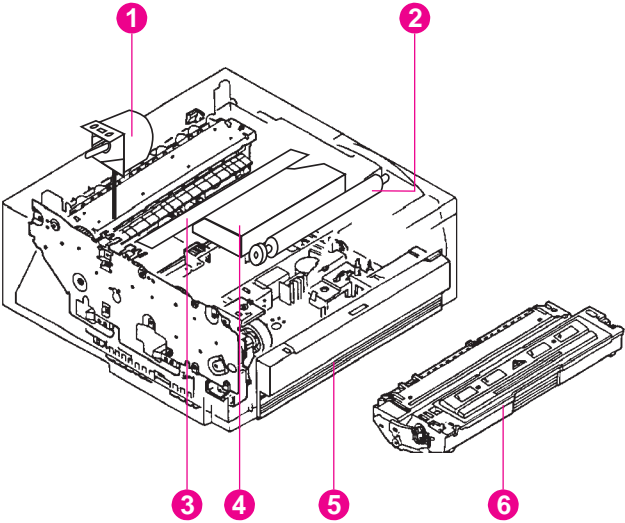

**Figure 8-7** LJ 6P, 5P Parts

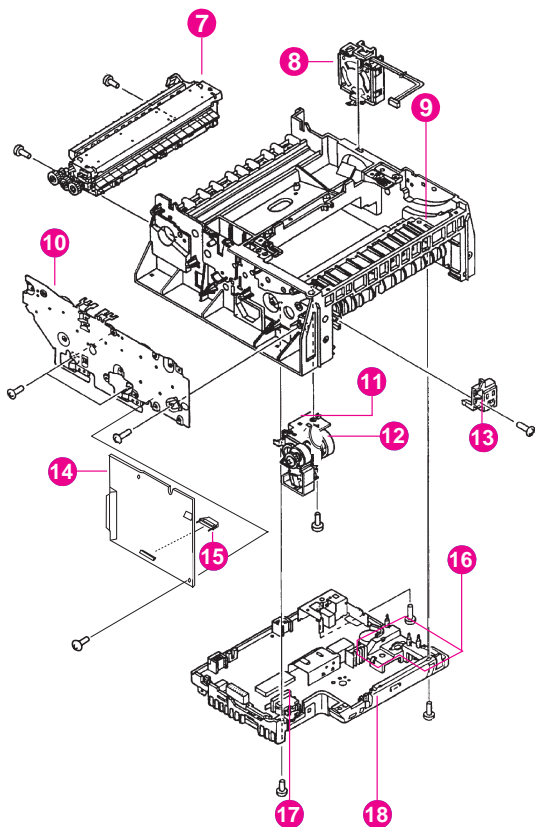

**Figure 8-8** LJ 6P, 5P Parts (continued)


<b>LJ 6P, 5P Parts (See figures 8-7 and 8-8)</b>		
1	RG5-1799-000CN 5P RG5-2786-000CN 6P	Motor Assembly Motor Assembly
2	RF5-1290-000CN 5P RF5-0596-000CN 6P	Transfer Roller Assembly Transfer Roller Assembly
3	RG5-1786-000CN	Mirror Assembly
4	C3150-69005* 5P C3980-69005* 6P	Laser Scanner Assembly (exchange) Laser Scanner Assembly (exchange)
5	R75-4000-000CN 5P R98-1001-000CN 6P	Complete Tray 2 Assembly Complete Tray 2 Assembly
6	C3903A	Toner Cartridge
7	C3150-69003* 5P C3150-69004* 5P C3980-69003* 6P C3980-69004* 6P	Complete Fuser Assembly (100-120V)(exchange) Complete Fuser Assembly (220-240V)(exchange) Complete Fuser Assembly (100-120V)(exchange) Complete Fuser Assembly (220-240V)(exchange)
8	RG5-1801-000CN 5P RG5-2776-000CN 6P	Fan Assembly Fan Assembly
9	RG5-1698-000CN RF5-1283-000CN	Top Oblique Roller Assembly Static Charge Eliminator
10	RG5-1713-000CN 5P RG5-2778-000CN 6P	Gear Train Assembly Gear Train Assembly
11	RG5-1692-000CN 5P RG5-2796-000CN 6P RG5-1693-000CN 5P RG5-2790-000CN 6P	Pickup Assembly (Tray 2) Pickup Assembly (Tray 2) Complete Tray 1 Pickup Assembly Complete Tray 1 Pickup Assembly
12	RB1-6332-000CN	Pickup Roller (Tray 2)

<b>LJ 6P, 5P Parts (continued)</b> <b>(See figures 8-7 and 8-8)</b>		
13	RB1-2205-000CN	Tray 1 Roller
14	C3151-69001* 5P C3981-69001* 6P	Formatter PCA (exchange) Formatter PCA (exchange)
15	1252-5460	Formatter to Controller PCA Connector
16	RG5-1719-000Cn	High-voltage Connector Assembly
17	RH7-1258-000CN 5P RH7-5160-000C 6P	Tray 1 Solenoid (SL2) Tray 1 Solenoid (SL2)
18	C3150-69001* 5P C3150-69002* 5P C3980-69001* 6P C3980-69002* 6P	DC Controller PCA (110-120V) (exchange) DC Controller PCA (220-240V) (exchange) DC Controller PCA (110-120V) (exchange) DC Controller PCA (220-240V) (exchange)
	RG5-1702-000CN 5P RG5-1703-000CN 5P RG5-2802-000CN 6P RG5-2803-000CN 6P RG5-1801-000CN 5P RG5-2776-000CN 6P RG5-0593-000CN RB1-5939-000CN 5062-4661	Hot Roller 120V Hot Roller 220V Hot Roller 120V Hot Roller 220V Fan Fan Brush, Mirror Sensor Arm, Tray 1 Infrared Communication Test Tool

\*Rebuilt part, requires exchange

\*\*Cover assembly does not include items 3, 5, and 6.

## LJ 5 Parts

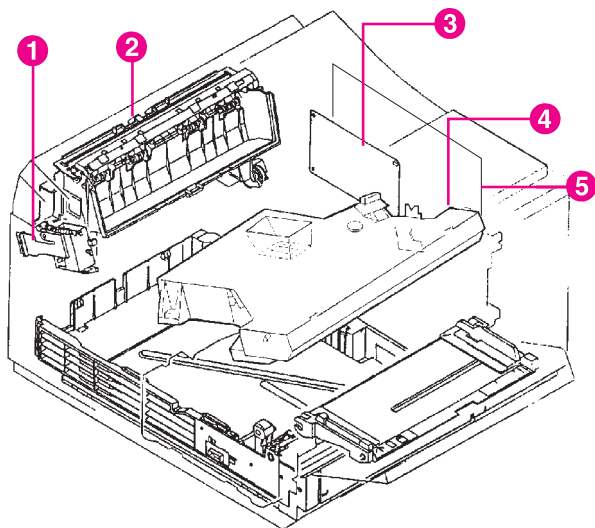


**Figure 8-9** LJ5 Parts



LJ 5 Parts		
1	RG5-0475-060CN	Paper Output Sensor Assembly
2	RG5-2189-000CN	Paper Output Assembly
3	C2037-69004*	DC Controller PCA
4	C2037-69008*	Laser Scanner Assembly
5	C3919-69001*	Formatter PCA
	RB1-2205-000CN	Tray 1 Pickup Roller
	RB1-7911-000CN	Tray 2 Pickup Roller
	RB1-7983-000CN	Tray 3 Pickup Roller
	RB1-2133-000CN RF5-0343-000CN RF5-0349-000CN	Paper Out Sensor Flag Tray 1 Separation Pad Transfer Roller

\*Rebuilt part, requires exchange

## LJ 5 Parts, continued

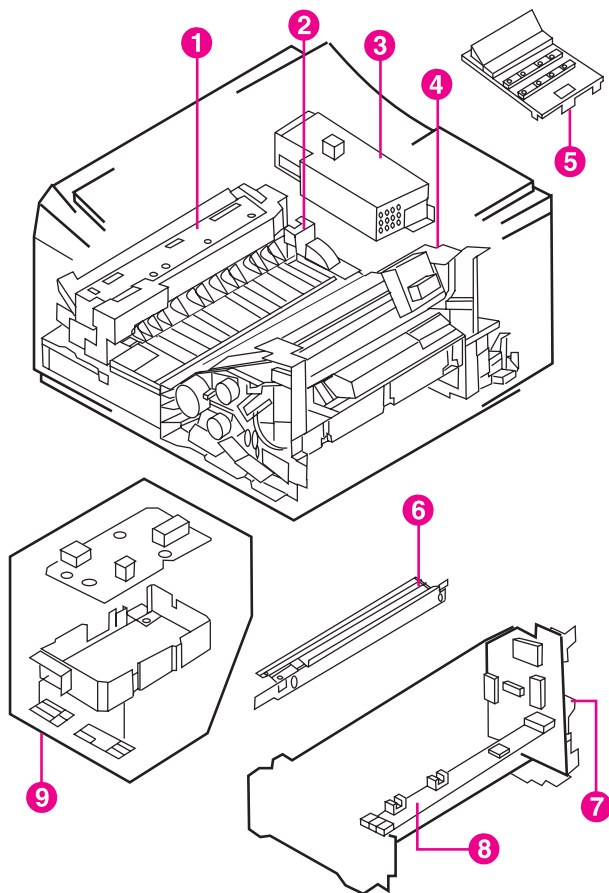


**Figure 8-10 LJ5 Parts**

<b>LJ5 Parts (See figure 8-10)</b>		
1	C2037-69001* C2037-69002*	110V Fusing Assembly 240V Fusing Assembly
2	RH7-1301-000CN	Main Motor
3	C2037-69006* C2037-69007*	110V Power Supply 240V Power Supply
4	C3916-69005*	Paper Feed Assembly
5	RG5-2238-000CN	Display Assembly (without overlay)
6	RG5-0469-020CN	Transfer Guide Assembly
7	RG5-0512-070CN	Paper Control PCA
8	RG5-0514-000CN	Sensor PCA
9	C2037-69009*	High Voltage PCA

\*Rebuilt part, requires exchange


## LJ 5 Duplexer Parts

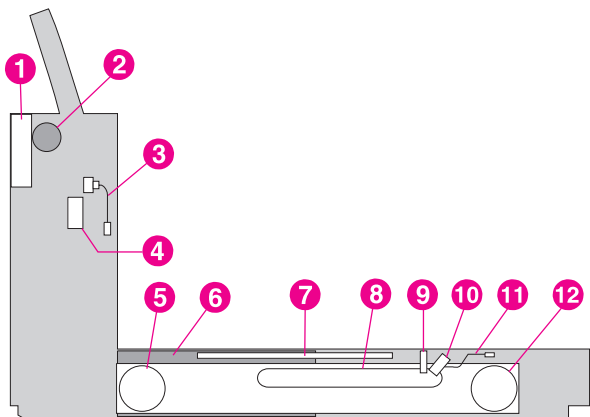

**Figure 8-11** LJ5 Duplexer (cross-section)

<b>LJ5 Duplexer Parts</b>		
1	RH7-1235-000CN	Switchback Fan
2	RF1-3813-000CN	Switchback Stepper Motor (M2)
3	RG1-3529-000CN	Switchback Sensor Cable
4	RF1-3808-000CN	Switchback Solenoid (SL1)
5	RF1-3814-000CN	Rear Holding Tray Motor (M3)
6	RG1-3503-000CN	Power Supply Assembly
7	RG1-3582-000CN	Duplex Control PCA
8	RA2-2072-000CN	Timing Belt
9	RA2-2076-000CN	Sensor Arm
10	WG8-5210-000CN	Photosensor (PS2)
11	RG1-3530-000CN	Paper Pickup Cable
12	RF1-3815-000CN	Front Holding Tray Motor (M1)

## LJ 4V, 4MV Parts

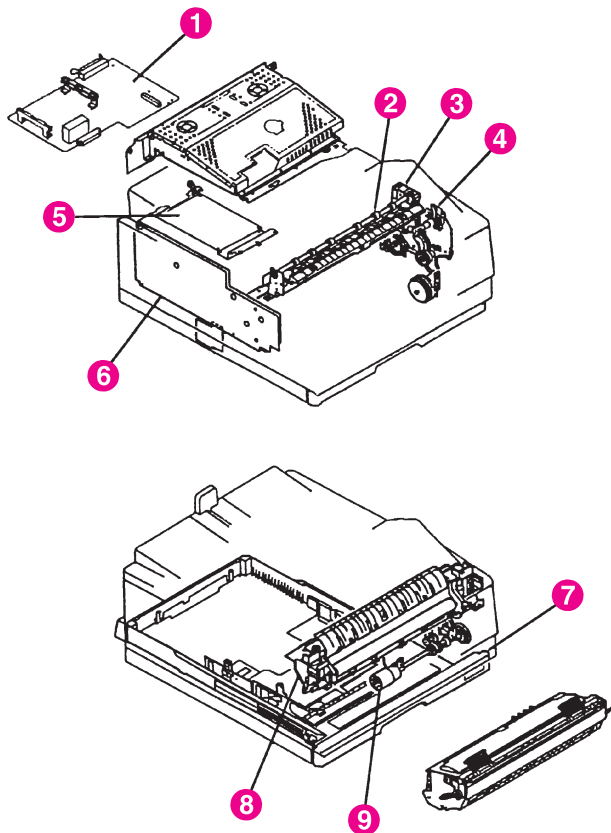


**Figure 8-12** LJ 4V/4MV Major Assemblies

LJ 4V/4MV Parts		
1	C3143-69001*	Exchange Formatter PCA
2	RG5-0198-000CN	Face Down Delivery Assembly
3	RG5-1545-000CN	Guide, Delivery Unit
4	RG5-1398-000CN	Main Drive Assembly
5	C3141-69003*	DC Controller PCA Assembly
6	RG5-2044-000CN	HV Power Supply Assembly
7	RG5-1552-000CN	Fuser
8	C3141-69002*	Fusing Assembly 100/115V
9	C3141-69001*	Fusing Assembly 220/240V
	RG5-1391-000CN	Pickup Roller Assembly (not shown)
	RF5-0302-000CN	Separation Pad
	RG5-1566-000CN	Drum Drive Assembly
	RS5-2123-000CN	Spring, Compression
	RH7-1126-000CN	Fan (FM1)
	RH7-5094-000CN	Registration Clutch
	RG5-2041-000CN	Laser/Scanner Assembly
	C3141-69005*	Power Supply Assembly 100/115V
	C3141-69006*	Power Supply Assembly 220/240V
	C3141-69007*	Paper Guide Plate Assembly
	RH7-1199-000CN	Motor, dc 17.5W
	WD1-0224-000CN	Fuse, 125V, 6.3A
	VD7-0643-151CN	Fuse, 250V, 3.15A
	RH7-1214-000CN	Fan (FM2)
	RH7-1317-000CN	Fan (FM3)
	RG5-1539-000CN	Digital Display Panel 100/115V
	RG5-1540-000CN	Digital Display Panel 220/240V
	RB1-6389-000CN	Static Charge Eliminator
	RG5-1410-000CN	Transfer Roller Assembly
	RG5-1555-060CN	Guide


RG5-1442-000CN	Cable, Beam Detect
RG5-1446-000CN	Option Cable Assembly, 500 Sheet LC
RB5-1447-000CN	Clutch Cable
RH-6-0098-000CN	Plastic Bezel (does not include digital display)
RG-5-0239-000CN	DC Cable Assembly
RG5-1485-000CN	Display Panel Cable Assembly

## LJ 4P, 4L Parts

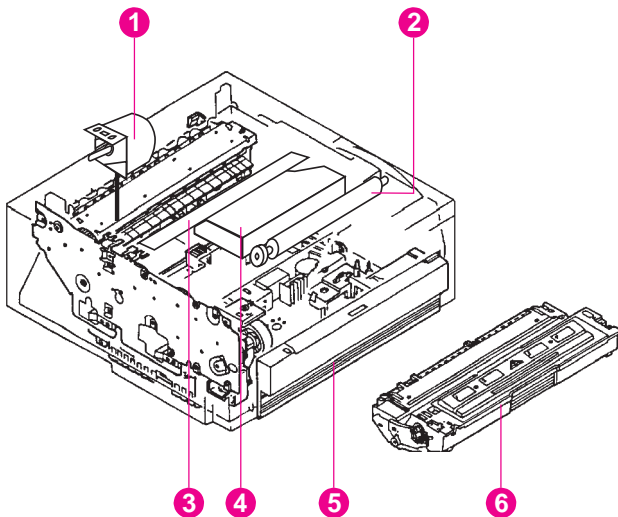

**Figure 8-13 LJ 4P, 4L Parts**



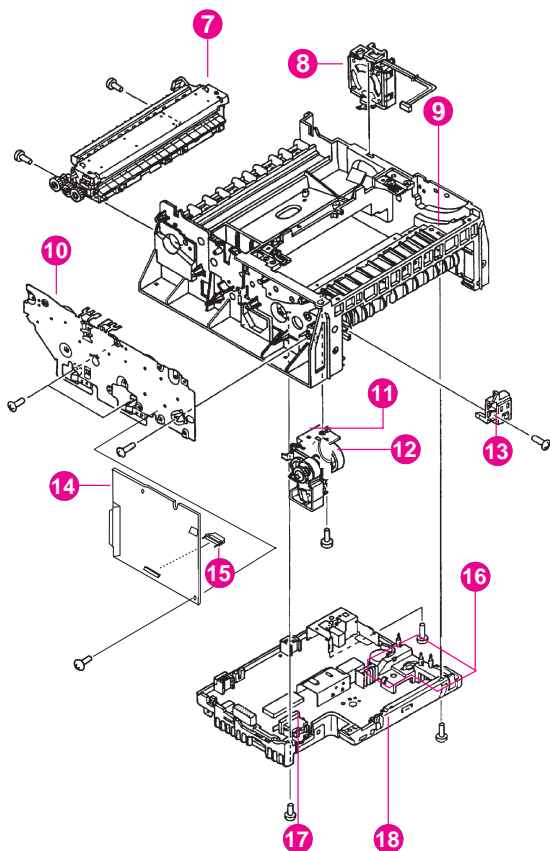


**Figure 8-14 LJ 4P, 4L Parts (continued)**

<b>LJ 4P, 4L Parts (See figures 8-13 and 8-14)</b>		
1	RG5-0765-000CN	Motor Main Assembly
2	RF5-0596-000CN	Transfer Roller Assembly
3	RG5-0667-000CN 4L RG5-0802-000CN 4P	Beam-to-Drum Mirror Beam-to-Drum Mirror
4	C2003-69005* 4L C2005-69005* 4P	Laser/Scanner Assembly Laser/Scanner Assembly
5	R75-0010-000CN 4L R75-2010-000CN 4P	Universal Paper Cassette Universal Paper Cassette
6	92274A	Toner Cartridge
7	C2003-69001* C2003-69002*	Fuser Assembly 100-120V Fuser Assembly 220-240V
8	RG5-0703-000CN 4L RG5-0804-000CN 4P	Fan Assembly Fan Assembly
9	RG5-0711-020CN	Top Oblique Roller Assembly
10	RG5-0684-000CN 4L RG5-0791-000CN 4P	Drive Train Plate Assembly Drive Train Plate Assembly
11	RG5-0668-000CN 4L RG5-0796-000CN 4P	Pickup Assembly Pickup Assembly
12	RB1-3029-000CN 4L RB1-3368-000CN 4P	Pickup Feed D-Roller Pickup Feed D-Roller
13	RG5-0669-000CN	Front Oblique Roller Assembly
14	C2004-69001* 4L C2016-69001* 4ML C2006-69001* 4P C2041-69001* 4MP	Formatter C2003A Formatter C2015 Formatter C2005A Formatter C2040A
15	1252-5278 4L 1252-5460 4P	DC Controller Connector DC Controller Connector
16	RG5-0701-000CN	High Voltage Connector Assembly
17	RH7-5092-000CN	Paper Feed Solenoid
18	C2003-69003* 4L C2003-69004* 4L C2005-69003* 4P C2005-69004* 4P	100-120V DC Controller PCA 220-240V DC Controller PCA 120V DC Controller PCA 220V DC Controller PCA
	RG5-0678-000CN RG5-0679-000CN RY5-0011-000CN RF5-0690-000CN RF5-0601-000CN RB1-3389-000CN RS5-8209-000CN RF5-0601-000CN	Hot Roller 120V Hot Roller 220V Filter Brush Input Paper Sensor Arm Velcro Strip EP Label Input Sensor Arm

\*Rebuilt part, requires exchange

\*\*Cover assembly does not include items C, E, and F

## LJ 4 Plus, 4 Parts

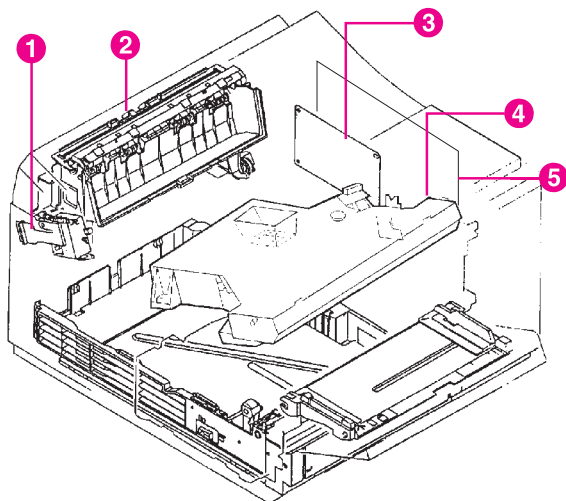


**Figure 8-15 LJ4+, 4 Parts**

LJ 4+, 4 Parts		
1	RG5-0475-060CN	Paper Output Sensor Assembly
2	RG5-0456-000CN 4	Paper Output Assembly
2	RG5-0886-070CN 4+	Paper Output Assembly
3	C2001-69002* 4	DC Controller PCA
3	C2037-69004* 4+	DC Controller PCA
4	C2001-69006* 4	Laser/Scanner Assembly
4	C2037-69008* 4+	Laser/Scanner Assembly
5	C2002-69001* 4	Formatter PCA
5	C2038-69004* 4+	Formatter PCA
	RBI-2127-000CN 4, 4+	MC Pickup Roller

	<b>RBI-2126-000CN 4</b>	<b>PC Pickup Roller</b>
	<b>RBI-3477-000CN 4+</b>	<b>PC Pickup Roller</b>
	<b>RBI-2632-000CN 4</b> <b>RBI-2650-000CN 4+</b>	<b>LC Pickup Roller</b> <b>LC Pickup Roller</b>
	<b>RB1-2133-000CN</b> <b>RF5-0343-000CN</b> <b>RF5-0349-000CN</b>	<b>Paper Out Sensor Flag</b> <b>MP Tray Separation Pad</b> <b>Transfer Roller</b>

\*Rebuilt part, requires exchange

## LJ 4 Plus, 4 Parts

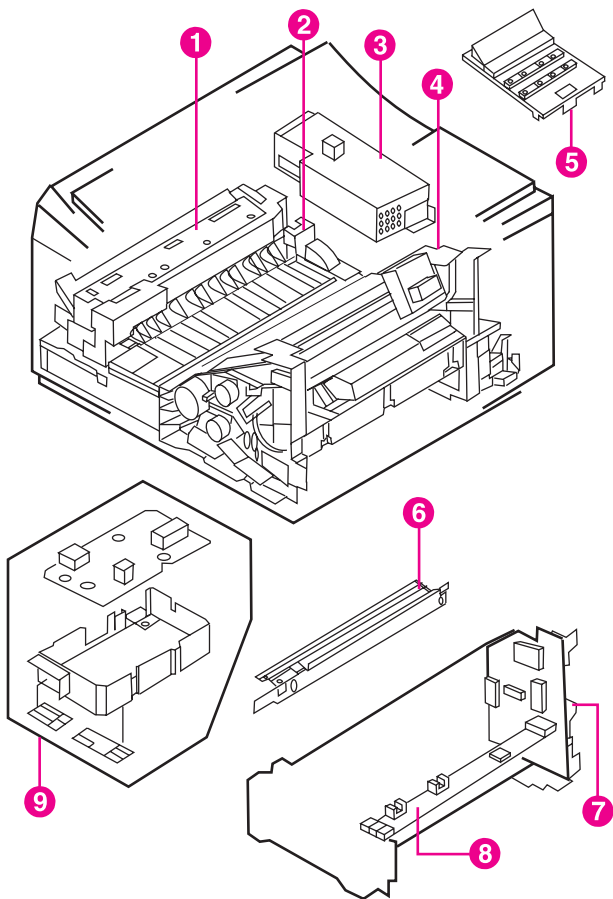


**Figure 8-16** LJ 4+, 4 Parts

<b>LJ 4+, 4 Parts (see Figure 8-16)</b>		
<b>1</b> <b>1</b>	C2001-69003* 4 C2001-69004* 4 C2037-69001* 4+ C2037-69002* 4+	110V Fusing Assembly 240V Fusing Assembly 110V Fusing Assembly 240V Fusing Assembly
<b>2</b> <b>2</b>	RH7-1151-000CN 4 RH7-1301-000CN 4+	Main Motor Main Motor
<b>3</b> <b>3</b>	C2001-69007* 4 C2001-69008* 4 C2037-69006* 4+ C2037-69007* 4+	110V Power Supply 240V Power Supply 110V Power Supply 240V Power Supply
<b>4</b> <b>4</b>	C2001-69005* C2037-69003* 4+	Paper Feed Assembly Paper Feed Assembly
<b>5</b> <b>5</b>	RG5-0478-000CN 4 C2001-69010* 4 C2037-69005* 4+ RG5-1077-000CN* 4+	Display Assembly (without overlay) Display Assembly (English) Display Assembly (without overlay) Display Assembly (English)
<b>6</b>	RG5-0469-020CN	Transfer Guide Assembly
<b>7</b>	RG5-0512-070CN	Paper Control PCA
<b>8</b>	RG5-0514-000CN	Sensor PCA
<b>9</b> <b>9</b>	C2001-69009* 4 C2037-69009* 4+	High Voltage PCA High Voltage PCA

\*Rebuilt part, requires exchange


# LJ 4Plus Duplexer Parts

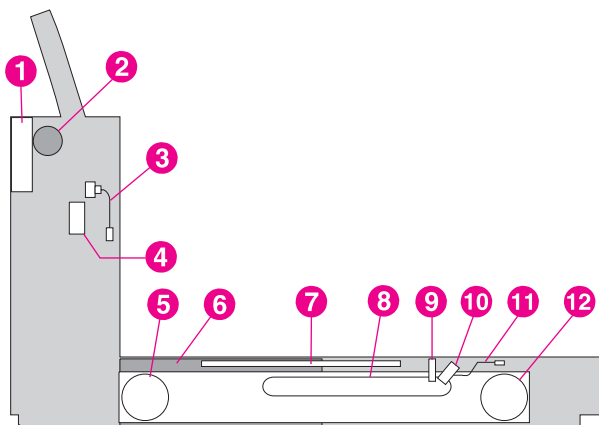

**Figure 8-17 LJ 4Plus Duplexer (cross-section)**

1	RH7-1235-000CN	Switchback Fan
2	RF1-3801-000CN	Switchback Stepper Motor (M2)
3	RG1-3529-000CN	Switchback Sensor Cable
4	RF1-3808-000CN	Switchback Solenoid (SL1)
5	RF1-3804-000CN	Rear Holding Tray Motor (M3)
6	RG1-3503-000CN	Power Supply Assembly
7	RG1-3501-000CN	Duplex Control PCA
8	RA2-2072-000CN	Timing Belt
9	RA2-2076-000CN	Sensor Arm
10	WG8-5210-000CN	Photosensor (PS2)
11	RG1-3530-000CN	Paper Pickup Cable
12	RF1-3807-000CN	Front Holding Tray Motor (M1)

## LJ 4Si, IIISi Parts

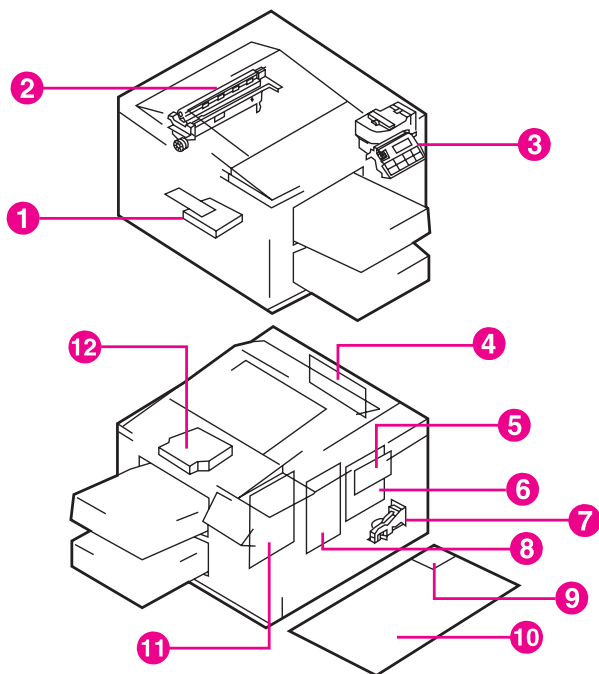


**Figure 8-18** LJ 4Si, IIISi Parts



<b>LJ 4Si, IIISi Parts</b>		
1 1	RG5-0076-200CN IIISi C2009-69004* 4Si	HV Power Supply HV Power Supply
2	C2009-69008*	Job Offset Assembly
3 3	RG5-0088-000CN IIISi RG5-0162-000CN 4Si	Control Panel Assembly Control Panel Assembly
4	RG5-0067-180CN	Delivery Cover Assembly
5	RG5-0094-000CN	Sensor PCA
6 6	RG5-0095-120CN IIISi RG5-0096-000CN IIISi RG5-0166-060CN 4Si RG5-0167-060CN 4Si	115V AC Power Supply 240V AC Power Supply 115V AC Power Supply 240V AC Power Supply
7	RG5-0102-000CN	Main Switch Assembly
8 8	RG5-0085-060CN IIISi RG5-0086-060CN IIISi C2009-69005** 4Si C2009-69006** 4Si	115V DC Power Supply 240V DC Power Supply 115V DC Power Supply 240V DC Power Supply
9	28644-69002*	MIO Interface Card
10 10 10	33491-69143* IIISi 33491-69160* IIISi C2009-69001* 4Si	Formatter PCA S/N ≤ 3199 Formatter PCA S/N ≥ 3200 Formatter PCA
11	33491-69011* IIISi C2009-69002* 4Si	DC Controller PCA DC Controller PCA
12 12	RG5-0021-000CN IIISi C2009-69003*	Laser Scanner Assembly Laser Scanner Assembly


\*Rebuilt part, requires exchange

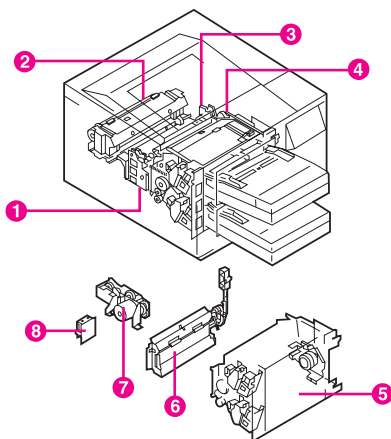

**Figure 8-19 LJ 4Si, IIISi Parts**

LJ 4Si, IIISi Parts		
1	RG5-0038-000CN	Left Main Block Assembly
2	33491-69012*	115V Fusing Assembly
2	33491-69013*	240V Fusing Assembly
3	RG5-0039-070CN	Right Main Block Assembly
4	RG5-0161-090CN	Registration Assembly
5	C2009-69007*	Paper Input Assembly
6	RG5-0056-000CN	Paper Refeed Assembly
7	RG5-0040-060CN	Main Motor Drive Assembly
8	RG5-0042-000CN	Main Motor PCA
	RF5-0041-000CN	Pickup/Separation Roller
	RG5-0034-100CN	Paper Input PCA
	RH7-1104-000CN	Fan Motor 1 (Back)
	RH7-1105-000CN	Fan Motor 2 (Right Front), 3Si
	RH7-1106-000CN	Fan Motor 3 (Right Center), 3Si
	RH7-1162-000CN	Fan Motor 2 (Right Front), 4Si
	RH7-1163-000CN	Fan Motor 3 (Right Center), 4Si
	RG5-0141-000CN	Transfer Roller Assembly


\*Rebuilt part, requires exchange

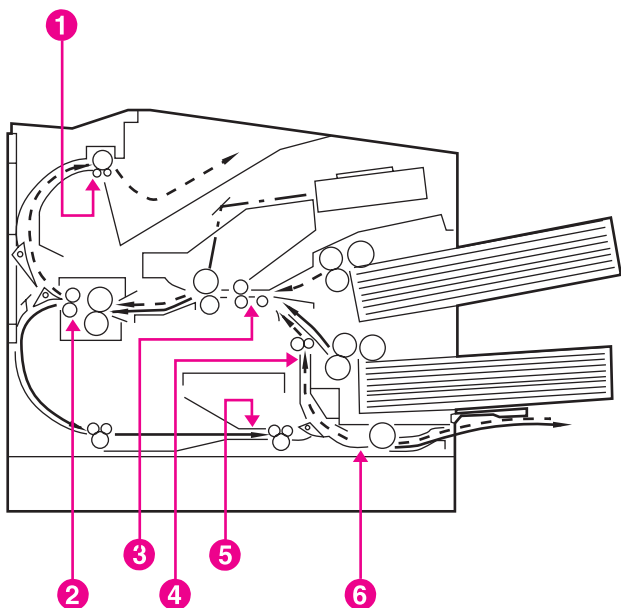

**Figure 8-20 LJ 4Si, IIISi Sensor Locations**

LJ 4Si, IIISi Sensor Locations		
1	PS7	Face-Down Output Sensor
2	PS151	Fusing Assembly Exit Sensor
3	PS3	Registration Assembly Sensor
4	PS2	Paper Refeed Sensor
5	PS5	Duplex Assembly Sensor
6	PS4	Switchback Assembly Sensor

## LJ IIIP, IIP+, IIP Parts

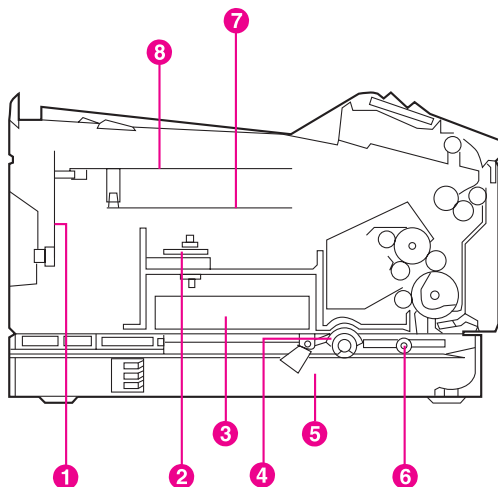


**Figure 8-21 LJ IIIP, IIP+, IIP Parts**

LJ IIIP, IIP+, IIP Parts		
1	33471-67905 IIP	Interface Assembly Dual I/O
1	33486-67901 IIIP	Interface Assembly Dual I/O
1	C2092-67901 IIP+	Interface Assembly Single I/O (Parallel only)
2	RG1-1771-000CN	Scanner Motor Assembly
2	RG1-1769-020CN	Laser PCA
3	RG9-0696-000CN	High Voltage Power Supply
4	RA1-7674-000CN	Lower Cassette Pickup Roller (3 required)
5	33472-69001*	Lower Cassette Assembly
6	RA1-7654-000CN	Lower Cassette Feed Roller
7	33471-69002*	DC Controller PCA
8	33471-69001* IIP	Formatter PCA
8	33481-69001* IIIP	Formatter PCA
8	C2008-69001* IIP+	Formatter PCA
	33471-69017	120V DC Power Supply
	RG1-1910-020CN	240V DC Power Supply


\*Rebuilt part, requires exchange

**Figure 8-22 LJ IIIP, IIP+, IIP Parts**

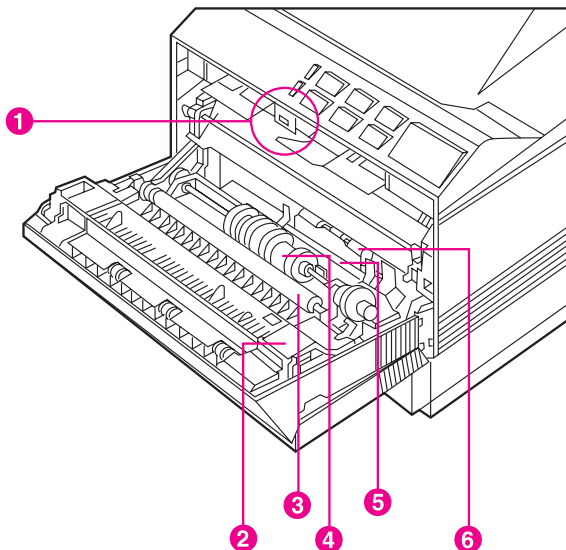

LJ IIIP, IIP+, IIP Parts		
1	RG1-1604-000CN	Density PCA
2	33471-69018*	115V Fuser Assembly
2	33471-69019*	240V Fuser Assembly
3	RA1-7627-000CN	Transfer Roller
4	RG1-1792-000CN	MP Pickup Roller Assembly
5	RG1-1912-080CN	Separation Pad
6	RF1-2394-000CN	Input Feed Roller
	RH7-1121-000CN RH6-0010-000CN RG1-1777-000CN RG1-1806-070CN	Fan Cooling Control Panel Assembly EP Drum Drive Gear Assembly MP Tray Assembly


\*Rebuilt part, requires exchange

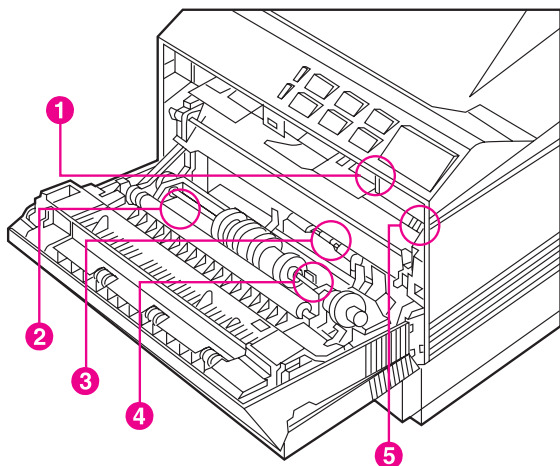

**Figure 8-23 LJIIIP, IIP+, IIP Sensor Locations**

<b>LJIIIP, IIP+, IIP Sensor Locations</b>			
1	WG8-0291-000CN	PS3 Photosensor	(Senses paper in fuser)
2	WG8-0323-000CN	PS4 Photosensor	(Senses door open)
3	WG8-0291-000CN	PS1 Photosensor	(Senses paper at input feed rollers)
4	WG8-0323-000CN	PS2 Photosensor	(Senses paper in MP tray)
5	WG8-0291-000CN	PS5 Photosensor	(Senses door open and toner cartridge installed)
	WG8-0291-000CN	PS6 Photosensor	(Senses paper in optional lower cassette)

# LJ IIID, III, IID, II Parts

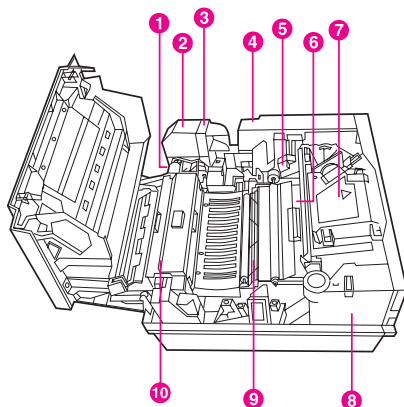


8

**Figure 8-24 LJ IIID, III, IID, II Parts**

LJ IIID, III, II Parts		
1	RG9-0205-000CN II	115V AC Power Module
1	RG9-0206-000CN II	240V AC Power Module
1	33459-69001* IID, III, IIID	115V AC Power Module
1	RG9-0750-000CN IID, III, IIID	240V AC Power Module
2	RH7-1122-000CN	Fan Upper Cooling
3	RF1-2130-000CN**	Ozone Filter (User replaceable)
3	RG1-1753-000CN II	Ozone Filter (Upgrades to user replaceable)
4	33449-69005* II III	115V DC Power Supply
4	33440-69010* II III	240V DC Power Supply
4	RG1-1310-000CN IID	115V DC Power Supply
4	RG1-1312-000CN IID	240V DC Power Supply
4	RG1-2007-000CN IIID	115V DC Power Supply
4	RG1-2009-000CN IIID	240V DC Power Supply
5	RG1-0718-000CN II, III, IID	Paper Control PCA
5	RG1-2549-000CN IIID	Paper Control PCA
6	RG1-0932-120CN II, III	Registration Assembly (with separation pad)
6	RG1-1326-000CN IID, IIID	Registration Assembly (with separation pad)
7	33449-69006*	Laser Scanner Assembly
8	RG1-0936-110CN	High-Voltage Power Supply Assembly
9	RG1-0933-060CN	Transfer Corona Assembly
10	33440-69003*	115V Fuser Assembly
10	33440-69009*	240V Fuser Assembly

\*Rebuilt part, requires exchange \*\*Order 92295Q for package of 2 each.

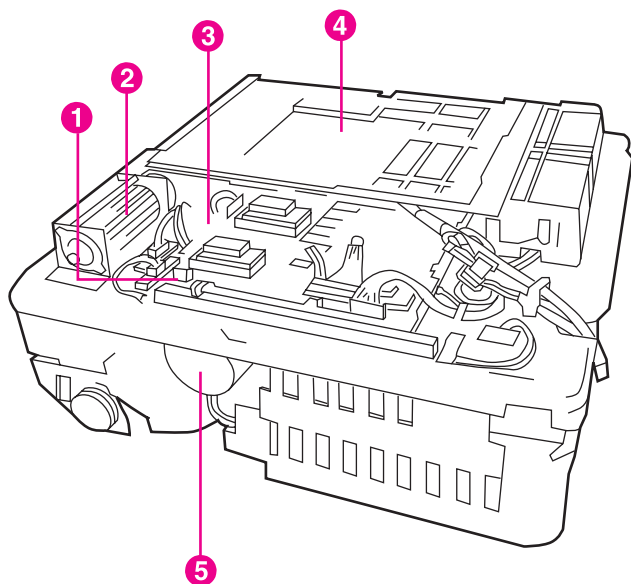

**Figure 8-25** LJ IIID, III, II Parts



LJ IIID, III, II Parts		
1	SW205 Switch Activation Lever	This switch lever may need to be removed when the DC Controller PCA is replaced.
2	RH7-1056-000CN	Fan, Lower Cooling
3	Information Only	Many failures attributed to DC Controller PCAs are actually cable/connector problems. Always reseal cables before replacing PCA. Replace cable(s) to solve intermittent problems.
3	33440-69002* II	DC Controller PCA
3	33449-69004* III	DC Controller PCA (see "1" above)
3	RG1-1278-000CN IIID	DC Controller PCA
3	RG1-1970-070CN IIID	DC Controller PCA (see "1" above)
4	33440-69001* II	Formatter PCA
4	33497-69001* III, IIID	Formatter PCA
4	33446-69001* IID	Formatter PCA
5	RH7-1048-000CN	Motor, Main Drive
	RG1-0931-060CN II, III RG1-0945-000CN RG1-0959-000CN II RG1-1974-000CN III RF1-1145-020CN II, III RA1-8278-030CN III RG1-0966-030CN RG1-0967-000CN 33449-69007* 33449-69008* 33440-67905 II, III 33447-67906 IID, IIID	Feed Roller Assembly (Paper pickup) Delivery Assembly (with Output rollers) Control Panel Control Panel Separation Pad Top Cover Release Button Fuser Cleaning Pad Delivery Coupler Assembly Engine Rebuild Kit (115V) Engine Rebuild Kit (240V) Test Tool (see chapter 4) Test Tool (see chapter 4)
	RG1-0905-000CN RG1-0906-000CN RG1-0907-000CN RG1-0908-000CN RG1-0912-000CN RH2-5108-000CN RG1-2307-000CN III SG4-6271-000CN II	AC Power Module/DC Power Supply Cable High-Voltage Supply/DC Control Cable Fusing/DC Control Cable Laser Scanning/DC Control Cable AC Power Module/DC Control Cable Fiber Optic Cable Control Panel Cable Assembly Control Panel Cable Assembly

\*Rebuilt part, requires exchange

## LJ IIID, IID Parts


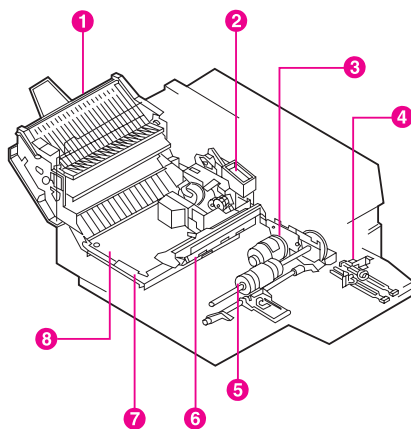


Figure 8-26 LJ IIID, IID Parts


<b>LJ IIID, IID Parts</b>		
<b>1</b> <b>1</b>	RG1-1350-000CN IID RG1-1992-000CN IIID	Switchback Assembly Switchback Assembly
<b>2</b>	RG1-1349-000CN	Switchback Drive Control Assembly
<b>3</b>	RG1-1347-000CN	Lower Feed Drive Motor Assembly
<b>4</b> <b>4</b>	RG1-1370-000CN IID RG1-2067-000CN IIID	Laser Scanner Cable Laser Scanner Cable
<b>5</b>	RG1-2500-000CN	Lower Pickup Roller Assembly
<b>6</b>	RG1-1345-060CN	Duplex Drive Roller Assembly
<b>7</b>	RG1-2498-000CN	Lower Duplex Guide Assembly
<b>8</b>	RG1-1344-000CN	Upper Duplex Guide Assembly
	RG1-0931-060CN IID RG1-2499-000CN IIID RH6-0009-000CN IID RG1-1989-000CN IIID SG5-4022-000CN RF1-2548-000CN RF1-1145-020CN RG1-2498-000CN RG1-1344-000CN RG1-1356-000CN	Upper Pickup Roller Upper Pickup Roller Control Panel Control Panel Control Panel Cable Assembly Lower Separation Pad Upper Separation Pad Lower Duplex Guide Assembly Upper Duplex Guide Assembly Duplex Align/Drive Roller

## LJ 2686D, 2686A Parts

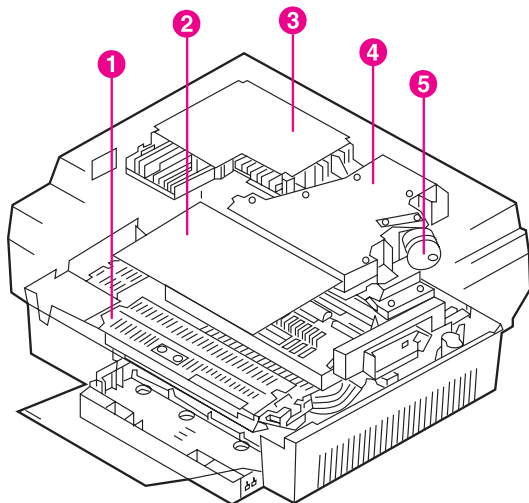


**Figure 8-27 LJ 2686D, 2686A Parts**

LJ 2686D, 2686A Parts		
1	02686-69011*	115V Fusing Assembly
1	02686-69111*	220V Fusing Assembly
2	02686-69008* 2686A	DC Controller PCA
2	RG1-0560-000CN 2686D	DC Controller PCA
3	RG1-0468-060CN	115V DC Power Supply
3	RG1-0624-000CN	240V DC Power Supply
4	02686-69010*	Scanning Unit
5	RG0-0009-000CN	Laser Unit
	02686-69001* 2686A 115V	Formatter PCA (Replaces SG4-6014-000CN)
	02686-69004* 2686A 240V	Formatter PCA (Replaces SG4-6019-000CN)
	02686-69005* 2686D	Formatter PCA (Replaces SG4-6022-000CN in 2686A, Opt. 200, 210, 300, and 2686D)
	02686-69006 2686D	Formatter PCA (Replaces SG4-6025-000CN in 2686A and D with 2 MB option)

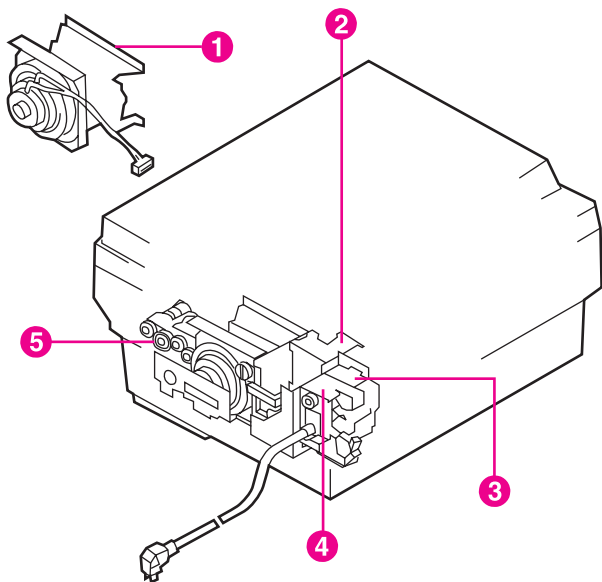

**Figure 8-28 LJ 2686D, 2686A Parts**

LJ 2686D, 2686A Parts		
1	RG9-0102-000CN	Main Motor Assembly
2	RG1-0649-000CN	High Voltage Power Supply
3	RG1-0209-030CN	AC Controller PCA (115V)
3	RG1-0210-040CN	AC Controller PCA (240V)
3	RG1-0204-080CN	AC Driver Assembly (115V)
4	RG1-0208-030CN	Fuser Safety PCA
5	FG1-2354-000CN	Manual Feed Assembly

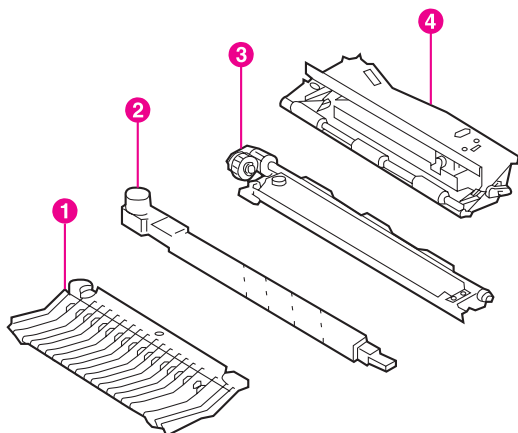

**Figure 8-29 LJ 2686D, 2686A Parts**

<b>LJ2686D, 2686A Parts</b>		
<b>1</b>	RG1-1039-000CN	Feed Guide Assembly
<b>2</b>	RG1-0191-020CN	Transfer Corona Assembly
<b>3</b>	RG1-0195-000CN	Transfer Guide Assembly
<b>4</b>	RG1-0215-000CN	Registration Shutter Assembly
	RG1-0328-020CN	Separation Belt
	FF1-3872-000CN	Fuse, Resistor 47Ω 1/4 Watt
	RA1-0666-000CN 2686A	Pick-Up Roller (3 required)
	RA1-2621-000CN 2686D	Pick-Up Roller (6 required)
	RA1-2622-000CN 2686D	Pick-Up Roller <i>small</i> (2 required)
	FS1-2651-000CN	Pick-Up Clutch Spring
	6040-0018	Clutch Grease (3/8-oz Tube)
	FA2-5664-020CN	Ozone Filter
	RH7-1006-000CN	Fan (115V)
	RH7-1007-000CN	Fan (240V)
	RH7-4007-000CN	Fuser Bulb (110V)
	RH7-4009-000CN	Fuser Bulb (220V)
	FG1-2377-020CN	Fuser Cleaning Pad

# 9

## Summary of service notes and technical tips


### Overview

This chapter addresses some of the more common service issues.

#### The Troubleshooting Process


The troubleshooting process, illustrated in figures 9-1 and 9-2, is a systematic approach to resolving printer problems. In searching for the causes for printer malfunctions and errors, the troubleshooting process addresses major problems first and then identifies secondary problems.

In figures 9-1 and 9-2, each heading depicts a major troubleshooting step. A **YES** answer to the questions allows you to proceed to the next major step. A **NO** answer indicates that additional testing is needed. Proceed to the referenced location and follow the instructions for that area. After completing the additional testing, proceed to the next major step.

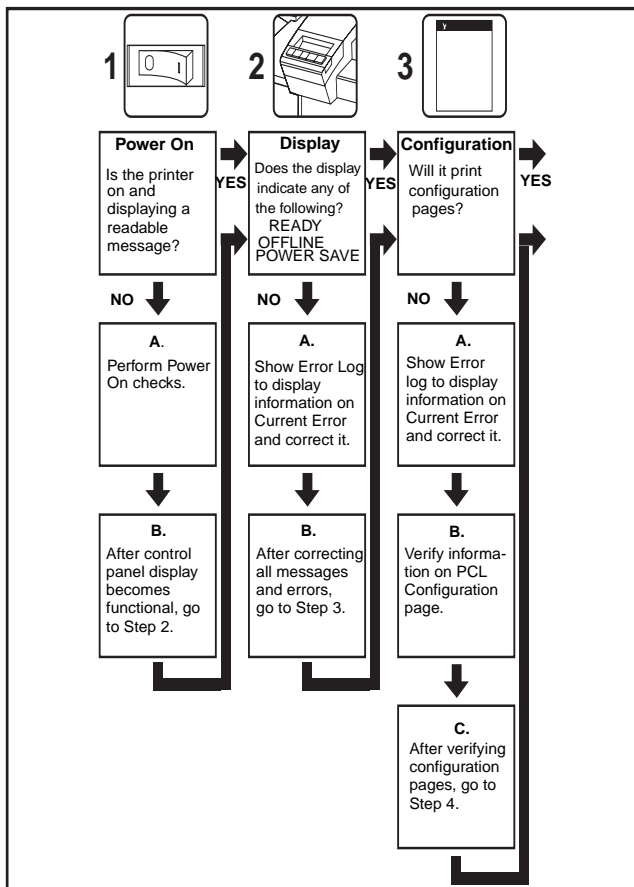

**Figure 9-1** Troubleshooting process for HP LaserJet printers



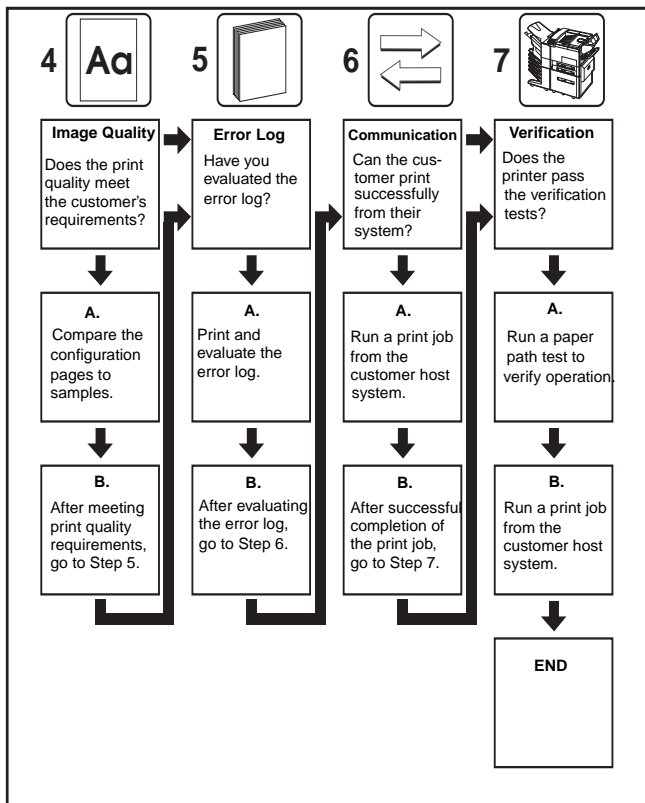




**Figure 9-2** Troubleshooting process for HP LaserJet printers


# Service Topic Index


Obtain service notes from HPNN or HP FIRST. See the chapter on services and support for additional information.



The tables that follow provide illustrations of printer models, a description of common problems, and pertinent reference information.




Printer Model	Problem Description	Service Note (number)	Technical Tip (page number)
	Replacement formatter and date code	N/A	206
	Accordion jams in fuser	C3941A-01	207
	Countermeasure for clearing fuser jams	C3941A-02A	208
	LaserJet 5Si and 5Si MX		
	Print quality defect: smeared print	C3166A-01 C3167A-01	213
	Noisy fan	C3166A-02 C3167A-02	214
	2000-sheet input unit jams	C3166A-03 C3167A-03	215
	13.x paper jams are due to bad clutch connector	C3166A-04 C3167A-04	216
	Firmware revision corrects 79 Errors	C3166A-05 C3167A-05	217
	Revised DC controller improves fusing	C3166A-06A C3167A-06A	220
	MIO and NVRAM reset problems	C3166A-07 C3167A-07	221

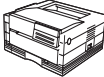Printer Model	Problem Description	Service Note (number)	Technical Tip (page number)
LaserJet 5Si and 5Si MX (continued)	Toner dumping and/or 79 service (04CC)	C3166A-08A	223
	Improved MP tray	C3166A-09 C3167A-09	224
	Printer firmware rolls to version 9.1	C3166A-10 C3167A-10	226
	Set default printer font from front panel	C3166A-11 C3167A-11	228
	High-capacity input (2,000-sheet input tray)	C3166A-12 C3167A-12	229
	Microswitch assembly in the 2,000-sheet input tray	C3166A-13 C3167A-13	231
	Executive-size paper tray	C3166A-14 C3167A-14	232
	Improved 220V fuser reduces toner contamination	C3166A-15 C3167A-15	234
	Improved MP tray	C3166A-16 C3167A-16	235
	Vendor revision "B" causes 79 service errors	C3166A-17 C3167A-17	237
	Entire Image Manager software	C3166A-18 C3167A-18	238
LaserJet 5 	LJ 5 Introduction: service note is available through HP FIRST and other sources	C3916A-01	N/A

Printer Model	Problem Description	Service Note (number)	Technical Tip (page number)
LaserJet 4V, 4MV  	Paper jams with three-hole punched paper	C3141A-01	241
	Printer hangs and displays "79 (0523) Service Error"	C3141A-02	242
	Printer will not access service model	C3141A-03	243
	PostScript SIMM replacement part	C3141A-04	N/A
	Repeating 94MM print defect	C3141A-05	243
	57 Service Error (not caused by main motor)	C3141A-06	244
	Thumb screw and back plate (part numbers)	C3141A-07	244
	55 Service Error troubleshooting hints	C3141A-08	245
	MP tray jams	C3141A-10	245
	Preventing damage to toner cartridge shutter arm	N/A	246
	Multipurpose tray pickup roller does not stop	C3141A-12 & C3142A-12	246
	Leading edge smudge	C3142A-13	247
	Formatter fan noise	C3141-14	248
	Paper jams occur in output area when large media is used	C3142A-15	250
	Input jamming when feeding from the 500-sheet feeder	C3760A-02C	250


Printer Model	Problem Description	Service Note (number)	Technical Tip (page number)
LaserJet 4P/ 4MP and 4L/4ML 	Clearing paper jams in LJ 4L and 4P	C2003A-01	252
	Fusing assembly gear lubricant	C2003A-02	N/A
	LaserJet 4P product introduction	C2005A-01	N/A
	LaserJet 4P "50 Service Error" (220 volt units only)	C2005A-02	N/A
	LaserJet 4P Service Manual part corrections	C2005A-03	N/A
	LaserJet 4L, 4P part number and diagram corrections	C2005A-04	N/A
	Media jams caused by input paper sensor arm that is broken or binding	C2003A-03 C2015A-03 C2005A-07 C2040A-07 C3134A-01	253
	Broken printer frame - paper cassette support guides	C2003A-04 C2015A-04 C2005A-08 C2040A-08 C3150A-02 C3155A-02 C3134A-02 C3932A-02 C3935A-02	254

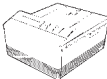Printer Model	Problem Description	Service Note (number)	Technical Tip (page number)
LaserJet 4 Plus/4M Plus and 4/4M 	Paper jams in optional 500 lower cassette	C2001A-01	255
	Paper jam errors 13 and 41.3 (multi-feed jams)	C2001A-02	256
	Accordion jams in output assembly	C2001A-03	257
	500-sheet lower cassette (Tray 3) shim improves paper handling	C2001A-04 C2021A-04 C2037A-02 C2039A-02 C3916A-03 C3171A-03 C395AA-03	258
	LJ 4 Plus ONLY: product introduction	C2037A-01	N/A
	LJ 4 Plus ONLY: duplex product introduction	C3157A-01	N/A
	False paper jams (last page only)	N/A	259
	Image skew (missing paper weight)	N/A	260
LaserJet 4Si 	Error 52 laser scanner failures	C2010A-01	N/A
	Missing scan lines 70-110mm from top of page	C2010A-02	261
	Preventing jams: face up or output stacker	C2010A-03	262
	Paper jamming and feed problems	N/A	263

Printer Model	Problem Description	Service Note (number)	Technical Tip (page number)
<b>LaserJet IIIP, IIP Plus, IIP</b> 	Moaning sound in separation pad	N/A	264
	Compressed print	N/A	265
	Continuous "PS Busy"	N/A	267
	Incompatibility: new fusing assembly component	33471A/AB-04 33481A/AB-04 C2007A-02	268
<b>LaserJet Series III, II</b> 	Potential safety issue following fuser repair	33440A/AB/AU12 33447A/AB/AU09 33449A/AB-05 33459A/AB-03	269
	Internal cabling problems	N/A	270
<b>LaserJet IIID, IID</b> 	Light-brown stain on front side of duplexed page	33447A/AB/AU10 33459A/AB-04	271
	Misaligned duplexed image	N/A	272
	Duplex jamming: duplex drive roller assembly	N/A	273
	Duplex jamming: misaligned switchback assembly	N/A	274
	Duplex jamming: worn lower duplex guide assembly	N/A	274
	Power envelope feeder jams	N/A	275

# Technical Tips

## LaserJet 6L, 5L

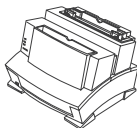

### Replacement Formatter and Date Code

**Service Note Number:** N/A

**Situation:** The HP LaserJet 5L printer contains three formatter PCAs and three firmware versions.

**Solution:** The replacement formatter for all versions of the formatter and firmware is the C3942-69002 formatter with a firmware date code 19950623.

Formatter	FW Date Code	Replacement Formatter (all)	Replacement Date Code (all)
C3942-60001	19950227	C3942-69002	19950623
C3942-60001	19950522		
C3942-60001	19950623		
C3942-60002	19950623		
C3942-60003	19950522		
C3942-60003	19950623		



## Accordion Jams in the Printer Fuser

**Service Note Number:** C3941A-01

**Serial Numbers Affected:** <JPBB022333, <JPTB000101, <JPBJ051310, <JPBK006151, <JPBL033831, <JPTJ000101, <JPTK000101, <JPTL000101, <USBB158323, <JPTM080500, <JPBM007279, <JPBM007279, <JPBT000101, <JPBV000101, <JPTT090666, <JPTV122612, <JPTX029034

**Description:** Under some conditions, paper can be pushed back down into the fuser. This results in a jam in the fuser area. The jam can be so severe that customers cannot remove the paper and the printer requires servicing.

To remove the jam, the fuser area of the printer must be disassembled. Check the fusers and pressure rollers for damage from the jam or from the attempts to remove the paper.

Install the output bin in any LaserJet 5L printer that has the affected serial number and that is returned for any service, paper jam, or other problem.

**Solution:** Place the output bin (RB1-7332-000CN) in the output tray of the printer. Doing so decreases the number of paper jams in the fuser area. The bin should be installed in all printers that do not already have it.

# Countermeasure for Clearing Jams in the Printer Fuser

**Service Note Number:** C3941A-02

**Serial Numbers Affected:** JPBK000000 - JPBK016388

JPBL000000 - JPBL055374, JPCW000000 - JPCW043448

JPVW000000 - JPVW081157, USCB000000 - USCB302011

JPBV000000 - JPBV010501, JPVV000000 - JPVV216255


CNVM000000 - CNVM175233, CNVN000000 - CNVN0189964

**Description:** When a paper jam occurs in the LaserJet 5L, it commonly occurs in the fuser area, with the paper folding accordion-style between the fuser and delivery assembly. When paper jams occur in the fuser, customers often cannot remove the paper, and their attempts to do so damage the printer. As a result, the printer requires servicing. This countermeasure will not prevent paper jams, but will allow users to clear the paper jams without damaging the printer.

To remove this type of paper jam, the fuser area of the printer must be disassembled. Check the fuser and pressure roller for damage from the paper jam or from the attempts to remove the paper jam. See chapter 6 in the service manual for disassembly instructions.

This JP protector and the output bin (from service note C3941A-01) should be installed in all LaserJet 5L printers that are within the affected serial number range that are being serviced.

**Solution:** Add the JP Protector (RB1-7334-000CN) to the delivery assembly (RG5-2012-000CN) of every printer in the affected serial number range that is being serviced. To install this part, remove the delivery assembly according to the instructions provided in the service manual. The delivery assembly is shown in figure 8-10 of the service manual. Install the JP protector into the delivery assembly. Order the Service Note if graphics are needed.

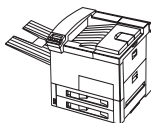

## Print Quality Defect: Smeared Print

**Service Note Number:** C3166A-01 & C3167A-01

**Associated Part Numbers:** RG5-1887-000CN, C3166-69003

### Serial Number Range:

- **115V**  
USCB000703-USCB001710, NLCB000703-NLCB001710,  
SGCB000703-SGCB001710, USCC000703-USCC001710,  
NLCC000703-NLCC001710, SGCC000703-SGCC001710.
- **220V**  
USRB000045-USRB00083, NLRB000045-NLRB00083,  
SGRB000045-SGRB00083, USRC000045-USRC00083,  
NLRC000045-NLRC00083, SGRC000045-SGRC00083.

**Description:** Printers in the serial number range given above have a potential for smeared print. Smeared print is typically noticed first in heavy black or graphic areas, usually at the right-hand side of the media. More specifically, without magnification, blotchy areas of toner or fuzziness are visible around characters. A coating on the transfer roller and a specific current value applied to the roller induce this print anomaly.

**Solution:** HP has implemented an uncoated transfer roller and increased the current to the transfer roller via the DC controller printed circuit board (PCB). These solutions appear to have resolved this print-smear defect. After verifying the serial number range and the print defect, replace the transfer roller and the DC controller PCB.

## Noisy Fan 3 (FM3)

**Service Note Number:** C3166A-02 & C3167A-02

**Associated Part Numbers:** 5182-5899/Noise Kit

### Serial Number Range:

- **115v**

USCB000001-USCB099999, USCC000001-USCC011766,  
SGCB000001-SGCB099999, USBC000001-USBC015282,  
USBC000001-USBC015282, SGBB000001-SGBB099999,  
SGBC000001-SGBC015282, NLBB000001-NLBB099999,  
NLBC000001-NLBC015282

- **220v**

USRB000001-USRB099999, USRC000001-USRC006687,  
SGRB000001-SGRB099999, SGRC000001-SGRC006687,  
NLRB000001-NLRB099999, NLRC000001-NLRC006687,  
USQB000001-USQB099999, USQC000001-USQC011106,  
USQC000001-USQC011106, SGQB000001-SGQB-099999,  
SGQC000001-SGQC011106, NLQB000001-NLQB099999-  
NLQC000001-NLQC011106

**Description:** Printers with the serial numbers in the range listed above have a potential for excessive fan noise.

The noise is a result of fan vibration. More specifically, this vibration causes an increase of resonance between the fan duct and the formatter shield cover. This intensification of sound may be annoying.

**Solution:** HP has set up a noise kit (5182-5899). It includes a piece of foam tape and detailed instructions with drawings for correct placement of the foam tape to eliminate noise between the fan and the formatter shield.

Verify that the printer is in the serial number range listed. Attach the foam tape between the fan duct and the formatter shield cover according to the instructions included with the noise kit.

## Paper Jams When Feeding from the 2,000-Sheet Input Unit

**Service Note Number:** C3166A-03 & C3167A-03

**Associated Part Numbers:** RG5-1915-040CN

**Serial Number Range:**

- **115V**  
USBC000941-USBC002659, USCC000047-USCC000482  
USCC001711-USCC002017
- **220v**  
USQC001445-USQC001748, USRC001226-USRC003279  
NLQC001445-NLQC001748, NLRC001226-NLRC003279  
SGQC001445-SGQC001748, SGRC001226-SGRC003279
- **110V**  
SGBC000941-SGBC002659, SGCC000047-SGCC000482  
SGCC001711-SGCC002017

**Description:** After approximately 50,000 sheets have been printed from the 2,000-sheet input unit, there is a possibility of increased paper jams in the area of the right cover assembly. This increased potential for jams is caused by the texture of the cover guide being abraded, thus causing paper to stick to the paper guide.

**Solution:** To prevent this problem, 16 ribs were added to the textured face of the cover guide. These ribs provide a better path for the paper because they will not prematurely wear out, as the textured surface does. The solution was implemented at the factory on printers that are not included in range given above.

First, confirm that the printer is within the range above. If not, this service note does not apply and other troubleshooting needs to be conducted. Confirm that the jam condition occurs only when feeding from the 2,000-sheet input accessory. Keep in mind that the page count is approximate and could vary slightly for rougher media. Replace the right cover assembly (RG5-1519-040CN).

## 13.X Paper Jam Errors May Be Caused by Bad Clutch Connector

**Service Note Number:** C3166A-04 & C3167A-04

**Associated Part Numbers:** RH7-5120-000CN; PIU Clutch, RH7-5119-000CN; Registration Clutch, Tray 1 Pickup Assembly; RG5-1880-090CN

### Serial Number Range:

- **115V**  
USBC000000-USBC008623,USCC000000-USCC007432  
SGBC000000-SGBC008623,SGCC000000-SGCC007432
- **220V**  
USQC000000-USQC008887,USRC000000-USRC003729  
NLQC000000-NLQC008887,NLRC000000-NLRC003729  
SGQC000000-SGQC008887,SGRC000000-SGRC003729

**Description:** We have found reliability problems with feed clutches in the paper-feed assemblies used in LaserJet 5Si and 5Si Mx printers. The same clutch is used in the paper input unit, registration assembly, and Tray 1 pickup assembly. What makes each clutch unique is the gear attached for each particular assembly and the position of the connector relative to the stop. The analysis of the clutches shows that the contact pin cracks as it is pressed into the connector housing. We believe this is caused by metal fatigue, which may cause reliability problems with the clutch. These problems result in open circuit clutches. If the clutch problem is the Tray 1 pickup assembly, the pickup roller will not turn, resulting in 13.2 paper jams or 41.3 wrong-size paper errors. If it is the registration clutch, the registration assembly will not turn, resulting in 13.3 paper jams and paper jammed under the registration assembly. If it is the PIU clutch, the printer will feed the paper to PS #1 and then stop, resulting in a 13.2 paper jam.

**Solution:** HP has worked with the engine vendor to quickly sort out suspect clutches and ensure that only good parts are available as replacements. However, some printers in the serial number ranges listed earlier may have clutches that fail. Identify the jam condition as it relates to one of the assemblies above, and then replace the appropriate clutch or assembly.

## **New Firmware Revision Corrects 79 Error**

**Service Note Number:** C3166A-05 & C3167A-05

### **Serial Number Range:**

- **110V**

XXYC0000 - XXYC9999

XXYD0000 - XXYD9999

- **220V**

XXYC00000 - XXYC99999

XXYD00000 - XXYD99999

Where XX = US, NL, or SG

Y=B,C,D for 110V, or Q,R, or S for 220V

**Affected Part Numbers:** C3168-69001

**Part Required:** Formatter PCB

**Situation:** The LaserJet 5Si/5Si MX was introduced with firmware revision 7.9. To verify a firmware revision, review the configuration page in the TEST MENU. The most common error seen with this version firmware is a 79 Service Error with an associated sub-code. The sub-codes for which this service note is associated are 81ee, 8101, 0101, 0142, and 8108.

**Solution:** HP has completed testing and recently made available a revised formatter assembly. This new 8.5 version firmware will restore the above 79 Service Error and the sub-codes listed. This new firmware will **not** correct any MIO resets or NVRAM resets that cause the page count, serial number, firmware number, or default paper size to reset.

We are aware of this issue and expect to have a solution in the very near future. In addition to the 79 Service Error, the following issues have been corrected:

- 1 The printer hangs if printing while the printer is in PowerSave mode after a power cycle reset.
- 2 The printer hangs in “Processing Job” when printing a PostScript duplex job and the source paper tray runs out of paper before the job is finished.
- 3 The PostScript configuration page hangs the printer if an error TRAY 2 EMPTY is displayed on the front panel.
- 4 79 Service (81ee) when printing a Harvard graphics file.
- 5 79 Service (8101). Send down a PCL macro and print any other page.
- 6 Internal test hangs when turning printer on.
- 7 Bug would not allow selection of the pitch size for a permanent soft font.
- 8 79 Service (8108) when de-allocating a Hewlett-Packard graphics language (HPGL) global symbol set.
- 9 20 Memory Overflow problem.



- 10 Crash with Cyrillic font SIMM.
- 11 Bug where PJI default job identification (JOBID) only works if diagnostics is on.
- 12 OS/2 Job-Cancel bug.
- 13 Bug that hangs the printer when the menu item MIO CFG is set to YES (Configure) and then a PCL configuration page is selected to print.
- 14 The string ISO A3 paper size was changed to A3.
- 15 A floating point problem where HP was not properly initializing the floating point registers.
- 16 79 SERVICE (40e0) that occurred after a 20 MEMORY OVERFLOW.
- 17 Hang while canceling a PostScript job. (This was a problem when keying <ctrl>C in the middle of sending a PostScript job in a UNIX environment and then selecting Cancel Job from the front panel.)

**Action:** Verify the error, sub-code, and serial number range. If the serial number has a "C" or "D" in the fourth character location, the printer was built with the 7\_9 version firmware, which may experience the 79 errors. The new version firmware is an 8\_5. Always confirm the firmware revision by reviewing the configuration page. All printers in which the fourth character is an "F" are of the new revision. Use the configuration page to get the serial number, page count, default paper size, and maintenance count information needed for the new formatter PCB. See pages 3-18 in the service manual for accessing service mode. Replace the formatter if a 79 error and one of the above sub-codes are associated.

## Revised DC Controller Improves Fusing from Trays 2 and 3

**Service Note Number:** C3166A-06A & C3167A-06A

### Serial Number Range:

- **110V**

XXCB00000 - XXCB019885 XXCB019886 - XXCG999999  
XXCC00000 - XXCC019885 XXCC019886 - XXCG999999  
XXCD00000 - XXCD019885 XXCD019886 - XXCG999999  
XXBB00000 - XXBB013886 XXBB013887 - XXBG999999  
XXBC00000 - XXBC013886 XXBC013887 - XXBG999999  
XXBD00000 - XXBD013886 XXBD013887 - XXBG999999

- **220V**

XXQB00000 - XXQB015530  
XXQC00000 - XXQC015530  
XXQD00000 - XXQD015530  
XXRB00000 - XXRB008920  
XXRC00000 - XXRC008920  
XXRD00000 - XXRD008920

Where XX = US, NL, or SG

### Part Required: Revised DC Controller

**Situation:** This service note is to communicate the availability of a new DC controller which has an increased temperature for all supported paper sizes. The service note it supersedes affected only letter-sized and ledger-sized media. Printers in the serial number range listed above have an older version firmware which can be updated if fusing is found to be a problem with any of the supported paper sizes. If a printer was updated by the first revision (C3166-06 or C3167-06) of this service note, there is no need to update to the 2.60—unless a paper size other than letter or ledger is experiencing a problem with toner adhesion. Printers manufactured with an “H” in the fourth character position of the serial number have this new 2.60 version DC controller firmware.

**Solution:** To improve fusing ability on all supported paper sizes, the fusing temperature has been increased from 180 degrees Celsius to 190 degrees Celsius for trays 2 and 3. The solution is provided through updated firmware on the DC Controller PCB.

**Action:** Confirm the printer is within the serial number range listed, and then replace the DC controller PCB. It is also important to be cautious of the media being used. If you need to verify the firmware revision, refer to IC201 on the DC controller board. The first revision 1.11 is identified by a "02." The current 2.22 revision is identified by a "05" on IC201. The 2.6 revision is identified with a "060" on IC201.

## New Firmware Revision Fixes MIO and NVRAM Reset Problems

**Service Note Number:** C3166A-07 & C3167A-07

### Serial Number Range:

- **110V**  
XXYC00000 - XXYC99999  
XXYF00000 - XXYF99999
- **220V**  
XXYC00000 - XXYC99999  
XXYF00000 - XXYF99999

Where XX = US, NL, or SG

Y=B,C,D for 110V, or Q,R, or S for 220V

**Affected Part Numbers:** C3168-69002

**Part Required:** Formatter PCB

**Situation:** When the printer is turned off and then back on again, there is a potential that the MIO or NVRAM configuration will be lost. As a result, the user could no longer successfully print a job, and they must reconfigure the Network card before successful printing is resumed. If the NVRAM is reset, the printer has no serial number, accurate page count, or default paper size. When the formatter has been reset, it forces the MIO card to reset itself. (This function is part of the MIO card specification.) The reset of the MIO card will occur even if the MIO card was not installed at the time the formatter reset itself. If plugged in later, the MIO card will detect the bits in NVRAM, which will tell it to perform a RESET of the MIO Card. This condition may have been misdiagnosed in the past as a defective MIO card. It is easy to assume the MIO card is the problem when in fact it is not.

**Solution:** HP has completed testing and (as of July 1, 1996) made available a revised formatter assembly to the service channel. This new 8.6 version firmware resolves the problem of MIO and NVRAM resets.

**Action:** Replace the formatter if MIO and NVRAM resets are experienced. All printers in which the fourth character of the printer serial number is a "G" are of the new revision. Any serial number lower than "G" in the fourth character position has a potential to fail. Use the configuration page to get the serial number, page count, default paper size, and maintenance count information needed for the new formatter PCB. If the NVRAM has reset the serial number, locate it on the back panel of the printer. See page 3-18 in the service manual for information on accessing service mode to re-enter this information for the new formatter.

### Note

At installation, the formatter will force a reset of itself and the MIO card; therefore, an MIO configuration will be required at the time of installation.

## Toner Dumping and/or 79 Service with (04CC) Subcode

**Service Note Number:** C3166A-08A

**Serial Number Range:**

- **110V:** XXXH00000 - XXXX99999
- **220V:** XXXH00000 - XXXX99999

**Parts Required:** C3166-69010 (Exchange), RG5-1844-050CN (New)

**Situation:** HP has been investigating an increase in calls regarding toner dumping inside of the printer. The investigation revealed three potential scenarios in which toner dumps. It is imperative that the support partners thoroughly troubleshoot this condition in order to successfully complete the repair.

### **Scenario Number 1:** (Most likely scenario)

Toner cartridge usage may have exceeded the life of the cartridge. A toner cartridge for the 5Si family of printers has a life expectancy of 15,000 images. A toner cartridge that is used longer than 15,000 images can experience a failure due to wear on the photoconductive drum and on some mechanical components such as gears and seals. This failure can cause some toner to leak into the printer. In this scenario, no printer parts are needed. Refer the customer to proper usage.

**Scenario Number 2:** If the printer has a formatter revision that is earlier than 9.1, the engine may continue to run, which causes dumping of the toner cartridge. Verify that the version of the DC controller is a 1.11 version. To do so, refer to IC 201 on the DC controller; the identifier is "02." Replace the DC controller if it is a 1.11 version. Do not replace the formatter for this condition.

**Scenario Number 3:** (Least likely scenario) The printer may be exhibiting a 79 Service (04CC) error. The 79 Service (04CC) was added to the firmware code of formatters (9.1 version or greater) to capture the signal combination that resulted in toner dumping. Verify that the DC controller is not a 1.11 version, as in scenario number 2. If the error condition continues, power cycle the printer; do not replace the formatter. Escalate through the normal escalation channel if the error persists.

**Action:** Replace the DC controller only if it is a 1.11 version.

## Improved MP Tray

**Service Note Number:** C3166A-09 & C3167A-09

### Serial Number Range:

- **110V:** XXYC00000 - XXYC99999  
XXYD00000 - XXYD99999
- **220V:** XXYC00000 - XXYC99999  
XXYD00000 - XXYD99999

Where XX = US, NL, or SG

Y=B,C,D for 110V, or Q,R, or S for 220V

**Affected Part Number:** RG5-1880-090

**Part Required:** MP tray

**Situation:** The current MP tray experienced a higher than acceptable level of failures from the tray failing to lift. This can be an intermittent failure. The failure occurs when the actuating solenoid fails to engage the tray-lifting mechanism. The feed roller engages to drive the paper, but the paper tray is never lifted. The printer will attempt to raise the tray twice before posting an error. The majority of the time the printer will post a 13.2 paper jam error, which can be cleared by opening and closing the printer door. Sometimes the printer will report a 58.3 error, which requires that the printer be power-cycled. However, if the printer has a formatter with version 8.6 or older firmware, the 58.3 error message will disappear within 5 seconds, leaving the previous message that occurred in the display. The printer is now in a state requiring that it be power cycled, but nothing is indicated on the control panel. With version 9.1 firmware, the 58.3 error message will remain on the display, stating that the printer be power cycled. In all cases, the error will be logged and can be viewed by printing the error logs. Although there may be many causes for a 13.2 paper jam error, only an MP tray failure will cause a 58.3 error.

**Solution:** The MP tray has been modified with a more powerful solenoid and a metal sleeve designed to reduce friction.

**Action:** Replace a failing MP tray with a new one. The failure can be confirmed by observing the tray not lifting when the feed roller is in operation or by 58.3 Errors in the error logs.

# LaserJet 5Si Printer Firmware Rolls to Version 9.1

**Service Note Number:** C3166A-10 & C3167A-10

**Serial Number Range:**

- **110V:** XXYC00000 - XXYG99999
- **220V:** XXYC00000 - XXYG99999

Where XX = US, NL, or SG

Y = B, C, D for 110V, or Q, R, or S for 220V

**Affected Part Number:** C3168-69003

**Part Required:** Formatter PCB

**Situation:** The firmware for the LaserJet 5Si has rolled to a new revision that includes corrections to some specific error conditions that were found after the product's introduction. HP recommends upgrading to the new version if any of the problems listed below occur.

**Solution:** HP has completed testing and, as of November 1, 1996, has made available a 9.1 version of the formatter assembly. The following fixes are included in the new version of the firmware:

- **HUNG IN PROCESSING JOB.** The printer has the potential to hang up and not respond to any key presses to the front panel. The front panel will display `PROCESSING JOBS`. Getting out of this locked-up mode requires power-cycling the printer. This is corrected in the 9.1 firmware.
- **20 MEMORY OVERFLOW PROBLEM.** A problem with memory allocation existed in the 73 firmware, which allocated the maximum amount available. This resulted in numerous memory overflow problems. The problem was fixed to allocate just the required amount of memory.



- **FORM LENGTH SELECTION FROM THE FRONT PANEL.** This function can be found in the PCL MENU structure of the control panel.
- **SLOW PRINTING OF FORMS.** Versions 7.9, 8.5, and 8.6 firmware had a problem handling raster graphics in 300 dot-per-inch (dpi) mode. Often, the size of the raster strip used was too small and inefficient. The implemented fix allows the formatter to run close to engine speed.
- **INTERNAL TRAYS NOT LIFTING WHILE IN POWERSAVE MODE.** If the user opened one of the internal trays while the printer was in PowerSave mode, the tray would not lift it after it was closed. This would result in an “Out of Paper” message for that tray.
- **IMPROPER SELECTION OF TRANSPARENCIES AND CARDSTOCK ALLOWED FROM INTERNAL TRAYS.** Customers were able to select transparencies and card stock as a paper type from the front panel even though these paper types were not supported from internal trays 2 and 3. These selections no longer appear on the front panel.

**Action:** Replace the formatter assembly if the problem is listed in this service note or depicted in the troubleshooting section of the *LaserJet 5Si Service Manual*.

### Note

For information on a complete Hewlett-Packard LaserJet 5Si Printer Mopy Upgrade, call (800) 563-2983.

## Default Printer Font Can Now Be Set from the Front Panel

**Service Note Number:** C3166A-11 & C3167A-11

### Serial Number Range:

- **110V:** XXY C00000 - XXY G99999
- **220V:** XXY C00000 - XXY G99999

Where XX = US, NL, or SG

Y = B, C, D for 110V, or Q, R, S for 220V

### Part Required: Formatter PCB

**Situation:** The LaserJet 5Si printer was introduced without the capacity of being able to set a default front panel font. HP soon realized the importance of this capability to many customers, particularly those in a UNIX environment who rely on setting a default font at the front panel of the printer.

**Solution:** HP has added this functionality back into the current 9.1 version of firmware. Any customer needing the front panel font capability can get it by contacting the Customer Support Center (U.S.) at (208) 323-2551 or by contacting the nearest HP Authorized Dealer Service Center.

Outside of the U.S., customers should contact the European Customer Support Center or the nearest HP Authorized Service Center.

There are also PJI commands that allow for permanent changing of the default printer font. For example: For font number 2, Ec%-12345X@PJL  
DEFAULT LPARM :PCL FONTNUMBER = 2<CR> <LF> Ec%-12345X

**Action:** Replace the formatter assembly according the instructions provided in the removal and replacement section of the service manual, part number C4077-99014. BE SURE TO RE-ENTER THE SERIAL NUMBER, PAGE COUNT, AND MAINTENANCE COUNT VIA THE SERVICE MODE. This information is required so the printer will report the "PERFORM USER MAINTENANCE" message at the 350,000 page interval.

## High-Capacity Input (2,000-Sheet Input Tray)

**Service Note Number:** C3166A-12 & C3167A-12

**Serial Number Range:** LCF00000 to LCF99999

**Part Required:** None

**Situation:** In some cases, the registration from Tray 4/HCI causes print to start too close to the edge of the paper. Although this may or may not be within specifications, some users do not want printing to be so close to the edge. To them, the situation is unacceptable.

**Solution:** This issue is **not** affecting all of the installed base, since in many cases the Tray 4 alignment is fine. In other cases, customers do **not** care about the Tray 4 offset. However, for those customers experiencing the problem, perform the adjustment procedure given below.

**Action:** Adjustment procedure from the Tray 4/HCI left margin:

- 1 With the HCI stand-alone, remove the left, right, and rear covers from the HCI.
- 2 Remove the vertical transfer unit.

- 3 Open the HCI paper tray.
- 4 Loosen both screws that support the paper tray locking bracket on the right side of the HCI.
- 5 Locate the bracket hole and pin at the middle (right side).
- 6 Slide the bracket so the locating pin is positioned at the middle of the bracket hole.
- 7 Tighten both screws.
- 8 Loosen both screws that support the paper tray locking bracket on the left side of the HCI.
- 9 Locate the bracket hole and pin at the middle (left side).
- 10 Slide the bracket so the locating pin is positioned at the middle of the bracket hole.
- 11 Tighten both screws.
- 12 Reassemble the vertical transfer unit.
- 13 Make sure that all cables (vertical transfer unit and paper deck drive assembly) are re-connected.
- 14 Reinstall the left, right, and rear covers to the HCI.

### Note

Positioning the locating pin at the middle could still be unacceptable for some customer's applications. If so, repeat the procedure by moving the locating pin further back and testing the margin.

## Microswitch Assembly in the 2,000-Sheet Input Tray

**Service Note Number:** C3166A-13, C3167A-13

**Serial Number Range:** LCF00000 to LCF99999

**Affected Part Number:** C3168-69003

**Part Required:** RG5-2546-000CN

**Situation:** A microswitch, located at the center top of the HCI tray, has been implemented to protect the tray's functionality. When depressed, this microswitch displays "TRAY 4 EMPTY", causing the tray to **not** lift at all. For unknown reasons, this microswitch has been failing or breaking. When this happens, replacement of the whole unit is required because the microswitch was **not** set up as a spare part and is not documented in either the service or operator manuals.

The purpose of this switch is to avoid serious damage to Tray 4 if a customer loads Letter or A4 paper sizes (portrait orientation) in the right side of Tray 4, and stocks paper or any other media in the empty left side at the same time. If this happens, the tray will be unable to lift all the way up because the microswitch is depressed. The depressed microswitch disables the current of the lifting motor, thus avoiding serious damage to Tray 4.

**Solution:** Work is currently underway to obtain samples from the field in order to perform a failure analysis and to design a countermeasure.

It is strongly recommended that customers do **not** stock paper in the empty space of the HCI. Results of usability tests indicate that users do **not** pay attention to the warning label attached on the bottom-left side of Tray 4.

**Action:** If the microswitch is damaged, regardless of the cause, replace it by ordering part number RG5-2546-000CN. This number is already set up at SMO/SME.

The microswitch assembly includes the microswitch itself, the mounting metallic bar, and the necessary cables.

**Removal and Replacement:** Lift the printer clear of the HCI and place it on a smooth, sturdy surface. With the HCI standalone:

- 1 Remove the top cover.
- 2 Remove the back cover.
- 3 Disconnect the outside cables (connector with two cables) to release the microswitch assembly from the back top of the frame.
- 4 Release the screw that holds the microswitch mounting metallic bar.
- 5 Take out the microswitch assembly (switch and metallic bar) by pushing forward the back edge of the mounting metallic bar.
- 6 Install the replacement microswitch assembly.

## **LaserJet 5Si Now Available with an Executive-Size Paper Tray**

**Service Note Number:** C3166A-14 & C3167A-14

**Situation:** HP recently made available the LaserJet 5Si with an executive-size paper tray. The 5Si Executive printer is product number C3166A, option #ABAUEA. The product option is specifically for the Marriott Corporation.

This tray provides users with the capability to print from a 500-sheet tray, which is exclusive to executive-size media (10.5 x 7.3 in).

Prior to the new executive tray, Tray 1 was the only source for printing this size of media. The executive tray replaces the standard Tray 2. All other sizes must feed from either Tray 1 or Tray 3.

**Support Information:** The Executive printer is identified with an “X” in the fourth position of the serial number. Response Center systems have been updated to recognize the Executive printer for repair purposes because the Executive printer has three unique parts:

- DC controller, part number C3166-60153
- Executive-size tray, part number R77-0008-000CN
- Printer label, C3166-00032

Become familiar with these two specific conditions:

- 1 If you receive the message “MANUALLY FEED TRAY 1 PLAIN EXECUTIVE”, when Tray 2 is empty, load executive-size paper into Tray 2 and press **Select** on the printer control panel.
- 2 If Tray 1 and Tray 2 are loaded with different types of executive-size paper, such as plain executive paper in Tray 1 and yellow executive paper in Tray 2, you must select your input tray by media type, rather than by the input tray. See the user guide for information on configuring the media types at the control panel for each tray. Make the type selection in the printer driver on the PAPER tab, which is under the OPTIONS button for the printer, or from the Page Setup dialog of the word processing application.

## Improved 220V Fuser Reduces Toner Contamination

**Service Note Number:** C3166A-15 & C3167A-15

**Serial Number Range:**

- **220V:** NLYC000000 - SGYK999999

Where XX = NL or SG

**Affected Part Number:** C3166A

**Part Required:**

New: RG5-1871-190

Exchange: C3166-69013

**Situation:** This service note is to communicate the availability of a new revision of the C3166A fuser unit in Europe. This new fuser reduces the likelihood of build-up from calcium carbonate on fuser rollers, which can degrade print quality. Calcium carbonate is used as a filler and brightener by European paper manufacturers. This build-up has only been seen on papers using calcium carbonate. The problem is often described as “blobs on the output” or “printouts getting dirty after a few days.”

**Solution:** Replace the failing user assembly with this new version to reduce problems of print quality caused by European paper containing calcium carbonate.

**Action:** Confirm that the print quality problems are caused by the fusing unit and are not attributable to other components such as the toner cartridge or the use of media that does not meet HP specifications. The build-up on the fuser can be visually inspected by examining the surface of the rollers. If the rollers are contaminated, replace the fuser unit and record the page count in the CSO (in the “Usg Qty” field on the U2 screen).



## Improved Multipurpose Tray

**Service Note Number:** C3166A-16A & C3167A-15A

### Serial Number Range:

- **110V**

XXBY000000 - XXBY142588

XXJY000000 - XXJY 142588

XXDY000000 - XXDY097990

XXLY000000 - XXLY097990

XXCY000000 - XXCY099999

- **220V**

XXZY000000 - XXQY028190

XXSY000000 - XXSY070281

XXRY000000 - XXRY099999

Where XX = US, NL, or SG

Y = B, C, D, F, G, H, J, K, X

**Affected Part Numbers:** RG5-1880-100CN, MP serial numbers JAA0326819 to JAA0420130; RG5-1880-110CN, MP serial numbers JAA0420131 and higher

**Part Required:** MP Tray

**Situation:** The current MP tray has been experiencing a higher than acceptable level of failures in which the tray fails to lift. This can be an intermittent failure. The failure occurs when the actuating solenoid fails to engage the tray-lifting mechanism. The feed roller engages to drive the paper, but the paper tray is never lifted. The printer attempts to raise the tray twice before posting an error.

The majority of the time, the printer posts a 13.2 paper jam error, which can be cleared by opening and closing the printer door. Sometimes the printer reports a 58.3 error message, which requires the printer to be power-cycled. However, if the printer has a formatter with version 8.6 or older firmware, the 58.3 error message disappears within 5 seconds. In this case, the message for the previous error remains on the display. The printer is now in a state requiring that it be power- cycled, with no indication on the control panel.

With version 9.1 firmware, the 58.3 error message remains on the display, stating that the printer needs to be power-cycled. In all cases, the error is logged and can be viewed by printing the error logs. Although there may be many causes for a 13.2 paper jam error, only an MP tray failure will cause a 58.3 error.

**Solution:** The MP tray has been modified with a more powerful solenoid and a metal tab designed to reduce friction.

**Action:** Replace a failing MP tray with a new one: RG5-1880-100CN, MP serial numbers JAA0326819 to JAA0420130 or RG5-1880-110CN, MP serial numbers JAA0420131 and higher. The failure can be confirmed by observing the tray not lifting when the feed roller is in operation or by 58.3 errors in the error logs.

## 16-Megabyte SIMM Manufactured by HP: Vendor Revision “B” Causes 79 Service Errors

**Service Note Number:** C3166A-17 & C3167A-17

**Serial Number Range:**

- **110V:** XXYC00000 - XXYJ99999
- **220V:** XXYC00000 - XXYJ99999

Where XX = US, NL, or SG

Y=B,C,D for 110V, or Q,R, or S for 220V

**Affected Part Number:** C3146

**Part Required:** C3146A

**Situation:** LaserJet 5Si family printers having 16-Megabyte (MB) (revision “B”) SIMMs installed can fail with various 79 service errors. Removing or replacing these SIMMs with non-revision “B” SIMMs or two 8 MB SIMMs resolves this issue. To identify the failing SIMMs, look for the identification number “HM5117400BS6” on the components. Older 16 MB SIMMs (Revision “A”, identification number ends with AS6), as well as SIMMs made with other components (not marked with this specific identification number) do not exhibit this problem.

**Solution:** Replace the failing SIMM with a non-revision “B” SIMM.

## Action:

- Verify that the printer has a 16 MB SIMM marked with HM5117400BS6.
- Do **not** replace the formatter.
- Remove the 16 MB SIMM and verify that the printer no longer fails.
- Replace the failing SIMM with a non-revision "B" SIMM and return the failing SIMM.
- CSO entries: Move the product number and the serial number to the system entry fields. Change the product number field from the printer model number to C3146A (SIMM) and the serial number to 0000A00000.

## LaserJet 5Si and Entire Image Manager Software

**Service Note Number:** C3166A-18

### Serial Number Range:

- **110V:** XXYC00000 - XXYJ99999
- **220V:** XXYC00000 - XXYJ99999

Where XX = US, NL, or SG

Y=B,C,D for 110V, or Q,R,S for 220V

**Part Required:** C3168-69005

**Situation:** HP has entered an agreement with Entire, Incorporated. Entire has developed a software solution called the Entire Image Manager. Essentially, the solution takes up to four LJ 5Si printers and enables them to work as one logical printer. With print speeds up to 96 pages per minute, it is ideal for printing books and manuals as well as other high-volume print jobs.

The software comes with a full standard set of tools to raster image process (RIP), manage, merge, retrieve, impose, queue, and store in an electronic library, and to output files to an LJ 5Si.

Image Manager can accept PostScript Level 2, PCL 5e, TIFF, and CCITT G3/G4 files from modems, floppy disks, tapes, or other media. Customers can connect their printer cluster to almost any Ethernet, Token Ring, LocalTalk, and FDDI networks. It supports TCP/IP, Novell, DECnet, AppleTalk, LAN Manager, LAN server, SNA, and Banyan protocols. Any engine sold after September 1, 1997 that does not have the 9.7 firmware or later will require a formatter replacement.

**Solution:** Clarity of support and firmware compatibility for this solution is important. If the customer is having problems with the solution, please instruct them to call the HP reseller that sold them their solution. If the reseller is distributing the Image Manager software, they also have the responsibility for first-level support for the software.

Second-level support is provided by the master distributor: Ahearne & Soper support (800) 879-3224 (extension 120).

The master distributor will determine whether the equipment is defective and, if so, direct the customer to the manufacturer.


Entire, Inc. is responsible for third-level support on the software bundle: Entire's support group can be reached at (716) 742-2200 (extension 251).

HP's traditional LJ 5Si support infrastructure will be responsible for supporting the LJ 5Si engine. The Image Manager Software only works with firmware version 9.7 or later. This service note covers any 5Si printers sold after September 1, 1997 that do not have the required firmware to be compatible with the Entire Image Manager software.

In Europe, the solution will be rolled out as a co-labeled HP and Entire product. In North America, the solution will be a third-party program. The rest of the world will not be addressed until we have the other two major regions running. Both regions are expected to see installations around September 1, 1997.

**Action:** Confirm the firmware version by printing a configuration page. Replace the formatter assembly (part number C3168-69005) as noted above.

## LJ 4V/4MV



### Paper Jams When Using Three-Hole Punched Paper

**Service Note Number:** C3141A-01 & C3142A-01

#### Serial Numbers Affected:

- **110V:** JPBF000000-JPBF002856, JPBC000000-JPBC003385, JPBH000000-JPBH001216
- **220-240V:** JPBQ000000-JPBQ014821, JPBR000000-JPBR008695, JPBS000000-JPBS003616

**Associated Part Numbers:** DC controller PCB (P/N RG5-1932-000CN)

**Situation:** Printers in the serial number ranges listed above have a DC controller that may not allow enough time for three-hole paper to pass by the first paper sensor (PS501).

**Solution:** To increase paper feed performance with three-hole punched paper, an end of the front registration sensor lever has been widened. To accommodate the widened lever, the guide assembly was notched as necessary, and the main frame structure was enlarged. Sensor levers for the serial number range above are unique. If they are worn or broken, the only replacement part is RF5-0397-000CN.

**Action:** If a three-hole jam problem occurs in printers that are within the serial number range, replace the DC controller PCB.

## Printer Hangs or Displays 79 (0523) Service Error

**Service Note Number:** C3141A-02

**Situation:** When using a PostScript level 1 driver, the printer will either hang or exhibit a 79 SERVICE (0523) error when the following condition is present:

Page size A has been selected, with the printer containing Page size B, according to the following table:

A (Driver)	B (Tray)			
	Legal	A4	JB5	JB4
Legal		X	X	
11 x 17	X	X	X	X
A3	X	X	X	X
JB4		X	X	
Custom	X	X	X	X

The hang occurs if the job consists of only one page. If the job consists of multiple pages, the error 79 occurs.

### Solution:

- Ask the customer to use PostScript level 2 drivers exclusively.
- If #1 is not feasible, replace the formatter PCA.



## Printer Will Not Access Service Mode

**Service Note Number:** C3141A-03A

**Serial Numbers Affected:** JPB0000000 - JPB9999999

**Associated Part Numbers:** C3141-60003 - patch SIMM

**Description:** Printers manufactured in the range shown above may have firmware that will not recognize depressed control panel keys upon power-up. Therefore, there is no access to Service Mode, Language Localization, or Cold Reset. This affects 110V and 220V units with the #ABA English option.

**Solution:** To order a patch SIMM, call HP Distribution at (970) 339-7009 (U.S.) or (+31) 20 682-8291 (Europe).

## Repeating 94mm Print Defect

**Service Note Number:** C3141A-05

**Associated Part Numbers:** Toner cartridge: C3900A

**Situation:** Toner cartridges for the LaserJet 4V and 4MV products could have a damaged print drum. Due to the design of the product, this defect can be induced if the cartridge body is squeezed hard in the middle. The defect can also occur if the cartridge is dropped (even if the cartridge is still in the box).

The symptom will be one or two black or white dots that repeat every 94mm in the direction of the paper path. The dots will be located near the center of a letter-sized page when viewed in a landscape orientation.

**Solution/Action:** Any toner cartridge that exhibits this defect should be returned to HP or an HP Authorized Service Center for replacement. Cartridges beginning with lot code 4I28S\* will not have the potential to become damaged.

## **57 Service Error (not caused by the main motor)**

**Service Note Number:** C3141A-06

**Associated Part Numbers:** RS5-2125-000CN - Spring

**Description:** A 57.1 SERVICE error, which normally indicates a main motor failure, may also be caused by a broken spring in the sensor flag associated with the Front Door Open Sensor (PS402). Failure of the Door Sensor prohibits power to the main motor, causing the error.

**Solution:** Before replacing the main motor assembly, check the spring and sensor flag. Replace the spring, if broken.

## **Parts for Thumb Screws and Back Plate of Formatter Card Cage Can Be Ordered**

**Service Note Number:** C3141A-07 & C3142A-07

**Associated Part Number:** Thumb screws (RB1-5788-000CN) and the Cardcage Back Plate (RB1-5556-000CN)

**Situation:** Some cases have been reported of the formatter thumb screws breaking; in some cases, the threads in the card cage back plate have been stripped. The design and material used for the screw is being addressed. However, in the event that this becomes a problem, it is important that the individual pieces are available through our normal parts-ordering channels.

Therefore, the thumb screws (RB1-5788-000CN) and the card cage backplate (RB1-5556-000CN) are now available.

Replace broken screws or stripped back plate on failure only. Refer to Internal Components in chapter 8 of the LaserJet 4V service manual. The back plate is part of the formatter card cage, as shown in figure 8-10, item 11. Make the appropriate mark-ups in your service manuals.

## 55 Service Error Troubleshooting Hint

**Service Note Number:** C3141A-08 & C3142A-08

**Situation:** A “55 Service Error” is usually caused by a communication error between the DC controller and the formatter PCA. If the formatter PCA is not seated properly to the interface PCA, this error will occur. This is an important troubleshooting tip because the service manual directs you to replace the laser/scanner as the second most-likely solution. Mark your service manuals with the second most-likely fix to be: “2. Reseat the formatter PCA” prior to unnecessarily replacing the laser/scanner assembly. The next revision to the service manual will reflect this change.

## MP Tray Paper Jams

**Service Note Number:** C3141A-10

**Associated Part Numbers:** RB1-6389-000CN - static charge eliminator, RG5-1555-050CN - guide

### Serial Numbers Affected:

- **110V:** JPCF011302, JPCG007020, JPCH005190
- **220V:** JPCQ002711, JPCR000101, JPVQ003523, JPVR008774, JPVS000101

**Description:** Early units have an increased possibility of paper jams. The parts listed above have been upgraded to fix the problem.

**Solution:** Refer to chapter 6 in the service manual to remove the registration roller guide plate and anti-static brush. Replace with the redesigned parts.

## Preventing Damage to Toner Cartridge Shutter Arm

**Service Note Number:** NONE

**Associated Part Numbers:** NONE

**Description:** If the front door of the printer is not fully opened when a toner cartridge is being removed, it is very likely that the shutter that covers the cartridge drum will be broken, destroying the cartridge and resulting in blank pages being printed.

**Solution:** Advise the customer to always open the front door completely before removing the toner cartridge.

## Pickup Roller on the Multipurpose Tray Does Not Stop

**Service Note Number:** C3141A-12 & C3142A-12

**Serial Numbers Affected:**

- 115V: JPBXXXXXXX - ALL, JPCXXXXXXX - ALL, JPDXXXXXXXX - ALL, JPDGXXXXXXX - ALL, JPDH000000 - JPDH030601
- 220V: JPBXXXXXXX - ALL, JPCXXXXXXX - ALL, JPDXXXXXXX - ALL, JPXS000000 - JPDH007198

**Associated Part Number:** RG5-1584-000CN (paper guide plate assembly), C3141-69007 (exchange part number)

**Situation:** Occasionally the pickup clutch on the paper guide plate assembly will not disengage. If this occurs, paper is continually picked from the (MP) multipurpose tray, and as many as three or more sheets jam in the printer.

**Solution:** A new clutch is now being used on the paper guide plate assembly (RG5-1584-000CN). The old clutch used an oil-impregnated metal bushing as a lubricant. On some clutches, this oil would leak from the bushing, causing the armature to stick. Then, the clutch would not disengage. The new clutch uses a mold bushing that does not require oil, thus solving the problem. The part number for the paper guide plate assembly containing this new clutch is the exchange part number C3141-69007. After confirming the error condition described above, replace the paper guide plate assembly.

## Leading Edge Smudge

**Service Note Number:** C3142A-13

### Associated Serial Numbers:

- **115V:** JPFH000000-JPFH001548, JPBXXXXXXXX-ALL, JPCXXXXXXXX-ALL, JPDXXXXXXXX-ALL
- **220V:** JPFQ000000-JPFQ000389, JPXS000000-JPXS022660, JPVXXXXXXXX-ALL, JPWXXXXXXXX-ALL

**Associated Part Number:** Old part number: RF5-1380-000CN; New part number: RF5-1380-030CN

**Situation:** The fuser entrance guide has a ridge of material along its length. Toner can build up along the edge of this ridge. This accumulated toner can cause the page to catch at the inlet to the fuser; when caught, the unfused toner scatters, creating a print defect called “leading edge smudge.” This defect appears as smudged print or a toner halo around the characters. This print defect can occur as early as a 10K page count. The smudges can occur anywhere along the leading edge of the document (landscape paper path).

**Solution:** Material has been removed along the length of the fuser entrance guide, and the ribs were extended. This change prevents the toner accumulation on the entrance guide from hitting the paper. Refer to the LaserJet 4V and 4MV Service Manual, Second Edition (C3141-90929), section 8, figure 8-4, item 28 for the part. Replace the part with the new part number: RF5-1380-030CN.

**Action:** For the replacement procedure, see the *LaserJet 4V and 4MV Service Manual*, Second Edition (C3141-90929).

### Note

Be sure to observe all warnings, notes, and cautions provided in this procedure.

## Formatter Fan Noise

**Service Note Number:** C3141-14

### Serial Numbers Affected:

- **100V/120V**

JPBF000000 to JPBF999999, JPDF000000 to JPDF999999,  
JPBG000000 to JPBG999999, JPDG000000 to JPDG999999,  
JPBH000000 to JPBH999999, JPDH000000 to JPDH999999,  
JPCF000000 to JPCF999999, JPFF000000 to JPFF018699,  
JPCG000000 to JPCG999999, JPFH000000 to JPFH005145,  
JPCH000000 to JPCH999999

- **220V/240V**

JPBQ000000 to JPBQ999999, JPVQ000000 to JPVQ999999,  
JPBR000000 to JPBR999999, JPIR000000 to JPIR999999,  
JPBS000000 to JPBS999999, JPIV000000 to JPIV999999,  
JPCQ000000 to JPCQ999999, JPWQ000000 to JPWQ999999,  
JPCR000000 to JPCR999999, JPWR000000 to JPWR999999,  
JPCS000000 to JPCS999999, JPWS000000 to JPWS999999,  
JPDQ000000 to JPDQ999999, JPXQ000000 to JPXQ012118,  
JPDR000000 to JPDR999999, JPXS000000 to JPXS033088,  
JPDS000000 to JPDS999999, JPFQ000000 to JPFQ006200,  
JPFS000000 to JPFS010991

**Associated Part Number:** Fan: RH7-1317-000CN or video controller assembly: RG5-1560-060CN

**Situation:** The majority of formatter fan replacements have been for noise. These replacements have been categorized into two failure modes:

- The fan/card cage assembly produces a strong pitch or tone due to the fan rotational speed that causes the formatter cage to resonate. Customers may be more sensitive to this noise because this fan is the only fan on at all times.
- Some fans may have a defective bearing which causes noise.

**Solution:** The operating speed of the fan has been re-engineered. The fan speed has been reduced from 7,000 revolutions per minute (rpm) to 5,000 rpm with no detrimental effect upon the printer operation. Also, an inspection process was created to check for bearing defects. The formatter fan has received a new part number RH7-1317-000CN and is available now through regular parts distribution.

**Action:** For the replacement procedure, refer to the *LaserJet 4V and 4MV Service Manual*, Second Edition (C3141-90929), section 6, pages 6-16; “Card Cage.” The fan then can be removed from the card cage assembly and the countermeasure fan installed.

### Note

Be sure to observe all warnings, notes, and cautions provided in this procedure.

## Paper Jams In Output Area When Using Large Media

**Service Note Number:** C3142A-15

**Affected Serial Numbers:** All Units

**Associated Part Number:** RG5-0198-000CN

**Situation:** After 400k images are printed, toner can build up on the face-down delivery assembly rollers. This can cause paper jams in the fuser or output area and/or leave claw marks on large-sized media (B size or 11X17 media).

**Solution:** Clean or replace the face-down delivery assembly rollers.

**Action:** For the replacement procedure, refer to the LaserJet 4V and 4MV Service Manual, Second Edition (C3141-90929).

### Note

Be sure to observe all warnings, notes, and cautions provided in this procedure.

## Input Jamming When Feeding from the 500-Sheet Feeder

**Service Note Number:** C3760A-02C

**Associated Part Numbers:** C3760-67900/Roller and Clip Kit

**Situation:** The volume of calls has increased for LaserJet 4V/4MV printers with the 500-sheet optional cassette. The jam occurs at the registration area (PS1) and/or there are mis-picks from the optional tray.

After extensive investigation and testing, we determined that installing the Roller and Clip kit should resolve the input jamming condition.



## Solution:

- 1 The tooling mold for the J11 clip was modified to ensure that the manufactured part is free of burrs.
- 2 The manufacturing process of the rollers has been modified with a new ultrasonic cleaning procedure to eliminate any blooming effects. The new preconditioned rollers have been tested extensively, with good results and performance.
- 3 A new Roller and Clip kit (C3760-67900) has been set up at SMO/SME. The kit contains a J11 deflector clip, a new preconditioned roller assembly, and installation guidelines.



## Action:

- 1 If the failure occurs, install the new Roller and Clip kit C3760-67900, using the instructions sheet included in the kit.
- 2 If you continue to experience a jamming problem from the lower cassette after performing the service note, consider the following recommendations:
  - Be sure **not** to install the roller assembly backwards.
  - Be sure that paper-size slider is seated properly into the four black pulleys (bushings). Ensure the pulleys are fully seated in their channels.
  - Be sure that the position lock on the paper-size slider is engaged in the correct hole. (The position lock has a green lever.)
  - Be sure that the magnetic sensors that detect paper size are properly placed.
  - Try different media or have the media evaluated. We have seen numerous issues relating to the customer's media.
  - The lower cassette units with serial number DE03695118 and greater are shipped with the new preconditioned roller assembly.

## LJ 4P/4MP

and

## LJ 4L/4ML



### Paper Jams

**Service Note Number:** C2003A-01 (Information only)

**Description:** A majority of the problems on the LaserJet 4L and 4P center around paper jams and removal of paper jams. In their haste to remove paper jams, people often damage the paper-input sensor flag (RF5-0601-000CN). The printer is inoperable with a broken sensor flag.

**Solution:** Replace the broken flag, and INSTRUCT THE CUSTOMER on proper removal of jams.

#### If a jam occurs at the printer's input:

- 1 Slide the paper to the right, freeing it from the front and top oblique rollers of the printer.
- 2 Carefully pull the paper out from the front of the printer.

#### If a jam occurs at the rear of the printer:

- 1 Open the fuser door and lift up on the release lever of the printer's rear fusing assembly.
- 2 Carefully pull the paper out from the rear of the printer.

## Media Jams Caused by Broken or Binding Input Paper Sensor Arm

**Service Note Number:** C2003A-03, C2015A-03, C2005A-07, C2040A-07, C3134A-01

**Serial Numbers Affected:** AAAA000000 - ZZZZ999999

**Description:** Improperly removing jammed media can damage or break the Input Paper Sensor Arm (RF5-0601-000CN). As a result, media will jam frequently or constantly, regardless of whether media is fed from the lower cassette or from the manual feed slot.

**Solution:** Replace the Input Paper Sensor Arm. This sensor arm has been re-designed to prevent it from breaking even if a media jam is removed improperly.

### Note

When replacing the Input Paper Sensor Arm, the replacement sensor arm may bind with the High Voltage Shield (RB1-2987-000CN). If this occurs, also replace the High Voltage Shield. Due to the increased size of the redesigned Input Paper Sensor Arm, it may come into contact with the flange on the original version of the High Voltage Shield. To prevent this from happening, a flange on the original version of the High Voltage Shield has been removed.

## Broken Printer Frame - Paper Cassette Support Guides

**Service Note Number:** C2003A-04, C2015A-04, C2005A-08, C2040A-08, C3150A-02, C3155A-02, C3134A-02, C3932A-02, C3935A-02

**Serial Numbers Affected:** AAAA000000 - ZZZZ999999


**Description:** A customer can damage a printer by improperly removing the paper cassette. Improper removal usually consists of pulling up or pushing down excessively on the paper cassette before it is fully removed from the printer. Improper removal can break off the support guide(s) the frame of the printer, which may cause an increase in media jams and image skew, or may crease printed output.

**Solution:** Install the paper cassette support guide repair kit (5062-4662). First, be sure that the printer is placed on a firm, flat surface. Apply the kit (a three-piece appliance) directly to the paper cassette. The kit includes two bottom supports, a left-side support, and instructions.

**Procedure:** To ensure correct installation, before starting the procedure go through the steps below carefully without removing the adhesive backing from the supports:

- 1 Remove the paper cassette and place it on a flat surface.
- 2 Remove the adhesive backing from one of the bottom supports. Carefully place the support in one of the two positions.
- 3 Remove the adhesive backing from the other bottom support and place it in the remaining position.
- 4 Remove the adhesive backing from the left-side support. Carefully place the support in position.
- 5 Replace the paper cassette in the printer; check for proper operation.

## LJ 4 Plus/4M Plus and LJ 4/4M




### Paper Jams in Optional 500-Sheet Lower Cassette

**Service Note Number:** C2001A-01

**Description:** Misadjustment of the counter-balance adjustment on the 500-sheet optional lower cassette is a leading cause of paper jams. Either no-picks or multi-picks will occur, resulting in 13 and/or 41 errors.

**Solution:** Follow these instructions to adjust the cassette:

- 1 Fill the cassette completely full of paper of all the same weight (do not overfill). Make sure the paper is flush against the rear paper guide and that it rests under the front left corner tab.
- 2 Push down and release the front edge of the paper in the cassette until it bounces. If the cassette is adjusted correctly, the purple-colored indicator will stop in the very center of the indicator window. If you need to adjust it, rotate the knob and try “bouncing” the paper once again. Repeat these steps until the purple indicator stops in the center of the window.

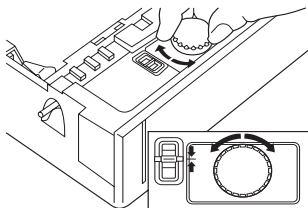

**Figure 9-3** Adjustment of the optional 500-sheet lower cassette

Repeat this process any time you change the paper basis weigh. Note that if the indicator behaves erratically, the paper may not be flush against the rear paper guide.


## Paper Jam Errors 13 and 41.3 (multi-feed jams)

**Service Note Number:** C2001A-02

**Associated Part Numbers:** RA2-1999-000CN - corner tab

**Description:** LaserJet 4/4M only: Multi-feed paper jams (where more than one sheet of paper is picked from the paper tray) may become a recurring problem if customers use marginal paper (paper that does not meet HP specifications or that is damaged).

**Solution:** A modified corner tab was designed to correct this problem. Service Note C2001A-02 provides instructions for obtaining and installing free replacement corner tabs (in quantities from one to ten). The redesigned corner tab is installed in the 250-sheet paper tray, and is specifically designed to increase the paper-feeding performance of lighter weight (60-75 g/m<sup>2</sup> [16-20 lb]) papers. The original tab should be retained if the customer intends to use heavier weight papers in the future.

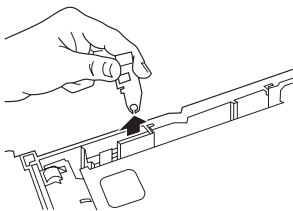

**Figure 9-4** Installing the corner tab

To obtain free tabs, phone HP Distribution:

United States: (970) 339-7009 Europe: (+31) 20 682-8291

## Accordion Jams in Output Assembly

**Service Note Number:** C2001A-03A

**Associated Part Numbers:** RF5-0425-000CN, quantity of 4

**Description:** Accordion jams occur on the LaserJet 4 as the paper leaves the fusing assembly and enters the output stacker. The leading edge of the paper may catch in the output stacker and fold up like a fan or an accordion. A defective output roller holder that was used in the manufacture of a number of printer caused this problem. Only U.S.-built printers had this flawed roller holder. European and Asian- built printers did not. The following ranges of serial number may contain the defective roller holder:

- USBB074298 through USBB081811
- USBB099540 through USBB190983
- USBC085451 through USBC093129
- USBC112090 through USBC234957
- USTB000101 through USTB007397
- USTC000101 through USTC010123

**Solution:** Replace the defective output rollers with the redesigned rollers.

### Note

Your customer may have a printer with serial numbers within this range and never experience the “accordion jam” problems. Note that the likelihood of these jams increases with the use of somewhat marginal papers (papers with a poor leading-edge cut). The roller holders do not need to be replaced if accordion jams are not occurring.

## 500-Sheet Lower Cassette (Tray 3) Shim Improves Paper Handling with Letter and Legal Size Paper

**Service Note Numbers:** C2001A-04, C2021A-04, C2037A-02, C2039A-02, C3916A-03, C3917A-03, C3952A-03

**Associated Part Numbers:** C3916-67906/Lower Cassette (Tray 3) Shim Kit

**Situation:** The lower cassette (Tray 3) accessory of the LJ4, LJ4+, and LJ5 series printers requires some user setup and adjustment to operate properly.

If the lower cassette tray is not set up properly and monitored for proper adjustment, the performance of the tray can suffer. The performance degradation typically exhibits itself as 13 PAPER JAMS and/or 41.3 ERRORS from the lower cassette tray. The *500-Sheet Feeder Paper (Tray 3) Installation Guide* provides instructions on properly adjusting the tray. The bottom plate of the lower cassette also contains illustrated installation instructions. For a variety of reasons, the tension adjustment and/or the right-side guide adjustment are often not correct. Testing indicates that improper adjustment of the right-side guide is the major cause of performance problems with the lower cassette tray. This problem has been found to predominantly affect letter/legal size paper.

**Solution:** HP has developed a right-side shim that enhances the performance of the lower cassette (Tray 3). The shim is designed to be used with letter/legal size paper. The shim installs in the lower cassette (Tray 3) between the side-guide adjustment and the side rail of the tray. The shim stiffens the side guide and positions the guide properly for letter/legal size paper. Installing the shim improves the performance of the lower cassette (Tray 3).



## Note

This shim kit will not solve all paper feed problems from the lower cassette. All the standard media checks should be performed to assure media meets HP specifications, is not damaged, and so forth. The adjustment for paper tension should also be set properly for the weight of the paper that is installed in the tray.

**Action:** A Lower Cassette Shim Kit has been designed that includes the shim and an instruction sheet for proper installation. The shim kit is user-installable and available to service providers or end users. The shim kit can be ordered free of charge by calling HP Distribution at (970) 339-7009. Callers should request the HP Shim Upgrade Kit, part number C3916-67906. The shim kit will work only for customers using letter or legal-size paper.

## False Paper Jams (last page only)

**Associated Part Numbers:** RB1-2133-000CN

**Description:** If the printer is giving a false paper jam message on only the last page, and a piece of paper cannot be found in the printer, verify that the paper-out sensor flag is still attached. To locate the flag, remove the 250-sheet paper cassette and look for a small, black piece of plastic hanging down in the center of the slot.

**Solution:** If this flag is missing, the printer will give a false paper jam message. If this occurs, replace the sensor flag.

## **Image Skew or Paper Damage (feeding from the 250-sheet tray)**


**Service Note Number:** NONE

**Associated Part Numbers:** RF5-0369-000CN - hinge (front),  
RB1-2259-000CN - hinge (back)

**Description:** Skewed print images, and/or damage to the left edge of the paper can result when a paper weight is missing from the cavity of the 250-sheet paper tray. To check for this problem, remove the 250-sheet cassette and look inside the cavity. You should see a “V”- shaped, hinged plastic weight hanging down from under the high voltage power supply area. This weight puts a slight amount of pressure in the paper and prevents the paper from skewing as it is fed into the paper path.

**Solution:** Replace the weight.

# LaserJet 4Si

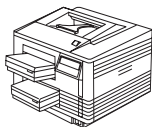

## Missing Scan Lines, 70-110 mm from Top of Page

**Service Note Number:** C2010A-02

**Associated Part Numbers:** RG5-0381-180CN (Job Offset Assembly)

**Description:** An intermittent print-quality defect may occur when the job-offset feature is used to print multiple-page jobs. Missing scan lines, approximately 70 to 110 mm from the top of the page, are caused when the bumper that is mounted on the Job Offset Assembly becomes deformed. This causes the assembly to “bang” to the left. As a result, the beam-to-drum mirror mounted on the printer's top cover vibrates, resulting in what appears to be missing scan lines. This defect appears only if more than three pages are being printed **and** the job-offset feature is being used. The first and second page do not exhibit the defect.

**Solution:** Replace the Job Offset Assembly.

## Preventing Jams: Face Up or Output Stacker

**Service Note Number:** C2010A-03

**Associated Part Numbers:** RB1-0557-040CN (Paper Guide)

**Description:** When printing jobs to the face-up tray with an output stacker (C2801A), the potential exists for an increase in the number of paper jams. The jams are a result of paper being deflected incorrectly by the paper guide of the delivery cover assembly.

The adhesive used to secure the gray pad on the paper guide causes this problem. Over time, the adhesive causes incorrect paper deflection and jamming. Typically the left leading edge of the paper may catch on the upper edge of the rear exit slot of the delivery cover assembly and cause the media to skew and jam.

The error also can occur when the upper tray has been selected and the output is delivered to the lower tray.

**Solution:** The rear delivery cover assembly has been redesigned so that the pad is no longer needed. Either of the two fail conditions cited above can be corrected by replacing the paper guide on the delivery cover assembly.

When printing to the face-up tray or output stacker, the paper-handling performance will be improved because the paper is routed more precisely through the paper slot in the delivery cover assembly.

Perform the modification only when the specified failure occurs. Use the procedures shown in the source note.


## Paper Jamming and Feed Problems

**Associated Part Numbers:** RF5-0041-000CN (Paper Feed Rollers)

**Description:** Since introduction, the paper feed rollers have been replaced more frequently than any other part. These rollers have been life-tested at nearly 300K pages without any problem. Theoretically, these parts should not need replacement until regularly scheduled (200,000 page) user maintenance. Premature wear is likely to be caused by media that does not meet specifications.

**Solution:** Replace the paper feed rollers and consult with the customer to ensure that the media used meets specifications and is not causing undue printer wear.

## LJ IIIIP, IIP Plus, IIP



### Moaning Sound in Separation Pad

**Associated Part Numbers:** RG1-1912-080CN - separation pad

**Description:** After a certain amount of printer usage, the combination of separation pad wear and the use of smoother papers can cause a vibration in the separation pad assembly. The vibration occurs at a resonant frequency while paper is being fed into the printer. This resonance is amplified by the lower frame pan, and results in an audible moaning sound that continues the entire time the page is being fed into the printer. An important diagnostic clue is the length of time that the noise is audible. Note that some noise during the first second of paper pickup from the MP tray is considered normal.


**Solution:** A production change was made to the separation pad to minimize the occurrence of the moaning sound in the separation pad. The improved pad is indistinguishable from the previous pad to the naked eye. The former part number, RG1-1912-000CN, can no longer be ordered. The new part number is RG1-1912-080CN.

#### Note

This problem may still be exhibited when the customer uses excessively smooth paper or the separation pad is worn.

**Associated Part Numbers:** RG1-1777-000CN - drum drive gear assembly


9




**Figure 9-5** Gap between lines and compressed line on the same page

Why does this happen? When something causes the toner cartridge to freeze up, the shaft on the drum drive gear continues to turn for a short period of time but the gear does not. This can later cause the toner cartridge drum to stop turning momentarily due to slippage between the deformed gear and the shaft (even though the rest of the printer is functioning normally). This results in compressed print or in gaps in the print. Once the shaft has turned, the problem may recur intermittently even after the toner cartridge is replaced.

**Solution:** Replace the drum drive gear assembly, part number RG1-1777-000CN.

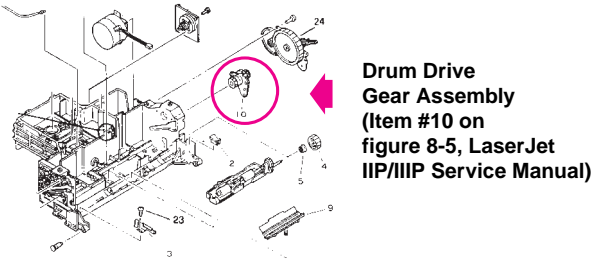

**Figure 9-6** Drum drive gear assembly

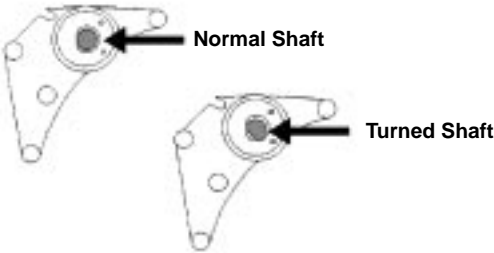

**Figure 9-7** Good versus bad drum drive assembly



## Continuous “PS Busy”

**Description:** On rare occasion, when using the HP PostScript Cartridge (HP 33439P/Q) with a LaserJet IIP, a continuous PS BUSY condition can occur if auto continue is ON and the document being printed is longer than 1 or 2 pages. If the page is printed, this condition may result in missing lines, shifted text, and some malformed letters. If the faulty pages are ejected, the printer flashes PS BUSY on the display indefinitely and no more text is printed.

This error condition can result from a fuser discharge phenomena that causes a 41 ERROR in the LaserJet IIP. Since the PostScript mode of operation does not report errors in the same manner as PCL, the 41 ERROR is not displayed and the printer displays a continuous PS BUSY status.

### Note

Many other conditions can cause a similar PS BUSY symptom. However, if a LaserJet IIP printer exhibits this problem, a bad fusing assembly is the likely culprit.

## Incompatibility of New Fusing Assembly Component

**Service Note Number:** 33471A/AB-04, 33481A/AB-04, C2007A-02

**Associated Part Numbers:** RF1-3305-000CN

**Description:** Some changes have occurred to the fusing assemblies used in the HP LaserJet IIP, IIP+ and IIIP printers. All assemblies are fully compatible with all LaserJet IIP/IIP+/IIIP printers, with the exception of the **original** fusing assembly used in the LaserJet IIP printer (see Service Notes 33471A-02B and 33471AB-01B for details). Changes made in the later assemblies have made some component-level repairs unfeasible.

**Solution:** Newer fusing assemblies are identified by a missing blue wire from the center conductor of the thermistor assembly connector. If the thermistor or its cable assembly (including the connector) requires replacement in a newer fusing assembly, the correct replacement part number is RF1-3305-000CN. Replacements are not available for the right connector holder (item 14 in the LJIIIP/IIP+/IIIP Service Manual), and they are not available for the plates to which the diode leads that are soldered on the right end of the assembly. If these components are damaged, replace the entire fusing assembly. Use all other assembly components documented in Table 8-8 of the LaserJet IIP/IIP+/IIIP service manual to perform component repair of any fusing assembly.

## LJ II, III



### Potential Safety Issue Following Fuser Repair

**Service Note Numbers:** 33440A/AB/AU-12, 33447A/AB/AU-09, 33449A/AB-05, 33459A/AB-03

**Associated Part Numbers:** RA1-3959-000CN, RA1-3960-000CN

**Description:** There have been reports of damage incurred to the left and/or right fusing assembly covers of the LaserJet II, IID, III, and IIID printers as a result of repair or replacement of the fusing assembly. A primary function of these covers is to protect the user from hazardous line voltages (100-240 VAC).

These voltages are routed to the fusing lamp via wires fastened to metallic strips just beneath these covers. The wires, strips, and screws used to fasten these wires are all exposed if the covers are missing or damaged. The line voltage used to power the fusing lamp is present at these exposed surfaces as long as the printer is turned on, even when the top cover is open.

**Solution:** When servicing these printers, ensure that the left and right fusing assembly covers are undamaged and properly fastened in place upon completion of the repair. The cover can be damaged if all the wires routed beneath the covers are **not** positioned properly prior to tightening the cover screws. Damage can occur during shipment or through other mishandling of the fusing assembly. The replacement part numbers are as follows:

Cover, Left, Fuser RA1-3959-000CN

Cover, Right, Fuser RA1-3960-000CN

## Internal Cabling Problems

**Description:** Four cable harnesses located in the LaserJet series II and LaserJet III printers may be the cause of certain printer failures.

**Solution:** Replace these cables before attempting to replace expensive assemblies. Part numbers for the cable assemblies appear in the following table.

Part Number	Description	Error Conditions
RG1-0908-000CN	Laser scanner cable assembly	41 51 52 scanner motor whining, distorted print, lines across page.
RG1-0907-000CN	Fusing assembly cable (long, 7-wire)	13, 50, ghosting, open thermoprotector.
RG1-0906-000CN	High-voltage power supply cable (8-wire)	Constant ozone production, repetitive print defects, improper toner-low sensing.
RG1-0912-000CN	AC power module cable (short, 4-wire)	50, with a cold fuser.

The LaserJet IID/IIID scanning cable assembly may also cause errors 41, 51, or 52. Cable assembly part numbers are: **LaserJet IID:** RG1-1370-000CN  
**LaserJet IIID:** RG1-2067-000CN.

The printer test tool (see chapter 4) is useful in detecting problems in high voltage power supply.

## Light-Brown Stain on Front Side of Duplexed Page

**Service Note Number:** 33447A/AB/AU-10,33459A/AB-04

**Associated Part Numbers:** RG1-1356-000CN,  
RG1-2498-000CN

**Description:** A light-brown streak can appear on the front side of a duplexed page when the duplex feature is not used for several weeks. The stain is approximately 10 mm (3/8" wide) and can be seen along the entire length of the page, approximately 38 mm (1.5") from the right edge of the paper. Some have described the stain as being some sort of oil contamination, such as excess lubricant on the fuser cleaning pad.

The oblique duplex registration roller in the LaserJet IID and IIID printer requires a preservative to help protect it from the long-term effects of normal usage and ozone exposure within the printer. Without this preservative, the roller would fail prematurely and, as a result, would not continue to feed paper properly through the duplexing portion of the printer. This preservative can accumulate on the surface of the roller if the duplexer is not used for extended periods of time. The accumulation may result in the light-brown stain on the "front" side of a duplexed page.

**Solution:** The problem will typically resolve itself after 10-50 pages have been run through the duplex portion of the printer. This process cleans the surface of the oblique roller. If you must replace the roller, prior to installing the new roller in the printer, be sure to rub the surface of the new roller with some clean paper to remove any excessive build-up of the preservative. Do **not** clean the roller with alcohol or other cleaning solutions. Doing so would remove the preservative altogether, leading to premature failure of the new roller.

If the oblique roller (RG1-1356-000CN) requires replacement, be sure to also check the inside portion of the white plastic alignment guide. Paper being run through the duplexer and forced into the side of the alignment guide can eventually wear a groove into the plastic. If a groove has developed, replace the entire lower duplex guide assembly (RG1-2498-000CN). If it is not replaced, subsequent duplex paper jams can result when paper gets caught in the groove. (Contrary to the implication in the service manual, note that the lower duplex guide assembly does **not** include the oblique paper alignment roller.)

## Misalignment of Duplexed Images

**Description:** Sometimes, a customer may notice that the images on the front and back of a duplexed page may not exactly align when held up to the light. This is most noticeable when printing on pre-printed forms or when the document has a border. The most prevalent reason for this misalignment is the process of fusing the toner into the page.

The first time paper passes through the fusing assembly, it is heated and almost all the moisture is removed. This causes the paper to shrink. Therefore, the physical size of the paper and the printed image are no longer the same when the second image is placed on the page. This results in the second image being slightly larger than the first.

The manufacturing tolerances for the registration of the paper also cause misalignment between the front and back images. The current registration specification for these printers is 4.2 mm (+/- 2.5 mm) from the leading edge of the paper to the first printed dot. Reducing this tolerance would increase the cost of the printer exponentially.

## Duplex Jamming: Duplex Drive Roller Assembly

**Associated Part Numbers:** RG1-1345-060CN

**Description:** The lower and upper duplex guide assemblies (figures 8-24 and 8-25 in the IID/IIID service manual) are used to properly position the paper left-to-right prior to its passing a second time through the printer. When this is performed, the leading edge of legal-sized paper may buckle slightly, causing it to dive between the lower duplex guide and the duplex drive roller assemblies (figures 8-24 and 8-26 in the IID/IIID service manual).

A clear plastic strip was attached to the drive assembly to prevent paper from diving into the gap between these assemblies. With use, a slight nick may develop in this plastic strip, leading to paper jams. If such a nick is the cause of a jamming problem, it can be felt with your fingernail.

**Solution:** This problem was fixed by extending the metal base of the duplex drive roller assembly, thus alleviating the need for the plastic strip. The part number of this new assembly is RG1-1345-060CN. If paper is jamming in the duplexer just prior to the duplex drive roller assembly, install a new assembly.

## Duplex Jamming: Misaligned Switchback Assembly

**Associated Part Numbers:** RA1-8420-000CN

**Description:** Another possible cause of paper jams in the duplexer is a misaligned switchback assembly (figure 8-16A/B in the *IID/IIID Service Manual*). This is often the result of using the switchback assembly as a handle while lifting the printer, or shipping the printer without the packing rods installed in the switchback assembly. The switchback assembly should never be used as a handle when the printer is being moved. If the printer needs to be transported, install the packing rods to properly support the switchback assembly. If the rods have been disposed of or misplaced, they can be ordered from HP Parts Direct (800) 227-8164, part number RA1-8420-000CN.

**Solution:** To properly realign the switchback assembly, loosen the mounting screws and re-position the assembly until the switchback frame is parallel with the output slot at the rear of the printer.

## Duplex Jamming: Worn Lower Duplex Guide Assembly

**Associated Part Numbers:** RG1-2498-000CN

**Description:** Some time after 60,000 pages have been printed (and depending upon the paper being used), a groove may develop in the white plastic guide in the lower duplex guide assembly (figure 8-24 in the *IID/IIID service manual*). The assembly is used to perform the left-to-right alignment of the paper during its pass through the duplexer. This guide can be best observed by removing the printer's cover panel just below the switchback assembly. If a groove has been cut into the plastic, paper will tend to hang up as it is dragged through the cut. If this failure occurs, replace the lower duplex guide assembly (RG1-2498-000CN).



## Jams in the Power Envelope Feeder

**Associated Part Numbers:** 33457A/33458A

**Description:** Proper envelope feeding is a difficult task for most printers. Jams and multiple feeds are the most common complaints. HP has done extensive testing with a wide variety of envelopes and has concluded that while many envelopes are suitable for use with these feeders, many others are not. Some envelopes will cause jams on the order of one in six, while others may not experience a single jam in a thousand!

Can HP recommend a specific envelope to use for diagnostic purposes? Unfortunately, it is not that simple. Envelopes within a particular region are manufactured by local converters. Though a specific envelope may perform well in one region, there is typically enough variance in the manufacturing process that the same brand of envelope may not be at all suitable for use in another region! If you encounter regular complaints from customers that their envelopes will not work properly with the HP envelope feeders, it might be well worth your time to test a variety of envelopes in your area so that you can make some worthwhile recommendations. This will also help you identify an envelope to use for diagnostic purposes when troubleshooting potential envelope feeder problems.

## Jams in the Power Envelope Feeder: 13 PAPER JAM Error Indication

**Associated Part Numbers:** RG1-0718-000CN (IID Paper Control PCA), RG1-2549-000CN (IIID Paper Control PCA)

The power envelope feeders use the Manual Feed Sensor (PS302) in the printer to determine whether an envelope has been fed correctly into the printer. If this sensor is faulty, a 13 PAPER JAM message will be displayed after the feeder has been installed and the printer is turned on. This is because the printer determines that an envelope is “jammed” in its input area.

To resolve this problem, replace the paper control PCA (figure 8-33 in the *LaserJet IID/IIID Service Manual*).

# 10 Image defects

## Overview

This chapter provides illustrations of image defects, lists suspected causes, and offers suggested remedies

### Using a Cleaning Page

For any print-quality defects, try using HP LaserJet Cleaning Utility to generate a cleaning page. The HP LaserJet Cleaning Utility is designed to remove excess paper and toner particles that can accumulate on the fusing assembly rollers. The buildup of toner/paper dust results in random spots on the front and back of the printout. Running the HP LaserJet Cleaning Utility at regular intervals can extend the useful life of the fuser and reduce service procedures. The HP LaserJet Cleaning Utility works on all HP monochrome printers, regardless of driver type.

To download the HP LaserJet Cleaning Utility file and obtain instructions on using it, access the HP website at [www.hp.com/cposupport/printers/software/lj123en.exe.html](http://www.hp.com/cposupport/printers/software/lj123en.exe.html).

# Image Defect Table

For more information, see the page numbers below each image.



**Blank Page**  
(see page 276)



**Black Page**  
(see page 278)




**Thin Dark Vertical  
Black Lines**  
(see page 279)



**Image Skew**  
(see page 280)



**Faulty  
Registration**  
(see page 282)



**Light Print/ Faded  
Print**  
(see page 284)




**Horizontal Lines/  
Repetitive Defect**  
(see page 286)



**Poor Fusing/  
Character Voids**  
(see page 287)




**Background  
Scatter**  
(see page 288)



**Back of Page Dirty**  
(see page 290)



**Thin Vertical  
White Lines/  
Stripes**  
(see page 291)




**Improperly Sized  
Image**  
(see page 292)




**Smudged Band  
with Overprint**  
(see page 293)



**Toner Smear on  
Right/Left Side**  
(see page 293)



**Vertical Fogged  
Stripes**  
(see page 294)




**Right/Left Text  
Missing/Distorted**  
(see page 295)



**Distortion**  
(see page 296)



**Bubble Print**  
(see page 296)



**Leading Edge  
Scatter**  
(see page 297)



**Dropout**  
(see page 298)




**Compressed Print**  
(see page 299)



**Portion of Page  
Blank**  
(see page 299)



**White Horizontal  
Line**  
(see page 300)



**Horizontal Fogged  
Stripes**  
(see page 300)



**Wavy Print**  
(see page 301)

# Blank Pages



## All Printers

- The toner cartridge is empty or defective.
- The sealing tape has been left in the toner cartridge.
- The high-voltage power supply (HVPS), contacts, or cable is bad.  
**LJ 4L and 4P:** The HVPS, AC power module, and the DC controller are all on the same board.
- The laser shutter arm or beam-to-drum mirror is broken.
- The transfer roller is defective.
- The direct-current (DC) controller is defective.
- Occasional blank pages are being printed.
  - Check the software, sharing device, or network settings. If the printer is feeding multiple pages, the paper may not meet HP specifications.
- There are multiple paper feeds.

## 2686A, 2686D

- The transfer corona wire is broken.

## **II, IID, III, IIID**

- The transfer corona wire or assembly is bad.
- The toner cartridge or HVPS connections are bad.
- The HV power supply cable is defective.
- The toner cartridge drum is not rotating.
  - Replace the toner cartridge and inspect the gears.
- The laser/scanner assembly or cable is bad.
- The hinge brackets of the top cover are bent.

## **IIP, IIP+, IIIP**

- The laser interlock tab of the toner cartridge is broken.
  - Replace the laser cover assembly (RG1-1773-000CN).
- The transfer roller assembly is defective.
- The HV PCA or HV contact cable is defective.

## **IIP Only**

- There is an error 41 and the serial number is between 2925J0000 and 3047J9999.
  - Replace the fusing assembly.

## **IIISi/4Si, 4, 4 Plus, 4L, 4P**

- The transfer roller assembly is defective.
- The HV PCA or HV contact cable is defective.
- The DC controller is defective

## Black Pages



### All Printers

- The toner cartridge is improperly installed or is defective.
- The HV contacts are dirty or the HV PCA is defective
  - Clean the HV contacts or replace the HV PCA.
- **LJ 4L and 4P:** The HVPS, AC power module, and DC controller are all on the same board.
- The DC controller is defective.
- The laser/scanner cable or assembly is defective.

### 5L, 5P, 6P, 6L

- Light is leaking into the printer

### IIP, IIP+, IIIP

- The fiber optics cable is defective.

### 4L, 4P, 4V

- Light is leaking into the printer.




## Thin, Dark, Vertical Black Lines



### All Printers

- The toner cartridge is defective.
  - Check for a thin scratch around the print drum. If present, replace the toner cartridge.
- The primary charging roller is dirty because of a defective cartridge.
  - Replace the cartridge.
- Paper does not meet HP specifications.
- The static eliminator teeth are contaminated or defective.
  - Clean the printer.
- The fuser cleaning pad or fusing assembly is defective.

# Image Skew



## All Printers

- The paper is loaded incorrectly.
- The media does not meet HP specifications.
- The rollers or separation pads are worn.

## 5Si

- The pickup and separation rollers are worn.
- The registration assembly is dirty or defective.
- The drive gears in the drive train assembly are defective.

## 5L

- The LC, PC, or MP pickup rollers are worn.
- The separation pad is worn.
- The LC or input feed roller is worn.
- The pickup, oblique, or registration roller is worn.
- The pickup or registration roller is worn.

## 5L, 5P, 6P, 6L

- The paper guides need to be adjusted.
- The separation pad and/or pickup roller are worn or dirty.

**2686A, 2686D**

- The leading edge of the paper is curled.
  - Replace with another ream of paper.
- The paper tray is defective.
- The laser/scanner unit is misaligned.
- The paper input door is misaligned
- The registration assembly is defective.

**II, IID, III, IIID**

- The paper and paper tray are not installed correctly.
- The feed roller assembly is worn.
- The registration assembly is defective.

**IIISi, 4Si**

- The registration assembly is dirty or defective.
  - Replace the separation pad.
- The drive gears in the drive train assembly are defective.
  - Replace the LC or the input feed roller.

**4, 4 Plus**

- The beam-to-drum mirror requires an adjustment.

**4L, 4P**

- The paper guides need to be adjusted.
- The fuser cleaning pad or fusing assembly is defective.

# Faulty Registration



## All Printers

- The media does not meet HP specifications.
- The paper is loaded incorrectly or the paper guides are not adjusted correctly.
- The leading edge of the paper is curled.
  - Replace with another ream of paper.
- The paper is overloaded.
- The feed rollers are worn.
- The registration assembly is dirty or defective.
- The drive gears are worn or broken.
- The input paper sensor is defective.

## 5L

- The first dot row of the page is not 2 mm (+/- 1 mm) from the leading edge of the page on engine test print.
  - A registration adjustment is required (VR202 on DC Controller).

## 5P, 6P

- The first dot row of the page is not 2 mm (+/- 0.5 mm) from the leading edge of the page.
  - A registration adjustment is required (VR301 on DC Controller).

## 2686A, 2686D

- The registration shutter assembly is sticking or defective. (The white nylon rollers should turn freely.)
  - Remove the rubber bumper on the shutter. If the problem persists, replace the registration shutter assembly.
- The paper tray is defective.
- The laser/scanner unit is misaligned.

## II, IID, III, IIID, IIISi, IVSi, 4V

- The feed roller assembly is worn.
  - The registration solenoid is stuck
- Replace the paper control PCA.
- The registration assembly is defective.
- The paper tray is defective.
- The input sensor is defective.

## IIP, IIP+, IIIP

- The first dot row of the page is not 3 mm (+/- 1 mm) from the leading edge of the page.
  - A registration adjustment is required (VR201 on DC Controller).
- The drive gears are worn or broken.
- The input paper sensor is defective (PS1).

## 4, 4 Plus

- The first dot row of the page is not 2 mm (+/- 1 mm) from the leading edge of the page on engine test print.
  - A registration adjustment is required (VR202 on DC Controller).
- The drive gears are worn or broken.
- The input paper sensor is defective (PS1).

## 4L, 4P

- The first dot row of the page is not 2 mm (+/- 0.5 mm) from the leading edge of the page.
  - A registration adjustment is required (VR301 on DC Controller).
- Drive gears are worn or broken.
- Pickup, oblique, or registration rollers are worn.

## Light Print/Faded Print



### All Printers

- The media does not meet HP specifications.
- The toner cartridge is low on toner or empty.
- The print density is improperly set.
- EconoMode is turned on.
- The transfer roller is defective.
- The HV PCA or HV contact assembly is defective.
- The DC controller is defective.

### 2686A, 2686D

- The transfer corona assembly is defective.
- The laser power is low.
  - Adjust the laser power; replace if necessary.
- The HV power supply is defective.
- The DC controller PCA is defective.
- The drum sensitivity microswitch (MS3, MS4) is faulty.
  - Replace MS3, MS.

## **II, IID, III, IIID**

- The transfer corona assembly is defective.
- The HV power supply or cable is defective.

## **IIP, IIP, IIIP, IIISi, 4Si**

- The transfer roller is defective.
- The HV PCA or HV contact assembly is defective.
- The DC controller is defective.

## **4, 4 Plus, 4L, 4P, 4V**

- EconoMode is on.
- The transfer roller is defective.
- The HV PCA or HV contact assembly is defective.
- The DC controller is defective.





## Poor Fusing/Character Voids



### All Printers

- The media does not meet HP specifications.
- The transparencies are defective.
- Printing is on the wrong side of the paper.
- The fuser is defective.
  - Replace the fuser.
- The transfer roller is defective.
- The HVPS or DC controller is defective.

### 2686A, 2686D

- The fuser cleaning pad is improperly installed.

### II, IID, III, IIID

- The print density is set improperly.  
Set to "9" to minimize voids.
- Cover the interlock switch on the DC controller.
  - The switch is not present on all DC controllers (see Service Note 33449A-04, 33459A-02).
- The fuser cleaning pad is dry (non-HP).
  - Replace the cleaning pad.

# Background Scatter



## All Printers

- The print density is set improperly.
  - Adjust the print density to a darker setting.
- The toner cartridge is defective.
- Media does not meet HP specifications.
- The paper may be wet or too dry.
  - Optimum humidity should be between 40 and 60 percent.
- The inside of the printer is dirty.
- The transfer roller or corona is dirty or defective.

## 5Si

- Toner buildup has occurred in the fuser inlet guide.
  - Clean the fuser inlet guide.

## 5L/6L

- Printing is on the envelope seams.
  - Switch envelopes or move text to an area with no seams.
- Printing is on the wrong side of paper.
  - Turn the paper over. In the future, check to see if the ream label indicates the proper print side.
- The density or grayscale settings need to be adjusted.
  - Change the software density or grayscale settings to minimize the scatter effect.
- The entire background of the page is dark.
  - Clean the high-voltage contact points on the toner cartridge and transfer roller. If the error persists, first replace the laser/scanner unit, and then replace the DC controller.


## 2686A, 2686D

- The grounding spring is set improperly.
  - Adjust to the center of the drum drive gear.
- The laser power is out of adjustment.
- The HV power supply is defective.
- The DC controller PCA is defective.
- The DCPS/main motor driver PCA is defective.

## II, IID, III, IIID

- The primary corona wire is dirty.
  - Replace the toner cartridge.
- The transfer corona is dirty or worn.

## Back of Page Dirty



### All Printers

- Toner has leaked from the toner cartridge.
  - Replace the toner cartridge.
- The inside of the printer is dirty.
- The transfer roller is dirty.
- The feed rollers are dirty.
- The fuser is contaminated.

### 2686A, 2686D, II, IID, III, IIID

- The fuser cleaning pad is dirty.

### II, III Only

- The corona wire is stuck “on.”
  - Use the test tool to verify (see chapter 4). Replace the cable HV power supply to the DC controller (P/N RG1-0906-000CN).

### IIP, IIP, IIIP, IIISi, 4Si, 4, 4 Plus, 4L, 4P

- The input feed roller is dirty.
- There is toner build-up in the fuser assembly.
  - Use cleaning paper to clean the rollers. If needed, clean the thermostats (TS1 & TS2). Note: To create cleaning paper, print a self-test page.

## Thin Vertical White Lines/Stripes



### All Printers

- The toner cartridge is defective or nearly empty.
  - Gently shake the toner cartridge and reseal. If the error persists, replace the toner cartridge.
- Foreign obstacles are in the path of the laser beam.
  - Check the laser beam shutter.
- The printer needs to be cleaned.

### 5Si/5

- The focusing lenses in the scanner assembly may be dirty.
- The beam-to-drum mirror is contaminated.

### 2686A, 2686D

- The fuser cleaning pad is dirty.
- The transfer corona wire is dirty.
- The laser/scanner assembly is defective.

### II, IID, III, IIID

- The transfer corona is dirty or worn.
- The beam-to-drum mirror is dirty.
- The laser/scanner assembly is defective.


### III Si, 4 Si

- The focusing lenses in the scanner assembly may be dirty.

### 4, 4 Plus, 4L, 4P

- The beam-to-drum mirror is contaminated.

## Improperly Sized Image



### All Printers

- Check the microswitches in the paper tray.
- The paper size specified in the software does not match the actual paper size.

## Smudged Band with Overprint



### All Printers

- The gear train assembly in the main motor is not engaging with the toner cartridge drum gears.
  - Replace the gear train and/or main motor assembly.
- The fusing assembly is dirty or defective.
- The static teeth are dirty.
- The toner cartridge is defective.

## Toner Smear on Right or Left Side of Page



10

### 2686A, 2686D

- The separation belt, separation roller or pinch roller is dirty.
- The toner cartridge is defective.

### II, IID, IIID

- The primary corona wire in the toner cartridge is dirty.

## Vertical Fogged Stripes



### **2686A, 2686D**

- The conductive surface of the guide is worn, causing static charge.
  - The feed guide assembly (P/N RG1-1039-000CN) is defective.
- The primary corona wire is dirty.
- The toner cartridge is defective.
- The inside of the printer is dirty.

### **IIP, IIP, IIIP**


- The media does not meet HP specifications.
- The fusing assembly is dirty or defective.
  - Use a self-test cleaning page to clean the fusing assembly, or replace the fusing assembly.

### **4, 4 Plus, 4V**

- The media does not meet HP specifications.
- The fusing assembly is dirty or defective.
- The DC controller is defective.
- The static teeth are bent.



## Right or Left Hand Text Missing/Distorted



### All Printers

- A foreign object is in the path of the laser beam.

### II, IID, III, IIID

- The toner cartridge is empty.
- The instruction label on the beam mirror shutter has come loose.
- The beam-to-drum mirror is bent or misaligned.
- The hinge brackets of the top cover assembly are bent.

## Distortion



### All Printers

- The toner cartridge is defective.
- The gear train is damaged.

### 2686A, 2686D

- There is a problem with the paper drive.
  - Check all parts of the drive mechanism, gear train, and motor.
- The main motor is defective.
- The DC power supply/main motor driver PCA is defective.

## Bubble Print




### All Printers

- The print density dial is not aligned properly with the HVPS.
  - Reseat the HV power supply PCA.

- The photosensitive drum inside the toner cartridge is not grounded.
  - Reseat the toner cartridge. Replace the toner cartridge. Reseat the HVPS. Replace the HVPS.
- The fuser is defective.
- The toner cartridge is leaking.
- Paper does not meet HP specifications.
- The HVPS is defective.

## Leading Edge Scatter



### All Printers

- The media does not meet HP specifications; a single sheet of paper may be defective.

# Dropout



## All Printers

- The fuser inlet guide is set improperly.
  - Replace the fuser inlet guide (see chapter 6 in the service manual).
- Paper is defective, improperly loaded, or does not meet HP specifications.
- The HVPS or transfer roller/wire is defective.

## 5L/6L

- The print density requires adjustment.
  - Adjust the print density through the software.
- The rollers and high-voltage contact points require cleaning.
- Blank spots appear on the page.
  - Replace the toner cartridge. If the spots persist, first replace the transfer roller, and then replace the DC controller.

## Compressed Print



### All Printers

- The toner cartridge is defective.
- The drive gear in the drum is broken or worn.

### IIP, IIP+, IIIP

- The gear assembly of the drum drive is defective.

## Portion of Page Blank



### All Printers

- The page is too complex.
  - Reduce the complexity of the page or set Page Protect to On or Auto.
- There is not enough memory.
- The printer is printing on legal paper, but the setting in the software is letter-size paper.


## White Horizontal Line



**5L/6L**

- The toner cartridge is defective.

## Horizontal Fogged Stripes



**III, II**

- The laser scanner cable is defective.
- The toner cartridge is damaged.
  - Replace the toner cartridge and HV cable.

**2686A, 2686D**

- The toner cartridge is defective.
- The HV PCA is defective.
- The ground contact to the toner cartridge is defective.

# Wavy Print



## All Printers

- The scanner unit is defective.

## IIID, III, IID, II


- The laser scanner assembly is defective.
- The laser scanner cable is defective.

## 2686D, 2686A

- The DC controller PCA is defective.


# Repetitive Image Defect Ruler LJ 6L/5L

Use the ruler shown below to measure the approximate distances between repetitive image defects.

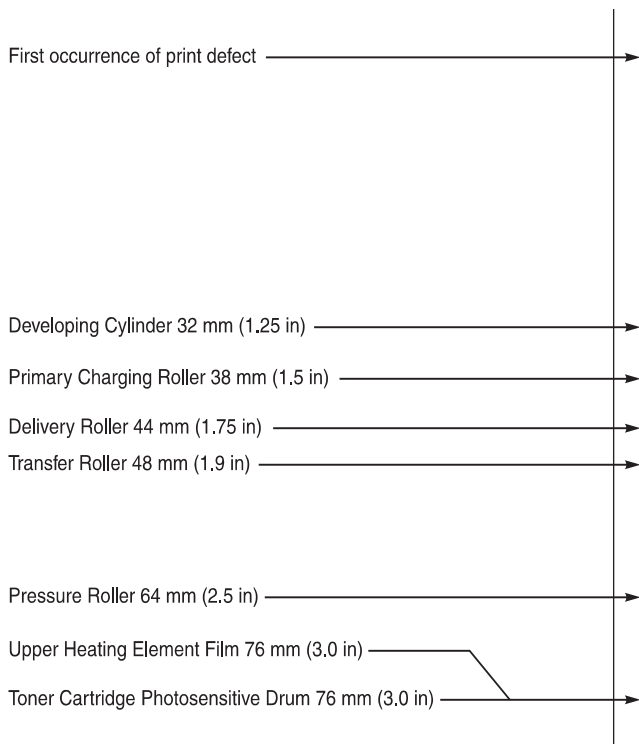




# Repetitive Image Defect Ruler LJ 5Si

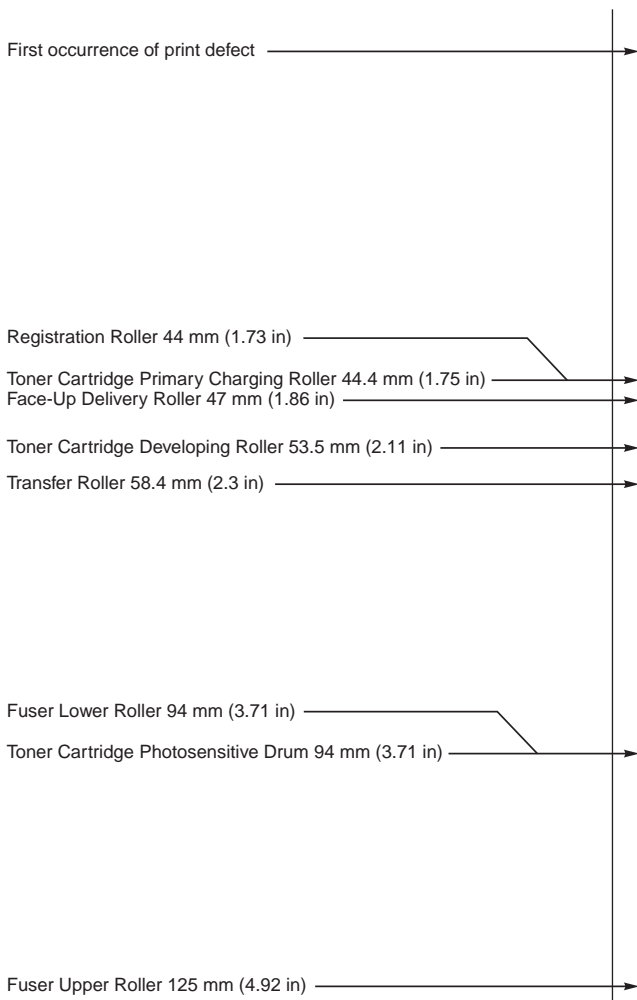


# Repetitive Image Defect Ruler LJ 6P/5P

Use the ruler shown below to measure the approximate distances between repetitive image defects.

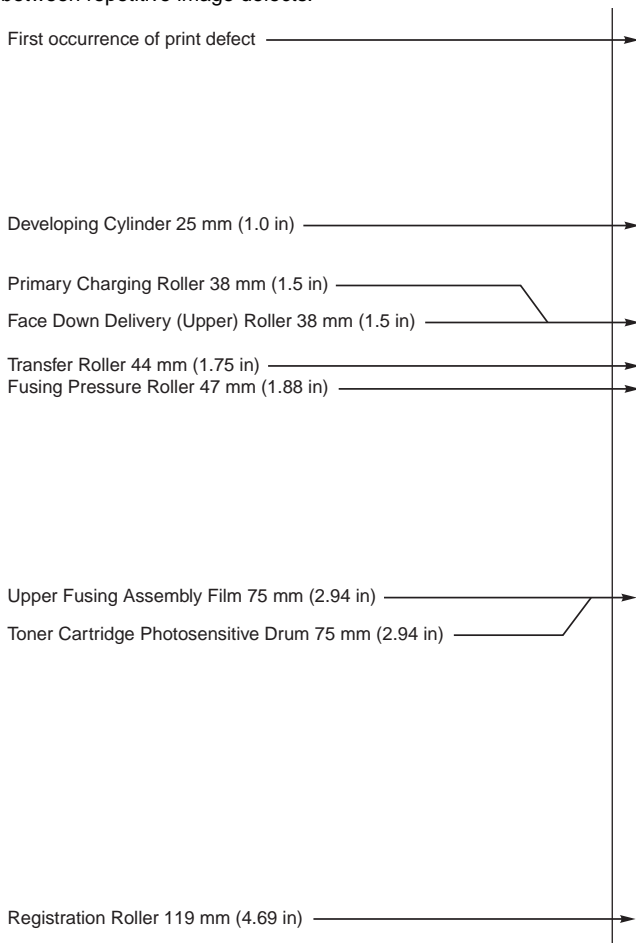


# Repetitive Image Defect Ruler LJ 5

Use the ruler shown below to measure the approximate distances between repetitive image defects.

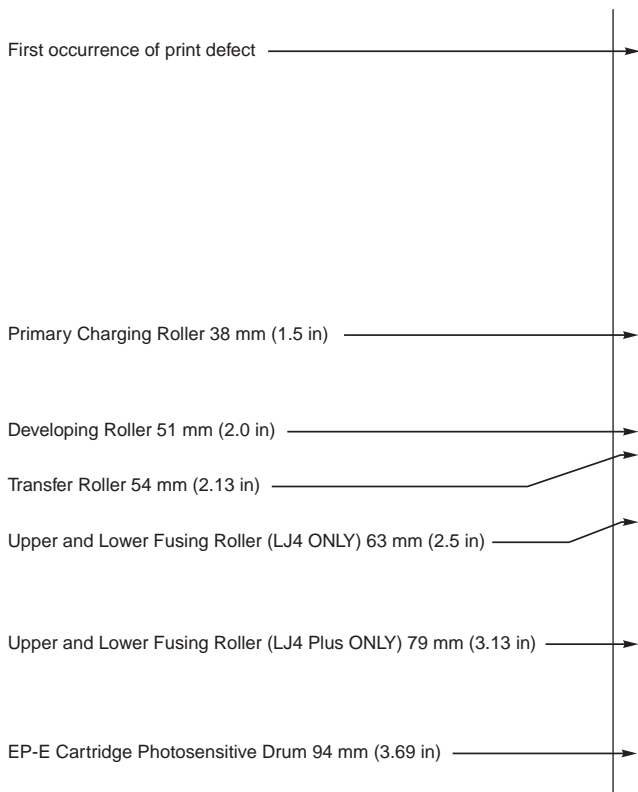


# Repetitive Image Defect Ruler LJ 4V

Use the ruler shown below to measure the approximate distances between repetitive image defects.

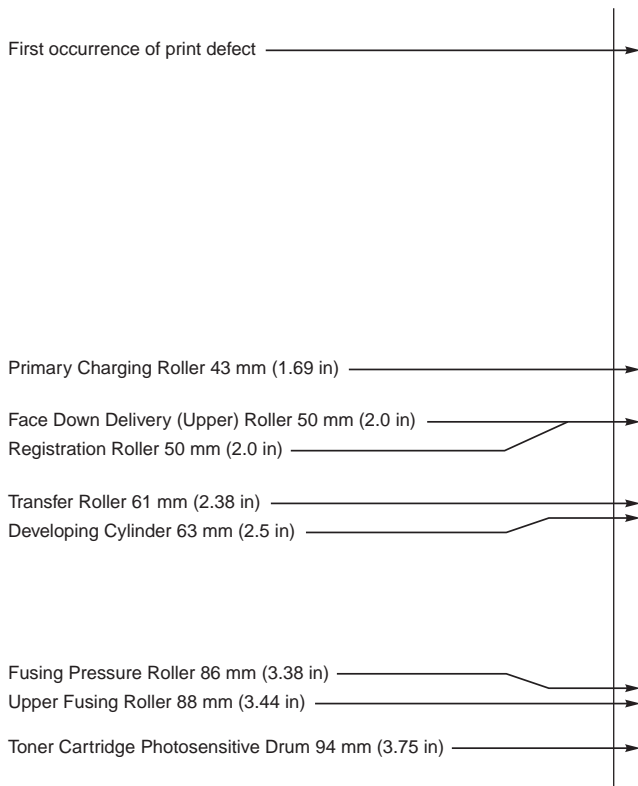


# Repetitive Image Defect Ruler LJ 4P, 4L

Use the ruler shown below to measure the approximate distances between repetitive image defects.

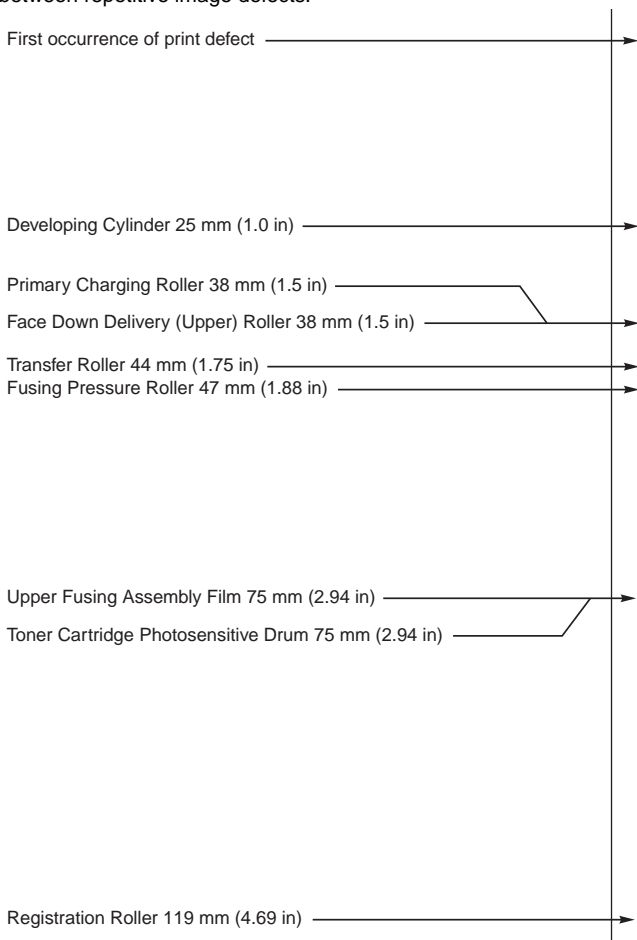


# Repetitive Image Defect Ruler LJ 4+, 4

Use the ruler shown below to measure the approximate distances between repetitive image defects.

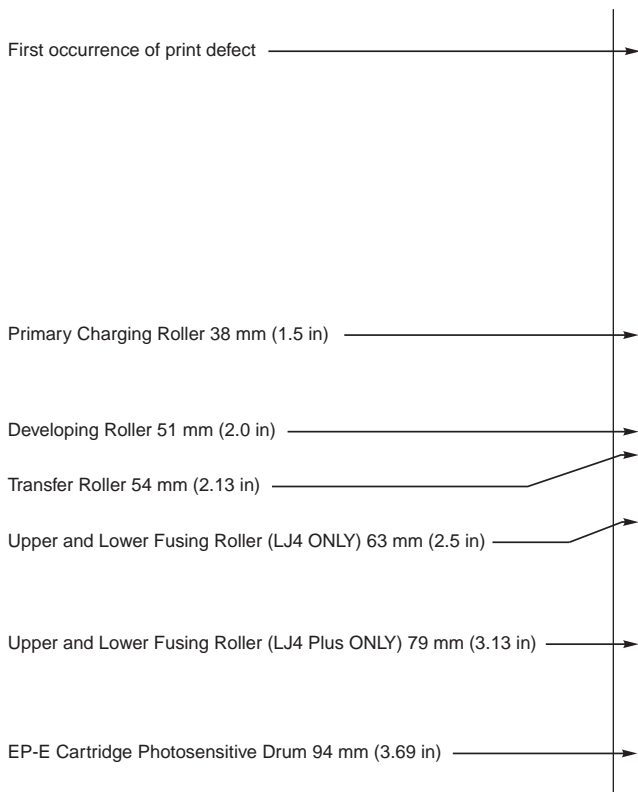


# Repetitive Image Defect Ruler LJ 4Si, IISi

Use the ruler shown below to measure the approximate distances between repetitive image defects.

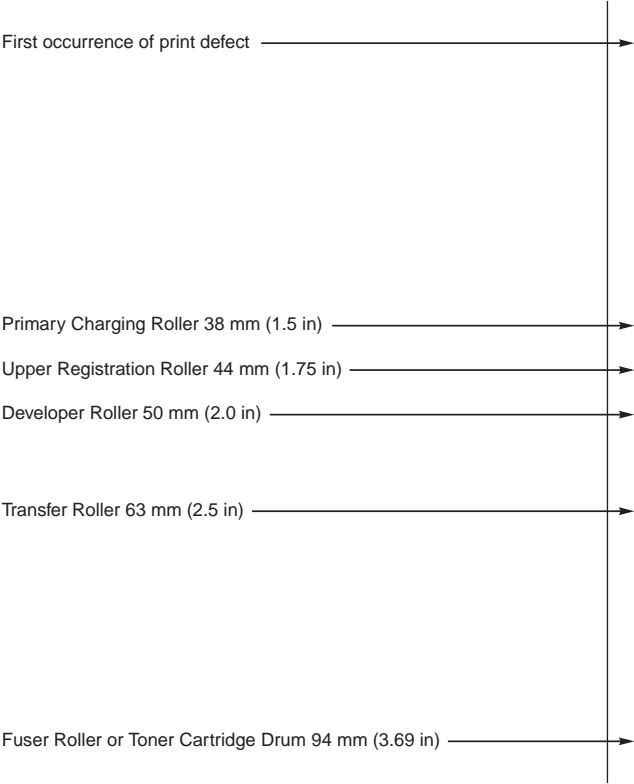

# Repetitive Image Defect Ruler IIP, IIP+, IIP


Use the ruler shown below to measure the approximate distances between repetitive image defects.

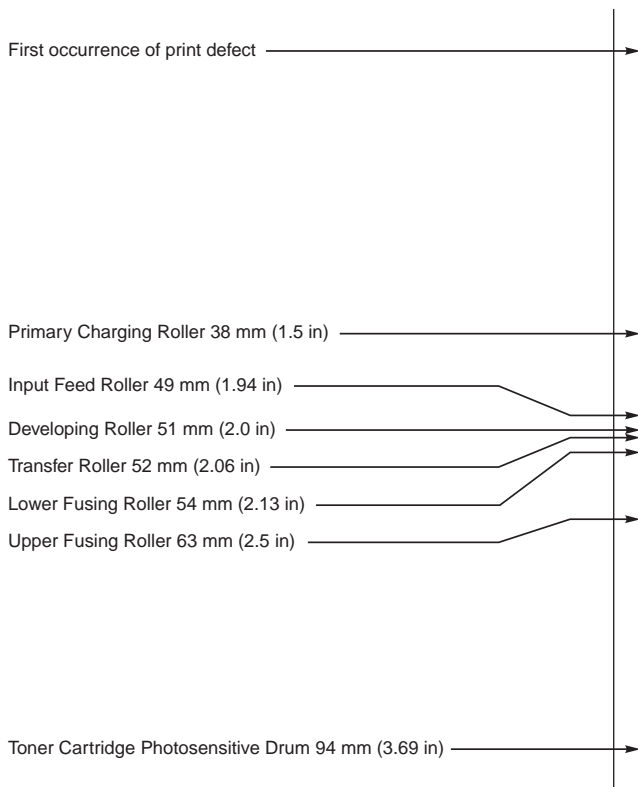



# Repetitive Image Defect Ruler IID, III, IID, II

Use the ruler shown below to measure the approximate distances between repetitive image defects.

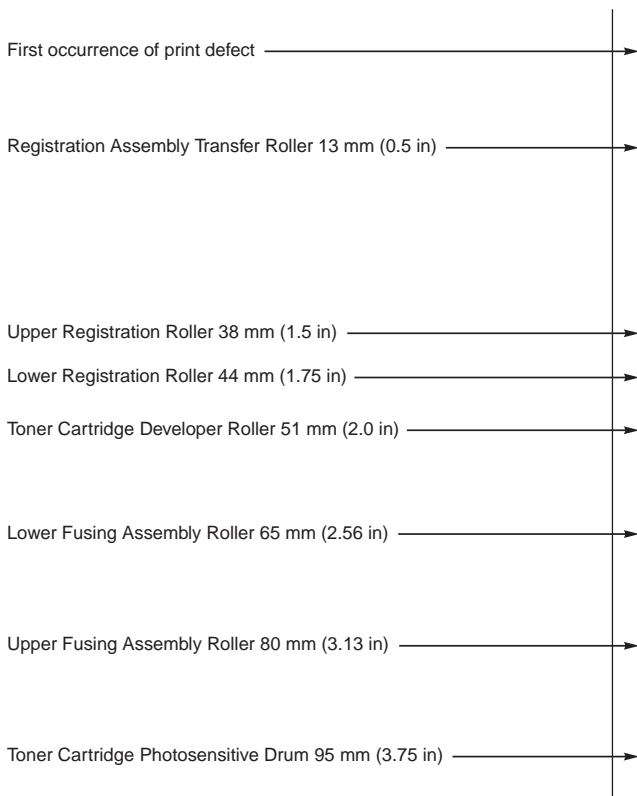



# 11 Wiring diagrams

## Overview

The chapter provides wiring diagrams for printers supported in this guide.

## 314 – Wiring diagrams



**Figure 11-2**      **Wiring Diagram: HP LaserJet 5Si (1 of 5)**


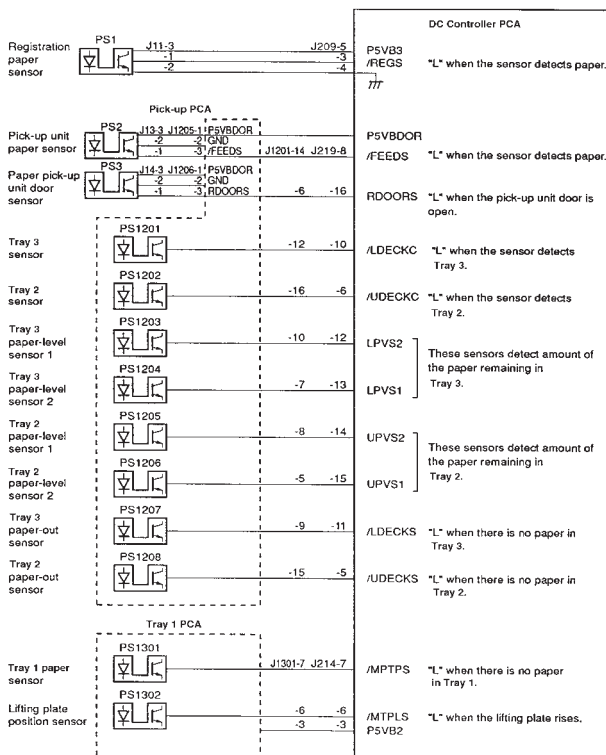


Figure 11-3 Wiring Diagram: HP LaserJet 5Si (2 of 5)

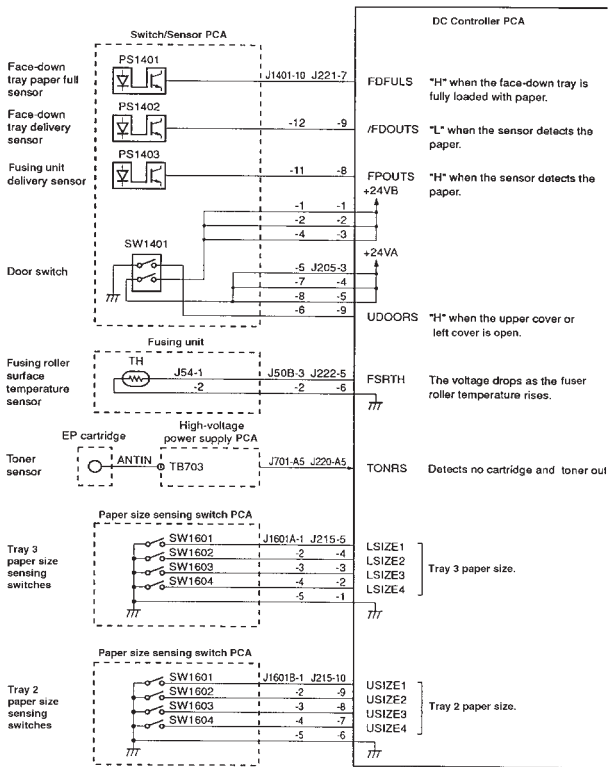

**Figure 11-4 Wiring Diagram: HP LaserJet 5Si (3 of 5)**



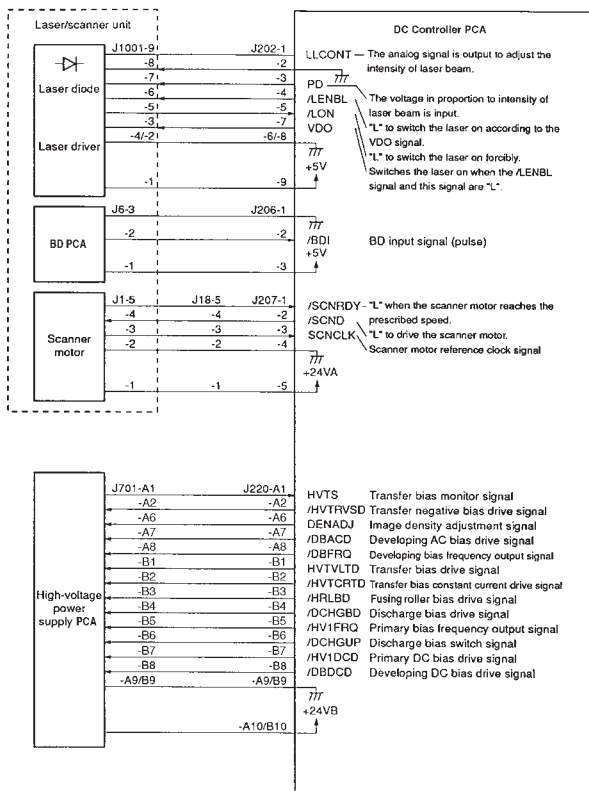


Figure 11-5 Wiring Diagram: HP LaserJet 5Si (4 of 5)



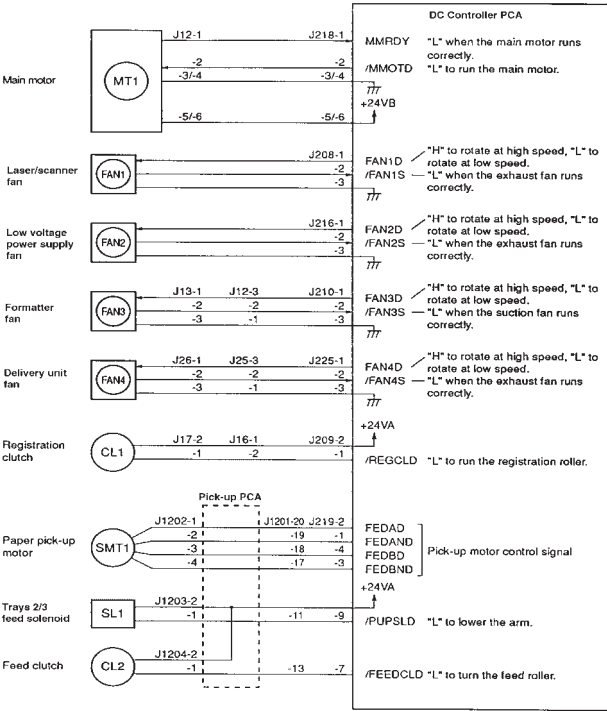

**Figure 11-6 Wiring Diagram: HP LaserJet 5Si (5 of 5)**

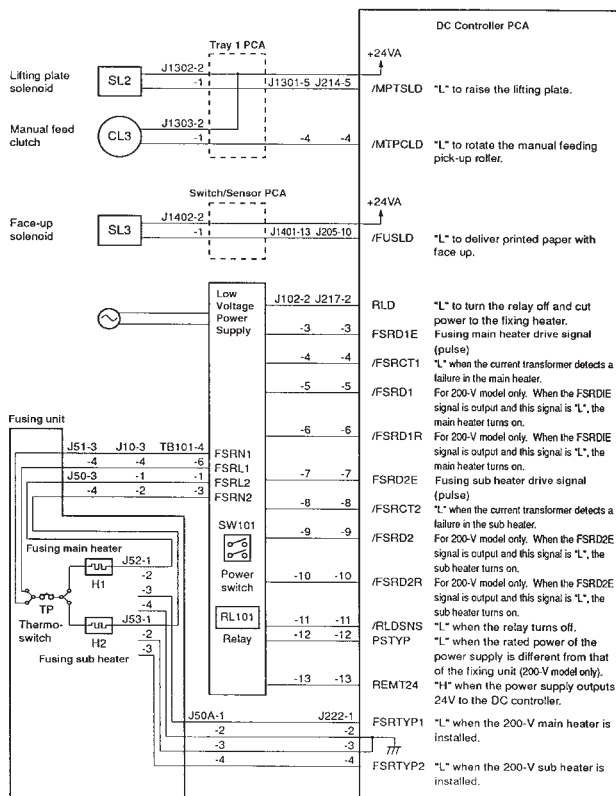

**Figure 11-7 Main Wiring Diagram: HP LaserJet 5P**

## Main Wiring Diagram



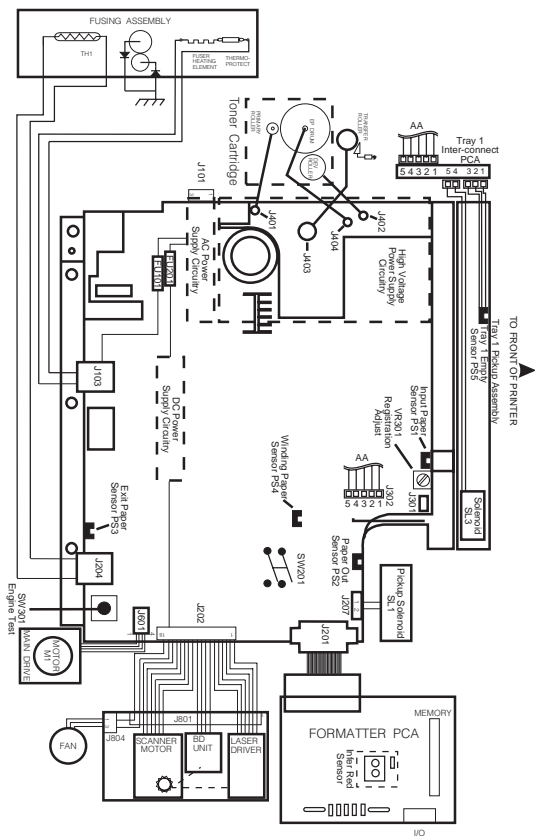


Figure 11-8 Main Wiring Diagram: HP LaserJet 5

PRINTER WIRING DIAGRAM, LaserJet 4 Plus / 5

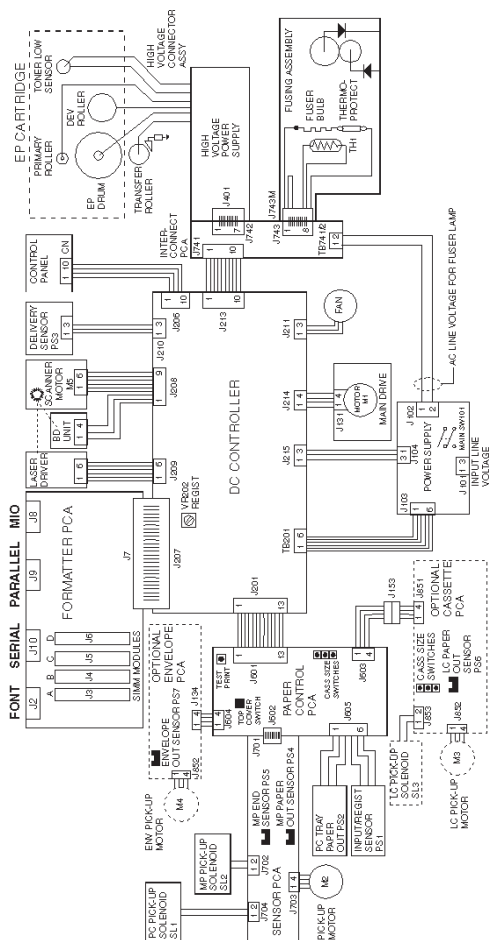

**Figure 11-9 Main Wiring Diagram: HP LaserJet 4V (1 of 2)**

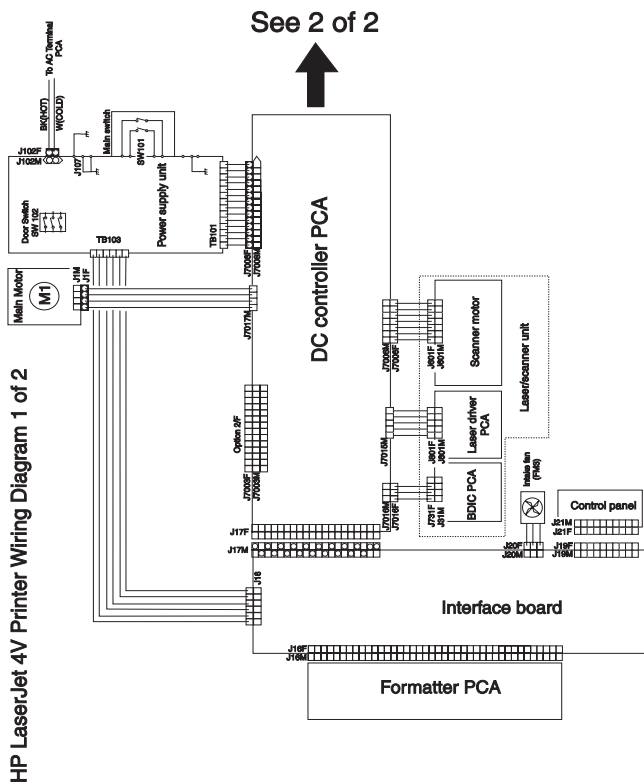

11



**See 1 of 2**



**Figure 11-12 Main Wiring Diagram: HP LaserJet 4P/4MP, 4L/4ML**


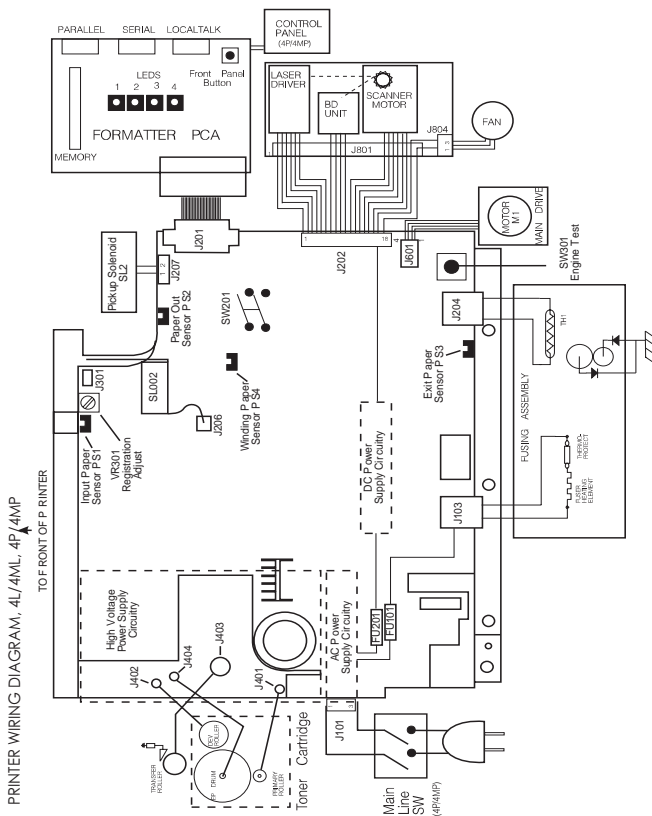



Figure 11-13 Main Wiring Diagram: HP LaserJet 4

PRINTER WIRING DIAGRAM, LaserJet 4




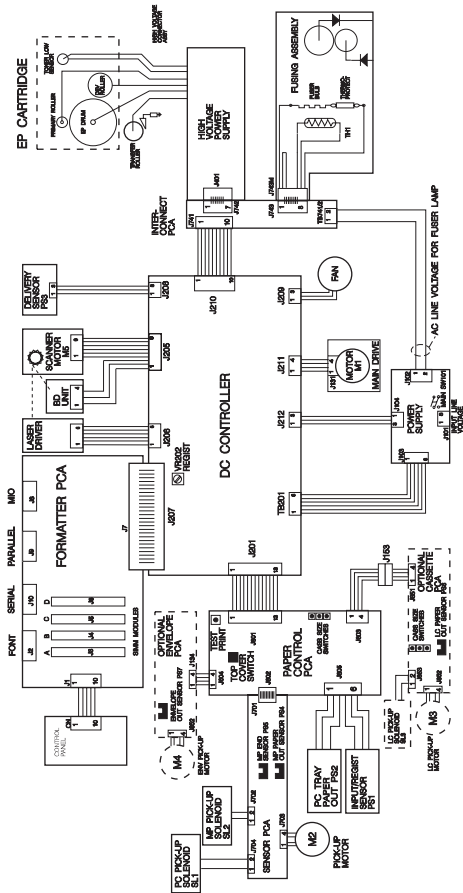


**Figure 11-14 Main Wiring Diagram: HP LaserJet 4Si, IIISi (1 of 3)**

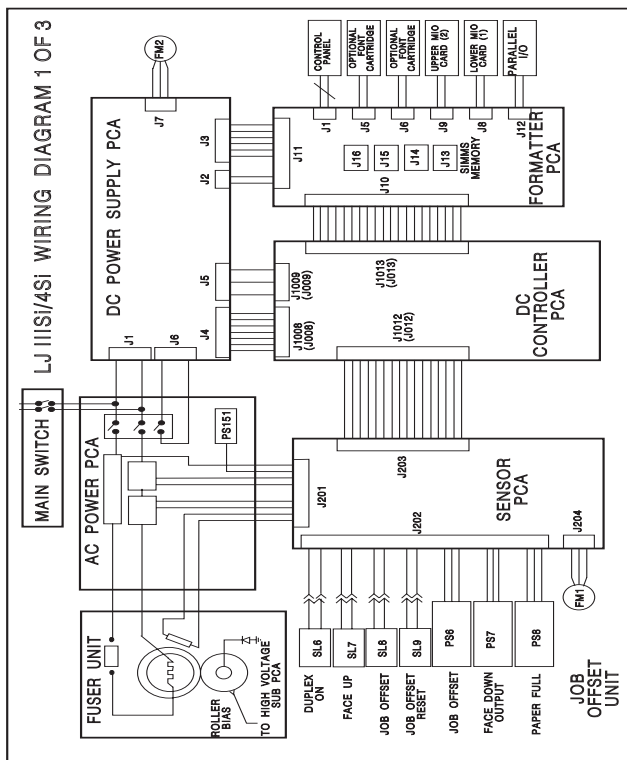

**Figure 11-15 Main Wiring Diagram: HP LaserJet 4Si, IIIiSi (2 of 3)**

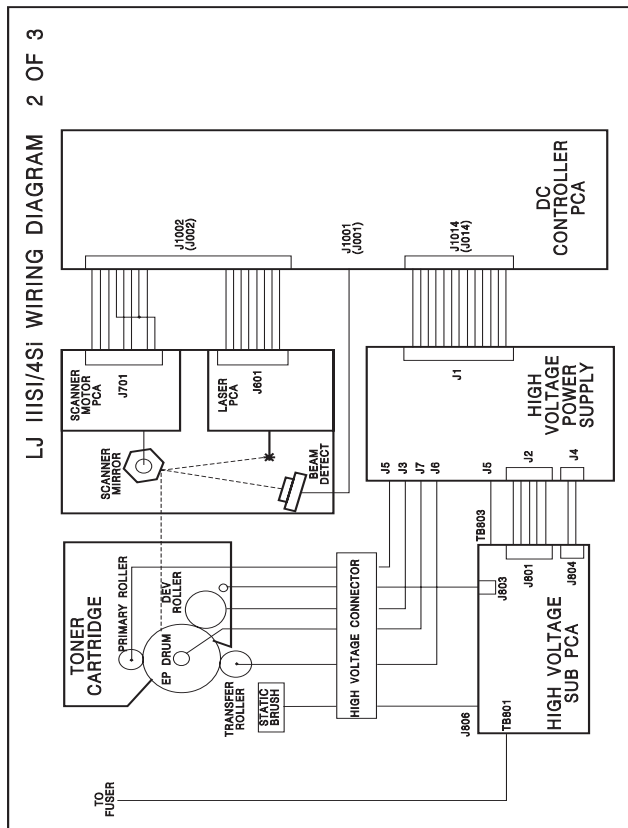


**Figure 11-16 Main Wiring Diagram: HP LaserJet 4Si, IIISi (3 of 3)**

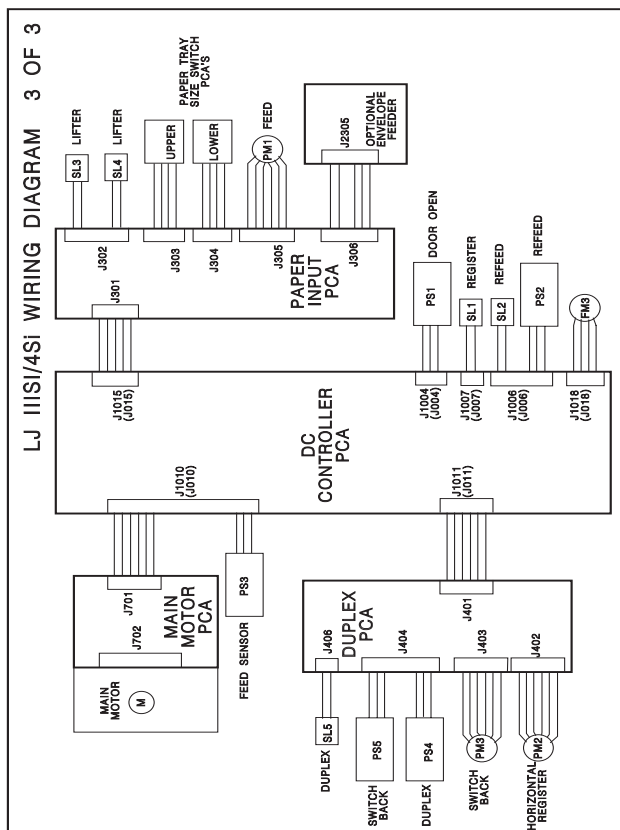






**Figure 11-19 Main Wiring Diagram: HP LaserJet III, II**

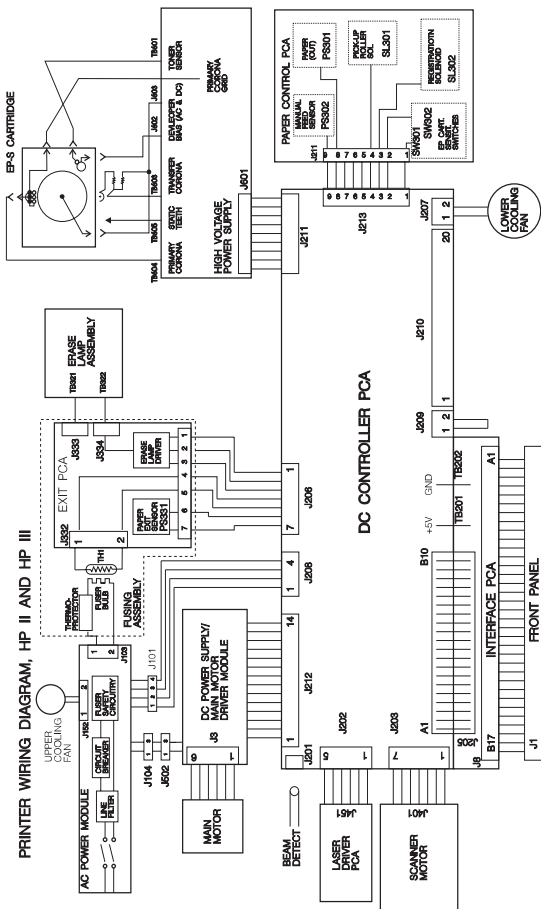

**Figure 11-20 Main Wiring Diagram: HP 2686D, 2686A**

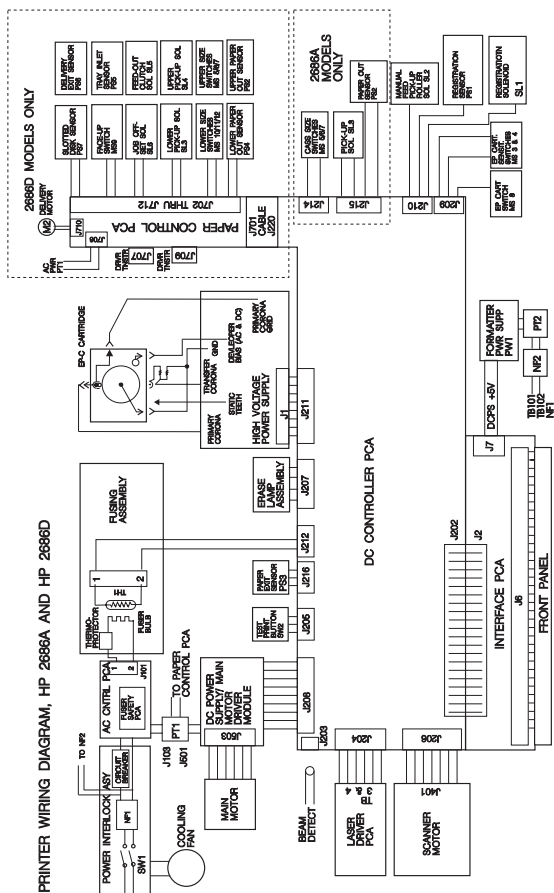





# 12 Services, support, and training

## Overview

This chapter provides information on obtaining training, support, and materials.

# How to Get Training

## Lecture/Lab Training (U.S. Only)

Service technicians who want individual, hands-on training can attend regularly scheduled lecture/lab training classes. These classes are offered throughout the country. To receive the latest schedule, call HP FIRST at (800) 333-1917, or see the HP website ([www.hp.com/go/resellertraining](http://www.hp.com/go/resellertraining)) and request document ID number 9104. The latest schedule will immediately be sent to the fax number of your choice. Class schedule and registration information can also be obtained by calling the centralized registration center at (512) 434-1520.

## Self-Paced Training Kits

Product	Description	Part Number
All LaserJet Printers	Basic Hardware Training Course (prerequisite for all LaserJet service training) Paper Specifications for LaserJet Printers	5961-0880  5961-0711 (NTSC) 5961-0712 (PAL)
LJ 5	Self-paced Training Kit NTSC Format PAL Format	C3916A+49A-61 C3916A+49A-62
LJ 5P/6P	Self-paced Training Kit NTSC Format PAL Format	C3980A+49A-60001 C3980A+49A-60002

## Self-Paced Training Kits (continued)

Product	Description	Part Number
LJ 5L/6L	Self-paced Training Kit NTSC Format PAL Format	C3990+49A-60001 C3990+49A-60002
LJ 5Si/5Si Mopier	Self-paced Training Kit NTSC Format PAL Format	C4076-61101 C4076-61102
5P/6P	Self-paced Training Kit NTSC Format PAL Format	C3980-61101 C3980-61102
LJII and III	Self-paced Training Kit	33449A + 49A-0
LJ IID and IIID	Self-paced Training Kit	33459A + 49A-0
LJ IIP, IIIP, and IIIP Plus	Self-paced Training Kit	33481A + 49A-00
LJ 4 and 4 Plus	Self-paced Training Kit NTSC Format PAL Format	C3916-67903 C3916-67904
LJ 4L/4P	Self-paced Training Kit NTSC Format PAL Format	C3980-61101 C3980-61102
LJ IIISi and 4Si	Self-paced Training Kit NTSC Format PAL Format	C2009A + 49A-61 C2900A + 49A-62
LJ 4V	Self-paced Training Kit NTSC Format PAL Format	C314XA + 49A-61 C3141-67903 C3141-67901

# Support Resources

## North American Response Center (NARC)

The North American Response Center (NARC) provides technical support to service technicians. Reach the NARC at (800) 544-9976.

## Other Areas

Outside of North America and Europe, contact your local HP sales office for assistance in obtaining technical support.

## HP FIRST Fax System

HP FIRST (Fax Information Retrieval Support Technology) is a phone-in fax service that provides technical information to HP LaserJet users as well as to service personnel. Receiving a fax requires a group-3 facsimile machine or fax card. Service-related information includes the following:

- Service notes (HP Authorized dealers)
- Application notes
- Product Data Sheets
- Material Safety Data Sheets (MSDS)
- Typeface and accessory information
- Printer support software information
- Toner information
- Forms for requesting drivers and the Software Matrix

# To retrieve Service Notes

(Authorized dealers, HP CEs ONLY):

- 1 Dial (1) (800) 333-1917 from any touch-tone phone.
- 2 Select (1) for HP FIRST.
- 3 Select (3) for a password customer.
- 4 Enter the password: 737842.
- 5 Follow the voice prompts to enter a document ID number or to select the index.
- 6 Follow the voice prompts to enter your fax number or the fax number of your customer.

## Note

Delivery time depends on the length and complexity of the document.

## HP FIRST, U.S.

Call the HP ASAP system at (800) 333-1917 and follow the voice prompts to enter HP FIRST.

## HP FIRST, Europe

Call HP FIRST at one of the following numbers:

United Kingdom	(44) (134) 0800-960271
Netherlands	(31) (20) 0800-222420
Belgium (Dutch)	(32) (2) 0800-11906
Germany	(49) (13) 081-0061
Switzerland (German)	(41) (1) 0800-551527
Austria	(43) (1) 0660-8128

For English service outside the countries listed above, call (31) 20-681-5792.

# HP End-User Support Options

## Local Support Assistance

The user's first source of assistance should be the local dealer or service center. HP continuously provides local computer dealers and service centers with the latest information regarding products and services. To locate the nearest authorized dealer or service center, phone (800) 243-9816 (U.S.) or (800) 387-3867 (Canada).

## 24-Hour Support Information

Phone (800) 333-1917 to access the HP ASAP system for 24-hour automated support services. User support information includes notes for common software applications and troubleshooting tips. Users may request up to three documents per call.

## Electronic Information Services

For 24-hour access to information via modem, we suggest:

- **CompuServe**- The CompuServe HP Peripherals forum (GO HPPER) provides printer drivers and interactive sharing of technical communication. To subscribe, call CompuServe, Inc. at (800) 524-3388. **Note:** CompuServe is not an official HP support channel, but the forum is maintained and supported by users.
- **Internet** - Printer drivers and product and support information can be obtained from the HP anonymous file transfer protocol (FTP) site 192.6.71.2 or <ftp-boi.external.hp.com>. The site is available to anyone with FTP access to the Internet. Access through the World Wide Web is available at URL <http://www.hp.com/>.

## Printer Drivers by Mail

To obtain printer drivers, contact the software application manufacturer. HP distributes printer drivers for a few of the most popular applications. Call (970) 339-7009, 6 days a week, 24 hours a day (closed Sundays). Shipping and handling charges may apply on some printer drivers.

## Telephone Assistance - In Warranty

Call (1) (208) 323-2551 Monday through Friday from 6 am to 10 pm, Saturday 9 am to 4 pm (Mountain Time) free of charge during the warranty period. However, your standard long-distance phone charges still apply. Have your system nearby and your serial number ready when calling.

## Telephone Assistance - Post-Warranty

Post-warranty telephone assistance is available to answer your product usage questions. Call (1) (900) 555-1500 (\$2.50 per minute, U.S. only) or call 1-800-999-1148 (\$25 per call, Visa or MasterCard, U.S. and Canada) Monday through Friday from 7 am to 6 pm and Saturday from 9 am to 3 pm (Mountain Time). *Charges begin only when you connect with a support technician. \*Prices subject to change.*

## Hardware Repair Services

To find a local authorized repair center for hardware repair needs, call (800) 243-9816. HP also offers a variety of service contract options to complement the standard warranty. Call (800) 743-8308 (U.S.) or (800) 268-1221 (Canada).





# 13 Hewlett-Packard LaserJet Companion

## Overview

This section provides information on the LaserJet 300 DPI page scanner, which is available in three models.

# Hewlett-Packard LaserJet Companion

The HP LaserJet Companion includes the following models:

- C3989A Companion
- C3079A Companion SE
- C4106A Companion XI

(Except for minor differences in software, these are the same product.)

## Description

The HP LaserJet Companion is a 300-DPI page scanner, parallel port pass-through accessory designed for Hewlett-Packard LaserJet 4, 5, and 6 series printers.

## Warranty

The HP LaserJet Companion comes with a 1-year warranty, offering Central Repair only (no dealer repairs); Express Exchange (U.S. and Canada); and Repair and Return (Worldwide).

## Supported Media

- The following media sizes are supported:

Maximum: 216 mm x 762 mm (8.5 by 30 inches)

Minimum: 51 mm x 89 mm (2 by 3.5 inches)

- The following media weights are supported:  
60 to 105 g/m<sup>2</sup> (16 lb to 28 lb)

## Skew Specifications

Some skew is normal. The maximum amount of skew that is considered normal is 3.35 millimeters (0.13 inches) over 279 millimeters (11 inches). Skew exceeding the normal amount may be caused by media that is damaged, media that does not meet the specifications, or media that is loaded incorrectly.

If media meets specifications, is not damaged, and is correctly loaded, but skew remains excessive, clean the separation pad, pickup roller, and scan roller.

## Cleaning

Clean these parts with isopropyl alcohol:

- separation pad
- pickup roller
- the white scan roller

Clean the image sensor with glass cleaner.

## Cables

HP Part Number	Part Description
8120-6963	Cable shipped with the HP LaserJet Companion
C2950A	Printer parallel cable
C2951A	Printer parallel cable

## Power Supply Modules

Output = 22 V DC, + or - 25%

HP Part Number	Part Description
9100-5534	120 Vac 60 Hz (U.S./CN/MX)
9100-5535	230 Vac 50 Hz (EUROPE)
9100-5536	240 Vac 50 Hz (U.K.)
9100-5537	220 Vac 50 Hz (ARG)
9100-5539	240 Vac 50 Hz (AUSTRL)
9100-5541	220 Vac 50 Hz (TI/INDO)
9100-5542	220 Vac 50 Hz (HNG KNG)

# Appendix

## Acronyms and Abbreviations

AC	Alternating current
AUTOCONT	Automatic continue
BNC	A 10-Base 2 connector used with coaxial cables
CFG	Configuration on control panel
DC	Direct current
DCPS	Direct current power supply
MS-DOS	Disk operating system
DPI	Dots per inch
DTR	Data terminal ready
DTR LINE	Data terminal ready line
EP	Electro-photographic
EPH	External paper handling
FRU	Field replacement unit
FTP	File transfer protocol
HP FIRST	Hewlett-Packard Fax information retrieval support technology
HP-GL/2	Hewlett-Packard graphics language
HTML	Hypertext markup language
HV	High voltage

HVPS	High-voltage power supply
I/O	Input/output
IR	Infrared
IrDA	Infrared Data Association
IRQ	Interrupt request
JEIDA	A type of memory module
JOBID	Print job identification
JP	Jobpack
LAN	Local area network
LED	Light-emitting diode
LVPS	Low-voltage power supply
LC PICKUP ROLLER	Lower-cassette pickup roller
MB	Megabyte
MEM	Memory
MIO	Modular input/output
MP PICKUP ROLLER	Multipurpose tray pickup roller
MP Tray	Multipurpose tray
MSDS	Material safety data sheets
NARC	North American Response Center
NTSC	National Television Standard Committee
NVRAM	Nonvolatile random-access memory
Ohm	A unit of measure of electrical resistance
PAL	Phase alternation line format
PCA	Printed-circuit assembly
PCB	Printed circuit board
PCL	Printer command language
PC PICKUP ROLLER	Paper-cassette pickup roller
PIU	Paper input unit

PJL	Printer job language
RAM	Random-access memory
RIP	Raster image process
ROM	Read-only memory
SIMM	Single inline memory module
SMO	Support materials organization
SMODE	Service mode
SPEC	Specifications
SRVR	Server
TCP/IP	Transmission control protocol/Internet protocol
TS I/T52	Thermoswitch
UNIX	Network operating system using TCP/IP protocol
URL	Universal resource locator
VDC	Volts direct current





# Index

## A

accessing service mode 75

## B

banding, reducing 123

baud rate switch 106

bidirectional parallel interface 94

## C

character voids 123

cleaning page 273

## D

default paper size, setting 79

defect rulers

repetitive image 302, 303, 304,

305, 306, 307, 308, 309

display lights 8

## E

envelopes

construction 116

feeding 116

reducing gray background 126

sizes 114

specifications 114

error messages 9

## G

gray background, reducing 126

## H

hardware repair services 341

Hardware Technical Support  
Center 338

hardware, part numbers 149

HP FIRST 338

HP LaserJet Companion

cables 345

cleaning 345

description 344

power supply modules 346

supported media 345

warranty 344

HP paper training video 120

HP Planet Partners program 127

## I

I/O type, selecting 105

image defects 274

infrared communications 103

infrared printing problems 103

IR test tool 104

## L

labels

specifications 117

types to avoid 118

light emitting diode displays 8

## M

Macintosh, verifying

communication 102

- media
  - envelope sizes 114
  - envelope specifications 114
  - label specifications 117
  - label types to avoid 118
  - paper curl 113
  - paper problems 111
  - paper sizes 108
  - paper specifications 109
  - paper types to avoid 112
  - paper weights 110
  - sizes 108
  - transparency specifications 119

## O

- operating voltages 86
- ordering
  - manuals iv
  - parts 131
- ordering, printer drivers 340

## P

- page count, setting 77, 78, 79
- paper
  - curl 113
  - sizes 108
  - specifications 109
  - troubleshooting problems 111
  - types to avoid 112
  - weights 110
- paper out 21
- paper size, setting 79
- parallel cables 95
- part numbers 152
- parts, ordering 131
- PC interface, configuring 100
- post image transfer 125
- power save interval, setting 80
- power supply checks 81

## printer

- baud rate switch 106
- bidirectional parallel interface 94
- cleaning page 273
- configuring PC interface 100
- display lights 8
- error messages 9
- hardware part numbers 149
- I/O cables, specifications 99
- infrared printing problems 103
- light emitting diode displays 8
- operating voltages 86
- parallel cables 95
- parts 152
- product part numbers 132
- schematics 81, 82
- serial cabling schematics 96
- service messages 9
- setting page count 77, 78, 79
- setting paper size 79
- status messages 9
- technical tips 206
- troubleshooting printing system
  - 197
- troubleshooting problems 200
- verifying communication 101
- wiring diagrams 313
- printer drivers, ordering 341
- product
  - description 132
  - ordering parts 131
  - part numbers 132

## R

- recycling, toner cartridges 127
- refill statement 128
- repetitive image defect ruler 302, 303, 304, 305, 306, 307, 308, 309, 310, 311

**S**

- self-paced training kits 336, 337
- serial cabling schematics 96
- serial I/O specifications 99
- serial number, setting 78, 79
- service manuals, ordering iv
- service messages 9
- service mode, accessing 75
- service notes 206
  - index 200
  - retrieving 339
- service part numbers 132
- setting
  - page count 77
  - power save interval 80
- sizes
  - envelopes 114
  - paper 108
- status messages 9

**T**

- technical support, contacting 338
- test tool 91
- toner cartridges
  - banding 123
  - character voids 123
  - minimizing post image transfer 125
  - page count 122
  - product numbers 122
  - toner cracking 124
  - weights 122

- toner cracking 124

- training class schedules 336

- training kits, self-paced 336, 337

- transparencies

- specifications 119

- types to use 119

- troubleshooting

- banding 123

- character voids 123

- envelope problems 115

- image defects 274

- infrared printing problems 103

- paper problems 111

- post image transfer 125

- printer problems 200

- printing system 197

- technical tips 206

- toner cracking 124

**W**

- wiring diagrams 313

# Service Websites

## Electronic Support Center

Software, drivers, support documentation, frequently asked questions

**<http://www.hp.com/go/support>**

## HP Technical Training (North America)

Classes and schedules

**<http://www.hp.com/go/resellertraining>**

## Parts

Parts information

**<http://outfield.external.hp.com/spi/welcome.htm>**

# Service Phone Numbers

All numbers listed are for North America only.

## Dealer Response Line

Dealer pre/post sales and service support

**(800) 544-9976** *U.S. Only*   **(800) 363-6594** *Canada*

## Customer Care Center

User questions, applications, LaserJet Fax

**(208) 323-2551**

## HP First Fax – Information Retrieval System

Service notes, sales information, user help, software information

**(208) 344-4809**   **(800) 333-1917** *U.S. Only*

## Customer Information Center

Sales dealer locations, literature, and specifications

**(800) 752-0900** *U.S. Only*

## HP Driver Distribution Center

Printer drivers and software application notes orders

**(970) 339-7009** *U.S. Only*

## Customer Support Sales Center

Authorized repair locations

**(800) 243-9816** *U.S. Only*

## Parts Direct Ordering / SMO

Service parts, supplies, and accessories orders

**(800) 227-8164** *U.S. Only*

## Parts Identification

Service part number identification

**(916) 783-0804**

## North American Response Center

Online technical assistance

**(800) 477-5526** *HP Only*

## Corvallis Customer Service Center

Express exchange/customer return services

**(916) 785-1200**

## Supported Products

HP LaserJet Companion (minimal support only)

HP LaserJet 6L

HP LaserJet 5Si Mopier

HP LaserJet 5Si/5Si MX

HP LaserJet 5L

HP LaserJet 6P/6MP

HP LaserJet 5P/5MP

HP LaserJet 5/5M/5N

HP LaserJet 4V/4MV

HP LaserJet 4P/4MP

HP LaserJet 4L/4ML

HP LaserJet 4+/4M+

HP LaserJet 4/4M

HP LaserJet 4Si/4Si MX

HP LaserJet IIISi

HP LaserJet IIIP

HP LaserJet IIP+

HP LaserJet IIP

HP LaserJet IID

HP LaserJet III

HP LaserJet IID

HP LaserJet II

HP Classic LaserJet (2686D)

HP Classic LaserJet (2686A)



Printed on at least  
50% Total Recycled Fiber with  
at least 10% Post-Consumer Paper

Copyright© 1998  
Hewlett-Packard Co.  
Printed in USA

**Manual Part No.  
5021-8943**



**5021-8943**