



MODEL

- BOSS MIG 185
- BOSS MIG 202
- BOSS MIG 255
- BOSS MIG 275















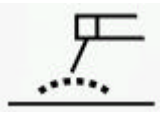



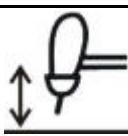

Operating Manual (Owner's Manual)

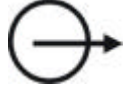IMPORTANT: Read these instructions before installing, operating, or servicing this system.

CONTENTS

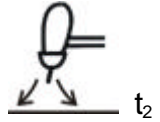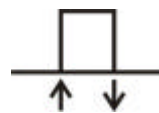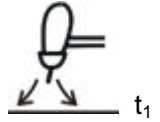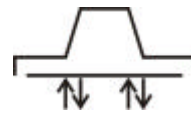SYMBOL LEGEND-----	2
STATEMENT OF WARRANTY-----	3
1.0 GENERAL INFORMATION-----	4
1.01 Notes, Cautions and Warnings-----	4
1.02 Important Safety Precautions-----	4
1.03 Transporting methods-----	6
2.0 INSTALLATION RECOMMENDATION-----	7
2.01 Electrical Input Connections-----	8
2.02 Installation of MIG/MAG-----	9
2.03 Specifications-----	10
2.04 Wire Feeder Specifications-----	10
2.05 Duty Cycle-----	11
3.0 OPERATOR CONTROLS-----	12
3.01 BOSS MIG Controls-----	12
3.02 BOSS MIG Control Methods-----	14
3.03 Weld Parameter Description-----	14
4.0 SET-UP FOR MIG/MAG-----	15
5.0 POWER SUPPLY CONTROLS INDICATORS AND REATURES-----	16
5.01 Basic MIG Welding Guide-----	17
5.02 Position of MIG GUN-----	17
5.03 Distance from the MIG Gun Nozzle to the Work Piece-----	17
5.04 Travel Speed-----	17
5.05 Electrode Wire Size Selection-----	17
5.06 Spot Welding Operation-----	18
6.0 MAINTENANCE-----	19
7.0 BASIC TROUBLESHOOTING-----	19
7.01 Check the item and excrescent phenomenon exclusion method-----	19
7.02 Solving Problems Beyond the Welding Terminals -----	21
7.03 Weld Problems-----	23
7.04 Power Supply Problems-----	24
8.0 PART LIST-----	25
9.0 REMARK-----	30

SYMBOL LEGEND

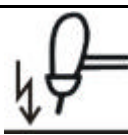A	Amperage		Stick (SMAW)
V	Voltage		Pulse Current Function (GTAW)
Hz	Hertz (frequency)		Spot Time (GTAW)
SEC	Seconds		Remote outputs control (Panel/Remote)
%	Percent		Remote Function
	DC (Direct Current)		Arc Control (SMAW)
	AC (Alternating Current)		Gas Post-Flow Time
	2T (GTAW)		Gas Pre-Flow Time
	4T (GTAW)	VRD	Voltage Reduction Device Circuit
	Repeat Function (GTAW)		Negative
	Spot Function (GTAW)		Positive
	High Frequency Starting (GTAW)		Gas Input
	Lift Start (GTAW)		Gas Output



STATEMENT OF WARRANTY

LIMITED WARRANTY: "BOSS" warrants to customers of its authorized distributors hereafter "BOSS" that its products will be free of defects in workmanship or material. Should any failure to conform to this warranty appear within the time period applicable to the BOSS products as stated below, BOSS shall, upon notification thereof and substantiation that the product has been stored, installed, operated, and maintained in accordance with BOSS's specifications, instructions, recommendations and recognized standard industry practice, and not subject to misuse, repair, neglect, alteration, or accident, correct such defects by suitable repair or replacement, at BOSS 's sole option, of any components or parts of the product determined by BOSS to be defective.

The BOSS COMPANY MAKES NO OTHER WARRANTY, EXPRESS OR IMPLIED. THIS WARRANTY IS EXCLUSIVE AND IN LIEU OF ALL OTHERS, INCLUDING, BUT NOT LIMITED TO ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE.

LIMITATION OF LIABILITY: BOSS shall not under any circumstances be liable for special, indirect or consequential damages, such as, but not limited to, lost profits and business interruption. The remedies of the Purchaser set forth herein are exclusive and the liability of BOSS with respect to any contract, or anything done in connection therewith such as the performance or breach thereof, or from the manufacture, sale, delivery, resale, or use of any goods covered by or furnished by BOSS whether arising out of contract, negligence, strict tort, or under any warranty, or otherwise, shall not, except as expressly provided herein, exceed the price of the goods upon which such liability is based. No employee, agent, or representative of BOSS is authorized to change this warranty in any way or grant any other warranty.

PURCHASER'S RIGHTS UNDER THIS WARRANTY ARE VOID IF REPLACEMENT PARTS OR ACCESSORIES ARE USED WHICH IN BOSS'S SOLE JUDGEMENT MAY IMPAIR THE SAFETY OR PERFORMANCE OF ANY BOSS PRODUCT. PURCHASER'S RIGHTS UNDER THIS WARRANTY ARE VOID IF THE PRODUCT IS SOLD TO PURCHASER BY NON-AUTHORIZED PERSONS.

The warranty is effective for the time stated below beginning on the date that the authorized distributor delivers the products to the Purchaser. Not with standing the foregoing, in no event shall the warranty period extend more than the time stated plus one year from the date BOSS delivered the product to the authorized distributor.

POWER SUPPLIES

MAIN POWER MAGNETICS (STATIC& ROTATING)

ORIGINAL MAIN POWER RECTIFIER

POWER SWITCHING SEMI-CONDUCTORS & CONTROL PC BOARD

ALL OTHER CIRCUITS AND COMPONENTS INCLUDING

BUT NOT LIMITED TO, CONTACTORS, RELAYS,
SOLENOIDS, PUMPS, SWITCHES, MOTORS

POWER SUPPLIES & WIRE FEEDERS

1YEAR

1YEAR

1YEAR

1YEAR

Warranty repairs or replacement claims under this limited warranty must be submitted to BOSS by an authorized BOSS repair facility within thirty (30) days of purchaser's notice of any Warranty Claim. No transportation costs of any kind will be paid under this warranty. Transportation charges to send products to an authorized warranty repair facility shall be the responsibility of the Purchaser. All returned goods shall be at the Purchaser's risk and expense. This warranty supersedes all previous BOSS warranties.

1.0 GENERAL INFORMATION

1.01 Notes, Cautions and Warnings

Throughout this manual, notes, cautions, and warnings are used to highlight important information. These highlights are categorized as follows:

NOTE

An operation, procedure, or background information which requires additional emphasis or is helpful in efficient operation of the system.

CAUTION

A procedure which, if not properly followed, may cause damage to the equipment.



WARNING

A procedure which, if not properly followed, may cause injury to the operator or others in the operating area.

1.02 Important Safety Precautions



WARNING

OPERATION AND MAINTENANCE OF ARC WELDING EQUIPMENT CAN BE DANGEROUS AND HAZARDOUS TO YOUR HEALTH.

To prevent possible injury, read, understand and follow all warnings, safety precautions and instructions before using the equipment. Call your local distributor if you have any questions.



GASES AND FUMES

Gases and fumes produced during the Arc welding or cutting process can be dangerous and hazardous to your health.

- Keep all fumes and gases from the breathing area. Keep your head out of the welding fume plume.
- Use an air-supplied respirator if ventilation is not adequate to remove all fumes and gases.
- The kinds of fumes and gases from the arc welding/cutting depend on the kind of metal being used, coatings on the metal, and the different processes. You must be very careful when cutting or welding any metals which may contain one or more of the following:
Antimony Arsenic Barium Beryllium Cadmium Chromium Cobalt Copper Lead
Manganese Mercury Nickel Selenium Silver Vanadium
- Always read the Material Safety Data Sheets (MSDS) that should be supplied with the material you are using. These MSDSs will give you the information regarding the kind and amount of fumes and gases that may be dangerous to your health.
- Use special equipment, such as water or down draft welding/cutting tables, to capture fumes and gases.
- Do not use the welding torch in an area where combustible or explosive gases or materials are located.
- Phosgene, a toxic gas, is generated from the vapors of chlorinated solvents and cleansers. Remove all sources of these vapors.



ELECTRIC SHOCK

Electric Shock can injure or kill. The arc welding process uses and produces high voltage electrical energy. This electric energy can cause severe or fatal shock to the operator or others in the workplace.

- Never touch any parts that are electrically “live” or “hot.”
- Wear dry gloves and clothing. Insulate yourself from the work piece or other parts of the welding circuit.
- Repair or replace all worn or damaged parts.
- Extra care must be taken when the workplace is moist or damp.
- Install and maintain equipment according to NEC code, refer to relative standards
- Disconnect power source before performing any service or repairs.
- Read and follow all the instructions in the Operating Manual.



FIRE AND EXPLOSION

Fire and explosion can be caused by hot slag, sparks, or the arc weld.

- Be sure there is no combustible or flammable material in the workplace. Any material that cannot be removed must be protected.
- Ventilate all flammable or explosive vapors from the workplace.
- Do not cut or weld on containers that may have held combustibles.
- Provide a fire watch when working in an area where fire hazards may exist.
- Hydrogen gas may be formed and trapped under aluminum workpieces when they are cut underwater, or while using a water table. Do not cut aluminum alloys underwater or on a water table unless the hydrogen gas can be eliminated or dissipated. Trapped hydrogen gas that is ignited will cause an explosion.



NOISE

Noise can cause permanent hearing loss. Arc welding/cutting processes can cause noise levels to exceed safe limits. You must protect your ears from loud noise to prevent permanent loss of hearing.

- To protect your hearing from loud noise, wear protective ear plugs and/ or ear muffs. Protect others in the workplace.
- Noise levels should be measured to be sure the decibels (sound) do not exceed safe levels.



ARC WELDING RAYS

Arc Welding/ Cutting Rays can injure your eyes and burn your skin. The arc welding/cutting process produces very bright ultra violet and infra red light. These arc rays will damage your eyes and burn your skin if you are not properly protected.

- To protect your eyes, always wear a welding helmet or shield. Also always wear safety glasses with side shields, goggles or other protective eye wear.
- Wear welding gloves and suitable clothing to protect your skin from the arc rays and sparks.
- Keep helmet and safety glasses in good condition. Replace lenses when cracked, chipped or dirty.
- Protect others in the work area from the arc rays. Use protective booths, screens or shields.

1.03 Transporting methods

These units are equipped with a handle for carrying purposes.

WARNING: ELECTRIC SHOCK can kill.



DO NOT TOUCH live electrical parts. Disconnect input power conductors from de-energized supply line before moving the welding power source.



WARNING: FALLING EQUIPMENT can cause serious personal injury and equipment damage.

- Lift unit with handle on top of case.
- Use handcart or similar device of adequate capacity.
- If using a fork lift vehicle, place and secure unit on a proper skid before transporting.

2.0 INSTALLATION RECOMMENDATION

Installation Environment

BOSS MIG is designed for use in hazardous environments.

Examples of environments with increased hazardous environments are -

In locations in which freedom of movement is restricted, so that the operator is forced to perform the work in a cramped (kneeling, sitting or lying) position with physical contact with conductive parts; In locations which are fully or partially limited by conductive elements, and in which there is a high risk of unavoidable or accidental contact by the operator, or in wet or damp hot locations where humidity or perspiration considerable reduces the skin resistance of the human body and the insulation properties of accessories.

Environments with hazardous environments do not include places where electrically conductive parts in the near vicinity of the operator, which can cause increased hazard, have been insulated.

Installation Location

Be sure to locate the welder according to the following guidelines:

- In areas, free from moisture and dust.
- In areas, free from oil, steam and corrosive gases.
- In areas, not exposed to direct sunlight or rain.
- Ambient temperature: between -10 degrees C to 40 degrees C.
- In areas, not subjected to abnormal vibration or shock.
- Place at a distance of 304.79mm or more from walls or similar that could restrict natural airflow for cooling.



WARNING 1

BOSS advises that this equipment be electrically connected by a qualified electrician.

The following Primary Current recommendations are required to obtain the maximum welding current and duty cycle from this Power Supply:

Model	Primary supply lead size	Minimum primary current circuit size	Current & Duty Cycle
BOSS MIG 185	Minimum 5mm ²	220V/30A 240V/27.5A	180A/23V@60% 160A/22V@100%
BOSS MIG 202	Minimum 6mm ²	220V/36.7A 240V/33.6A	200A/24V@50% 180A/23V@60% 160A/22V@100%
BOSS MIG 255	Minimum 8mm ²	220V/53.4A 240V/49A	250A/26.5V@60% 200A/24V@100%
BOSS MIG 275	Minimum 3.2mm ²	415V/16.9A	275A/27.75V@40% 250A/26.5V@60% 200A/24V@100%

Table 1 Primary current circuit sizes to achieve maximum current

2.01 Electrical Input Connections



WARNING: ELECTRIC SHOCK can kill; SIGNIFICANT DC VOLTAGE is present after removal of input power.

DO NOT TOUCH live electrical parts

SHUT DOWN welding power source, disconnect input power employing lockout/ tagging procedures. Lockout/ tagging procedures consist of padlocking line disconnect switch in open position, removing fuses from fuse box, or shutting off and red-tagging circuit breaker or other disconnecting device.

Electrical Input Requirements

Operate the welding power source from a single phase (MIG 185, 202, 255)/ three phases (MIG 275) 50/ 60 Hz, AC power supply. The input voltage must match one of the electrical input voltages shown on the input data label on the unit nameplate. Contact the local electric utility for information about the type of electrical service available, how proper connections should be made, and inspection required.


The line disconnect switch provides a safe and convenient means to completely remove all electrical power from the welding power supply whenever necessary to inspect or service the unit.

According to Table 1 and below as a guide to select line fuses for the disconnect switch.

Phases	Input Voltage	Fuse Size	Model
1 phase	220/240V AC	60 Amps	BOSS MIG 185, 202, 255
3 phases	415V AC	60 Amps	BOSS MIG 275

Table 2

Notice: Fuse size is based on not more than 200 percent of the rated input amperage of the welding power source (Based on Article 630, National Electrical Code).

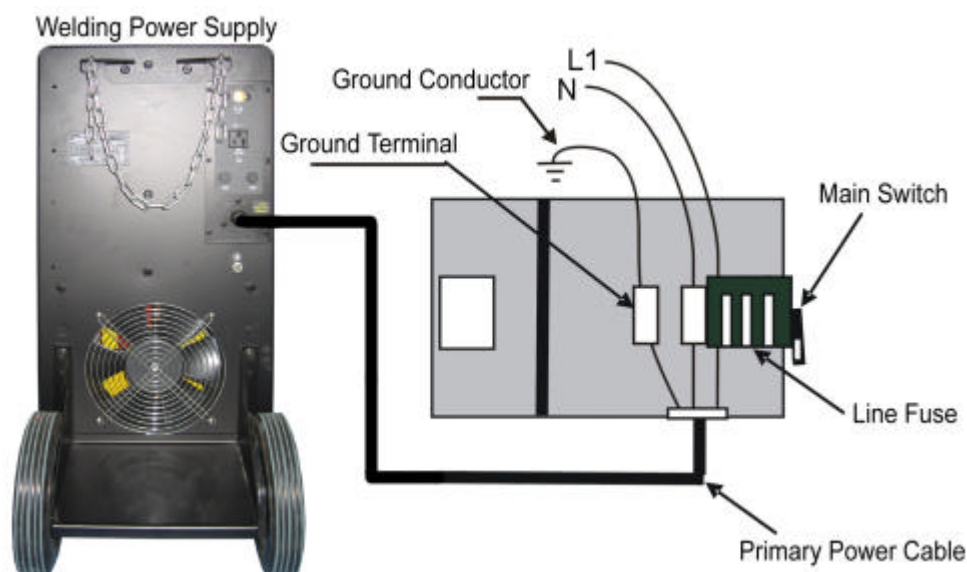

(MIG 185, 202, 255)

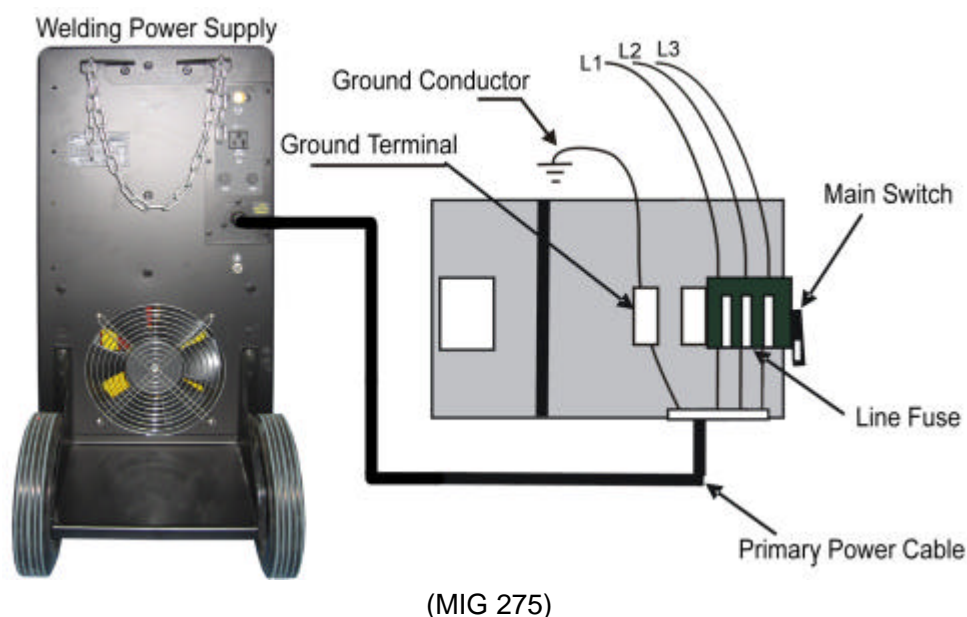


Figure 1 Electrical input connections

2.02 Installation of MIG/MAG

- Connect the work lead to negative (-) socket (positive (+) for special wire).
- Connect the gun lead to the positive (+) socket (negative (-) for special wire).
- Position a gas cylinder on the rear tray and lock securely to the power supply cylinder bracket with the chain provided. If this arrangement is not used then ensure that the gas cylinder is secured to a building pillar, wall bracket or otherwise securely fixed in an upright position.
- Fit the gas regulator/ flowmeter to the gas cylinder (choose different gas according to wire: CO₂, mixed gas, argon and so on).
- One dual groove feed rollers are supplied as standard with the power supply. These can accommodate 0.8mm and 1.0mm diameter hard wires. Select the roller required with the chosen wire size marking facing outwards.
- Fit the electrode wire spool to the wire reel hub.
- Lift up the wire feeder pressure lever and lift the electrode wire to the entrance of the gun.
- Lower the pressure lever and with the gun lead reasonably straight, feed the wire through the gun, till to extend from the hole in the middle of contact tip.
- Regulate the current, voltage to the value required according to the thickness of work piece (short circuit transition, dip transition, and spray transition can be produced according to different regulated current , voltage).
- Install appropriately, there is no faulty after inspecting, you can start welding.

2.03 Specifications

MODEL	BOSS MIG 185	BOSS MIG 202	BOSS MIG 255	BOSS MIG 275
Input voltage and frequency and phases	220/240V 50/60Hz	220/240V 50/60Hz	220/240V 50/60Hz	415V 50/60Hz
KVA @ max output	6.6KVA	8.0kVA	11.8kVA	12kVA
Input Current	30A	36.7A	53.4A	16.9A
Max current	180A	200A	250A	275A
Output current range	30~180A	30~200A	30~250A	30~275A
Open circuit voltage	43/47V	43/47V	43/47V	48V
Spot Time	0~5s	0~5s	0~5s	0~5s
Duty cycle at 40	60%	50%	60%	40%
Protection Grade	IP21	IP21	IP21	IP21
Insulation Grade	F	F	F	F
Weight	90kg	90kg	105kg	120kg
Dimensions	780×350×720mm	780×350×720mm	780×350×720mm	780×350×720mm

Table 3

2.04 Wire Feeder Specifications

	WF 2	Inside
Motor supply voltage	24VDC	24VDC
Motor supply frequency	65VA	45.5VA
Minimum wire speed	2m/min	3.2m/min
Maximum wire speed	17.08m/min	15.2m/min
Wire spool size	305mm	305mm
Wire spool weight	20kg	20kg
Spot time	0~5s	0~5s
Burnback time range	0~29s	0~28s
Wire diameter	Hard wire: 0.6mm, 0.8mm, 0.9mm, 1.0mm, 1.2mm Stainless steel: 0.8mm, 1.0mm Aluminum: 0.9mm, 1.0mm Flux cored: 0.8mm, 0.9mm, 1.2mm Protected flux cored: 0.8mm, 0.9mm, 1.2mm	

Table 4





	Wire Size			
	Idle Roll 1	2WZKIDLE001		
	Drive Roll	0.6/0.8mm	2WZKVVY0R6X0R8	2WZKKVY0R6X0R8
		0.8/1.0mm	2WZKVVY0R8X1R0	2WZKKVY0R8X1R0
		0.9/1.2mm	2WZKVVY0R9X1R2	2WZKKVY0R9X1R2
		1.0/1.2mm	2WZKVVY1R0X1R2	2WZKKVY1R0X1R2
		1.2/1.2mm		2WZKKVY1R2X1R2

Table 5

2.05 Duty Cycle

The duty cycle of a welding power source is the percentage of a ten (10) minute period that it can be operated at a given output without causing overheating and damage to the unit. If the welding amperes decrease, the duty cycle increases. If the welding amperes are increased beyond the rated output, the duty cycle will decrease.



WARNING: Exceeding the duty cycle ratings will cause the thermal overload protection circuit to become energized and shut down the output until has cooled to normal operating temperature

**Continually exceeding the duty cycle ratings
can cause damage to the welding power source.**

NOTICE :

Due to variations that can occur in manufacture products, claimed performance, voltages, ratings, all capacities, measurements, dimensions and weights quoted are approximate only. Achievable capacities and ratings in use and operation will depend upon correct installation, use, applications, maintenance and service.

3.0 OPERATOR CONTROLS

3.01 BOSS MIG Controls



Figure 2

1. Main Power Switch.
2. Wire Speed Control.
3. Spot Time Control.
4. Mode Selector Switch 2T/ Spot/ 4T.
5. 14 Pin Receptacle.
6. Positive Terminal.
7. Negative Terminal.
8. Euro fitting for MIG gun.
9. Amperage / Voltage Selector Switch.
10. Digital Meter.
11. Fine Voltage Switch.
12. Coarse Voltage Switch.
13. Warning indicator.
14. AC Power indicator.
15. Ground Screw.
16. Input Power Cable.
17. Fuse.
18. Fuse (Optional).
19. 110VAC Auxiliary Power (Optional).

20. Input Gas Fitting.
21. Burnback (Inside).

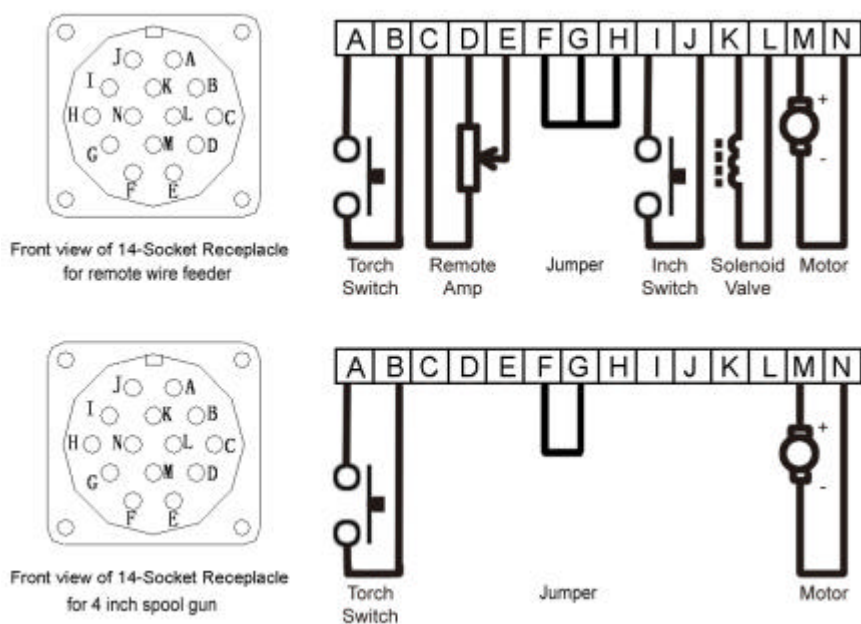


Figure 3

Pin	WF2 function	4 inch spool gun function
A	Torch switch input	Torch switch input
B	Torch switch input	Torch switch input
C	Current regulation	
D	Current regulation	
E	Current regulation	
F	Short line	Short line
G	Short line	Short line
H	Short line	
I	Spot switch	
J	Spot switch	
K	Solenoid valve	
L	Solenoid valve	
M	WF2 motor	Spool gun motor
N	WF2 motor	Spool gun motor

Table 6

WARNING

When the welder is connected to the primary supply voltage, the internal electrical components maybe at primary potential with respect to earth.

3.02 BOSS MIG Control Methods


Weld Control	MIG/MAG	Description
 2T Mode	Yes	2T mode MIG
 4T Mode	Yes	4T mode MIG
 Spot mode	Yes	Spot mode MIG

Table 7 BOSS MIG Series selection of weld technology in different weld methods

3.03 Weld parameter description

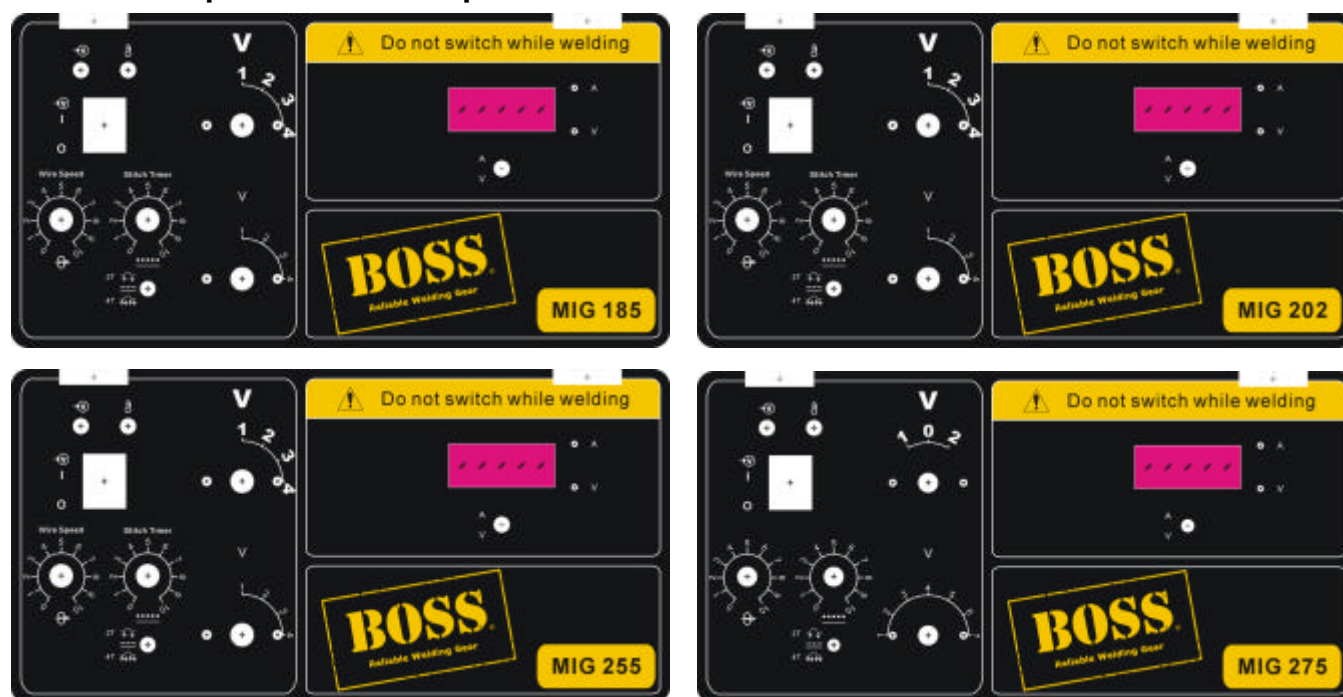


Figure 4 BOSS MIG series front panel with parameter description

Parameter	Description
Welding Current	This parameter sets the welding current.
Spot Time	MIG only. The welding current can be set, and be controlled according to the setting time. This mode of welding is used to melt the top & bottom plates together to form a nugget between them.
Burnback Time	MIG only. Burnback time is the difference between the wire feed motor stopping and switching off of the welding current. The Burnback time allows the electrode wire to burn out of the molten metal weld pool, to separate the electrode wire from work piece.

Table 8 Weld parameter description for BOSS MIG series

4.0 SET-UP FOR MIG/MAG

Conventional operating procedures apply when using the welding power source, i.e. connect work lead directly to work piece and connect MIG gun to the power source. Wide safety margins provided by the coil design ensure that the welding power source will withstand short-term overload without adverse effects. The welding current range values should be used as a guide only. Current delivered to the arc is dependent on the welding arc voltage, and as welding arc voltage varies between different classes of electrodes, welding current at any one setting would vary according to the type of electrode in use. The operator should use the welding current range values as a guide, and then finally adjust the current setting to suit the application.



Figure 5 Set up for BOSS MIG Series



WARNING:

Before connecting the work clamp to the work and inserting the electrode in the electrode holder make sure the Primary power supply is switched off.

CAUTION 2:

Remove any packaging material prior to use. Do not block the air vents at the front or rear of the Welding Power Source.

5.0 POWER SUPPLY CONTROLS INDICATORS AND REATURES

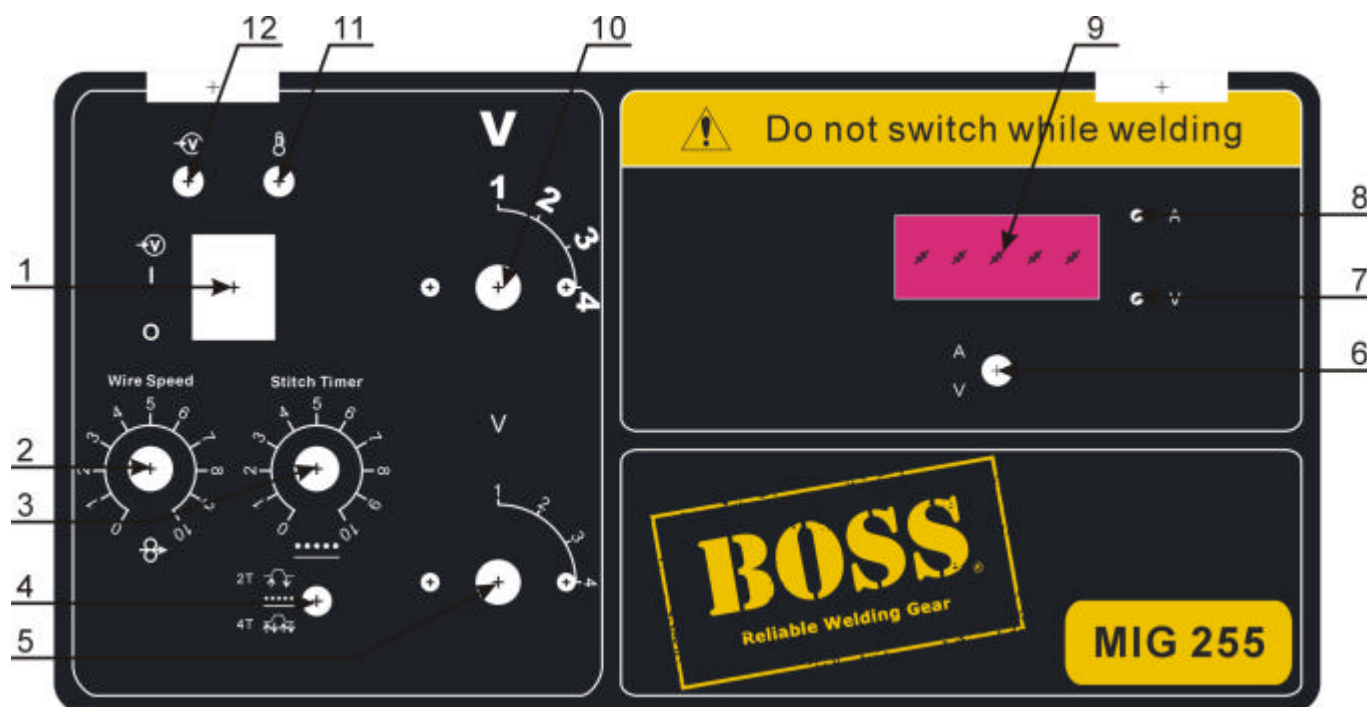


Figure 6 BOSS MIG series front panel

1. Main Power Switch.
2. Wire Speed Control.
3. Spot Time Control (a spot welding nozzle required).
4. Mode Selector Switch 4T/Spot /2T.
5. Fine Voltage Control.
6. Amperage / Voltage Selector Switch.
7. Voltage Indicator.
8. Amperage Indicator.
9. Digital Meter.
10. Coarse Voltage Switch.
11. Warning Indicator.
12. AC Power indicator.

5.01 Basic MIG Welding Guide

The welding power supply has two control settings that have to balance. These are the wire speed control and the voltage control switches. The welding current is determined by the wire speed control, the current will increase with increased wire speed, resulting in a shorter arc. Less wire speed will reduce the current and lengthen the arc. By decreasing the voltage, a shorter arc is obtained with little change in welding current, because the wire speed is not changed.

- When changing to a different electrode wire diameter, different control settings are required. A thinner electrode wire needs more wire speed to achieve the same current level.
- A satisfactory weld cannot be obtained if the wire speed and voltage switch settings are not adjusted to suit the electrode wire diameter and dimensions of the work piece.
- If the wire speed is too high for the welding voltage, “stubbing” will occur as the wire dips into the molten pool. If the wire speed is too slow for the welding voltage, large drops will form on the end of the electrode wire, causing spatter. Suppose that wire speed is constant, if the welding voltage is too high, large drops will form on the end of the electrode wire, causing spatter; if the voltage is too low, the wire will not melt.

5.02 Position of MIG Gun

The angle of MIG gun to the weld has an effect on the width of the weld run.

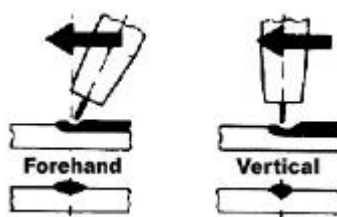


Figure 7 MIG gun angle

5.03 Distance from the MIG Gun Nozzle to the Work Piece

The electrode stick out from the MIG gun nozzle should be between 2.0mm to 5.0mm. This distance may vary depending on the type of joint that is being weld.

5.04 Travel Speed

Speed at which a weld travels influences the width of the weld and penetration of the welding run.

5.05 Electrode Wire Size Selection

The choice of electrode wire size in conjunction with shielding gas used depends on:

- Thickness of the metal to be welded.
- Type of joint.

- Capacity of the wire feed unit and power supply.
- The amount of penetration required.
- The deposition rate required.
- The bead profile desired
- The position of welding and cost of the electrode wire.

Weld metal deposition rate is proportional to current density. Current density is defined as the current per cross sectional area of electrode wire and is normally expressed as amps per mm². An example is tabled below.

Electrode Wire Size	Current (A)	Current Density (A/mm ²)	Deposition Rate (lbs/hour)
0.9mm (.035")	200	314	7.0
1.2mm (.045")	200	177	6.2

Table 9 0.9mm/ 1.2mm wire deposition rate

This demonstrates that where the upper limit of current is limited by the machine capacity and duty cycle, higher deposition rates therefore greater productivity will be achieved by using smaller electrode wire. The BOSS MIG series is a particularly efficient MIG welder with the 0.9mm~1.2mm steel wire in spray transfer mode. 0.9mm wire cost approx. 10% more than 1.2mm but is deposited approx 15% faster.

High current density or smaller diameter wire also gives deeper penetration as shown:

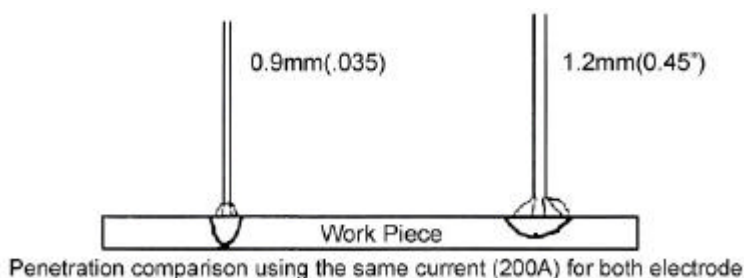


Figure 8 Wire penetration comparison

5.06 Spot Welding Operation

Fit a spot welding nozzle to the MIG gun for consistent spot welding operations. The BOSS MIG power supply will operate effectively using 0.8~1.2mm electrode wire when spot welding. Penetration depth is limited when using 0.6mm electrode wire for spot welding. Set the controls as follows for spot welding:

- 1 . Coarse & fine voltage selector switches and wire speed control.
Select higher voltage selector switch positions and set the wire speed control between 354 to 590ipm (9~15 meters/ minute)
- 2 . Mode selector switch.
- 3 . Spot Time.
- 4 . Burnback Time.

6.0 MAINTENANCE

If this equipment does not operate properly, stop work immediately and investigate the cause of the malfunction. Maintenance work must be performed by an experienced, qualified person only. Any electrical work must be performed by an electrician or other person properly trained in servicing electrical equipment. Do not permit untrained persons to inspect, clean or repair this equipment. Use only recommended replacement parts when servicing this machine.

Periodically clean the inside of the welding power source by using clean dry compressed air of not over 25psi as normal preventive maintenance. At the time of the cleaning, a full inspection of the welding machine and setup should be performed. Check warning labels on the machine for readability; replace if necessary. Check input and output connections as well as frame ground connections to the machine to insure that they are tight and the wires are not frayed or overheated. Inspect internal wiring of machine for loose or frayed connections; tighten or repair as necessary. It would also be advisable to check connections to wire feeders, fixtures, etc., at this time. Any damaged cable or hoses should be replaced.

DANGER: HIGH VOLTAGE is present internally even with the control power switch in the OFF position. Before inspecting, cleaning, or servicing, disconnect and lock out input power to the power source.

7.0 BASIC TROUBLESHOOTING



WARNING

There are extremely dangerous voltages and power levels present inside this product. Do not attempt to open or repair unless you are an accredited BOSS service agent and you have had training in power measurements and troubleshooting techniques.

If major complex subassemblies are faulty, then the welding power source must be returned to an accredited BOSS service agent for repair.

The basic level of troubleshooting is that which can be performed without special equipment or knowledge.

7.01 Check the item and excrescent phenomenon exclusion method

Troubleshooting Guide

Fault		Cause	Remedy
1. The AC power indicator light is not lit and welding arc can not be established.		1. No power input or main power switches damage. 2. Indicator damage.	1. Check input power or replace main power switch. 2. Replace indicator light.
2. The AC power indicator light on and welding arc can not be established.		1. Input voltage unstable. 2. Diode damage.	1. Connect stabilizer or reset power switch. 2. Replace diode.
3. The warning indicator light on.		Over load.	Reduce current or wait moment.
4. Turn on torch control switch	a. No gas flow No wire feed No output	1. MIG torch plug is not insert into the socket or the connect is bad. 2. MIG torch damage (diagnose method: make the welding machine control socket two pins short circuit, the faulty disappear). 3. Wire feeder plug is not insert into the socket or the connect condition is bad.	1. Insert the plug correctly, and rotate it clockwise. 2. Repair or replace MIG torch. 3. Insert the plug correctly, and rotate it clockwise.
	b. No gas flow Have wire feed Have output	1. The gas line is not turn on. 2. The MIG torch damage. 3. The solenoid damage. 4. Control board damage.	1. Turn on the gas system. 2. Repair or replace. 3. Repair or replace. 4. Repair or replace.
	c. Have gas flow Have wire feed No output	1. Disconnect the work piece to the work ground cable. 2. Control Board damage.	1. Reconnect the ground cable and tighten the work piece. 2. Repair or replace.
5. Faulty welding arc control.		1. The MIG torch damage. 2. Faulty setting. 3. Control board damage.	1. Repair or replace the MIG torch. 2. Read this manual carefully and set up correctly. 3. Repair or replace.
6. The arc weld has no output.		1. Transformer bad connect. 2. AC contactor bad connect.	1. Repair or replace. 2. Repair or replace.
7. Arc start difficult or often break off.		1. The power supply voltage is too low or the cable is too thin. 2. Control board damage. 3. The contact tip damage. 4. The work piece bad connect. 5. The wire roller damage. 6. The torch lead damage.	1. Connect a stabilizer or increase the thickness of the power cable. 2. Repair or replace. 3. Repair or replace. 4. Repair or replace. 5. Replace 6. Replace
8. The maximum output welding current can not achieved in the rated input voltage.		Control board damage.	Repair or replace.
9. The current decrease in the weld process.		Faulty cable connected to work piece.	Make sure the cable positive connect to the work piece correctly.

Table 10

7.02 Solving Problems Beyond the Welding Terminals

The general approach to fix gas metal arc welding (GMAW) problems is to start at the wire spool then work through to the MIG gun. There are two main areas where problems occur with GMAW:

a) Porosity

When there is a gas problem the result is usually porosity within the weld metal. Porosity always stems from some contaminant within the molten weld pool which is in the process of escaping during solidification of the molten metal.

Contaminants range from no gas around the welding arc to dirt on the work piece surface.

Porosity can be reduced by checking the following points:

- Gas cylinder contents and flow meter
Ensure that the gas cylinder is not empty and the flow meter is correctly adjusted to 15 liters per minute (0.5 cubic feet per minute)
- Gas leaks
Check for gas leaks between the regulator/ cylinder connection and in the gas hose to the power supply.
- Internal gas hose in the power supply
Ensure the hose from the solenoid valve to the MIG gun adaptor has not fractured and that it is connected to the MIG gun adaptor.
- Welding in a windy environment
Shield the weld area from the wind or increase the gas flow.
- Welding dirty, oily, painted oxidized or greasy plate.
Clean contaminates off plate.
- Distance between the MIG gun
Keep the distance between the MIG gun nozzle and the work piece to a minimum. Refer to distance from the MIG gun nozzle to the work piece in 5.03.
- Maintain the MIG gun in good work order
Ensure that the gas holes are not blocked and gas is exiting out of the gun nozzle. Refer to the WARNING.

Do not restrict gas flow by allowing spatter to build up inside the MIG gun nozzle.

Check that the MIG gun O-rings are not damaged.



WARNING: Disengage the drive roll when testing for gas flow by ear.

b) Inconsistent wire feed

Wire feeding problems can be reduced by checking the following points:

- Wire spool brake is too tight
Feed roller driven by motor in the cabinet will slip.
- Wire spool brake is too loose
Wire spool can unwind and tangle.
- Worn or incorrect feed roller size

Use “U” groove drive feeder roller matched to the aluminum wire size you are welding.

Use “V” groove drive feeder roller matched to the steel wire size you are welding.

Use “knurled V” groove drive feeder roller matched to the flux cored wire size you are welding.

- Mis-alignment of inlet/ outlet guides

Wire will rub against the mis-aligned guides and reduces wire feed ability.

- Liner blocked with debris

Debris is produced by the wire passing through the feed roller, if excessive pressure is applied to the pressure roller adjuster.

Debris can also be produced by the wire passing through an incorrect feed roller groove shape or size.

Debris is fed into the liner where it accumulates thus reducing wire feed ability.

- Incorrect or worn contact tip

The contact tip transfers the weld current to the electrode wire. If the hole in the contact tip is too large then arcing may occur inside the contact tip resulting in the electrode wire jamming in the contact tip.

When using soft electrode wire such as aluminum it may become jammed in the contact tip due to expansion of the wire when heated. A contact tip designed for soft electrode wires should be used.

- Poor work lead contact to work piece

If the work lead has a poor electrical contact to the work piece then the connection point will heat up and result in a reduction of power at the arc.

- Bent liner

This will cause friction between the wire and the liner thus reducing wire feed ability.

7.03 Weld Problems

Fault	Cause	Remedy
1. Undercut	A Welding arc voltage too high. B Incorrect gun angle. C Excessive heat input.	A Reduce voltage by reducing the voltage selection switches position or increase the wire feed speed. B Adjust angle. C Increase the gun travel speed and/ or reduce welding current by reducing the voltage selection switches position or reducing the wire feed speed.
2. Lack of penetration	A Welding current too low. B Joint preparation too narrow or gap too tight. C Shielding gas incorrect.	A Increase welding current by increasing wire feed speed and increasing voltage selection switch position. B Increase the joint angle or gap. C Change to a gas which gives higher penetration.
3. Lack of fusion	Voltage too low.	Increase voltage by increasing voltage selection switch position.
4. Excessive spatter	A Voltage too high. B Voltage too low.	A Lower voltage by increasing wire speed control or reducing the voltage selection switches. B Raise voltage by reducing wire speed control or increasing the voltage selection switches.
5. Irregular weld shape	A Incorrect voltage and current settings. Convex, voltage too low. Concave, voltage too high. B Wire is wandering. C Incorrect shielding gas. D Insufficient or excessive heat input.	A Adjust voltage and current by adjusting the voltage selection switches and the wire speed control. B Replace the contact tip. C Check shielding gas. D Adjust the wire speed control or voltage selection switches.
6. Welding cracking	A Weld beads too small. B Weld penetration narrow and deep. C Excessive weld stress. D Excessive voltage. E Cooling rate too fast.	A Decrease the travel speed. B Reduce current and voltage and increase MIG gun travel speed or select a lower penetration shielding gas. C Increase weld metal strength or revise design. D Decrease the voltage by reducing the voltage selection switches. E Slow the cooling rate by preheating part to be weld or cool slowly.
7. Cold weld puddle	A Faulty rectifier unit. B Loose welding cable connection. C Low primary voltage.	A Have an accredited BOSS service agent to test then replace the faulty component. B Check all welding cable connections. C Contact supply authority.


Table 11

7.04 Power Supply Problems

Fault	Cause	Remedy
1. Input power supply voltage is ON. Indicator light is not lit and welding arc can not be established.	A Primary fuse is blown. B Broken connection in primary circuit.	A Replace Primary fuse. B Have an accredited BOSS service agent check primary circuit.
2. Input power indicator light is not lit and welding arc can not be established.	Indicator light is open circuit.	Have an accredited BOSS service agent replace indicator light.
3. Input power supply is ON and indicator light is lit but when the gun trigger switch is depressed nothing happens.	Gun trigger switch leads are disconnected.	Reconnect.
4. Input power supply voltage is ON, no wire feed but gas flows from the MIG gun when the gun trigger switch is depressed.	A Electrode wire stuck in conduit liner or contact up (burn-back jam). B Faulty control PCB.	A Check for clogged/ kinked MIG gun conduit or worn contact tip, replace faulty components. B Have an accredited BOSS service agent investigate the faulty.
5. Wire feeds when the gun trigger switch is depressed but arc can not be established.	Poor or no work lead connection.	Clean work clamp area and ensure good electrical contact.
6. Wire continues to feed when the gun trigger switch is released.	The mode selector switch has been set to 4T (latch operation).	Set the mode selector switch to 2T (normal operation).
7. Jerky wire feed.	A Worn or dirty contact tip. B Worn feed roll. C Excessive back tension from wire reel hub. D Worn, kinked or dirty conduit liner.	A Replace. B Replace. C Reduce brake tension on spool hub. D Clean or replace conduit liner.
8. No gas flow.	A Gas hose is cut. B Gas passage contains impurities. C Gas regulator turned off.	A Replace or repair. B Disconnect gas hose from the rear of BOSS MIG series or then raise gas pressure and blow out the impurities. C Turn on the gas regulator.
9. Gas flow continues after the gun trigger switch has been released.	Gas valve has jammed open due to impurities in the gas or gas line.	Have an accredited BOSS service agent repair or replace gas valve.

Table 12

8.0 PART LIST

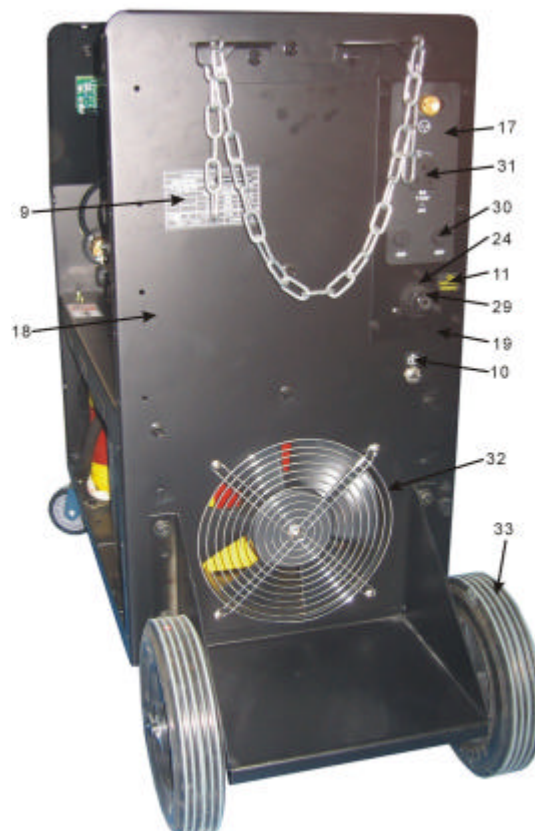


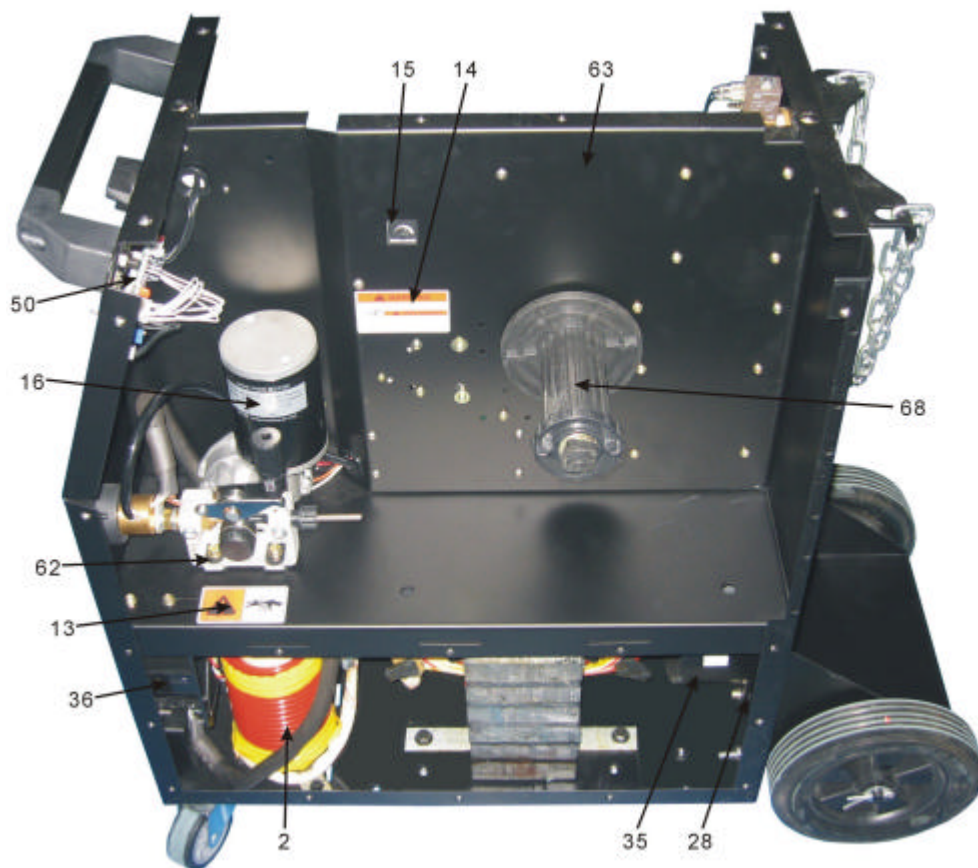




Figure 9

Sequence	Order No	Name	QTY.			
			MIG 185	MIG 202	MIG 255	MIG 275
1	3EER32002	TRANSFORMER,POWER ASSY,221	1	1		
1	3EER32003	TRANSFORMER,POWER ASSY,251			1	
1	3EER32013	TRANSFORMER,POWER ASSY,250				1
2	3EER23001	INDUCTOTR ASSY,	1	1	1	1
3	3KITP003301001	RECTIFIER,OUTPUT 3PH 250				1
3	3KITP003301003	RECTIFIER,OUTPUT 1PH 221	1	1		
3	3KITP003301004	RECTIFIER,OUTPUT 1PH 251			1	
4	3KITP002610020	BOARD,PCB,REALY (7.828.007)	1	1	1	1
5	3KITP000112001	VALVE AC220V	1	1	1	1
6	4KNCROT95	THERMOSTAT	1	1	1	1
7	2LAU8803009	LABEL (+)	1	1	1	1
8	2LAU8803010	LABEL (-)	1	1	1	1
9		LABEL MANUFACTURERS RATING 185 BOSS	1			
9		LABEL MANUFACTURERS RATING 202 BOSS		1		
9		LABEL MANUFACTURERS RATING 255 BOSS			1	
9		LABEL MANUFACTURERS RATING 275 BOSS				1
10	2LAM8800003	LABEL GROUND	1	1	1	1
11	2LAM8800001	LABEL VOLTAGE INPUT 240V 1PH	1	1	1	
11	2LAM8806006	LABEL VOLTAGE INPUT 415V 3PH				1
12	2LAM8806013	LABEL INPUT 0-220-240	1	1	1	
12	2LAM8806014	LABEL INPUT L1-L2-L3				1

13	2LAW8805002	LABEL WARNING	1	1	1	1
14	2LAW8805004	LABEL WARNING	1	1	1	1
15	2LAC8807053	LABEL BURNBACK	1	1	1	1
16	2LAV8817013	LABEL WIRE DRIVE	1	1	1	1
17	2LAR8806016	LABEL REAR	1	1	1	1
18	2FPB6123047	BASE FP6.123.047	1	1	1	1
19		PANEL REAR FP8.610.108	1	1	1	1
20	2FPBM8604042	BASE CYLINDER FP8.604.042	1	1	1	1
21		BRACKET CYLINDER FP6.615.001	1	1	1	1
22	2FPZ8319001	AXLE FP8.319.001	1	1	1	1
23	2FPBS8634006	BRACKET,MOUNTING FP8.634.006 (Inside)	1	1	1	1
24		BRACKET PG13.5 MOUNTING FP8.610.059	1	1		
25	4KCF3X3	SWITCH COARSE				1
25	4KCF4X4	SWITSH COARSE/FINE	2	2	2	
26	4KCF3X7	SWITCH FINE				1
27	2FP7854016	KNOB	2	2	2	2
28	4BFTDQ001D5	SPACER,NYLON 凸 D5	8	8	8	8
29	4SXJPG13R5	BUSHING,STRAIN RELIEF PG13.5	1	1		
29	4SXJPG29	BUSHING,STRAIN RELIEF PG29			1	1
30	4FUSH15X250XD6	FUSE HOLDER	2	2	2	2
31	4XSP6BH3	SOCKET 115V	1	1	1	1
32	4FANCSA200F	FAN COVER	1	1	1	1
33	4TRU8X1R75	WHEEL	2	2	2	2
34	4TRU2202396	CASTOR SWIVEL	2	2	2	2
35	4FAN001SA200F	FAN	1	1	1	1
36	4FAN001SA1725	FAN			2	
37	4EER400108	TRANSFORMER CONTROL BOD100	1	1	1	1
38	4EER400118	TRANSFORMER CONTROL BOD250				1
38	4EER400114	TRANSFORMER CONTROL BOD250	1	1	1	
39	4RX27D20W0R47H	RESISTOR 20W 0.47 OHM	2	2	2	2
40	4FUSH5A	FUSE LINE HOLDER (Inside)	1	1	1	1
41	4KNX203	SWITCH KNX203	1	1	1	1
42	4WTH1A2W5K	POTENTIONMETER 2W 5K	1	1	1	1
43	4WTH1A2W100K	POTENTIONMETER 2W 100K	1	1	1	1
44	4WP143102A	RECEPTACLE 14 PIN	1	1	1	1
45	4KNX202	SWITCH KNX202	1	1	1	1
46	8HSTD16RD	HEAT SHRINKABLE TUBE (Inside)	0.08	0.08	0.08	0.08
	8FWCD35BK	WELDING CABLE 35 (Inside)	0.25	0.25	0.25	0.25
	4SNOCS400B	SENSOR 400B (Inside)	1	1	1	1
	4TER50D8	CABLE LUG 50-8 (Inside)	1	1	1	1
	4TER50D12	CABLE LUG 50-12 (Inside)	1	1	1	1

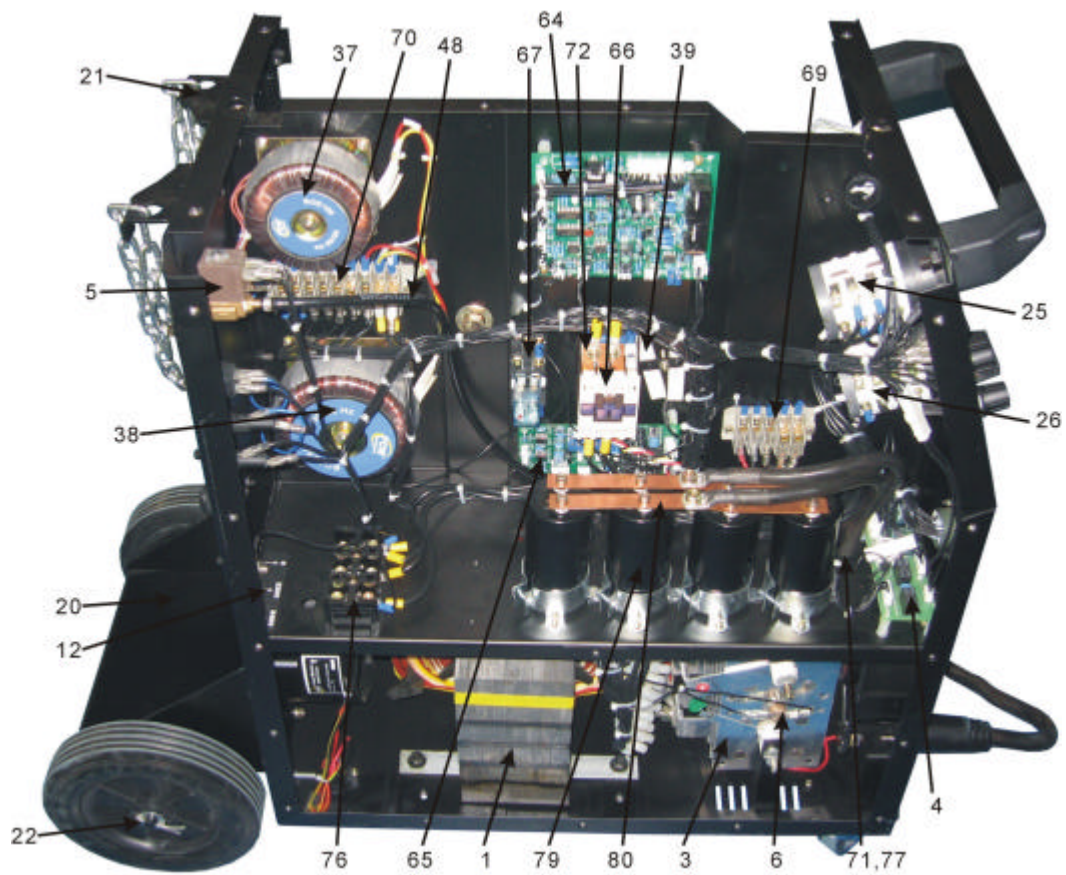

47	8HSTD16RD	HEAT SHRINKABLE TUBE	0.04	0.04	0.04	0.04
	8FWCD35BK	WELDING CABLE 35	0.7	0.7	0.7	0.7
	4SJM24	BUSHING,STRAIN RELIEF M24	1	1	1	1
	7GS50CC001M	CABLE CONNECTOR MALE 50	1	1	1	1
	4TER50D12	CABLE LUG 50-12	1	1	1	1
48	8HPVC5X8BK001	GAS HOSE 5*8	0.7	0.7	0.7	0.7
49	2FPPF6176000	PANEL,FRONT (6.176.000)	1	1	1	1
50	3KITP002706011	BOARD,PCB,DISPLAY-A (7.824.002A)	1	1	1	1
51	2LAC8807257	OVERLAY CONTROL 185 BOSS	1			
51	2LAC8807258	OVERLAY CONTROL 202 BOSS		1		
51	2LAC8807259	OVERLAY CONTROL 255 BOSS			1	
51	2LAC8807260	OVERLAY CONTROL 275 BOSS				1
52	2FP7854006	INSULATOR POTENTIONMETER	2	2	2	2
	2FP7854007	INSULATOR POTENTIONMETER	2	2	2	2
53	4V2FLEDN01D7R5	LED HOLDER UPPER	2	2	2	2
	4V2FLEDH01D6	LED HOLDER LOWER	2	2	2	2
54	4V2FDLEDD5GN	LED GN	1	1	1	1
	4V2FDLEDS01D5	LED BASE	1	1	1	1
55	4V2FDLEDD5RD	LED RD	1	1	1	1
	4V2FDLEDS01D5	LED BASE	1	1	1	1
56	2FP7854004	INSULATOR BULKHEAD FRONT	2	2	2	2
57	2FP7854008	INSULATOR BULKHEAD REAR	2	2	2	2
58	2GS50CC001FP	RECEPTACLE,TWIST LOCK(FEMALE) POWER	2	2	2	2
59	4KCD221BK	SWITCH	1	1	1	1
60	4KCD221BK	KNOB	2	2	2	2
61	4HDL00005	HANDLE	1	1	1	1
62	2FP7854018	INSULATOR WIRE DRIVE	2	2	2	2
63	2FPUT8038024	PANEL CENTER	1	1	1	1
64	3KITP003403001	BOARD,PCB,WIRE DRIVE (7.820.506B)	1	1	1	1
65	3KITP002706016	BOARD,PCB,DISPLAY-B (7.824.002B-02)	1	1	1	1
66	4KNC11810M5	CONTACTOR NC1-1810/220V				1
66	4KNC11801220	CONTACTOR NC1-1801/220V	1	1	1	
67	4KSG13F10A220VAC	RELAY	1	1	1	
	4KSG13F	RELAY HOLDER	1	1	1	
		RELAY CLAMP	1	1	1	
68	2BAR65002	SUPPORT SPOOL	1	1	1	1
69	4CC010206	TERMINAL 2*5	1	1	1	1
70	4CC010207	TERMINAL 2*9	1	1	1	1
71	4WRKSSBS26	BUSHING SNAP BS26	2	2	2	2
72	3BB7725048	STRAP				2
73	2FPUT8038023	PANEL UPPER TRAY	1	1	1	1

74	2FPBM8604036	BRACKET FAN MOUNTING UPPER (Inside)			1	
75	2FPBM8604037	BRACKET FAN MOUNTING LOWER (Inside)			1	
76	4CC010203	TERMINAL 2*3	1	1	1	1
77	4WRKSSBS26	BUSHING SNAP BS26	4	4	4	4
78	4WRNB1216	BUSHING SNAP (Inside)	1	1	1	1
79	4CDJ63V22000	CAPACITOR 63V22000uF	4	4	4	4
80	3BB7725057	BUS BAR	2	2	2	2
81	2FPPT8048047Y	PANEL TOP	1	1	1	1
82	2FPPT6170006Y	PANEL LEFT SIDE UPPER	1	1	1	1
83	2FPPT8048034Y	PANEL LEFT SIDE LOWER	1	1	1	1
84	2LAW8805000	LABEL WARNING	1	1	1	1
85	2PST8634002	LATCH SLIDE	2	2	2	2
86	2LAS8809040	LABEL BOSS	2	2	2	2

Table 13

9.0 REMARK

- 9.1 Welding machines rear panels meet the plume to have good to turn on the earth grounding, by guarantees the welder safety. When welder operation, should wear protects the mirror, the glove, puts on protects the clothing.
- 9.2 When the electrical network voltage is higher than 240V/260V (MIG 185, 202, 255) or 460V (MIG 275), the out-put will appear the class, the overload, the welding machine automatically has stopped outputting and giving the red candle demonstration warning.
- 9.3 Ambient temperatures high when big electric current long time continuous working, the welding machine has stopped because of the heat outputting, gets down until the temperature drop only then restores.
- 9.4 When welding machines do not use temporarily, its depository should maintain dryly, cleanly. The environment relative humidity is not bigger than 85%.
- 8.5 Storing ambient temperature is -25 ~ +55 .
- 8.6 When long-time does not use, every two months should electrify a time, a humidity month of every two week should electrify use a time, by use own thermal row of tide.