



OM-187 476D March 2003

Effective with serial number: 195 503

Processes



MIG (GMAW) Welding
Flux Cored (FCAW)


Description



Arc Welding Power Source

CE

Blu-Pak 35/45

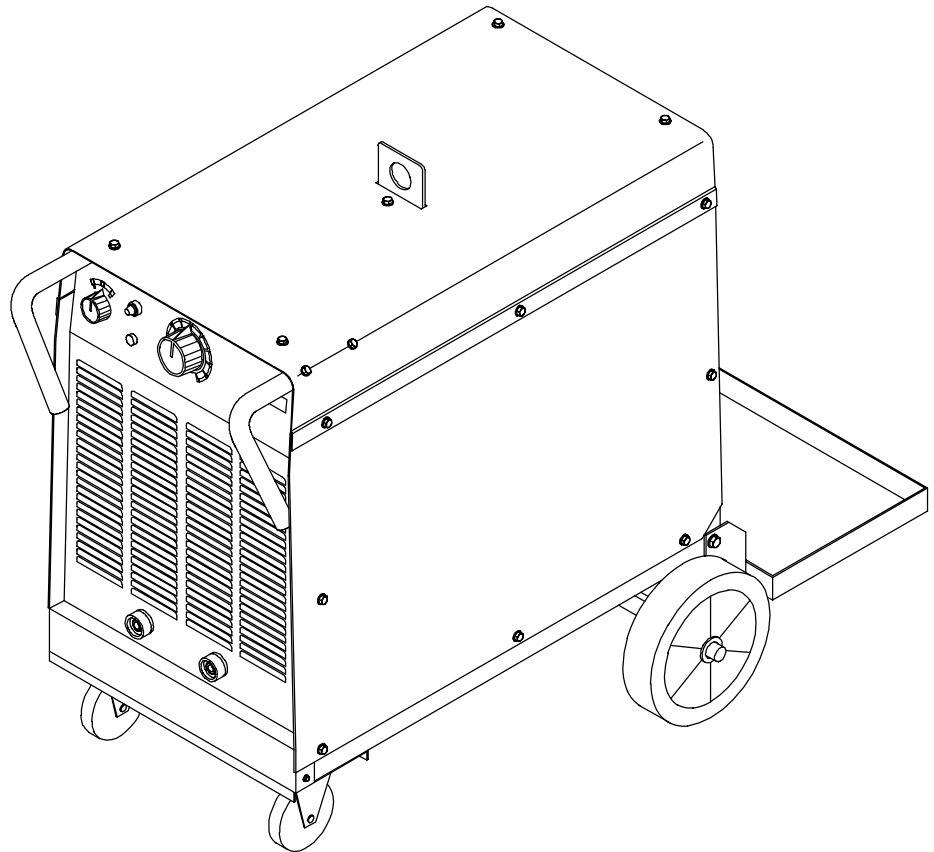

Visit our website at
www.MillerWelds.com

OWNER'S MANUAL

From Miller to You

Thank you and congratulations on choosing Miller. Now you can get the job done and get it done right. We know you don't have time to do it any other way.

That's why when Niels Miller first started building arc welders in 1929, he made sure his products offered long-lasting value and superior quality. Like you, his customers couldn't afford anything less. Miller products had to be more than the best they could be. They had to be the best you could buy.

Today, the people that build and sell Miller products continue the tradition. They're just as committed to providing equipment and service that meets the high standards of quality and value established in 1929.

This Owner's Manual is designed to help you get the most out of your Miller products. Please take time to read the Safety precautions. They will help you protect yourself against potential hazards on the worksite. We've made installation and operation quick and easy. With Miller you can count on years of reliable service with proper maintenance. And if for some reason the unit needs repair, there's a Troubleshooting section that will help you figure out what the problem is. The parts list will then help you to decide which exact part you may need to fix the problem. Warranty and service information for your particular model are also provided.



Miller Electric manufactures a full line of welders and welding related equipment. For information on other quality Miller products, contact your local Miller distributor to receive the latest full line catalog or individual catalog sheets.



Working as hard as you do – every power source from Miller is backed by the most hassle-free warranty in the business.



TABLE OF CONTENTS

SECTION 1 – SAFETY PRECAUTIONS–READ BEFORE USING	1
1-1. Symbol Usage	1
1-2. Arc Welding Hazards	1
1-3. Additional Symbols for Installation, Operation, and Maintenance	3
1-4. EMF Information	3
SECTION 2 – DEFINITIONS	4
SECTION 3 – INTRODUCTION	6
3-1. Included with Your Unit	6
3-2. Specifications	6
3-3. Duty Cycle Chart	6
3-4. Volt-Ampere Curves	6
SECTION 4 – INSTALLATION	7
4-1. Selecting a Location	7
4-2. Typical MIG Connections	7
4-3. Electrical Service Guide	8
4-4. Connecting Input Power	8
4-5. Remote 14 Receptacle RC1	8
SECTION 5 – OPERATION	9
5-1. Controls	9
SECTION 6 – MAINTENANCE AND TROUBLESHOOTING	10
6-1. Routine Maintenance	10
6-2. Troubleshooting	10
SECTION 7 - ELECTRICAL DIAGRAM	11
SECTION 8 - PARTS LIST	12
WARRANTY	

Declaration of Conformity

Manufacturer's Name: **MILLER Europe S.r.l.**

Manufacturer's Address: Via Privata Iseo, 6/E
20098 San Giuliano
Milanese, Italy

Declares that this product: **Blu-Pak 35/45**

Conforms to the following Directives and Standards:

Directives

Electromagnetic Compatibility Directives: 89/336/EEC

Low Voltage: 73/23/EEC

Machinery Directives: 89/392/EEC

And their amendments 91/368/EEC, 93/31/EEC, 93/44/EEC, 93/68/EEC

Standards

Electromagnetic compatibility (EMC) Product standard for arc welding equipment: EN50199: August 1995

Safety Requirements for Arc Welding Equipment Part 1: EN 60974-1: 1989

European Contact: Ing. Danilo Fedolfi, Managing Director
ITW WELDING PRODUCTS ITALY S.r.l.
Via Privata Iseo, 6/E
20098 San Giuliano
Milanese, Italy

Telephone: 39(0)298290-1
Fax: 39(0)298290-203

SECTION 1 – SAFETY PRECAUTIONS—READ BEFORE USING

som_woPSS_7/02

1-1. Symbol Usage



Means Warning! Watch Out! There are possible hazards with this procedure! The possible hazards are shown in the adjoining symbols.

▲ Marks a special safety message.

☞ Means “Note”; not safety related.



This group of symbols means Warning! Watch Out! possible ELECTRIC SHOCK, MOVING PARTS, and HOT PARTS hazards. Consult symbols and related instructions below for necessary actions to avoid the hazards.

1-2. Arc Welding Hazards

▲ The symbols shown below are used throughout this manual to call attention to and identify possible hazards. When you see the symbol, watch out, and follow the related instructions to avoid the hazard. The safety information given below is only a summary of the more complete safety information found in the Safety Standards. Read and follow all Safety Standards.

▲ Only qualified persons should install, operate, maintain, and repair this unit.

▲ During operation, keep everybody, especially children, away.



ELECTRIC SHOCK can kill.


Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.

- Do not touch live electrical parts.
- Wear dry, hole-free insulating gloves and body protection.
- Insulate yourself from work and ground using dry insulating mats or covers big enough to prevent any physical contact with the work or ground.
- Do not use AC output in damp areas, if movement is confined, or if there is a danger of falling.
- Use AC output ONLY if required for the welding process.
- If AC output is required, use remote output control if present on unit.
- Disconnect input power or stop engine before installing or servicing this equipment. Lockout/tagout input power according to OSHA 29 CFR 1910.147 (see Safety Standards).
- Properly install and ground this equipment according to its Owner's Manual and national, state, and local codes.
- Always verify the supply ground – check and be sure that input power cord ground wire is properly connected to ground terminal in disconnect box or that cord plug is connected to a properly grounded receptacle outlet.
- When making input connections, attach proper grounding conductor first – double-check connections.
- Frequently inspect input power cord for damage or bare wiring – replace cord immediately if damaged – bare wiring can kill.
- Turn off all equipment when not in use.
- Do not use worn, damaged, undersized, or poorly spliced cables.

- Do not drape cables over your body.
- If earth grounding of the workpiece is required, ground it directly with a separate cable.
- Do not touch electrode if you are in contact with the work, ground, or another electrode from a different machine.
- Use only well-maintained equipment. Repair or replace damaged parts at once. Maintain unit according to manual.
- Wear a safety harness if working above floor level.
- Keep all panels and covers securely in place.
- Clamp work cable with good metal-to-metal contact to workpiece or worktable as near the weld as practical.
- Insulate work clamp when not connected to workpiece to prevent contact with any metal object.

SIGNIFICANT DC VOLTAGE exists after removal of input power on inverters.

- Turn Off inverter, disconnect input power, and discharge input capacitors according to instructions in Maintenance Section before touching any parts.

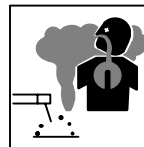

FUMES AND GASES can be hazardous.

Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

- Keep your head out of the fumes. Do not breathe the fumes.
- If inside, ventilate the area and/or use exhaust at the arc to remove welding fumes and gases.
- If ventilation is poor, use an approved air-supplied respirator.
- Read the Material Safety Data Sheets (MSDSs) and the manufacturer's instructions for metals, consumables, coatings, cleaners, and degreasers.
- Work in a confined space only if it is well ventilated, or while wearing an air-supplied respirator. Always have a trained watch-person nearby. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.
- Do not weld in locations near degreasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapors to form highly toxic and irritating gases.
- Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and if necessary, while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.



ARC RAYS can burn eyes and skin.

Arc rays from the welding process produce intense visible and invisible (ultraviolet and infrared) rays that can burn eyes and skin. Sparks fly off from the weld.

- Wear a welding helmet fitted with a proper shade of filter to protect your face and eyes when welding or watching (see ANSI Z49.1 and Z87.1 listed in Safety Standards).
- Wear approved safety glasses with side shields under your helmet.
- Use protective screens or barriers to protect others from flash and glare; warn others not to watch the arc.
- Wear protective clothing made from durable, flame-resistant material (leather and wool) and foot protection.



WELDING can cause fire or explosion.

Welding on closed containers, such as tanks, drums, or pipes, can cause them to blow up. Sparks can fly off from the welding arc. The flying sparks, hot workpiece, and hot equipment can cause fires and burns. Accidental contact of electrode to metal objects can cause sparks, explosion, overheating, or fire. Check and be sure the area is safe before doing any welding.

- Protect yourself and others from flying sparks and hot metal.
- Do not weld where flying sparks can strike flammable material.
- Remove all flammables within 35 ft (10.7 m) of the welding arc. If this is not possible, tightly cover them with approved covers.
- Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas.
- Watch for fire, and keep a fire extinguisher nearby.
- Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.
- Do not weld on closed containers such as tanks, drums, or pipes, unless they are properly prepared according to AWS F4.1 (see Safety Standards).
- Connect work cable to the work as close to the welding area as practical to prevent welding current from traveling long, possibly unknown paths and causing electric shock and fire hazards.
- Do not use welder to thaw frozen pipes.
- Remove stick electrode from holder or cut off welding wire at contact tip when not in use.
- Wear oil-free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap.
- Remove any combustibles, such as a butane lighter or matches, from your person before doing any welding.



FLYING METAL can injure eyes.

- Welding, chipping, wire brushing, and grinding cause sparks and flying metal. As welds cool, they can throw off slag.
- Wear approved safety glasses with side shields even under your welding helmet.



BUILDUP OF GAS can injure or kill.

- Shut off shielding gas supply when not in use.
- Always ventilate confined spaces or use approved air-supplied respirator.




HOT PARTS can cause severe burns.

- Do not touch hot parts bare handed.
- Allow cooling period before working on gun or torch.



MAGNETIC FIELDS can affect pacemakers.


- Pacemaker wearers keep away.
- Wearers should consult their doctor before going near arc welding, gouging, or spot welding operations.

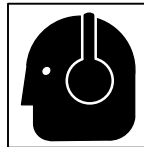

NOISE can damage hearing.

Noise from some processes or equipment can damage hearing.

- Wear approved ear protection if noise level is high.

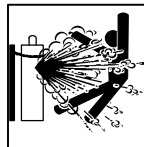

CYLINDERS can explode if damaged.

Shielding gas cylinders contain gas under high pressure. If damaged, a cylinder can explode. Since gas cylinders are normally part of the welding process, be sure to treat them carefully.

- Protect compressed gas cylinders from excessive heat, mechanical shocks, slag, open flames, sparks, and arcs.
- Install cylinders in an upright position by securing to a stationary support or cylinder rack to prevent falling or tipping.
- Keep cylinders away from any welding or other electrical circuits.
- Never drape a welding torch over a gas cylinder.
- Never allow a welding electrode to touch any cylinder.
- Never weld on a pressurized cylinder – explosion will result.
- Use only correct shielding gas cylinders, regulators, hoses, and fittings designed for the specific application; maintain them and associated parts in good condition.
- Turn face away from valve outlet when opening cylinder valve.
- Keep protective cap in place over valve except when cylinder is in use or connected for use.
- Read and follow instructions on compressed gas cylinders, associated equipment, and CGA publication P-1 listed in Safety Standards.

1-3. Additional Symbols for Installation, Operation, and Maintenance



FIRE OR EXPLOSION hazard.

- Do not install or place unit on, over, or near combustible surfaces.
- Do not install unit near flammables.
- Do not overload building wiring – be sure power supply system is properly sized, rated, and protected to handle this unit.




MOVING PARTS can cause injury.

- Keep away from moving parts such as fans.
- Keep all doors, panels, covers, and guards closed and securely in place.




FALLING UNIT can cause injury.

- Use lifting eye to lift unit only, NOT running gear, gas cylinders, or any other accessories.
- Use equipment of adequate capacity to lift and support unit.
- If using lift forks to move unit, be sure forks are long enough to extend beyond opposite side of unit.

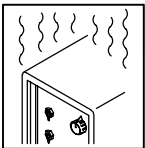

OVERUSE can cause OVERHEATING

- Allow cooling period; follow rated duty cycle.
- Reduce current or reduce duty cycle before starting to weld again.
- Do not block or filter airflow to unit.

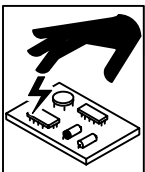

STATIC (ESD) can damage PC boards.

- Put on grounded wrist strap BEFORE handling boards or parts.
- Use proper static-proof bags and boxes to store, move, or ship PC boards.




MOVING PARTS can cause injury.

- Keep away from moving parts.
- Keep away from pinch points such as drive rolls.




WELDING WIRE can cause injury.

- Do not press gun trigger until instructed to do so.
- Do not point gun toward any part of the body, other people, or any metal when threading welding wire.

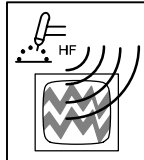

H.F. RADIATION can cause interference.

- High-frequency (H.F.) can interfere with radio navigation, safety services, computers, and communications equipment.
- Have only qualified persons familiar with electronic equipment perform this installation.
- The user is responsible for having a qualified electrician promptly correct any interference problem resulting from the installation.
- If notified by the FCC about interference, stop using the equipment at once.
- Have the installation regularly checked and maintained.
- Keep high-frequency source doors and panels tightly shut, keep spark gaps at correct setting, and use grounding and shielding to minimize the possibility of interference.

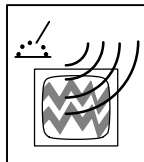

ARC WELDING can cause interference.

- Electromagnetic energy can interfere with sensitive electronic equipment such as computers and computer-driven equipment such as robots.
- Be sure all equipment in the welding area is electromagnetically compatible.
- To reduce possible interference, keep weld cables as short as possible, close together, and down low, such as on the floor.
- Locate welding operation 100 meters from any sensitive electronic equipment.
- Be sure this welding machine is installed and grounded according to this manual.
- If interference still occurs, the user must take extra measures such as moving the welding machine, using shielded cables, using line filters, or shielding the work area.

1-4. EMF Information

Considerations About Welding And The Effects Of Low Frequency Electric And Magnetic Fields

Welding current, as it flows through welding cables, will cause electromagnetic fields. There has been and still is some concern about such fields. However, after examining more than 500 studies spanning 17 years of research, a special blue ribbon committee of the National Research Council concluded that: "The body of evidence, in the committee's judgment, has not demonstrated that exposure to power-frequency electric and magnetic fields is a human-health hazard." However, studies are still going forth and evidence continues to be examined. Until the final conclusions of the research are reached, you may wish to minimize your exposure to electromagnetic fields when welding or cutting.

To reduce magnetic fields in the workplace, use the following procedures:

1. Keep cables close together by twisting or taping them.
2. Arrange cables to one side and away from the operator.
3. Do not coil or drape cables around your body.
4. Keep welding power source and cables as far away from operator as practical.
5. Connect work clamp to workpiece as close to the weld as possible.

About Pacemakers:

Pacemaker wearers consult your doctor first. If cleared by your doctor, then following the above procedures is recommended.

SECTION 2 – DEFINITIONS

Warning! Watch Out! There are possible hazards as shown by the symbols.

1 Electric shock can kill.

1.1 Wear dry insulating gloves. Do not touch electrode with bare hand. Do not wear wet or damaged gloves.

1.2 Protect yourself from electric shock by insulating yourself from work and ground.

1.3 Disconnect input plug or power before working on machine.

2 Breathing welding fumes can be hazardous to your health.

2.1 Keep your head out of the fumes.

2.2 Use forced ventilation or local exhaust to remove the fumes.

2.3 Use ventilating fan to remove fumes.

3 Welding sparks can cause explosion or fire.

3.1 Keep flammables away from welding. Do not weld near flammables.

3.2 Welding sparks can cause fires. Have a fire extinguisher nearby, and have a watchperson ready to use it.


3.3 Do not weld on drums or any closed containers.

4 Arc rays can burn eyes and injure skin.

4.1 Wear hat and safety glasses. Use ear protection and button shirt collar. Use welding helmet with correct shade of filter. Wear complete body protection.

5 Become trained and read the instructions before working on the machine or welding.

6 Do not remove or paint over (cover) the label.

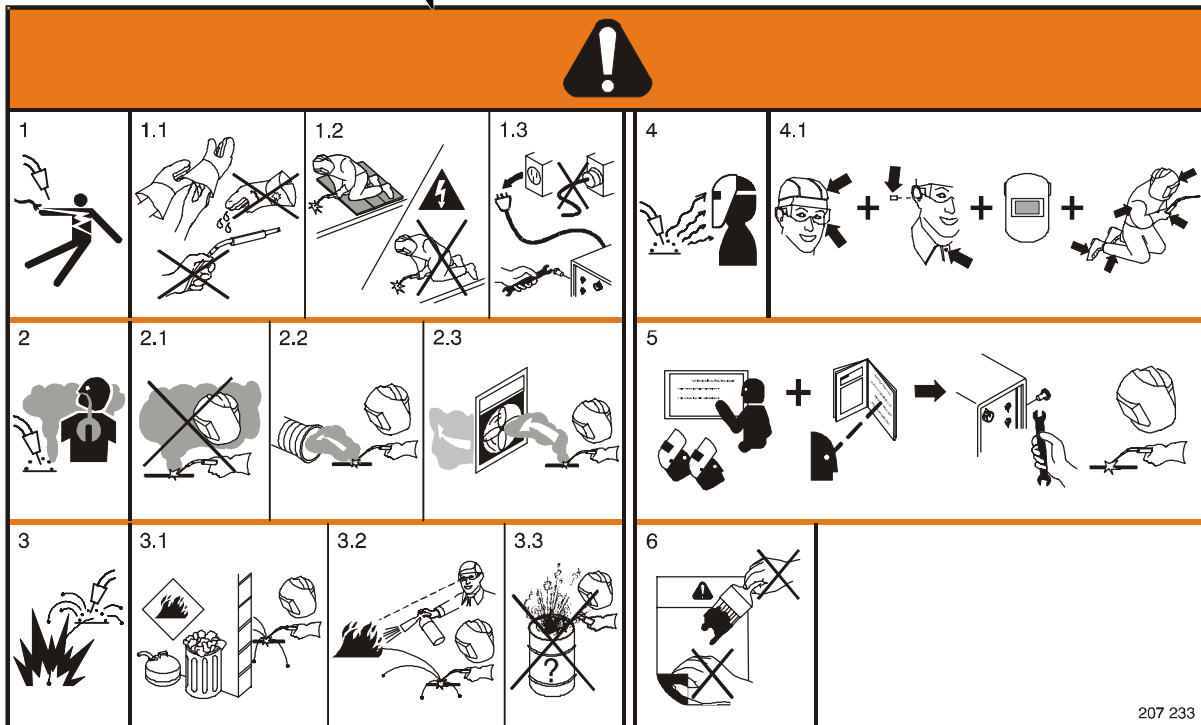

207 233

Warning! Watch Out! There are possible hazards as shown by the symbols.

Electric shock from wiring can kill.

Disconnect input plug or power before working on machine.

Read the Owner's Manual before working on this machine.

- 1 Consult rating label for input power requirements, and check power available at the job site – they must match.
- 2 Read Owner's Manual and inside labels for connection points and procedures.
- 3 Move jumper links as shown on inside label to match voltage at job site.
- 4 Having a loop of extra length, connect grounding conductor first.
- 5 Connect line input conductors as shown on inside label – double-check all connections, jumper link positions, and input voltage before applying power.

207 291

- 1 Warning! Watch Out! There are possible hazards as shown by the symbols.
- 2 Moving parts, such as fans, can cut fingers and hands and cause injury. Keep away from moving parts.


S-176 106

- 1 Warning! Watch Out! There are possible hazards as shown by the symbols.
- 2 Falling unit can cause injury. Do not move or operate unit where it could tip.
- 3 Cylinders can explode if damaged. Protect compressed gas cylinders from excessive heat, mechanical shock, slag, open flames, sparks, and arcs.

207 235

SECTION 3 – INTRODUCTION

3-1. Included with Your Unit

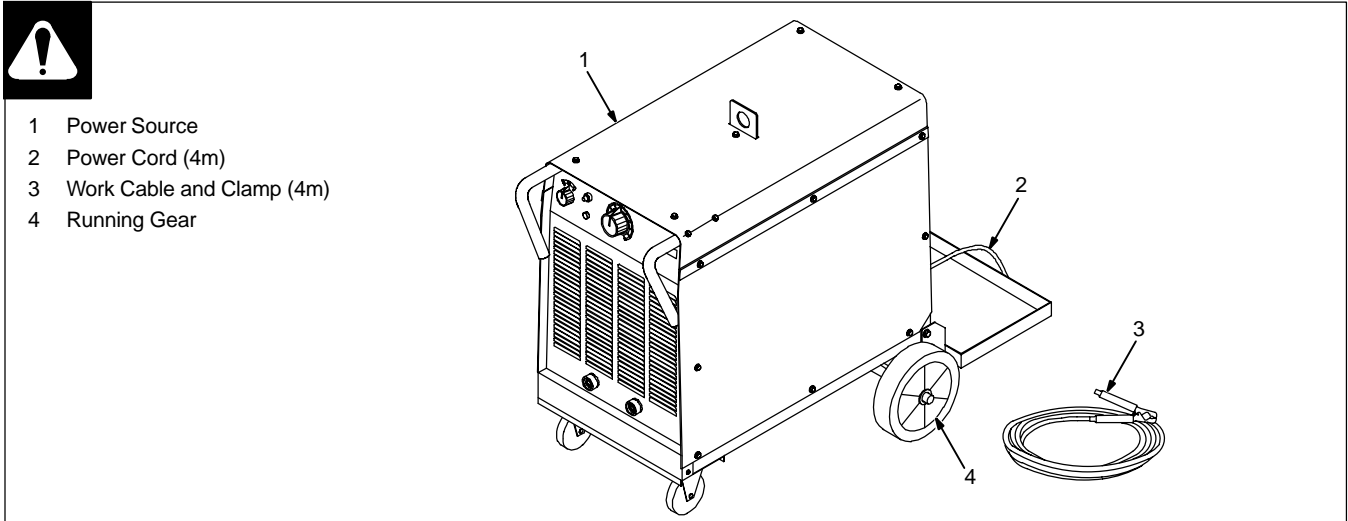


- 1 Power Source
- 2 Power Cord (4m)
- 3 Work Cable and Clamp (4m)
- 4 Running Gear


3-2. Specifications

	Rated Output at 45% Duty Cycle	Welding Range	Max. OVC	Input Rating	KVA	Dimensions	Net Weight
Blu-Pak 35	350 A 32 V	16-32	38	230-31A 400-18A	11.8 KVA	Length: 1040mm Height: 760mm Width: 435mm	146 kg
Blu-Pak 45	450 A 37 V	14-37	47	230-46A 400-27A	17.7 KVA	Length: 1040mm Height: 760mm Width: 435mm	156 kg

3-3. Duty Cycle Chart

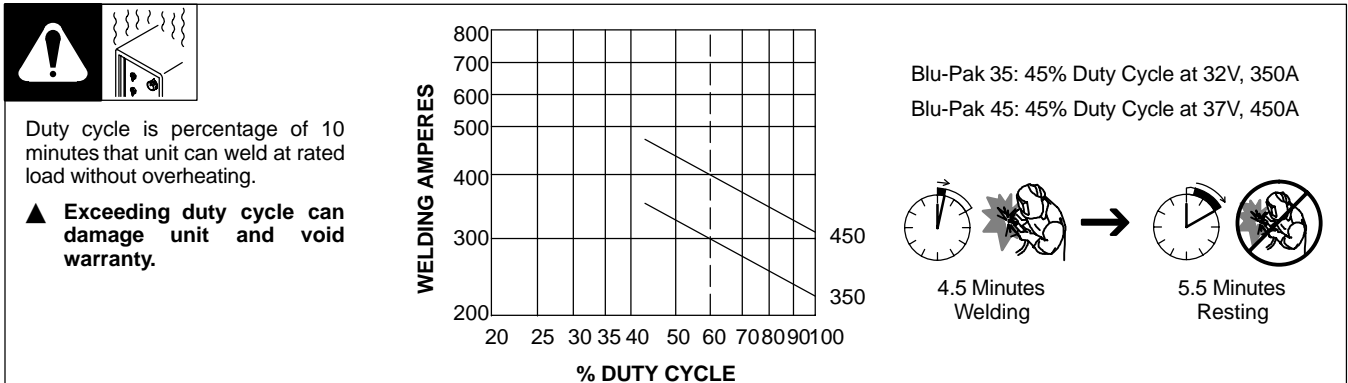


3-4. Volt-Ampere Curves

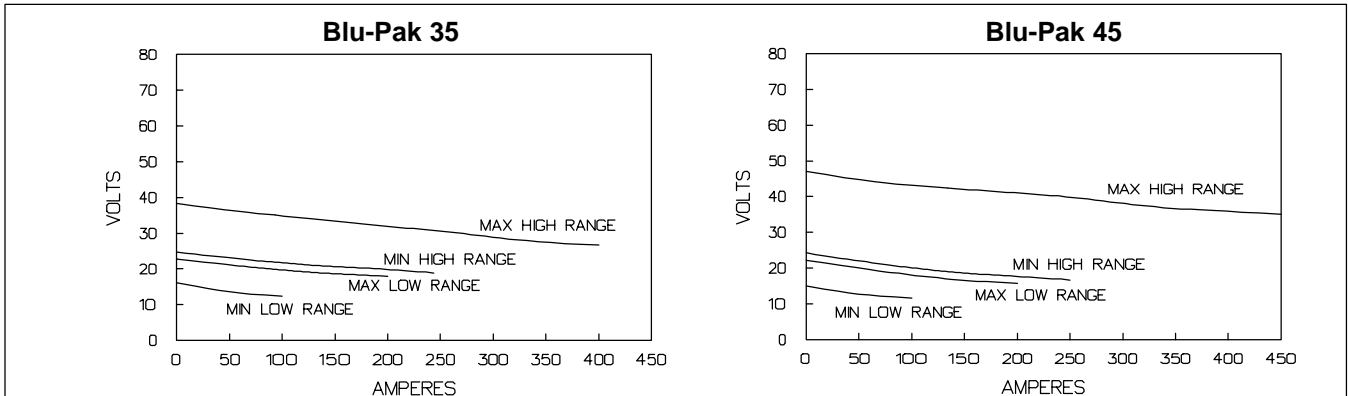

SECTION 4 – INSTALLATION

4-1. Selecting a Location

Position unit so air can circulate.

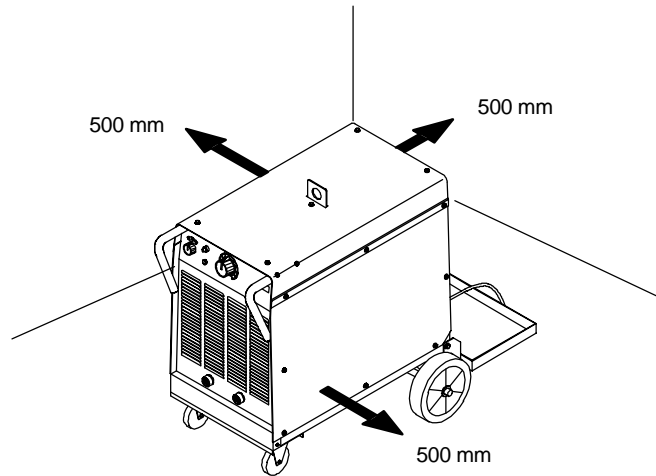

4-2. Typical MIG Connections





- 1 Power source
- 2 Work clamp (connect to receptacle as shown)
- 3 Water cooler for torch
- 4 Cylinder (chain to running gear)
- 5 Cylinder valve

Open valve slightly so gas flow blows dirt from valve. Close valve.

- 6 Regulator/Flow gauge

Install so face is vertical

- 7 Flow adjust
- 8 Gas supply line
- 9 Wire feeder
- 10 MIG torch

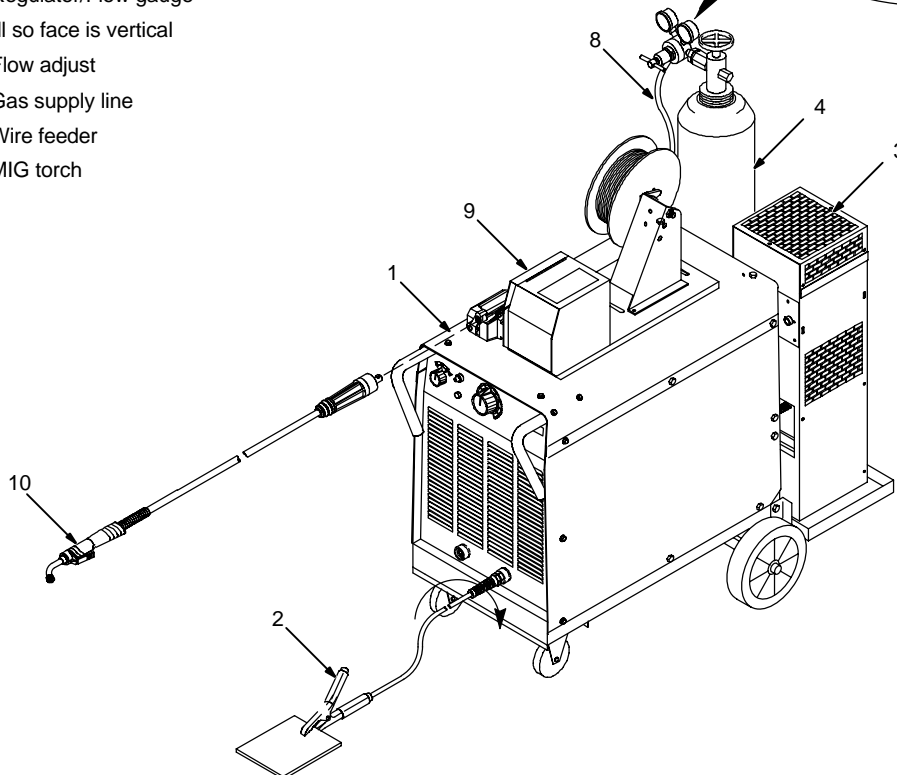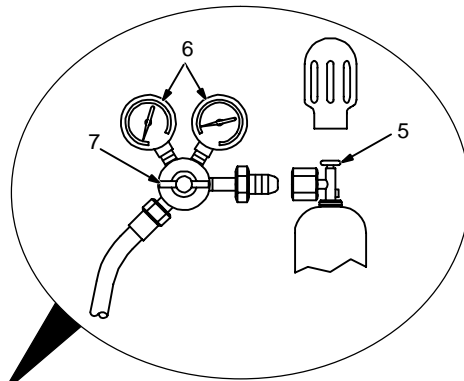


4-3. Electrical Service Guide

Input Voltage	Blu-Pak 35		Blu-Pak 45	
	230	400	230	400
Input amperes at rated output	36A	21A	52A	30A
Fuse or circuit breaker rating (max. rec)	36A	21A	52A	30A
Input conductor size*	6 mm ²	6 mm ²	6 mm ²	6 mm ²
Grounding conductor size**	6 mm ²	6 mm ²	6 mm ²	6 mm ²


* Power cord supplied with the unit is sized for 230V operation.
 ** Larger power cord may be required for cable length greater than 3 meters. Consult national or local regulations.

4-4. Connecting Input Power




- ▲ Have only qualified persons make this installation.
- ▲ Special installation may be required where gasoline or volatile liquids are present – consult national or local regulations.

ST-161 454-A

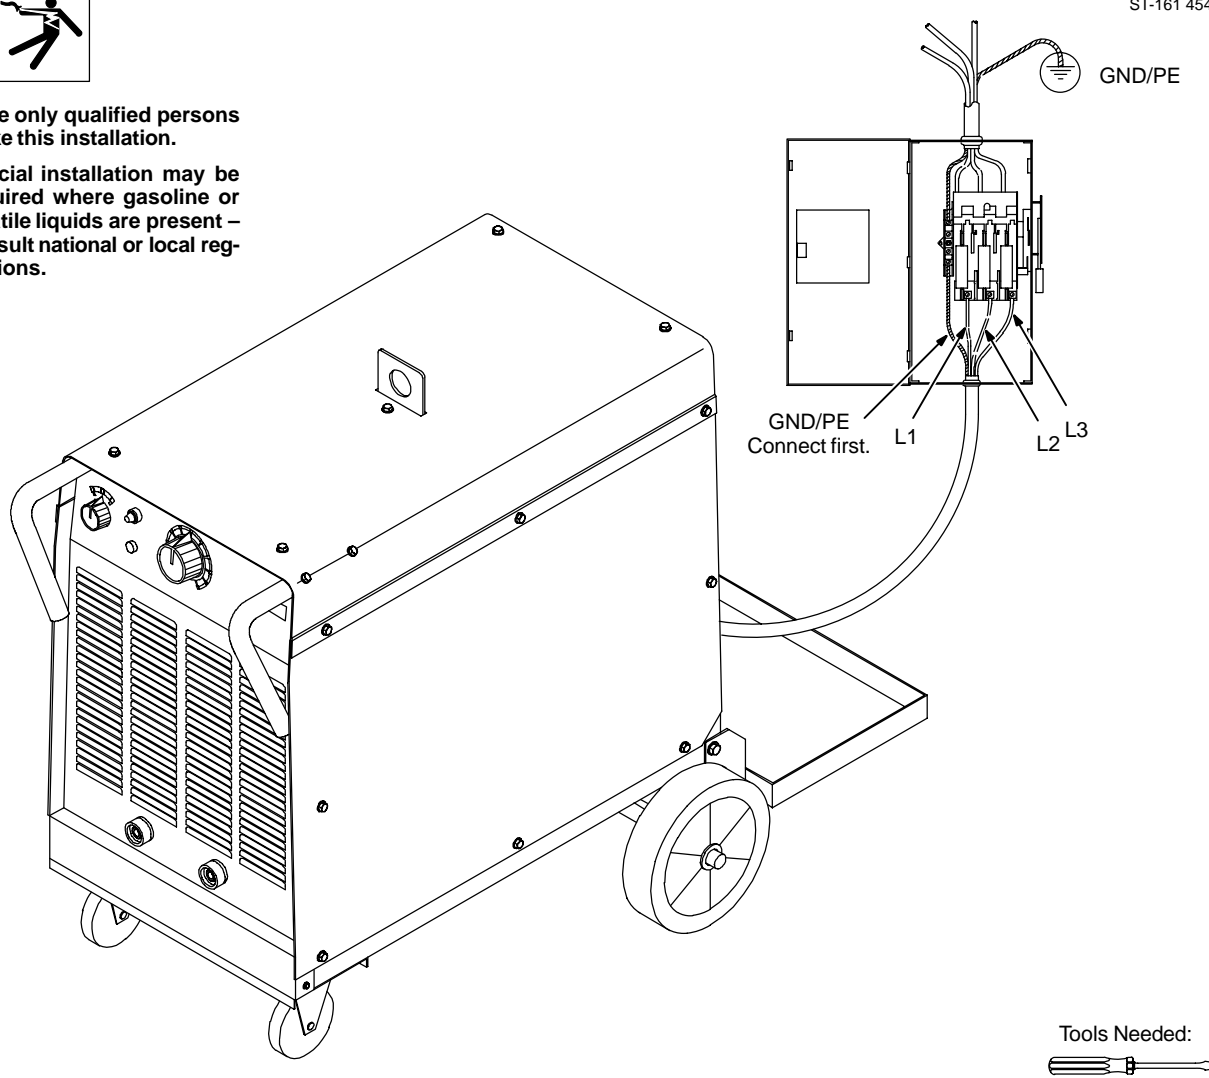



GND/PE
Connect first.

L1 L2 L3

Tools Needed:


4-5. Remote 14 Receptacle RC1

	Socket	Information
24 VOLTS AC  OUTPUT (CONTACTOR)	A	24 volts ac.
	B	Contact closure to A completes 24 volts ac contactor control circuit.
115 VOLTS AC  OUTPUT	I	115 volts AC, protected by fuse.
GND	K	Chassis common.
	G	Circuit common for 24 and 115 volts ac circuits.

SECTION 5 – OPERATION

5-1. Controls

Ref. ST-155 790-F



1 Power Switch

The power switch is a selector knob which permits selection of operation on either of the two available ranges (I and II) and the center position is off.

2 Indicator Lamp

This lights up when the power switch is placed in the ON position.

3 Protection Fuse

Fuse F protects the control circuit. Should it become necessary to replace any fuse in the welding power source, be sure to substitute with one of the same size and rating.

4 High Temperature Shutdown Light

This lights up when unit overheats and shuts down.

5 Use this control to adjust weld voltage 10 position switch. 20 weld setting, 10 high range (I), 10 low range (II).

6 Voltage/Amperage Meter.

Use toggle switch to select voltage or amperage.

7 Low Inductance Negative Output Terminal

Connect work lead here for most "short-arc" applications.

8 High Inductance Negative Terminal

Connect work lead here for stainless steel and spray arc conditions.


9 115 a.c. Receptacle

Located on the rear panel is a receptacle which provides power to the gas heater, when welding with CO₂ shielding gas and for the cooling system.


10 Wire Feeder Power Cable Receptacle

Located on the rear panel is a receptacle used to supply operating power to the wire feed unit.

11 Positive Out Terminal

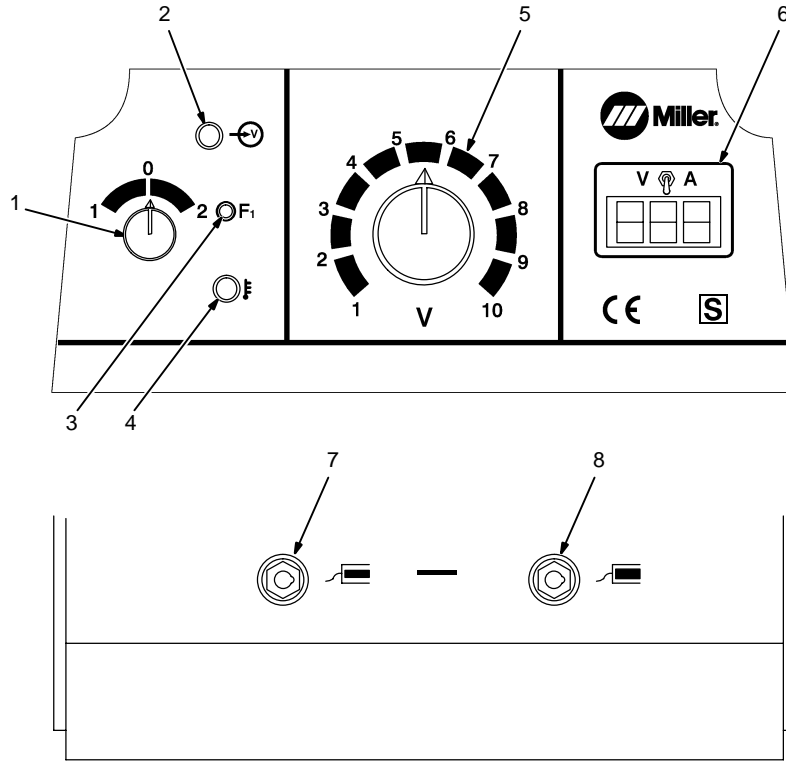

Front Panel

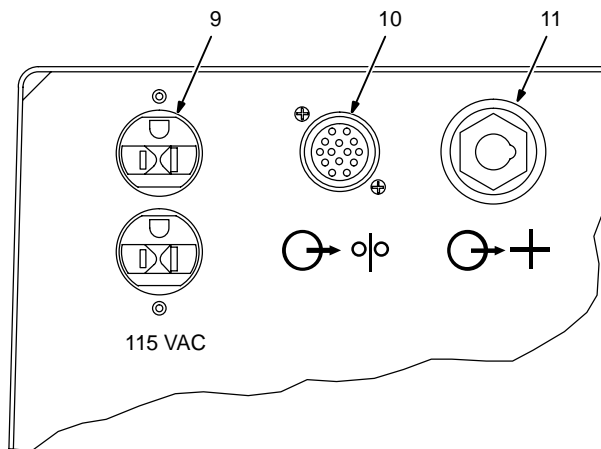

Back Panel

SECTION 6 – MAINTENANCE AND TROUBLESHOOTING

6-1. Routine Maintenance

				<p>▲ Disconnect power before maintaining.</p> <p> <i>Maintain more often during severe conditions.</i></p>
--	--	--	--	---

<p> 3 Months</p>	
<p>Replace unreadable labels.</p>	<p>Clean and tighten weld terminals.</p>
<p>Repair or replace cracked weld cable.</p>	<p>Repair or replace cracked gas hose.</p>
<p>Replace o-ring in Electrode/Gas Output receptacle if cracked.</p>	
<p> 6 Months</p>	
<p>Blow out or vacuum inside.</p>	

6-2. Troubleshooting


--	--	--	--	--	--

Trouble	Remedy
No weld output; fan does not run.	Place line disconnect switch in On position (see Section 4-4).
	Check and replace line fuse(s), if necessary, or reset circuit breaker (see Section 4-4).
	Check for proper input power connections (see Section 4-4).
No weld output; fan on.	Check and replace if necessary (see Section 5-1)
	Tighten wire feeder connection to Remote 14 receptacle.
	Unit overheated. Allow unit to cool (see Section 3-3).
Fan not operating; weld output available.	Check for and remove anything blocking fan movement.
	Have Factory Authorized Service Agent check fan motor.

SECTION 7 - ELECTRICAL DIAGRAM


7-1. Blu-Pak 35/45

cod.956.142.300/956.142.301

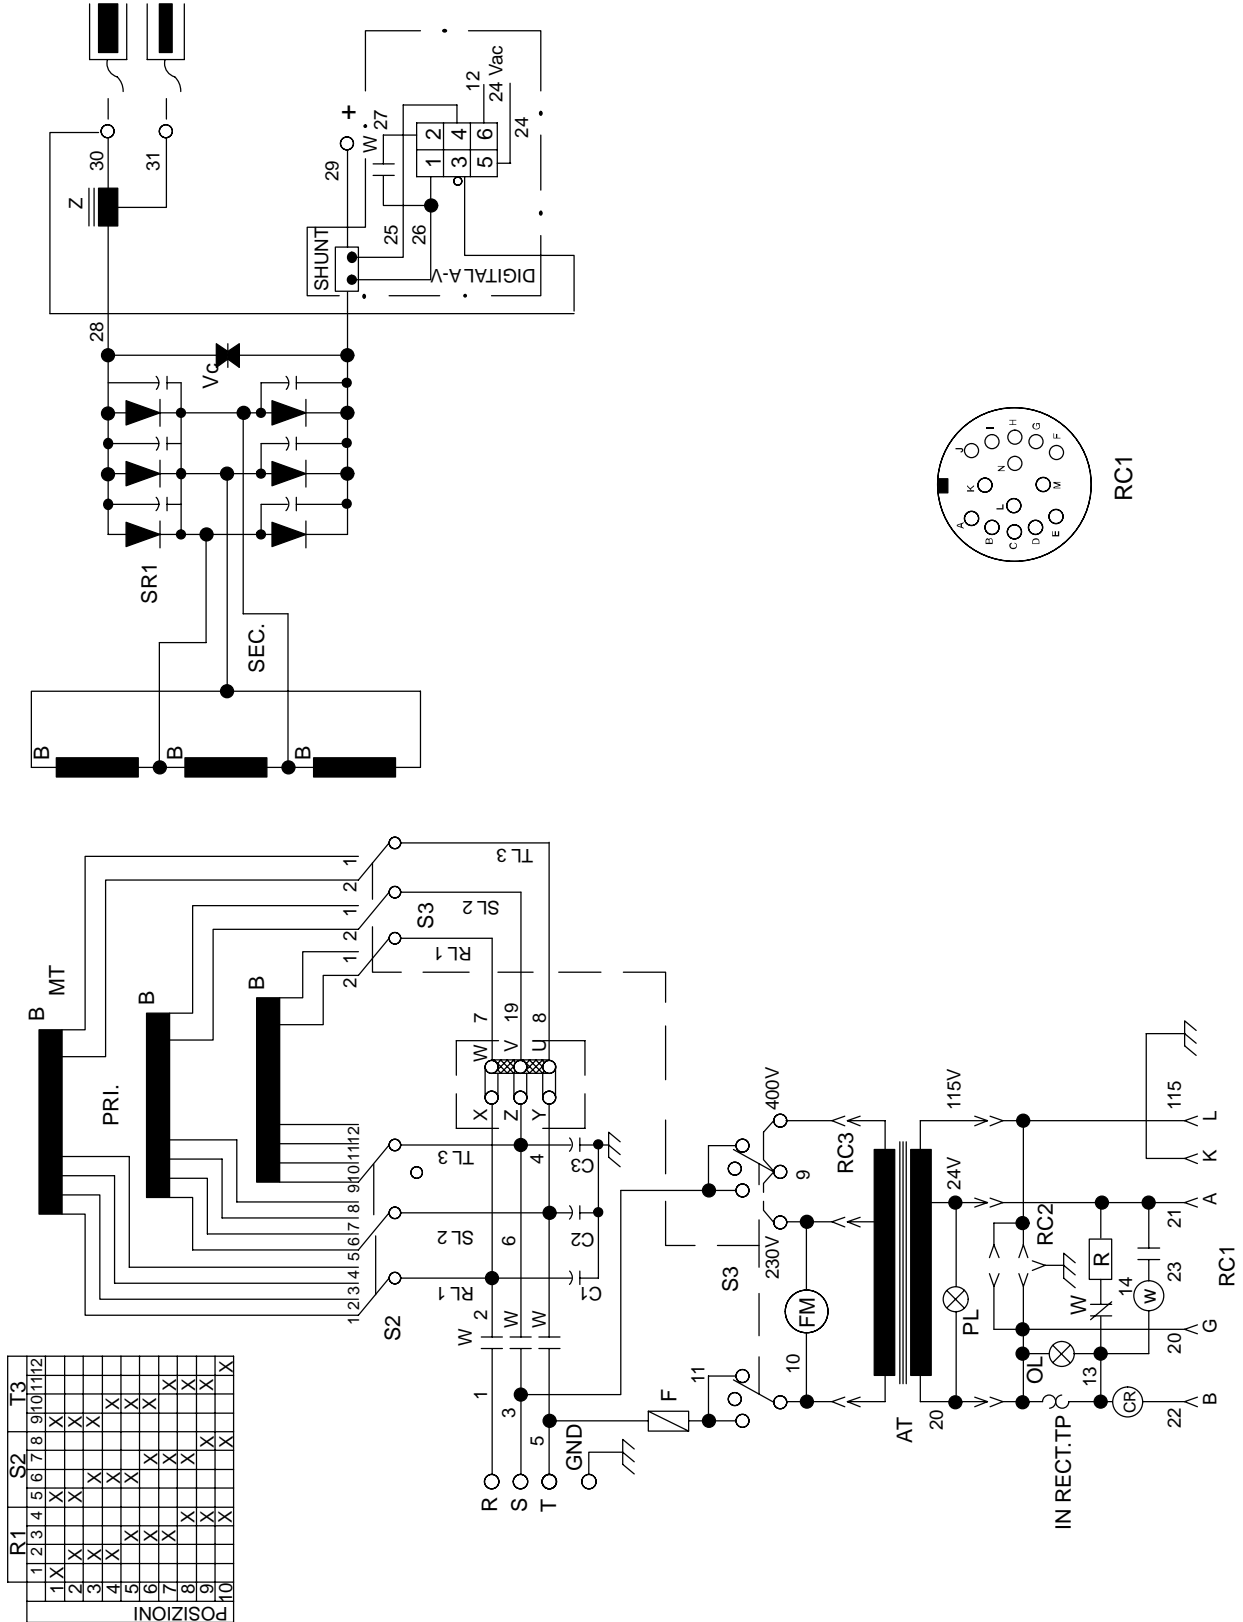

SECTION 8 - PARTS LIST

8-1. Main Assembly

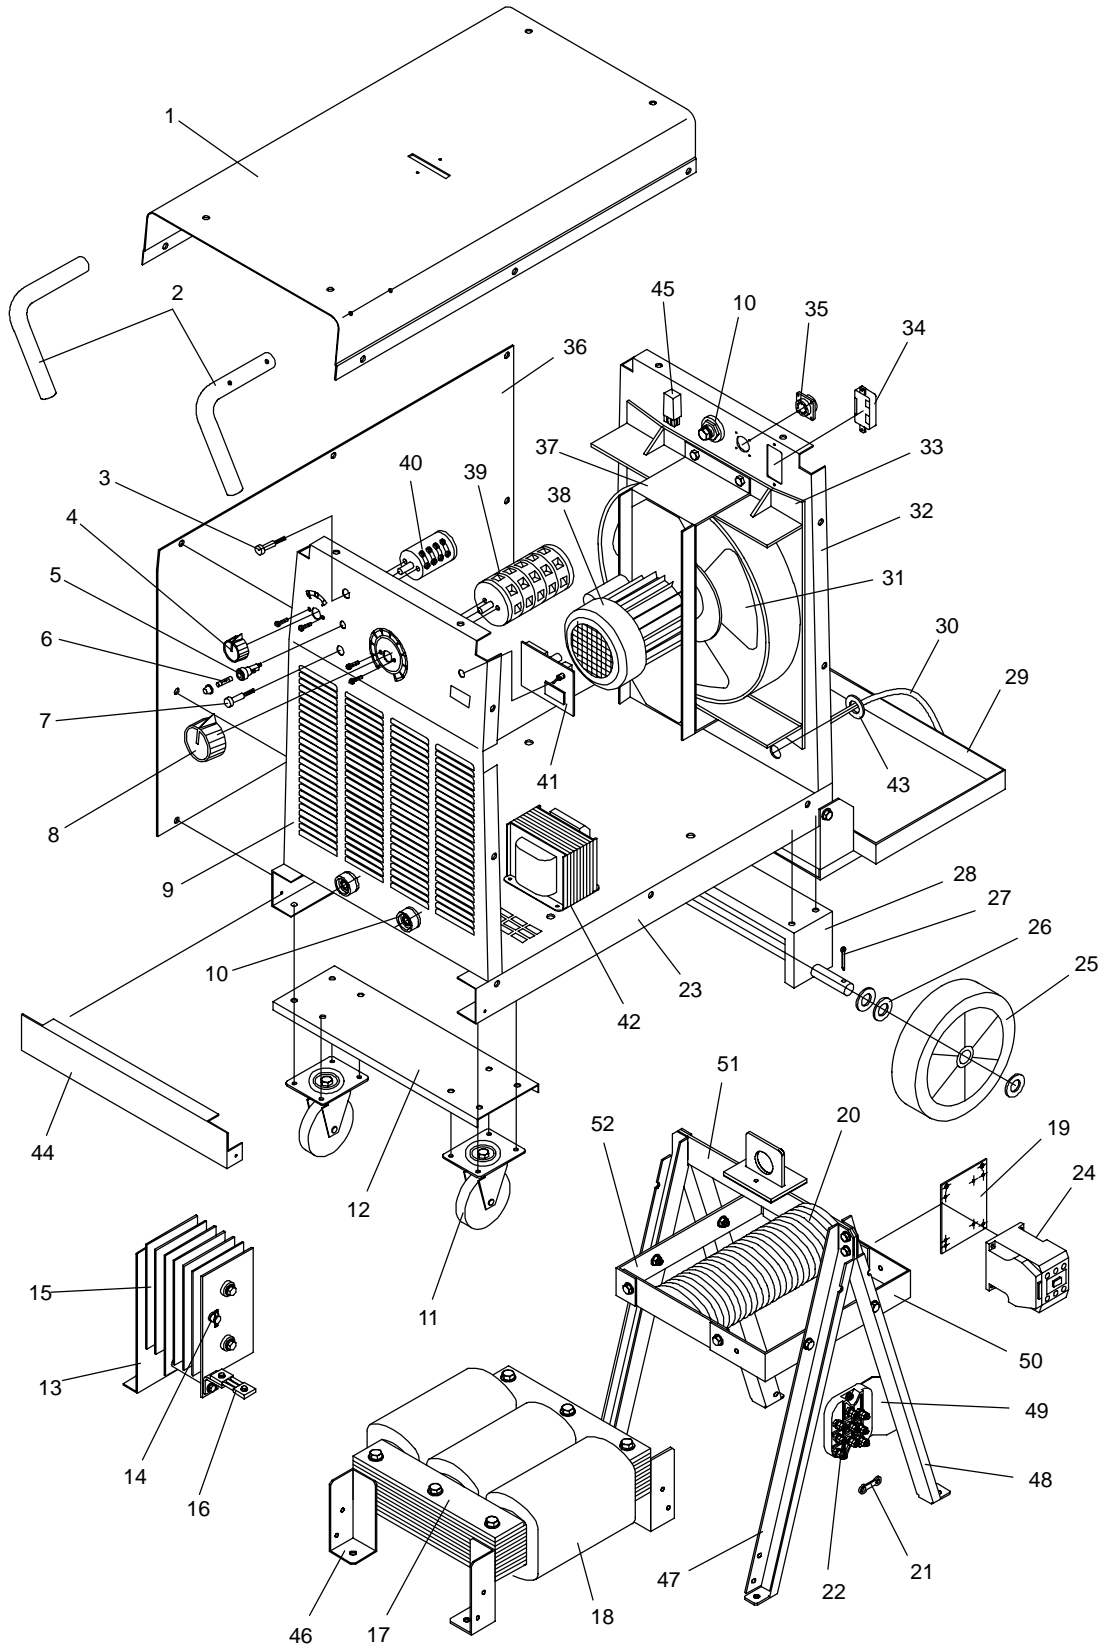

Item	Dia Ref.	Code	Dwg	Qty.		Item	Dia Ref.	Code	Dwg	Qty.	
				35	45					35	45
1		116121119	XH.0.0.3	1	1	25		056054064	VS.0.013	2	2
2		156002023	VS.0.0.15	2	2	26		156009067		6	6
3	PL	056072054	EG.1.0.4	1	1	27		156087017		2	2
4		058020044	VS.0.0.17	1		28		057029005	VS.0.3	1	1
4		056020042	VT.0.0.5		1	29		117029078	VS.0.2	1	1
5		000046432	OL.0.0.14			30		057014030	ML.0.3	1	1
6	F	056092039	EZ.4.0.5	1	1	31		356078032	PZ.0.0.8	1	1
7	OL	056072062	QF.0.0.10	1	1	32		116118151	VS.0.0.3	1	1
8		056020043	VS.0.0.16	1		33		000173283	QB.0.0.13	1	1
8		056020031	MN.3.0.3		1	34	RC2	000604176	EF.6.0.3	1	1
9		116118150	VS.0.0.2	1	1	35	RC1	056076170	FS.1.0.3	1	1
10	50mmq	056076152	DD.0.0.7	3		36	Destra/Right	116122277	VS.0.0.5	1	1
10	70mmq	056076169	DI.11.0.2		3	36	Sinistra/Left	116122278	VS.0.0.6	1	1
11		056054065	VS.0.0.14	2	2	37		000124274	QA.0.4.3	1	1
12		116085123	VS.0.0.8	1	1	38	FM	000116190	QB.0.12	1	1
13		116005081	XH.0.0.11	1	1			(230V, 50/60 Hz)			
14	TP.NC.110°	056159008	QF.0.0.7	1	1	39	S2	056067196	UV.0.011	1	
15	SR1	056050058	HC.0.0.2	1		39	S2	056067205	VT.0.0.3		1
15	SR1	056050017	AS.0.0.1		1	40	S3	056067203	VS.0.0.10	1	
16	SHUNT	056059257	UV.3.0.1	1		40	S3	056067204	VT.0.0.2		1
16	SHUNT	056059262	VT.0.0.1		1	41	A-V	027095012	VS.5.1	1	
17	MT 230/400V	028021447	VS.8	1		41	A-V	027095013	VT.4.1		1
17	MT 230/400V	028021448	VT.6		1	42	AT	058021042	MI.5	1	1
18	PRI. SEC 230/400V	027015542	VS.1.1	3		43		656089005	EZ.5.0.1	1	1
18	PRI. SEC 230/400V	027015541	VT.1.1		3		R	056059189	DH.6.0.4	1	1
19		156031040	VT.0.0.7	1	1		C1-C2-C3	057024004	PG.0.7	1	1
20	Z	028038040	VS.2	1		44		116122280	VS.0.0.11	1	1
20	Z	028038041	VT.2		1	45	CR	000006393	QA.0.0.10	1	1
21		556070011	HD.0.0.2	4	4	46			XH.0.0.10	4	4
22		756069012	BO.0.0.6	1	1	47		156085088	XH.0.0.8	2	2
23		156006030	XH.0.0.6	1	1	48		156085087	XH.0.0.7	2	2
24	W	057079033	VS.0.31	1		49		156031032	XH.0.0.12	1	1
	Aux. Contact	056070038				50		156031034	XH.0.0.14	1	1
24	W	057079034	VT.0.13		1	51		157029012	XH.0.3	1	1
	Aux. Contact	056070038				52		156031033	XH.0.0.13	1	1

TRUE BLUE®

WARRANTY

Effective January 1, 2002

This limited warranty supersedes all previous Miller warranties and is exclusive with no other guarantees or warranties expressed or implied.

LIMITED WARRANTY – Subject to the terms and conditions below, Miller Europe S.r.l., Milan Italy, warrants to its original retail purchaser that new Miller equipment sold after the effective date of this limited warranty is free of defects in material and workmanship at the time it is shipped by Miller. THIS WARRANTY IS EXPRESSLY IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING THE WARRANTIES OF MERCHANTABILITY AND FITNESS.

Within the warranty periods listed below, Miller will repair or replace any warranted parts or components that fail due to such defects in material or workmanship. Miller must be notified in writing within thirty (30) days of such defect or failure, at which time Miller will provide instructions on the warranty claim procedures to be followed.

Miller shall honor warranty claims on warranted equipment listed below in the event of such a failure within the warranty time periods. All warranty time periods start on the date that the equipment was delivered to the original retail purchaser, or one year after the equipment is sent to a European distributor or eighteen months after the equipment is sent to an International distributor.

1. 5 Years Parts – 3 Years Labor
 - * Original main power rectifiers
 - * Inverters (input and output rectifiers only)
2. 3 Years — Parts and Labor
 - * Transformer/Rectifier Power Sources
 - * Plasma Arc Cutting Power Sources
 - * Semi-Automatic and Automatic Wire Feeders
 - * Inverter Power Supplies
 - * Intellitig
 - * Engine Driven Welding Generators except Panther **(NOTE: Engines are warranted separately by the engine manufacturer.)**
3. 2 year – Parts and Labor (Panther only)
(NOTE: Engines are warranted separately by the engine manufacturer.)
4. 1 year – Parts and Labor unless specified
 - * DS-2 Feeder
 - * Motor Driven Guns (w/exception of Spoolguns)
 - * Process Controllers
 - * Positioners and Controllers
 - * Automatic Motion Devices
 - * RFCS Foot Controls
 - * IHPS Power Sources
 - * Water Coolant Systems
 - * Flowgaruge and Flowmeter Regulators (No Labor)
 - * HF Units
 - * Grids
 - * Maxstar 140
 - * Spot Welders
 - * Load Banks
 - * Miller Cyclomatic Equipment
 - * Running Gear/Trailers
 - * Plasma Cutting Torches (except APT & SAF Models)
 - * Field Options
(NOTE: Field options are covered under True Blue® for the remaining warranty period of the product they are installed in, or for a minimum of one year — whichever is greater.)
5. 6 Months — Batteries
6. 90 Days — Parts
 - * MIG Guns/TIG Torches
 - * Induction heating coils and blankets

- * APT, ZIPCUT & PLAZCUT Model Plasma Cutting Torches
- * Remote Controls
- * Accessory Kits
- * Replacement Parts (No labor)
- * Spoolmate Spoolguns
- * Canvas covers

Miller's True Blue® Limited Warranty shall not apply to:

1. **Consumable components; such as contact tips, cutting nozzles, contactors, brushes, slip rings, relays or parts that fail due to normal wear.**
2. Items furnished by Miller, but manufactured by others, such as engines or trade accessories. These items are covered by the manufacturer's warranty, if any.
3. Equipment that has been modified by any party other than Miller, or equipment that has been improperly installed, improperly operated or misused based upon industry standards, or equipment which has not had reasonable and necessary maintenance, or equipment which has been used for operation outside of the specifications for the equipment.

MILLER PRODUCTS ARE INTENDED FOR PURCHASE AND USE BY COMMERCIAL/INDUSTRIAL USERS AND PERSONS TRAINED AND EXPERIENCED IN THE USE AND MAINTENANCE OF WELDING EQUIPMENT.

In the event of a warranty claim covered by this warranty, the exclusive remedies shall be, at Miller's option: (1) repair; or (2) replacement; or, where authorized in writing by Miller in appropriate cases, (3) the reasonable cost of repair or replacement at an authorized Miller service station; or (4) payment of or credit for the purchase price (less reasonable depreciation based upon actual use) upon return of the goods at customer's risk and expense. Miller's option of repair or replacement will be F.O.B., Factory at Appleton, Wisconsin, or F.O.B. at a Miller authorized service facility as determined by Miller. Therefore no compensation or reimbursement for transportation costs of any kind will be allowed.

TO THE EXTENT PERMITTED BY LAW, THE REMEDIES PROVIDED HEREIN ARE THE SOLE AND EXCLUSIVE REMEDIES. IN NO EVENT SHALL MILLER BE LIABLE FOR DIRECT, INDIRECT, SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES (INCLUDING LOSS OF PROFIT), WHETHER BASED ON CONTRACT, TORT OR ANY OTHER LEGAL THEORY.

ANY EXPRESS WARRANTY NOT PROVIDED HEREIN AND ANY IMPLIED WARRANTY, GUARANTY OR REPRESENTATION AS TO PERFORMANCE, AND ANY REMEDY FOR BREACH OF CONTRACT TORT OR ANY OTHER LEGAL THEORY WHICH, BUT FOR THIS PROVISION, MIGHT ARISE BY IMPLICATION, OPERATION OF LAW, CUSTOM OF TRADE OR COURSE OF DEALING, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR PARTICULAR PURPOSE, WITH RESPECT TO ANY AND ALL EQUIPMENT FURNISHED BY MILLER IS EXCLUDED AND DISCLAIMED BY MILLER.

Some states in the U.S.A. do not allow limitations of how long an implied warranty lasts, or the exclusion of incidental, indirect, special or consequential damages, so the above limitation or exclusion may not apply to you. This warranty provides specific legal rights, and other rights may be available, but may vary from state to state.

In Canada, legislation in some provinces provides for certain additional warranties or remedies other than as stated herein, and to the extent that they may not be waived, the limitations and exclusions set out above may not apply. This Limited Warranty provides specific legal rights, and other rights may be available, but may vary from province to province.



Owner's Record

Please complete and retain with your personal records.

Model Name

Serial/Style Number

Purchase Date

(Date which equipment was delivered to original customer.)

Distributor

Address

Country

Zip/Postal Code

Miller Europe

Italy

Phone: 39 (0) 2982901

European Headquarters –

United Kingdom

Phone: 44 (0) 1204-593493

FAX: 44 (0) 1204-598066

Miller Electric Mfg. Co.

An Illinois Tool Works Company

1635 West Spencer Street

Appleton, WI 54914 USA

International Headquarters—USA

Phone: 920-735-4505

USA & Canada FAX: 920-735-4134

International FAX: 920-735-4125

