

#### NUFLO™

# MC-II™ Flow Analyzer

CE-Approved

# **QuickStart**

## Mount the MC-II


#### Direct Mount


(For remote mount instructions, see the MC-II User Manual.)

- Plug the MC-II cable connector into the pickup and turn the swivel nut clockwise until the connector is fully inserted into the pickup and the swivel nut is hand-tight.
- 2. Loosen the locking screws that secure the base MC-II mount.
- Position the MC-II on the flowmeter, carefully pulling excess signal cable through the strain relief cord connector on the side of the upper mount.
- 4. Thread the base of the mount onto the conduit adapter of the turbine meter and tighten two extra rounds after it is hand-tight. DO NOT allow the upper mount and MC-II readout to turn while tightening the base to avoid damaging the signal cable.
- Tighten the outside nut of the strain relief cord connector on the upper mount with a 15-mm open-end wrench to prevent cord slippage.
- 6. If necessary, adjust the MC-II readout for best viewing. Loosen the nut on the bolt that holds the MC-II readout on the upper mount, tilt the unit to the desired angle and retighten the nut.





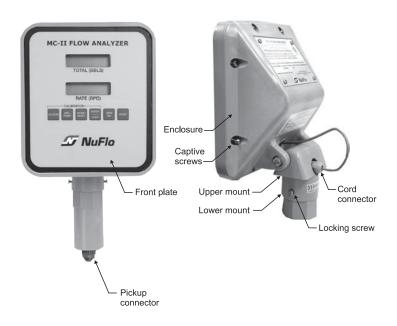


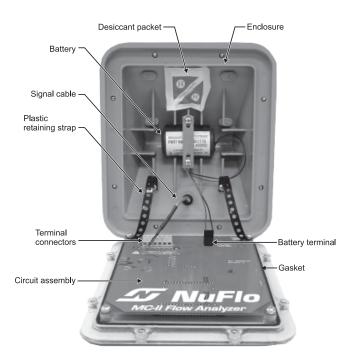

# **Install Field Wiring**

Connect the battery and flowmeter signal cable as shown at right.

CAUTION: The lithium battery that powers the MC-II is sealed, but a battery leak could expel toxic fumes into the MC-II enclosure. Before opening the enclosure, make sure the enclosure is in a well-ventilated area and avoid breathing fumes that could be trapped inside. See Appendix A of the MC-II Flow Analyzer User Manual (Part No. 9A-50165011) for instructions on battery disposal and a link to the MSDS sheet for the MC-II battery.

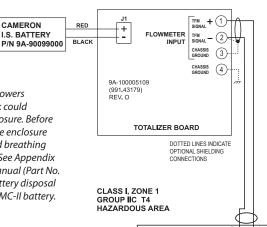

## Calibrate the MC-II


The following information is needed to calibrate the MC-II:


- unit of measure for volume
- flowmeter calibration factor (pulses per gallon)

CAMERON

I.S. BATTERY


- unit of measure for flow rate
- 1. Press and hold **ACCESS** for 3 seconds, then release, to enter Calibrate mode. **Prog.no** will appear in the top display and the version number of the firmware will appear in the bottom display. The **tot.Eng** menu will then appear in the top display, and the default volume unit - bbL - will appear in the bottom display.
- 2. Press **INCREMENT** until the desired unit of measure appears in the bottom display. Press ENTER/STEP.
  - If you select a preprogrammed unit (bbl, gal, m<sup>3</sup>, liter), **Pu.P.qAL** will appear in the top display. Go to Step 3 for instruction on entering your flowmeter's calibration factor (in pulses per gallon). The MC-II will automatically calculate the divisor.
  - If you select **uSEr**, **Ent.diV** will appear in the top display. Enter a calculated divisor (in terms of specified unit) from right to left. Press **INCREMENT** to select each digit; press **ENTER/STEP** to advance to the next digit. Proceed to Step 4.



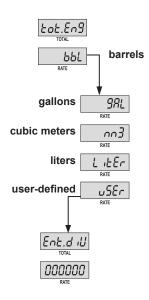



- 3. Locate the flowmeter calibration factor (pulses per gallon) on a plastic tag attached to the meter. Enter the number as follows:
  - a. Press **DEC. POINT** repeatedly to position your decimal point for the calibration factor.
  - b. Enter the digits from right to left, beginning with the flashing digit to the far
  - c. Press **INCREMENT** to select digits between 0 and 9 (or press and hold **INCREMENT** to scroll the digits). Press **ENTER/STEP** to save the selection.
    - Repeat this step to enter all six digits. If your calibration factor is less than six digits in length, enter 0 for remaining digits. When the last (sixth) digit is saved, the calibration factor will be saved in the MC-II's memory and **rAt.Eng** will appear in the top display.
- 4. At the **rAt.Eng** prompt, select a unit of measure for rate. Press **INCREMENT** until the desired unit appears in the bottom display. If you selected a user-defined unit

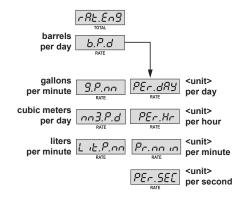

- of measure for volume in Step 2, the rate options will be per day, per hour, per minute, or per second. Press ENTER/STEP. PULSE will appear in the top display.
- 5. Deselect the Pulse Output option by pressing **ENTER/STEP** to accept the default setting (OFF). **CodE** will appear in the top display.
- 6. Enable or disable the password-protected security feature. Press ENTER/STEP to retain the default **NO** setting or press **INCREMENT** to toggle the setting to YES (password protection enabled). Press ENTER/STEP. If you select YES, a data entry field will appear in the bottom screen. Enter a numeric password containing up to six digits. Remember your password! You will be asked for it each time you press **ACCESS** (to enter the Calibration mode) or **RESET** (to zero the total).
- 7. The **SEt.tot** (preset total) menu will appear. To bypass this menu and complete the configuration, press ENTER/STEP. To preset a total, press INCREMENT to toggle the setting to YES; then press ENTER/STEP. Enter the digits of the total, right to left, pressing **INCREMENT** to select each digit, and pressing **ENTER**/ **STEP** to save the selection. When the last digit has been entered and saved, the prompt **SAVING** will appear in the lower display while the calibration settings are saved to nonvolatile memory. The calibration process is complete.

#### **MEASUREMENT SYSTEMS**

Formerly: NuFlo Measurement Systems • Barton Instrument Systems • Caldon, Inc.

HOUSTON | 281.582.9500 HEAD OFFICE

AMERICA

NORTH | 1.800.654.3760 ms-us@c-a-m.com

ASIA | PACIFIC

+603.2287.1039 ms-asiapacific@c-a-m.com

EUROPE, H44.1243.826 MIDDLE EAST & ms-uk@c-a-m.com +44.1243.826741

USA • CANADA • UK • SCOTLAND • CHINA • UAE • ALGERIA • MALAYSIA • SINGAPORE • WWW.C-a-m.com/f|o

