User manual M3

Direct voltage shunt: 0-60/150/300/1000 mV



Technical features:

- red display of -19999...99999 digits (optional: green, orange or blue display)
- minimal installation depth: 120 mm without plug-in terminal
- min-/max memory
- 30 parameter driven setpoints
- optical threshold value indication at threshold value exceedance / undercut
- [O]-key for triggering of Hold, Tara
- · permanent min-/max-value recording
- volume measurement (totaliser)
- · arithmetic function
- zero point slowdown
- programming interlock via access code
- · protection class IP65 at the front
- · plug-in terminal
- · option: digital input
- option: 2 or 4 analog outputs
- option: 2 or 4 relay outputs or 8 PhotoMos outputs
- option: interface RS232 or RS485
- accessories: PC-based configuration kit PM-TOOL incl. CD and USB-adapter for devices without keypad and for a simple adjustment of standard devices

Identification

STANDARD TYPES	ORDER NUMBER
Direct voltage shunt Housing size: 96x48 mm	M3-1VR5B.0002.470AD M3-1VR5B.0002.570AD
Housing size. 90x46 min	M3-1VR5B.0002.670AD

Options – breakdown of order code:

				4			_	_				_	_					
		M	3-	1	٧	R	5	B.	U	U	U	2.	6	7	2	Α	ט	
Standard type M-line																		Dimension D physical unit
Installation depth 139 mm, incl. plug-in terminal	3																	Version A A
Housing size 96x48x120 mm (WxHxD)	1																	Setpoints
Type if display V, A	V																	ono setpoints 2 relay outputs 4 relay outputs
Display colour Blue Green	B G																	Protection class 7 IP65 / plug-in Terminal
Red Orange	R Y																	Supply voltage 4 115 VAC 5 230 VAC
Number of digits 5-digit	5																	6 10-30 VDC galv.insulated
Digit height 14 mm	В																	Measuring input 2 Shunt
Digital input without 1 digital input Interface RS232	0 1 3																	Analog output 0
Interface RS485	4																	Sensor supply without

Please state physical unit by order, e.g. A

Contents

1.	Short description	2
2.	Assembly	3
3.	Electrical connection	4
4.	Description of function and operation	5
	4.1. Programming software PM-TOOL	6
5.	Setting up the device	7
	5.1. Switching on	7
	5.2. Standard parameterisation (flat operation level)	7
	Value assignment for the control of the signal input	
	5.3. Programming interlock "RUN"	10
	Activation/Deactivation of the programming interlock or change into professional operation level	
	/ back into flat operation level	
	5.4. Extended parameterisation (professional operation level)	10
	5.4.1. Signal input parameters "INP"	10
	Value assignment for the control of the signal input incl. linearisation	
	5.4.2. General device parameters "FLT"	14
	Superior device functions like Hold, Tara, min/max permanent, setpoint function respectively	
	nominal value function, average determination, brightness control, as well as the control of the digital input and the keyboard configuration	
	5.4.3. Safety parameters " <i>COD</i> "	18
	Assignment of user and master code for locking or access to certain	10
	parameters like e.g. analog output and alarms, etc.	
	5.4.4. Serial parameters "SER"	19
	Parameter for the definition of the interface	
	5.4.5. Analog output parameters " <i>0UT</i> " and " <i>0UZ</i> "	20
	Analog output functions	
	5.4.6. Relay functions "REL"	23
	Parameter for the definition of setpoints	
	5.4.7. Alarm parameters " <i>RL1RL</i> ษ"	25
	Acutator and dependcies of the alarms	
	5.4.8. Totaliser (Volume metering) " <i>T0T</i> "	26
	Parameters for the calculation of the sum function	
6.	Reset to factory settings	28
	Reset parameters to delivery state	
7.	Alarms / Relay	29
	Functional principle of the switching outputs	
8.	Interfaces	30
	Connection RS232 and RS485	
9.	Sensor alignment	31
	Functional sequence scheme for sensors with existing adjustable resistor	
10.	Technical data	32
11.	Safety advices	34
12.	Error elimination	35

1. Brief description

The panel meter instrument **M3-12** is a 5-digit device for direct voltage signals and a visual threshold value monitoring via the display. The configuration happens via four keys at the front or by the optional PC software PM-TOOL. The integrated programming interlock prevents unrequested chnages of parameters and can be unlocked again with an individual code. Optional the following functions are available: a supply for the sensor, a digital input for triggering of Hold (Tara), two analog outputs and interfaces for further evaluating in the unit.


With help of the two galvanic insulated setpoints (optional), free adjustable limit values can be controlled and reported to a superior master display.

The electrical connection is done via plug-in terminals on the back side.

Selectable functions like e.g. the recall of the min/max-value, an averaging of the measuring signals, a nominal presetting or setpoint presetting, a direct threshold value regulation during operation mode and further measuring setpoints for linearisation, complete the modern device concept.

2. Assembly

Please read the *Safety advice* on *page 34* before installation and keep this user manual for future reference.

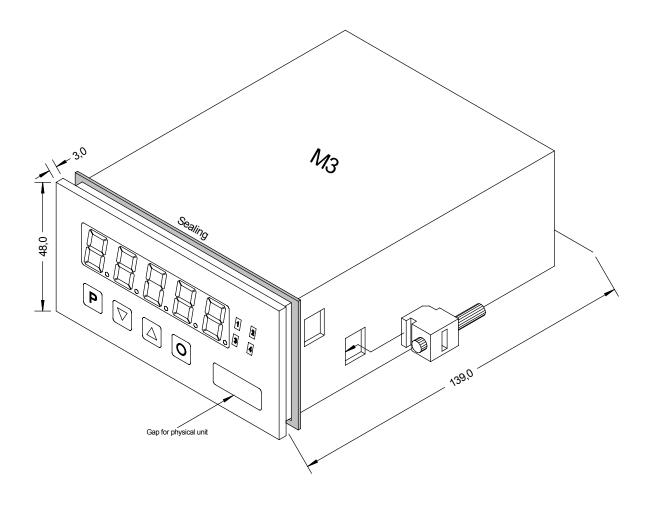


- 1. After removing the fixing elements, insert the device.
- 2. Check the seal to make sure it fits securely.
- 3. Click the fixing elements back into place and tighten the clamping screws by hand. Then use a screwdriver to tighten them another half a turn.

CAUTION! The torque should not exceed 0.1 Nm!


The dimension symbols can be exchanged before installation via a channel on the side!


3. Electrical connection

Type M3-1VR5B.0002.470AD with a supply of 115 VAC Type M3-1VR5B.0002.570AD with a supply of 230 VAC Type M3-1VR5B.0002.670AD with a supply of 10-30 VDC




Options:

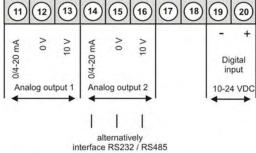



Relay 1 and 2

Relay 3 and 4



8 PhotoMos outputs

Alternative to analog output 2





Interface RS232 (Modbus protocol)

Interface RS485 (Modbus protocol)

4. Function and operation description

Operation

The operation is divided into three different levels.

Menu level (delivery status)

This level is for the standard settings of the device. Only menu items which are sufficent to set the device into operation are displayed. To get into the professional level, run through the menu level and parameterise "PROF" under menu item RUN.

Menu group level (complete function volume)


Suited for complex applications as e.g. linkage of alarms, setpoint treatment, totaliser function etc. In this level function groups which allow an extended parameterisation of the standard settings are availabe. To leave the menu group level, run through this level and parameterise "ULDC, under menu item RUM.

Parameterisation level:

Parameter deposited in the menu item can here be parameterised. Functions, that can be changed or adjusted, are always signalised by a flashing of the display. Settings that are made in the parameterisation level are confirmed with **[P]** and thus safed. By pressing the "**[O]-key**" it leads to a break-off of the value input and to a change into the menu level. All adjustments are safed automatically by the device and changes into operating mode, if no further key operation is done within the next 10 seconds.

Level	Key	Description
	Р	Change to parameterisation level and deposited values.
Menu-level		Keys for up and down navigation in the menu level.
	0	Change into operation mode.
	Р	To confirm the changes made at the parameterization level.
Parameterisation- level		Adjustment of the value / the setting.
	0	Change into menu level or break-off in value input.
	Р	Change to menu level.
Menu-group-level		Keys for up and down navigation in the menu group level.
	0	Change into operation mode or back into menu level.

Function chart:

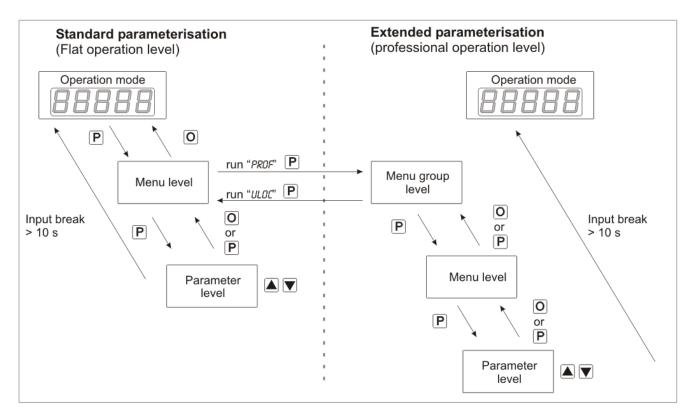

Underline:

- P Takeover
- O Stop
- ▲ Value selection (+)
- ▼ Value selection (-)

4.1 Parameterisation software PM-TOOL:

Part of the PM-TOOL are the software on CD and an USB-cable with device adapter. The connection is done via a 4-pole micromatch-plug on the back side of the device, to the PC-side the connection ist done via an USB plug.

System requirements: PC incl. USB interface Software: Windows XP, Windows VISTA

With this tool the device configuration can be generated, omitted and safed on the PC. The parameters can be changed via the easy to handle program surface, whereat the operating mode and the possible selection options can be preset by the program.

5. Setting up the device

5.1. Switching on


Once the installation is complete, you can start the device by applying the voltage supply. Before, check once again that all electrical connections are correct.


Starting sequence


For 1 second during the switching-on process, the segment test (**8 8 8 8 8**) is displayed followed by an indication of the software type and, after that, also for 1 second the software version. After the starting sequence, the device switches to operation/display mode.

5.2. Standard parameterisation: (Flat operation level)


To parameterise the display, press the **[P]** key in operating mode for 1 second. The display then changes to the menu level with the first menu item **TYPE**.

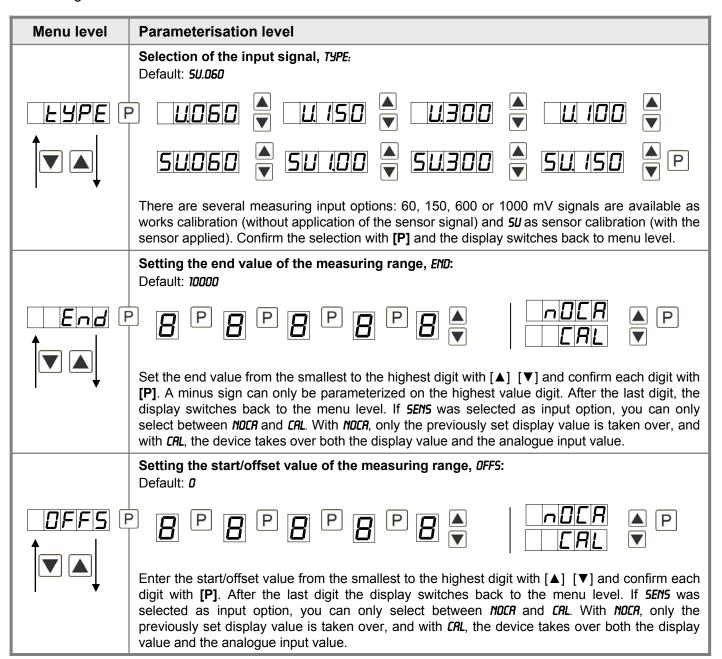

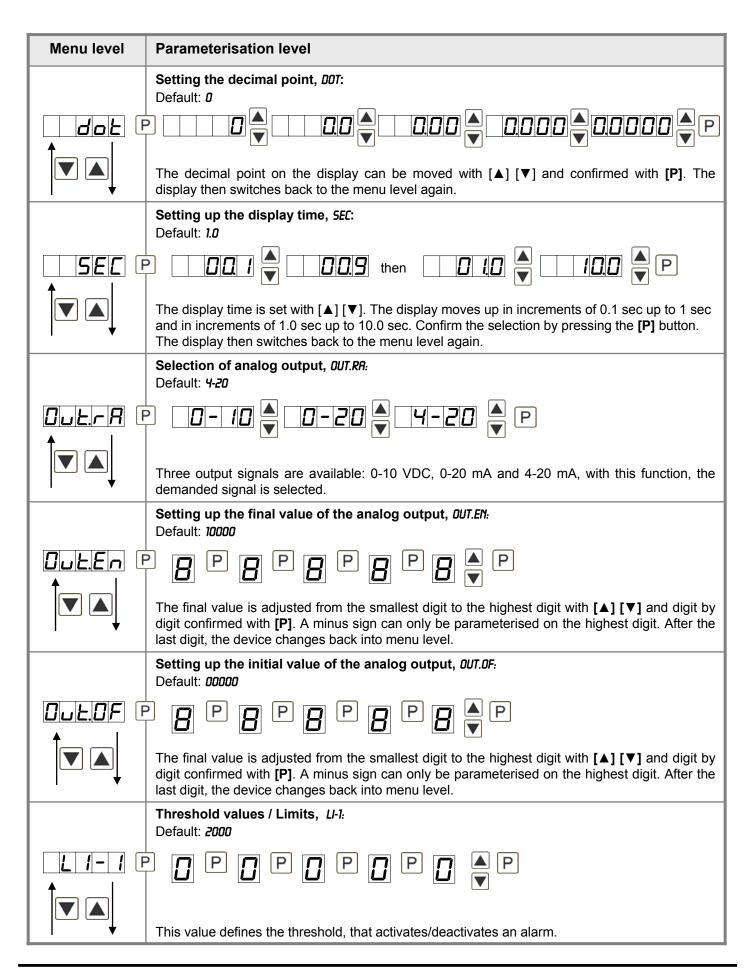

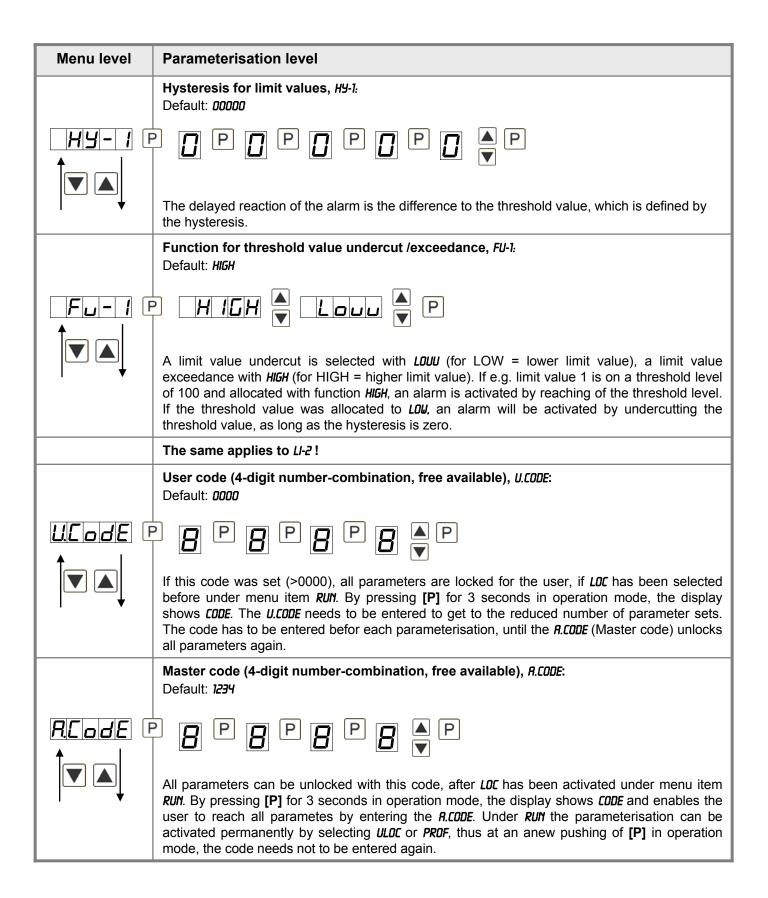



5.3 Programming interlock "RUN"

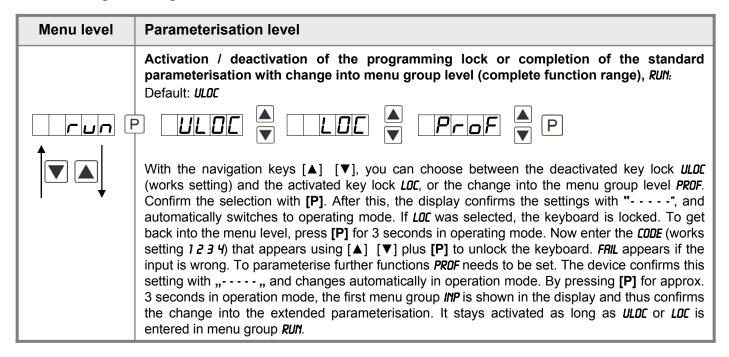



5.4. Extended parametrisation (Professional operation level)


5.4.1. Signal input parameters

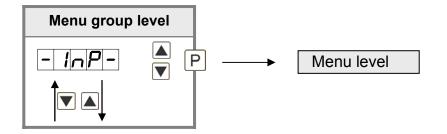

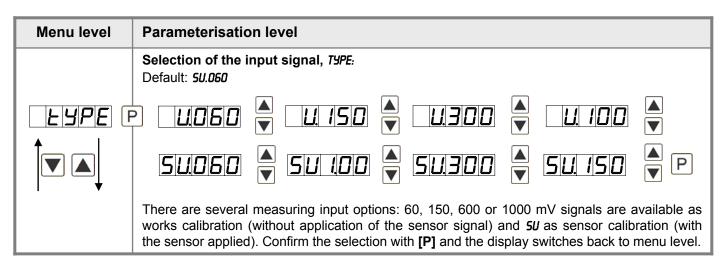


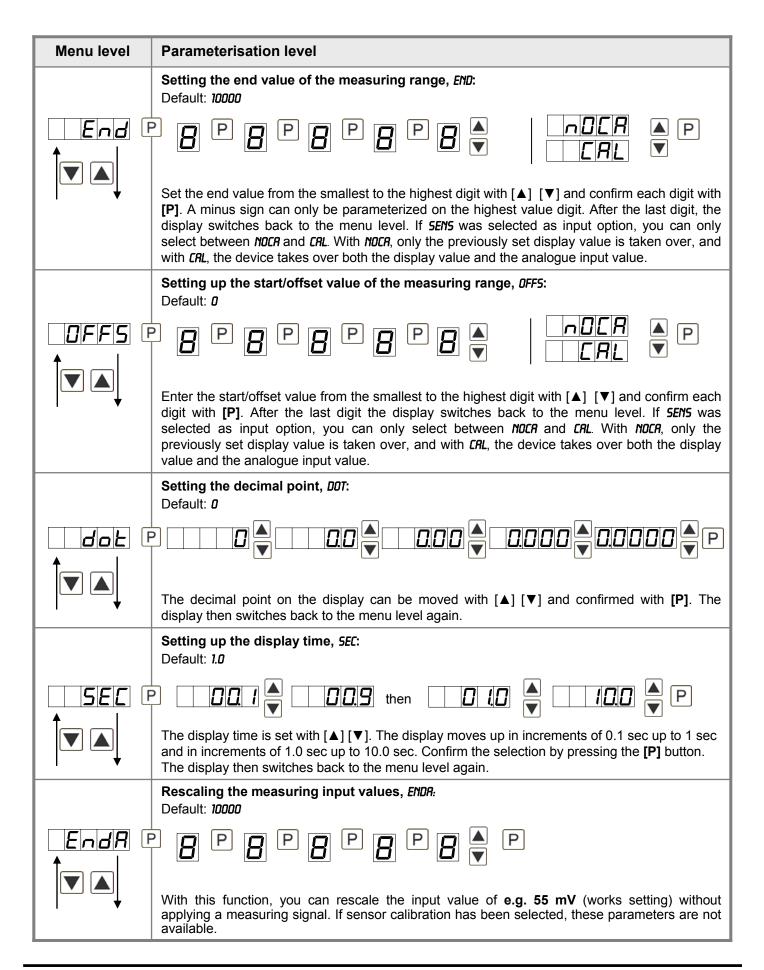


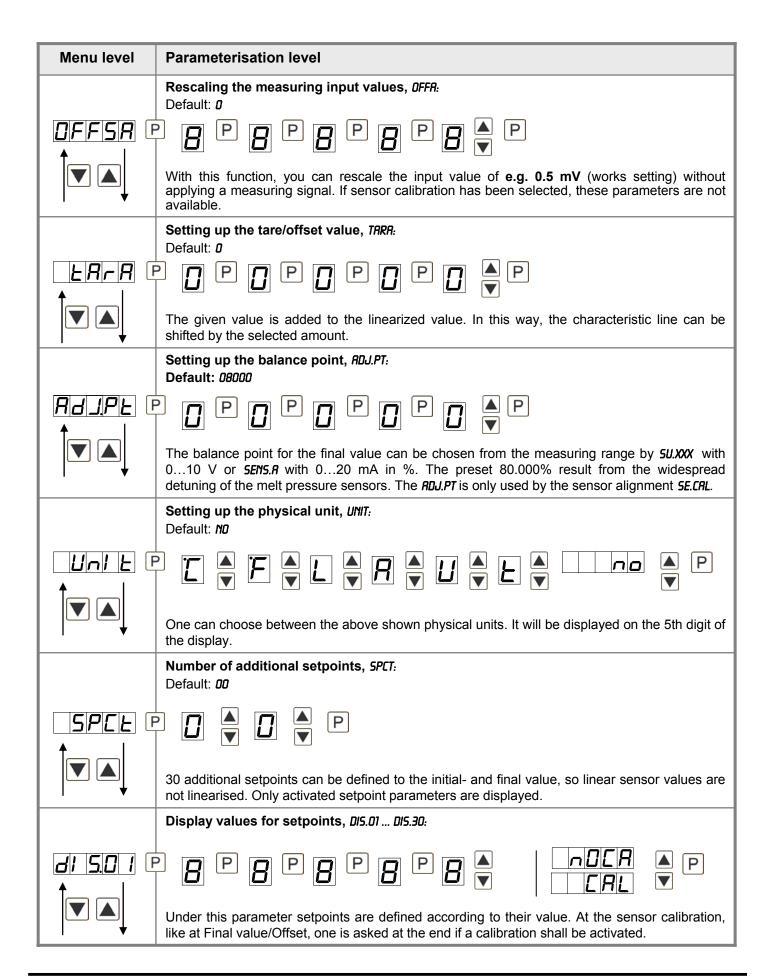


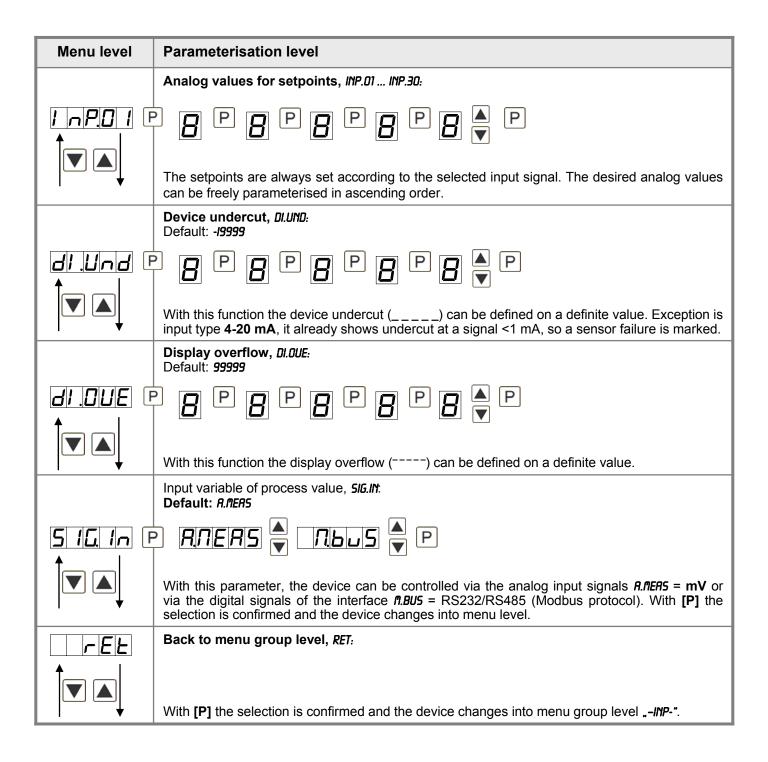



5.4.2. General device parameters

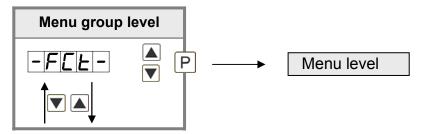

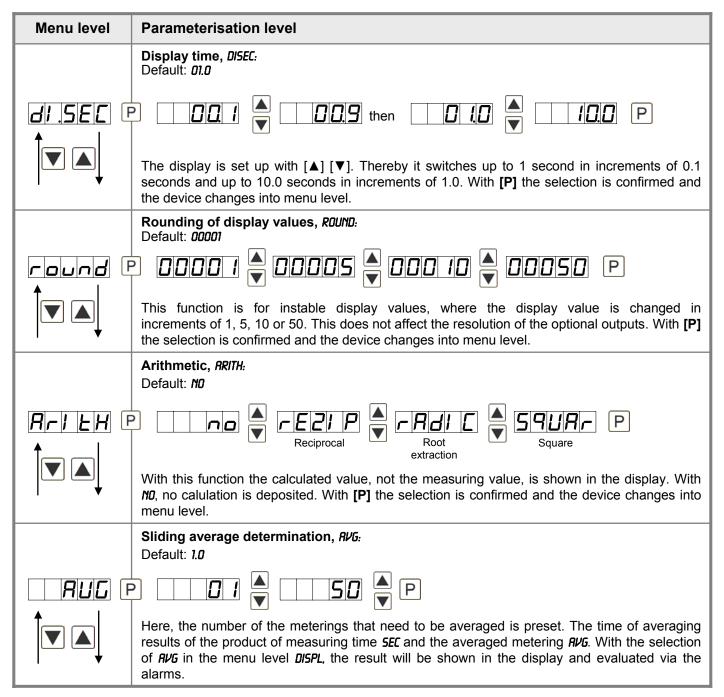


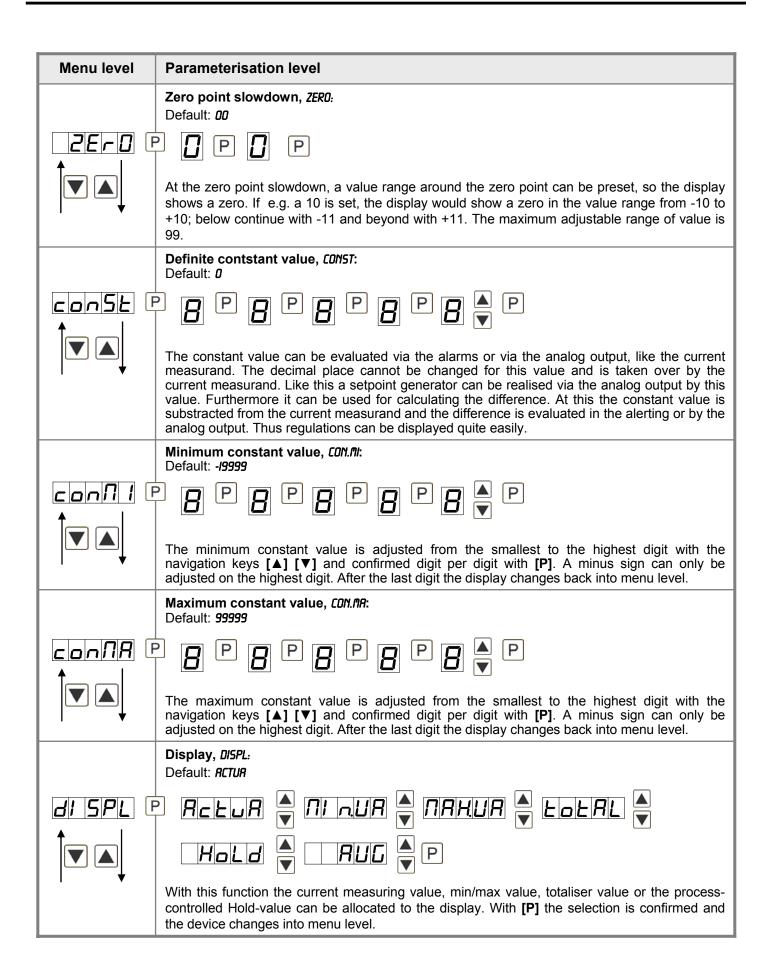


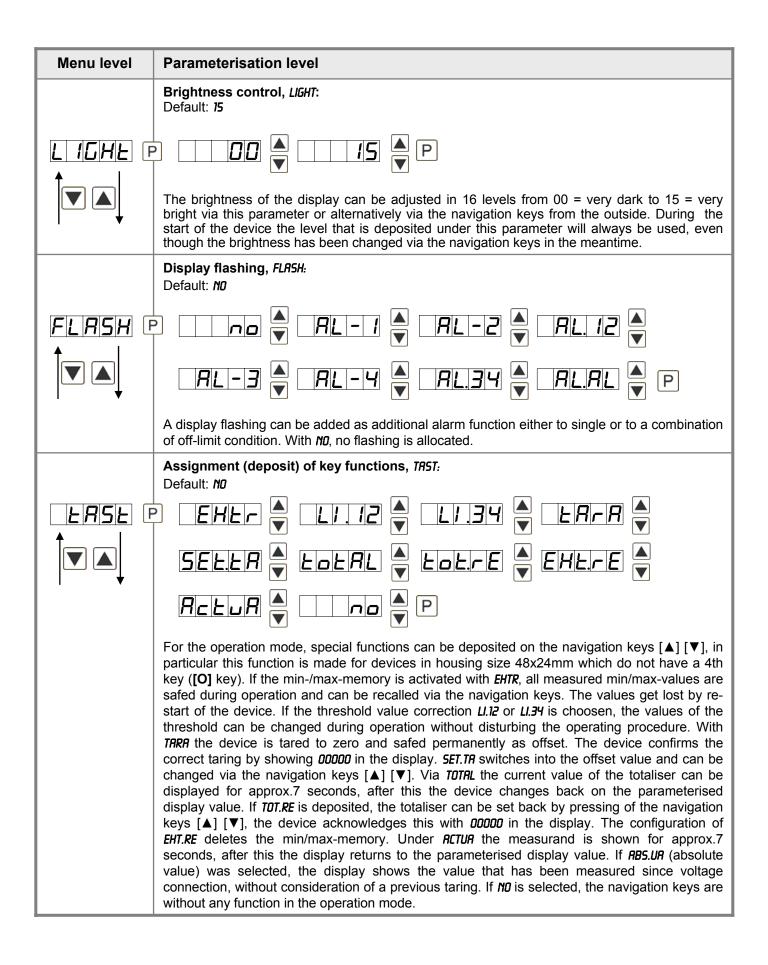

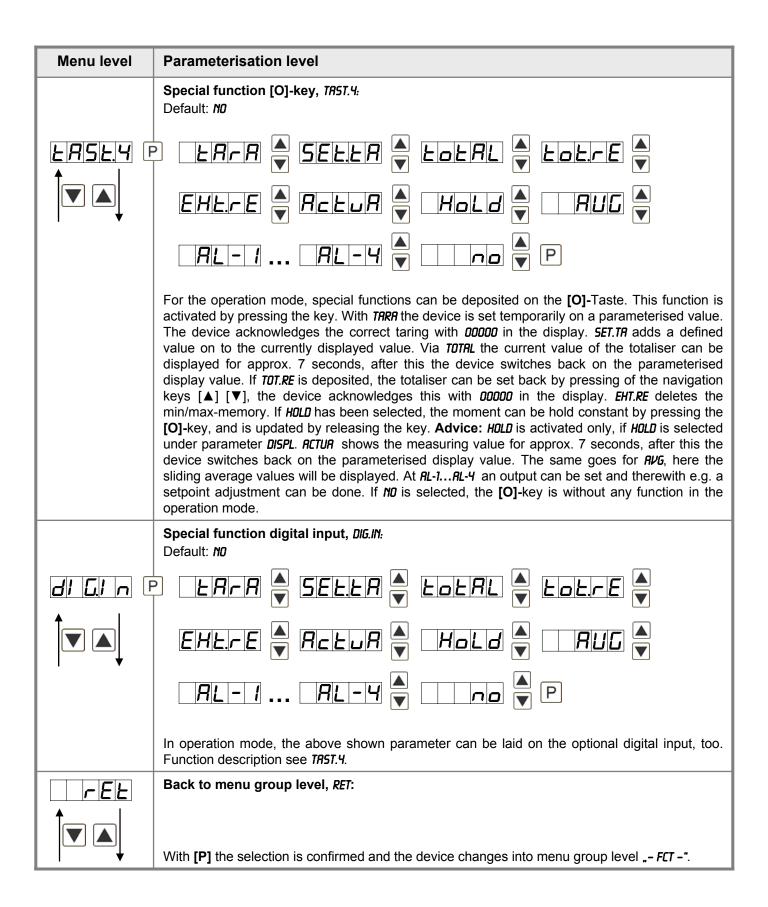



5.4.3. Safety parameters

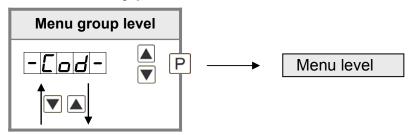

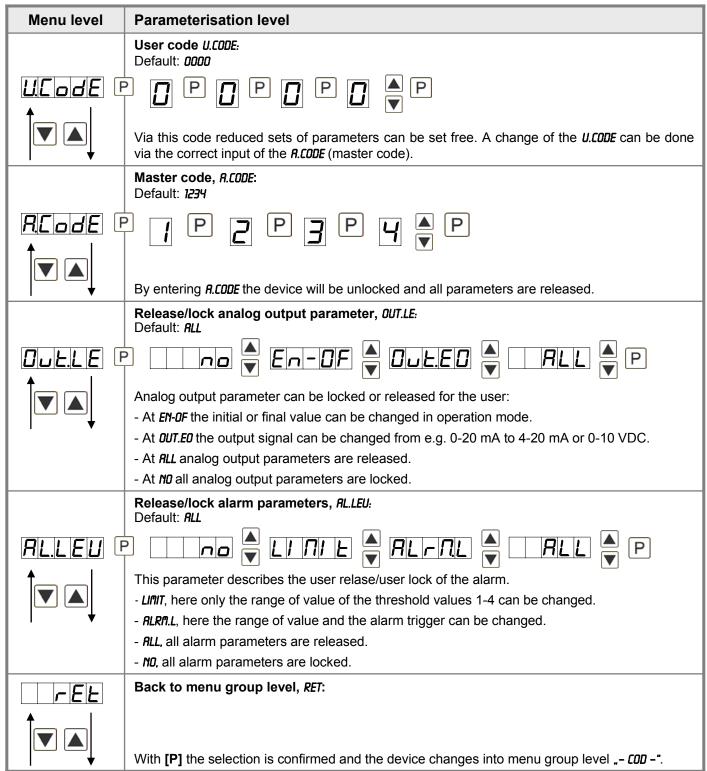



5.4.4. Serial parameters

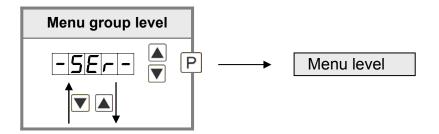


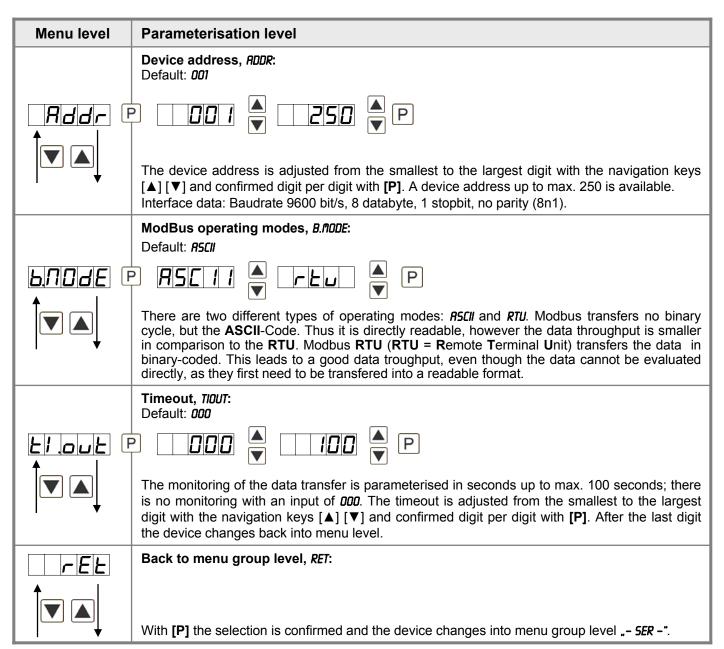


5.4.5. Analog output parameters for analog output 1

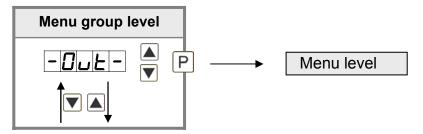


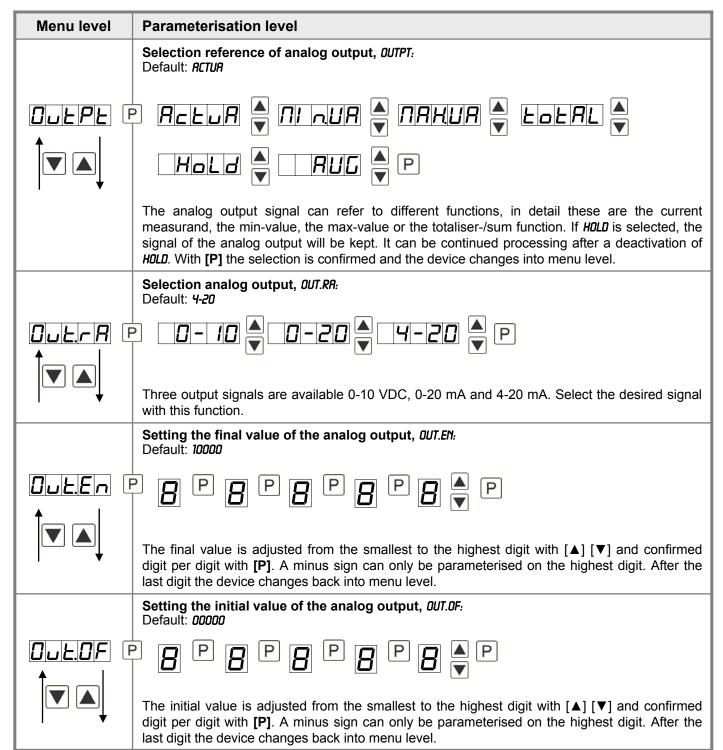


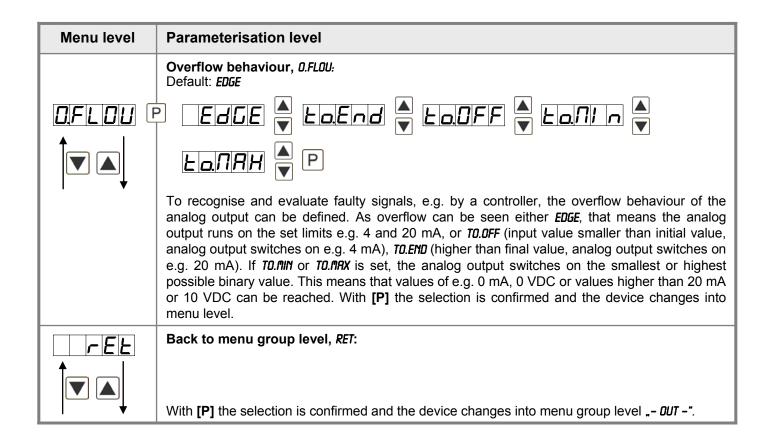


Analog output parameters for analog output 2

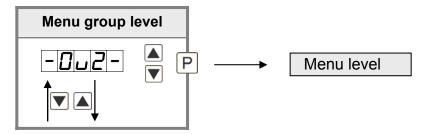


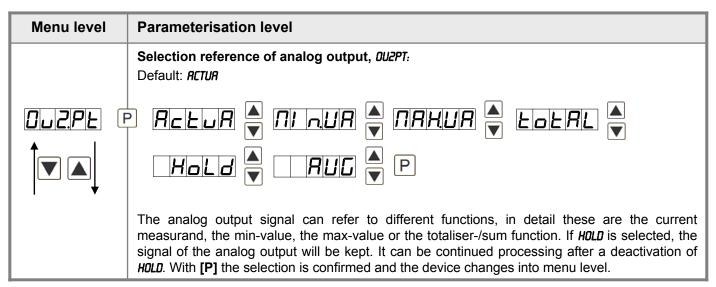


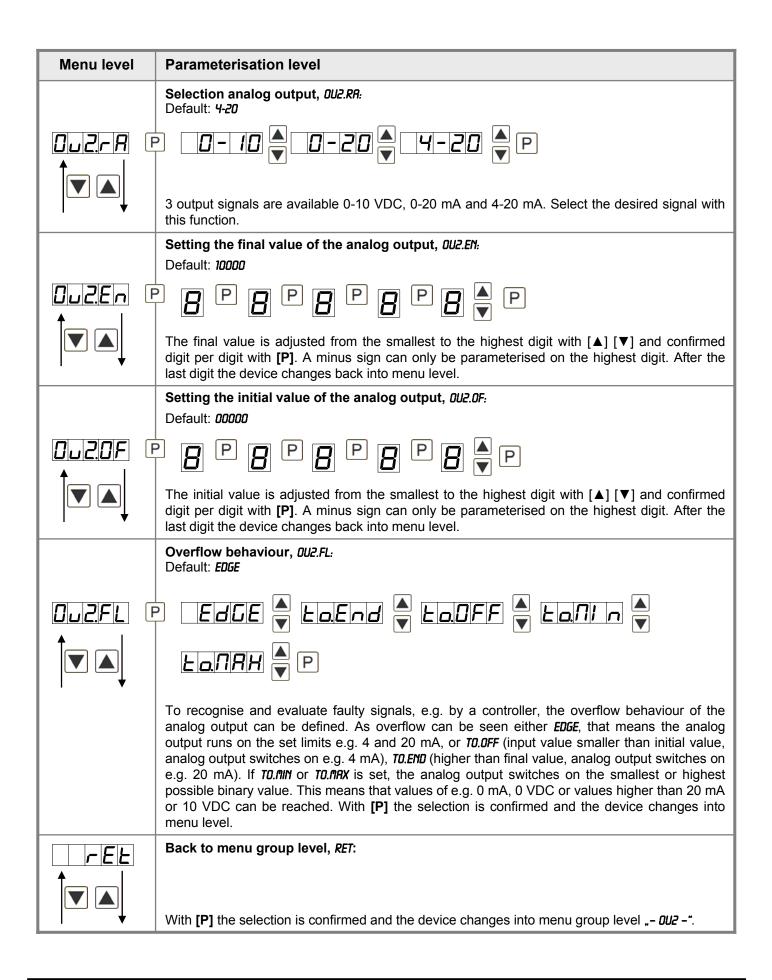


5.4.6. Relay functions

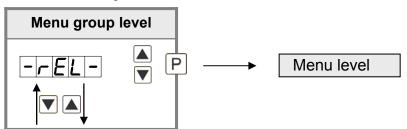


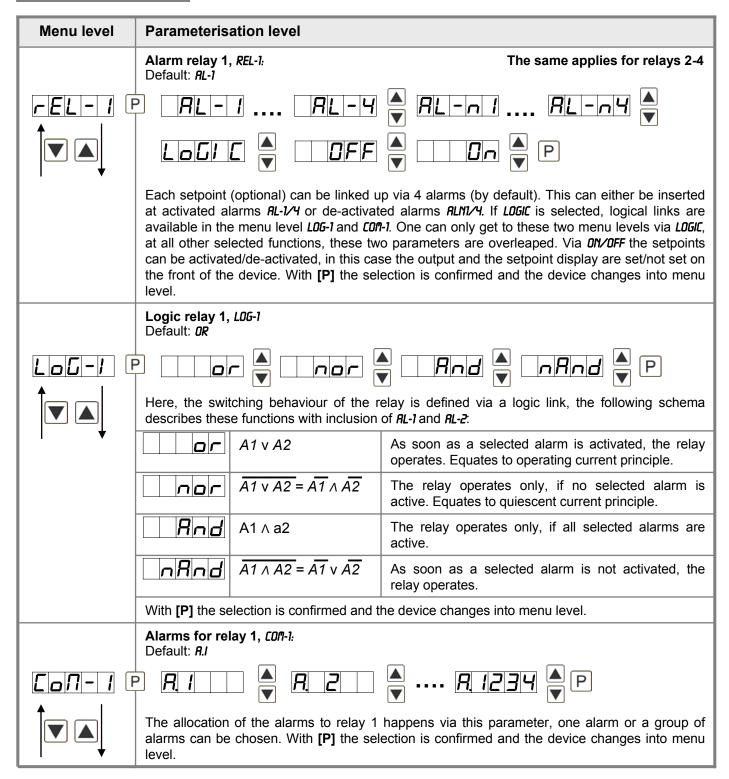


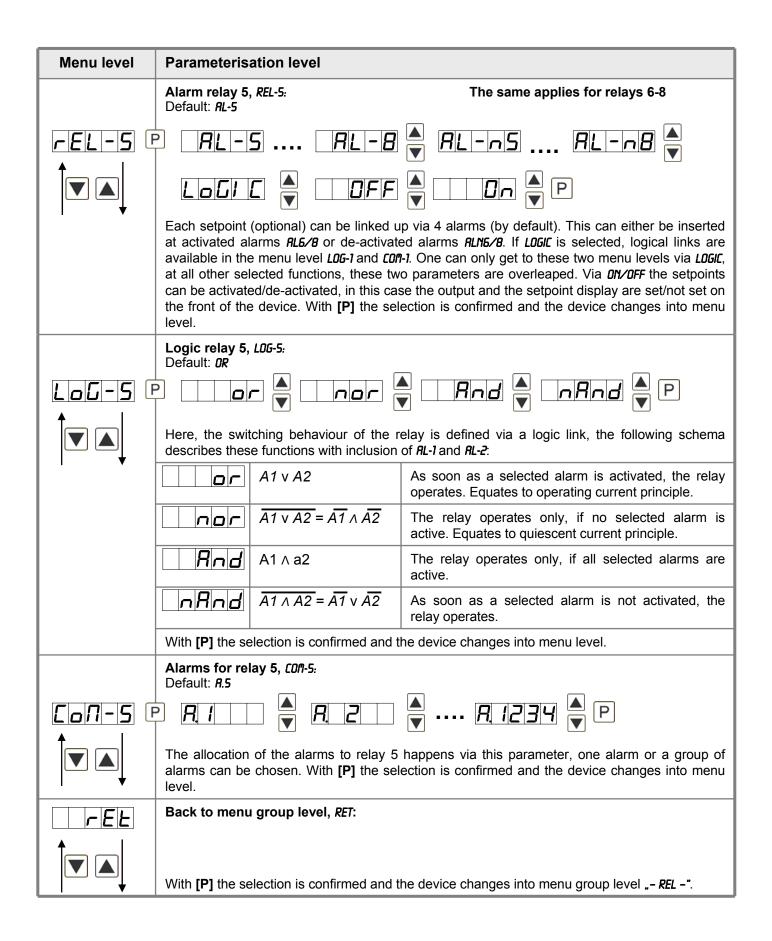

5.4.7. Alarm parameters

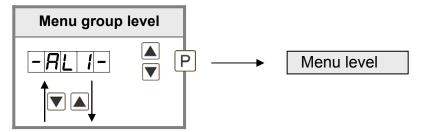


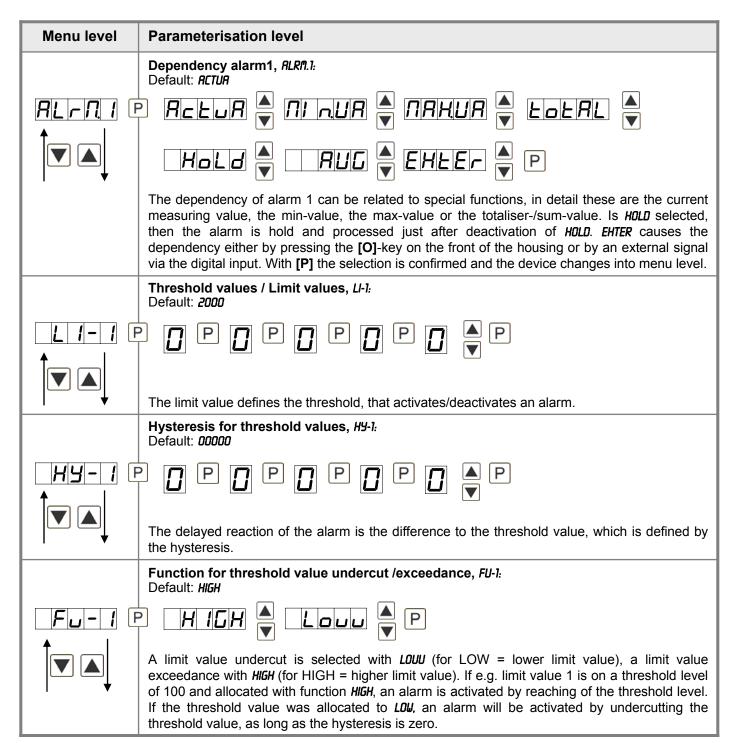


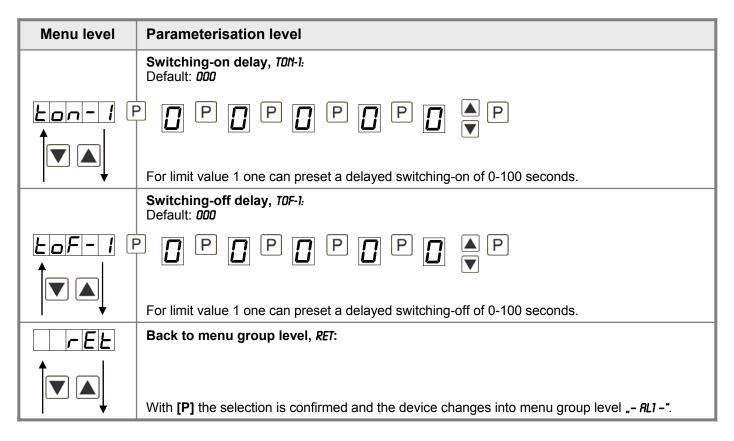


The same applies for RL2 to RL8.


5.4.8. Totaliser (Volume metering)

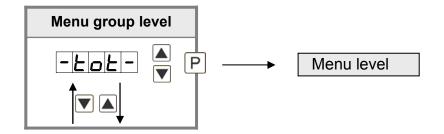

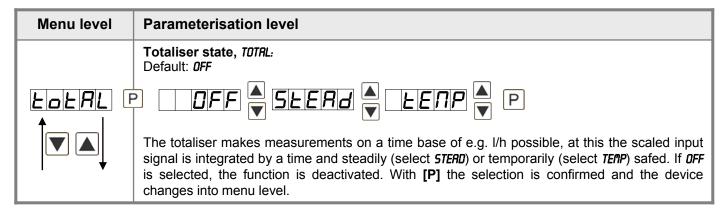

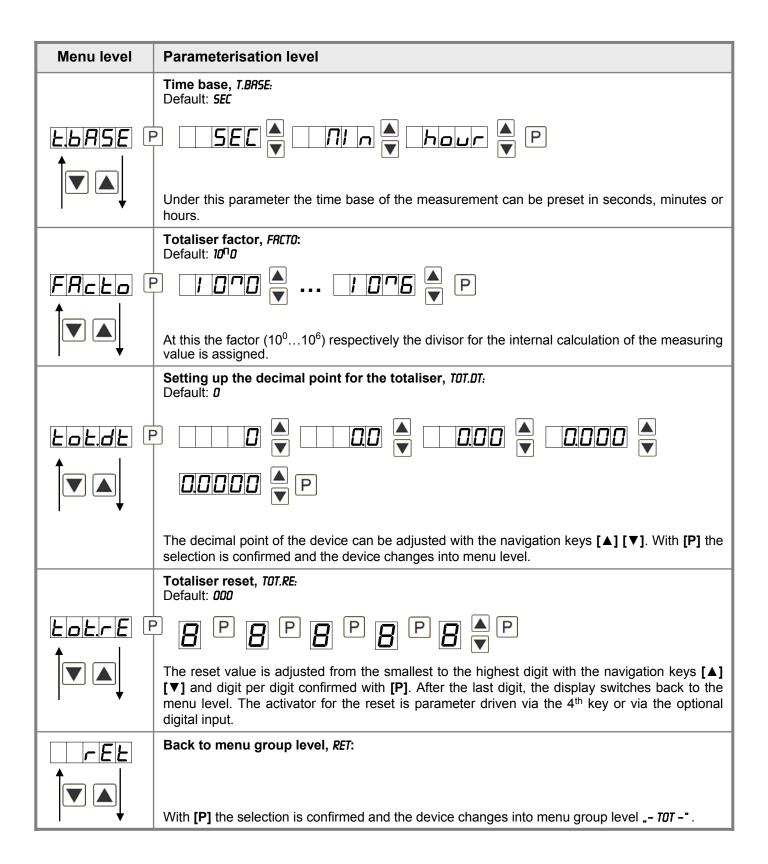

Programming interlock, RUM:

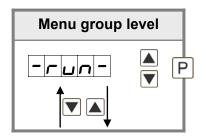

Description see page 10, menu level RUN

6. Reset to factory settings

To return the unit to a **defined basic state**, a reset can be carried out to the default values.

The following procedure should be used:

- Switch off the power supply
- Press button [P]
- Switch on voltage supply and press [P]-button until "----" is shown in the display.


With reset, the default values of the program table are loaded and used for subsequent operation. This puts the unit back to the state in which it was supplied.

Caution! All application-related data are lost.

7. Alarms / Relays


This device has 4 virtual alarms that can monitor one limit value in regard of an undercut or exceedance. Each alarm can be allocated to an optional relay output S1-S2; furthermore alarms can be controlled by events like e.g. Hold or min-/max-value.

Function principle of alarms / relays						
deactivated, instantaneous value, min-/max-value, hold-value, totaliser value, sliding average value, constant value, difference between instantaneous value and constant value or an activativia the digital input						
Switching threshold	Threshold / limit value of the change-over					
Hysteresis	Broadness of the window between the switching thresholds					
Working principle	Operating current / Quiescent current					

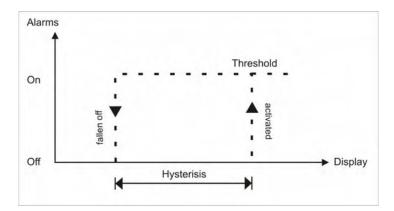


Operating current

By operating current the alarm S1-S2 is off below the threshold and on on reaching the threshold.

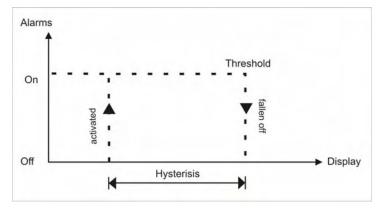

Quiescent current

By quiescent current the alarm S1-S2 is on below the threshold and switched off on reaching the threshold.

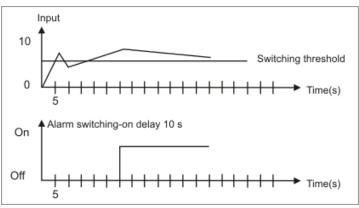


Switching-on delay

The switching-on delay is activated via an alarm and e.g. switched 10 seconds after reaching the switching threshold, a short-term exceedance of the switching value does not cause an alarm, respectively does not cause a switching operation of the relay. The switching-off delay operates in the same way, keeps the alarm / the relay switched longer for the parametrised time.


8. Interfaces RS232 and RS485

Connection RS232



Connection RS485


Digital device M3



The interface **RS485** is connected via a screened data line with twisted wires (Twisted-Pair). On each end of the bus segment a termination of the bus lines needs to be connected. This is neccessary to ensure a secure data transfer to the bus. For this a resistance (120 Ohm) is interposed between the lines Data B (+) and Data A (-).

9. Sensor alignment offset / final value

The device is equipped with a semi-automatic sensor calibration (*SU.XXX*). A switching output operates the trimming resistor, which exists in some sensors. An adjustment of offset and final value takes place, after which the sensor can be used directly. Depending on parameterisation, the calibration can be realized via the fourth key or via the digital input. It is possible to key during the calibration steps. So, reference signals can be connected manually. However the calibration will be interrupted after 30 seconds.

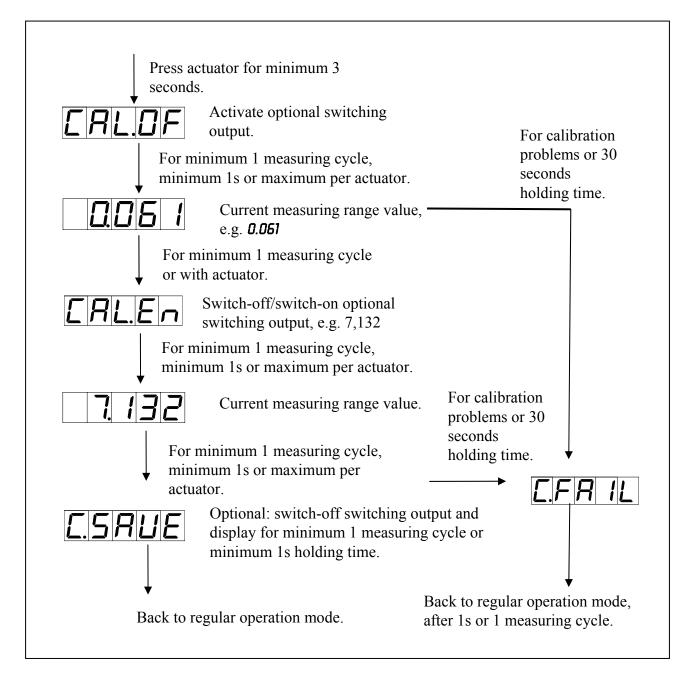

10. Technical data

Housing											
Dimensions	96x48x120 mm (BxHxD)										
	96x48x139 mm (BxH	96x48x139 mm (BxHxD) incl. plug-in terminal									
Panel cut-out	92.0 ^{+0,8} x 45.0 ^{+0,6} mm	92.0 ^{+0,8} x 45.0 ^{+0,6} mm									
Wall thickness	to 15 mm	to 15 mm									
Fixing	screw elements	screw elements									
Material	PC Polycarbonate, bl	PC Polycarbonate, black, UL94V-0									
Sealing material	EPDM, 65 Shore, bla	EPDM, 65 Shore, black									
Protection class	standard IP65 (Front)	standard IP65 (Front), IP00 (Back side)									
Weight	approx. 300 g	approx. 300 g									
Connection	plug-in terminal; wire	plug-in terminal; wire cross section up to 2.5 mm ²									
Display	·										
Digit height	14 mm	14 mm									
Segment colour	red (optional blue/gre	red (optional blue/green/orange)									
Range of display	-19999 to 99999	-19999 to 99999									
Setpoints	one LED per setpoint	one LED per setpoint									
Overflow	horizontal bars at the	horizontal bars at the top									
Underflow	horizontal bars at the	horizontal bars at the bottom									
Display time	0.1 to 10.0 seconds	0.1 to 10.0 seconds									
Input	Measuring range	Measuring range Ri Measuring error D									
-575 mV	060 mV	~12 kΩ	0.2 % of measuring range	±1							
-15180 mV	0150 mV	~60 kΩ	0.2 % of measuring range	±1							
-30360 mV	0300 mV	~30 kΩ	0.2 % of measuring range	±1							
-1001200 mV	01000 mV	01000 mV ~200 kΩ 0.2 % of measuring range ±1									
Digital input	< 2,4 V OFF, 10 V ON $R_1 \sim 5 \text{ k}\Omega$	< 2,4 V OFF, 10 V ON, max. 30 VDC $R_{l} \sim 5 \ k\Omega$									
Accuracy											
Temperature drift	100 ppm / K	100 ppm / K									
Measuring time	0.110.0 seconds	0.110.0 seconds									
Measuring principle	U/F-converter										
Resolution	approx. 18 Bit at 1s measuring time										

Output						
Analog output	0/4-20 mA / burden 350 Ω or 0-10 VDC / 10 kΩ, 16 Bit					
Switching outputs						
Relay with change-over contacts Switching cycles	250 VAC / 5 AAC; 30 VDC / 5 ADC 30 x 10 ³ at 5 AAC, 5 ADC ohm resistive load 10 x 10 ⁶ mechanically Diversity according to DIN EN50178 / Characteristics according to DIN EN60255					
PhotoMos outputs	8 normally open (NO) contacts 30 VDC/AC, 0,4 A					
Interface						
Protocol	Modbus with ASCII or RTU-protocol					
RS232	9.600 Baud, no parity, 8 databit, 1 stopbit, wire length max. 3 m					
RS485	9.600 Baud, no parity, 8 databit, 1 stopbit, wire length max 1000 m					
Power supply	230 VAC +/- 10 % max. 10 VA 10-30 VDC galv. insulated, max. 4 VA					
Memory	EEPROM					
	I					
Data life	≥ 100 years at 25°C					
Ambient conditions						
Working temperature	050°C					
Storing temperature	-2080°C					
Climatic density	relative humidity 0-80% on years average without dew					
EMV	EN 61326					
CE-sign	Conformity to directive 2004/108/EG					
Safety standard	EN 61010; EN 60664-1					

11. Safety advices

Please read the following safety advice and the assembly *chapter 2* before installation and keep it for future reference.

Proper use

The **M3-12-device** is designed for the evaluation and display of sensor signals.



Danger! Careless use or improper operation can result in personal injury and/or damage to the equipment.

Control of the device

The panel meters are checked before dispatch and sent out in perfect condition. Should there be any visible damage, we recommend close examination of the packaging. Please inform the supplier immediately of any damage.

Installation

The **M3-12-device** must be installed by a suitably **qualified specialist** (e.g. with a qualification in industrial electronics).

Notes on installation

- There must be no magnetic or electric fields in the vicinity of the device, e.g. due to transformers, mobile phones or electrostatic discharge.
- The fuse rating of the supply voltage should not exceed a value of 6A N.B. fuse.
- Do not install **inductive consumers** (relays, solenoid valves etc.) near the device and **suppress** any interference with the aid of RC spark extinguishing combinations or free-wheeling diodes.
- Keep input, output and supply lines separate from one another and do not lay them parallel with each other. Position "go" and "return lines" next to one another. Where possible use twisted pair. So, you receive best measuring results.
- Screen off and twist sensor lines. Do not lay current-carrying lines in the vicinity. Connect the **screening on one side** on a suitable potential equaliser (normally signal ground).
- The device is not suitable for installation in areas where there is a risk of explosion.
- Any electrical connection deviating from the connection diagram can endanger human life and/or can destroy the equipment.
- The terminal area of the devices is part of the service. Here electrostatic discharge needs to be avoided. Attention! High voltages can cause dangerous body currents.
- Galvanic insulated potentials within one complex need to be placed on a appropriate point (normally earth or machines ground). So, a lower disturbance sensibility against impacted energy can be reached and dangerous potentials, that can occur on long lines or due to faulty wiring, can be avoided.

12. Error elimination

	Error description	Measures
1.	The unit permanently indicates overflow.	 The input has a very high measurement, check the measuring circuit. With a selected input with a low voltage signal, it is only connected on one side or the input is open. Not all of the activated setpoints are parameterised. Check if the relevant parameters are adjusted correctly.
2.	The unit permanently shows underflow.	 The input has a very low measurement, check the measuring circuit . With a selected input with a low voltage signal, it is only connected on one side or the input is open.
		Not all of the activated setpoints are parameterised. Check if the relevant parameters are adjusted correctly.
3.	The word " <i>HELP</i> " lights up in the 7-segment display.	The unit has found an error in the configuration memory. Perform a reset on the default values and re-configure the unit according to your application.
4.	Program numbers for parameterising of the input are not accessible.	Programming lock is activated Enter correct code
5.	"ERR1" lights up in the 7-segment display	Please contact the manufacturer if errors of this kind occur.
6.	The device does not react as expected.	If you are not sure if the device has been parameterised before, then follow the steps as written in <i>chapter 6.</i> and set it back to its delivery status.





M3_12GB.pdf updated: 04.06.2012