


D2 line Installation manual

Table of contents

- General description
- Model code
- Electric safety
- Installation kit
- Removing/inserting the module in
- its housing
- Installation
- Electrical connections

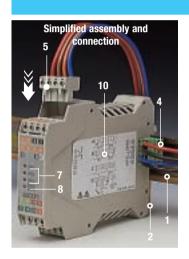


ASCON spa 20021 Bollate (Milano) Italy Tel. +39 02 333 371 Fax +39 02 350 4243 http://www.ascon.it e-mail info@ascon.it

ASCON spa

ISO 9001

Certified

- 1 DIN-rail, EN60022
- 2 Sping loaded slide for rail fastening
- 3 Side connector, build-in, to connect one instrument to another (up to 31)
- 4 5-pole male connector, with screw terminals, for power supply and serial communications bus
- Four quick polarised connectors with 5 4 screw terminals for I/O



General description 6 Female connector, with termination resistor for serial communications

DIN rail mounting

D2 line


temperature controller

with current transformer input

Installation manual • M.I. D2-1/04.05 • Cod. J30-658-1AD2

- 7 Four Output status leds (red)
- 8 Green Status led: - ON: power on
- flashing: serial communications
- in progress 9 Couple of connector protections
- 10 Wiring label
- 11 Model identification label



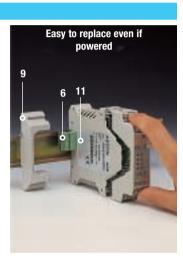





The product code indicates the specific hardware configuration of the instrument, that can be modified by specialized engineers only.

Line	D 2
OP1-OP2 outputs	В
Relay - Relay	1
Relay - SSR drive	2
SSR drive - SSR drive	3
SSR - SSR	4
SSR - SSR drive	5

Serial communications	C
CanBus	3
RS485 Modbus/Jbus SLAVE	5

User manual	F
Italian/English (std)	0
French/English	1
German/English	2
Spanish/English	3

Notes on electric safety and electromagnetic compatibility

Please, read carefully these instructions before proceeding with the installation of the controller

Class II instrument, rear panel mounting.

CE

This instrument has been designed in compliance with: **Regulations on electrical apparatus:**

according to regulations on the essential protection requirements in electrical apparatus EN 61010-1

Regulations on Electromagnetic Compatibility: according to:

- Regulations on RF emissions: EN61000-6-4 industrial environments;

- Regulation on RF immunity: industrial equipment and system. EN61000-6-2

It is important to understand that it's responsibility of the installer to ensure the compliance of the regulations on safety requirements and EMC.

This controller has no user serviceable parts and requires special equipment and specialised engineers. Therefore, a repair can be hardly carried on directly by the user. For this purpose, the manufacturer provides technical assistance and the repair service for its Customers.

Please, contact your nearest Agent for further information.

All the information and warnings about safety and electromagnetic compatibility are marked with the $\triangle C \in$ sign, at the side of the note.

Installation kit

Each set of interconnected controllers requires one model AD3-KIT/BA.RT.PC.CD kit:

Power supply and serial comm.s connector code AD3/BA



Couple of connectors protections code AD3/PC

Connector with termination resistor for serial communications code AD3/RT



CD Rom with configuration software tool code AD3/CD










1

Installation

Dimensions

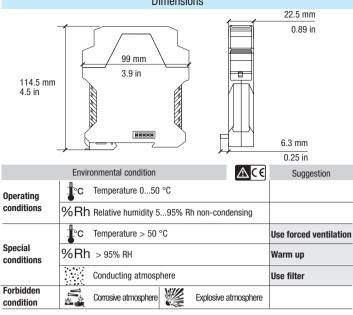

Mounting on DIN rail (EN60022)

Mounting

- 1 Clip the upper part of the instrument on the rail;
- 2 Rotate the instrument downwards until the click

When 2 or more instruments are installed on the same DIN rail, connect the communications/ power bus sliding the instruments side by side as explained in the following paragraphs.

2 1

Disassembly


Switch the instrument off

When 2 or more instruments are installed on the same DIN rail, disconnect the communications/power bus separating the selected instrument from the others:

- 1 Lower the spring slide by inserting a flat-blade screwdriver as indicated;
- 2 Turn and lift the instrument upwards.

1 After the mounting of instruments จ้ด้ด้ด้

- on the rail, put them side by side so that the male side connector fits into the corresponding female connector;
- After mounting all the instruments 2 side by side insert the female 5pole connector with the termination resistor of the serial communications into the corresponding male connector;
- 3 Wire the 5-pole male power supply and serial communications connector and insert it in the corresponding female connector;
- 4 When assembled insert the connectors protection on both sides.

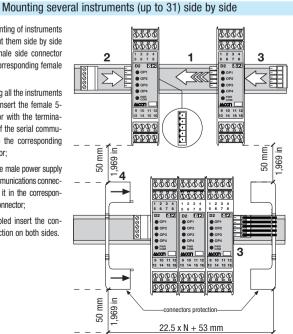

2

Remove/insert the module from/in its housing

How to remove the module from the housing

- 1 Insert the blade of a negative screwdriver under the I/O polarised connectors:
- 2 Moving the screwdriver as indicated, unplug the connector from the module;
- 3 Remove the connector and repeat these steps in order to unplug all the external connections.
- 4 With the blade of the screw-driver, press the two slots (at the top and bottom of the module) in order to free the I/O module from the housing;
- 5 Firmly grip the front panel in the terminal block area and pull the module outside the housing.







How to re-insert the I/O module in the housing


1 In order to correctly re-insert the module in its housing invert the previous extracting sequence, paying particular attention in inserting the printed circuit board in the slots present at the top and bottom of the case.




Electrical connections

Terminal connectors and plugs

4 terminal connectors

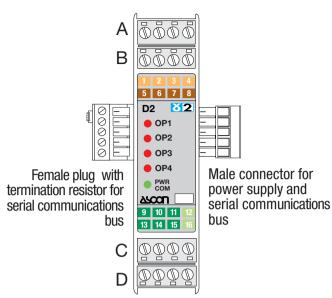


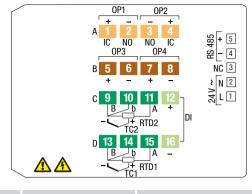


	Features		Terminal connectors A-B-C-D	Power supply and communications connector
	Flexible cable section:		0.22.5 mm ² (AWG24AWG12)	0.081.5 mm ² (AWG28AWG16)
			7 mm - 0.28 in	7 mm - 0.28 in
		Negative screwdriver	0.6 x 3.5 mm	0.4 x 2.5 mm
	(Tightening torque	0.50.6 Nm	0.40.5 Nm

Input


Isolated PV inputs: L-J-K-S-R-T-B-N-E-W thermocouple type

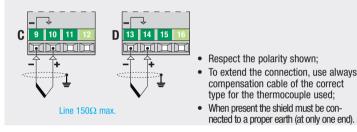

Isolated PV inputs: Pt100 resistance thermometer

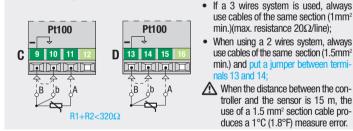

Digital input for external commands



• ON

The input is active when the logic state is ON, corresponding to the contact closed;

use cables of the same section (1mm²

use cables of the same section (1.5mm²

min.) and put a jumper between termi-

troller and the sensor is 15 m, the

use of a 1.5 mm² section cable pro-


duces a 1°C (1.8°F) measure error.

min.)(max. resistance 20Ω/line);


13 and 14

• 0FF The input is inactive when the logic state is OFF, corresponding to the contact open


Isolated PV inputs: in continua mA, mV

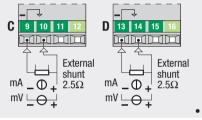

Isolated PV inputs: Pt100 resistance thermometer for ΔT measures (2 x Pt100) special



Digital inputs



▲ When terminals 5, 6 and 7, 8 are not configured as OP3 and OP4 outputs, they can be used as voltage or isolated contact inputs.

· Respect the polarity shown.

Electrical connections

Precautions

ACE


All the wiring must comply with the local regulations.

∕∿

The supply wiring should be routed away from the power cables.

Avoid to use electromagnetic contactors, power relays and high power motors nearby. Avoid power units nearby, especially if controlled in phase angle.

Keep the input low voltage sensor wires away from the power lines and the output cables. If this is not achievable, use shielded cables on the sensor input, with one end of the shield connected to earth.

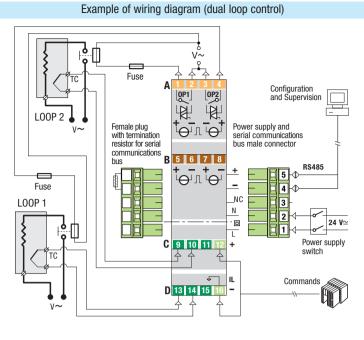

0P1 - 0P2 - 0P3 - 0P4 ouptuts

ACE

ACC

1 Make sure that the power supply voltage is the same indicated on the instrument.


Notes


- 2 Switch on the power supply only after all the electrical connections have been completed.
- 3 In accordance with the safety regulations, the power supply switch shall bring the identification of the relevant instrument. The power supply switch shall be easily accessible from the operator.
- 4 The instrument is PTC protected. In case of failure it is suggested to return the instrument to the manufacturer for repair.
- 5 To protect the instrument internal circuits use: 2 AT at 250 Vac (4 AT at 120 Vac) fuses for relay outputs or 1 A~T for SSR outputs.
- 6 Relay contacts are already protected with varistors. Only in case of 24 V~ inductive loads, use model A51-065-30D7 varistors (on request).

0P1-0P2-0P3-0P4 output characteristics


Output	Туре	For resistive load or auxiliary circuit breaker
0P1 - 0P2	Relay	SPST Relay N.O., 2A/250 Vca (4A/120Vac) External fuse 2A~T at 250Vac (4A~T at 120Vac)
0P1 - 0P2	SSR	1A/250 Vac External fuse 1A~T
0P1 - 0P2	SSR drive	Not isolated: 05 Vdc, ±20% 30 mA max.
0P4	Digital	Not isolated: 05 Vdc, ±20% 30 mA max.

Single action LOOP1 Relay (SSR or SSR drive)



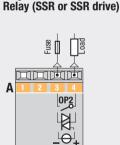

Single action LOOP2




▲ OP1 and OP2 outputs can be used as alarm outputs only if they are not used as control outputs


Power supply bus and serial communication RS485



Digital outputs SSR drives

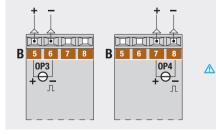

When terminals 5, 6 and 7, 8 are not configured as OP3 and OP4 outputs, they can be used as voltage or isolated contact inputs.



Power supply: Switching type with double insulation with incorporated PTC (resettable fuse).		
Rated voltage:	24 Vac(-25+12%) 50/60 Hz; 24 Vdc (-15+25%).	
Power consumption: 3 W max.		
Protection:	PTC protected.	
Serial communications: Passive and galvanically isolated interface 500 Vac/1 min.		

Conforms to standard EIA RS 485, Modbus/Jbus protocol.

4