

May 17, 2013

URGENT

SAFETY ALERT and MEDICAL DEVICE RECALL

Dear Valued GlideScope® Customer,

Verathon®, maker of GlideScope video laryngoscopes, is conducting a Safety Alert affecting all GlideScope Reusable Blades and a Product Recall affecting certain serial numbers of the Glidescope GVL and AVL blades. Our records indicate that your facility may have received one or more of the products affected by this notice. Please identify the serial number(s) of your GlideScope Reusable Blades located on the side of the handle and follow the instructions on the following pages that apply to your specific serialized device.

This Product Recall and Safety Alert are being conducted with the knowledge of the applicable Regulatory Authorities.

Thank you for your immediate attention to this matter. Verathon is committed to providing product of the highest quality and we regret any inconvenience these actions may cause. We encourage you to contact us if you need assistance or further information.

Thank you,



Rod J. Rylands
VP of Quality & Regulatory Affairs
Verathon, Inc.



John Panton
Sr. Manager, Regulatory Affairs/Quality Assurance
Verathon Medical (Canada) ULC

May 17, 2013

URGENT - SAFETY ALERT

Affected products: GlideScope Reusable GVL, AVL, and Ranger Blades

Note: Does not apply to Single Use Systems, including Video Batons and STATS

Verathon is implementing this Safety Alert to increase awareness of the importance of monitoring the blade condition to prevent blade breakage. Visual inspection of the blades before and after each use is required to prevent injury to the patient.

Our records indicate that your facility may have received one or more of the products affected by this safety alert. Please identify the Serial Number(s) of your GlideScope Reusable Blades located on the side of the handle and follow the instructions below.

| SAFETY ALERT | Product Name | Serial Number range | Instructions/Actions |
|--------------|---|---------------------|--|
| | GlideScope Reusable GVL, AVL, and Ranger Blades | All serial numbers | Verathon is implementing a Safety Alert to provide additional Safety Information to remind users to carefully examine these blades <u>before and after</u> use and promptly replace any that show signs of wear or damage. Please refer to the safety information included in this announcement for detailed instructions on how to inspect your product. |

It is critical to conduct routine inspections of the product before and after each use to identify any damage or wear such as cracks that may lead to breakage. Verathon is highlighting the following warning statement in the User Guide.

WARNING

To ensure patient safety, routinely inspect the GlideScope video laryngoscope blade before and after every use to ensure the blade is free of rough surfaces, sharp edges, cracks, protrusions, or any other indication of wear. If found, do not use the damaged or worn blade, otherwise blade breakage may occur which could cause patient injury or death.

- Always ensure that alternative airway management methods and equipment are readily available.



- Please ensure that all personnel/users are made aware of this warning; retain this safety information with GlideScope user instructions.
- Please fill out the attached self-addressed response card and return it to Verathon. Your Verathon sales representative will contact you shortly regarding replacement of your product(s). All customers have the option to purchase a single use laryngoscope to replace their reusable blades.

Should you have any questions or concerns about this Safety Alert, please contact your Verathon representative or Verathon Customer Care at +31 30 68 70 570. You may also e-mail us at RecallEMEA@verathon.com and we will respond promptly.



May 17, 2013

URGENT - MEDICAL DEVICE RECALL

Affected products: GlideScope Reusable GVL and AVL Blades

Note: Does not apply to Ranger Blades or Single Use Systems, including Video Batons and STATS

Verathon® has become aware of several patient incidents of a fracture/breakage of the laryngoscope blade resulting in a detached piece remaining in the patient airway requiring medical intervention to remove the component. These affected serial numbers are being recalled due to the potential risk of premature failure/breakage of the blade tip that may not be readily visible during routine inspection before or after intubation. We have received reports of laryngoscope blades breaking during use, which could potentially obstruct the patient’s airway or be swallowed, and there are reports of serious adverse health consequences, including death.

Our records indicate that your facility may have received one or more of the products affected by this recall. Please identify the Serial Number of your GlideScope Reusable Blades located on the side of the handle and follow the instructions below.

| PRODUCT RECALL | Product Name | Part Number | Serial Numbers | Instructions/Actions |
|----------------|--------------|-------------|---------------------|---|
| | GVL 3 | 0574-0007 | MD112388 - MD121908 | These serial numbers are being recalled due to the potential of premature failure resulting in cracking and breaking. Discontinue use of these products and refer to additional information below as well as instructions for return and replacement of these Reusable Blades. |
| | GVL 4 | 0574-0001 | LG112759 - LG122582 | |
| | GVL 5 | 0574-0030 | XL111799 - XL121759 | |
| | AVL 2 | 0574-0118 | AC111500 - AC121604 | |
| | AVL 3 | 0574-0115 | AD111500 - AD121688 | |
| | AVL 4 | 0574-0116 | AE111500 - AE121778 | |
| | AVL 5 | 0574-0117 | AF111500 - AF121666 | |



- Please fill out the attached response card and return it to Verathon. Your Verathon sales representative will contact you shortly regarding replacement units.
- To minimize interruption in the availability of your GlideScope system, Verathon will replace each of your affected video laryngoscope blades with new product at no cost to you or we can replace your reusable blades with a Single Use laryngoscope configuration.

Should you have any questions about this Recall, please contact your Verathon representative or Verathon Customer Care at +31 30 68 70 570. You may also e-mail us at RecallEMEA@verathon.com and we will respond promptly.

0014-0199-02-86

If you/your facility are using a reusable GlideScope Video Laryngoscope, please fill out and return the **Safety Alert Reply Form**.

If you/your facility are using a reusable GlideScope Video Laryngoscope with the Serial Number ranges listed in the second table, please fill out and return the **Blade Recall Notification Reply Form** and the **Safety Alert Reply Form**.

SAFETY ALERT REPLY FORM: RESPONSE REQUIRED

| Affected Devices: GlideScope Video Laryngoscope blades | | | | | | | | | | | |
|--|--------------------|-----------|-----------|-----------|-----------|-----------|-----------|-----------|--------------|--------------|-----------------------------|
| Model Number | GVL 2 | GVL 3 | GVL 4 | GVL 5 | AVL 2 | AVL 3 | AVL 4 | AVL 5 | Ranger GVL 3 | Ranger GVL 4 | Ranger GVL 4 w/ 2 ft. cable |
| Part Number | 0574-0010 | 0574-0007 | 0574-0001 | 0574-0030 | 0574-0118 | 0574-0115 | 0574-0116 | 0574-0117 | 0574-0029 | 0574-0028 | 0574-0018 |
| Serial Number | All Serial Numbers | | | | | | | | | | |

I received notification of your Safety Alert. I understand the need to inspect all GlideScope blades before and after use. I have ensured that the provided Safety Information is inserted into the GlideScope User's Manual.

BLADE RECALL NOTIFICATION REPLY FORM: RESPONSE REQUIRED

| Affected Devices: GlideScope Video Laryngoscope blades with the following Serial Numbers | | | | | | | |
|--|----------------------|----------------------|----------------------|----------------------|----------------------|----------------------|----------------------|
| Model Number | GVL 3 | GVL 4 | GVL 5 | AVL 2 | AVL 3 | AVL 4 | AVL 5 |
| Part Number | 0574-0007 | 0574-0001 | 0574-0030 | 0574-0118 | 0574-0115 | 0574-0116 | 0574-0117 |
| Serial Number Ranges | MD112388 to MD121908 | LG112759 to LG122582 | XL111799 to XL121759 | AC111500 to AC121604 | AD111500 to AD121688 | AE111500 to AE121778 | AF111500 to AF121666 |

I have ensured that the Recall Notification was distributed to users throughout the facility.

YES NO If NO, please explain: _____

I received notification of your recall and will contact Verathon Customer Care or my sales representative to replace the blades listed below.

List affected devices in your possession, by serial number, in the table below. Please attach a second page if necessary.

| GVL 3 Blade PN 0574-0007 | GVL 4 Blade PN 0574-0001 | GVL 5 Blade PN 0574-0030 | AVL 2 Blade PN 0574-0118 | AVL 3 Blade PN 0574-0115 | AVL 4 Blade PN 0574-0116 | AVL 5 Blade PN 0574-0117 |
|-----------------------------|-----------------------------|-----------------------------|-----------------------------|-----------------------------|-----------------------------|-----------------------------|
| Ex: MD105001 | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |

We no longer have GlideScope GVL device(s) with the following Serial Numbers: _____

| | |
|------------------------------|--------|
| Business Name: | |
| Address (Including Country): | |
| Signature: | Phone: |
| Printed Name: | Date: |

Please e-mail the completed form to Verathon. **E-mail: RecallEMEA@verathon.com**

GlideScope, GVL, Verathon, and the Verathon Torch symbol are trademarks of Verathon Inc. ©2013 Verathon Inc. 0014-0199-02-86

Retain this Safety Information with GlideScope User Instructions



SAFETY INFORMATION



WARNING

To ensure patient safety, routinely inspect the GlideScope video laryngoscope blade before and after every use to ensure the blade is free of rough surfaces, sharp edges, cracks, protrusions, or any other indication of wear. If found, do not use the damaged or worn blade, otherwise blade breakage may occur and could cause patient injury or death.

- Always ensure that alternative airway management methods and equipment are readily available.

Inspection Instructions

1. Regularly inspect the GlideScope video laryngoscope reusable blade before and after every use to identify any damage or wear that may lead to breakage (see representative examples on reverse side). It is critical to conduct regular inspections throughout the life of the product to prevent any risk to patient safety.
2. Immediately discontinue use if inspection reveals any of the following defects:
 - Rough surfaces
 - Protrusions
 - Sharp edges
 - Surface delamination
 - Cracks
 - Shell separation
3. Report any suspected blade defects to Verathon Customer Care at:

Phone: +31 30 68 70 570

E-mail: customercareEU@verathon.com

SAFETY INFORMATION

Visible Signs of Damage or Wear

Damages and wear that may affect safety are shown inside the red circles and are the result of accelerated cycle-to-failure testing to simulate worst-case usage (end-of-life).


Surface Degradation



Cracking



Camera Window Cracking

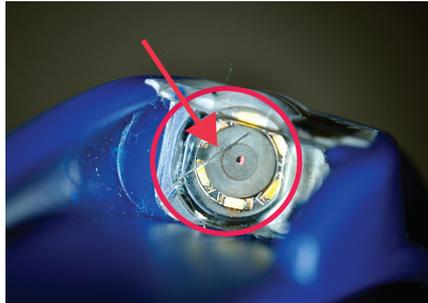

For more detailed product information, see the [GlideScope User's Manual](#).



Corporate Headquarters:
Verathon Inc.
20001 North Creek Parkway
Bothell, WA 98011, USA
Tel: +1 425 867 1348
Fax: +1 425 883 2896


Manufacturer:
Verathon Medical (Canada) ULC
2227 Douglas Road
Burnaby, British Columbia
Canada, V5C 5A9

 
EC Representative:
Verathon Medical (Europe) B.V.
Linnaeusweg 11
3401 MS IJsselstein, The Netherlands
Tel: +31 30 68 70 570
Fax: +31 30 68 70 512

GlideScope, the GlideScope symbol, GVL, Verathon, and the Verathon Torch symbol are trademarks of Verathon Inc. ©2013 Verathon Inc. GlideScope video laryngoscope systems are CE marked in accordance with the Medical Device Directive, and the Verathon Inc. quality system is Quality System Certified to ISO 13485:2003 standards. 0900-4310-01-60