
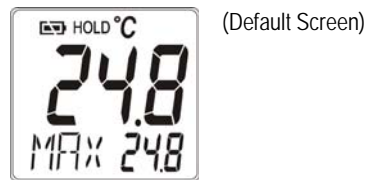


# LT-02 Infrared Laser BBQ Surface Thermometer Instructions

The LT-02 is a non-contact infrared thermometer, with Real-Time Maximum (MAX) temperature display. Please remember to keep away from children and don't use it for safety related applications.

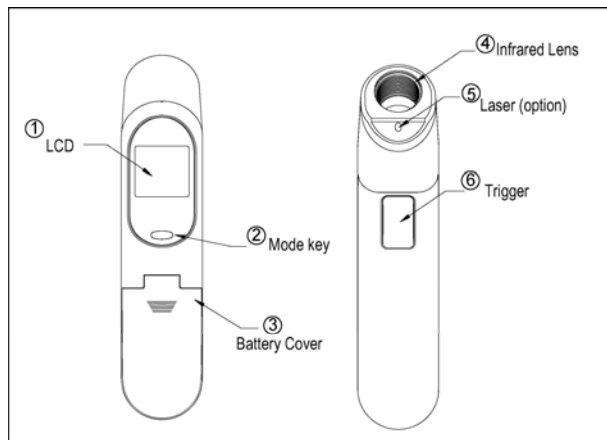

(Default Screen)

1. Simply aim the thermometer at the target with Laser (Ⓢ) and press trigger (Ⓣ) to display the surface temperature.
2. During the measurement, the MAX reading will be displayed beside the MAX icon.
3. The Distance:Spot is 9:1. Please make sure the target area is within the field of view.

## Features:

°C or °F	Press Mode key (Ⓣ) for °C or °F transferred.
Backlight	LCD Backlight: always on.
Laser	ClassII Laser: always enable while measuring.

## ⚠ EMC/RFI

Readings may be affected if the unit is operated within radio frequency electromagnetic field strength of approximately 3 volts per meter, but the performance of the instrument will not be permanently affected.

\* Note: Under the electromagnetic field of 3V/m from 350 to 550MHZ, the maximum error is 8°C (14.4°F).

## ⚠ CAUTION


1. WHEN DEVICE IS IN USE, DO NOT LOOK DIRECTLY INTO THE LASER BEAM—PERMANENT EYE DAMAGE MAY RESULT.
2. USE EXTREME CAUTION WHEN OPERATING THE LASER.
3. NEVER POINT THE DEVICE TOWARDS ANYONE'S EYES.
4. KEEP OUT OF REACH OF ALL CHILDREN.

## STORAGE & CLEANING

The sensor lens is the most delicate part of the thermometer. The lens should be kept clean at all times, care should be taken when cleaning the lens using only a soft cloth or cotton swab with water or medical alcohol. Allowing the lens to fully dry before using the thermometer. Do not submerge any part of the thermometer. The thermometer should be stored at room temperature between -20 to +65°C (-4-149°F).

## LCD ERROR MESSAGES

The thermometer incorporates visual diagnostic messages as follows:

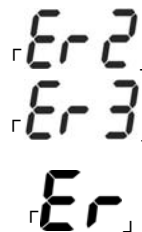

'Er2' is displayed when the thermometer is exposed to rapid changes in the ambient temperature.

'Er3' is displayed when the ambient temperature exceeds 0°C(32°F) or +50°C (122°F).

The thermometer should be allowed plenty of time (minimum 30 minutes) to stabilize to the working/room temperature.

For all other error messages it is necessary to reset the thermometer. To reset it, turn the instrument off, remove the battery and wait for a minimum of one minute, reinsert the battery and turn on. If the error message remains please contact the Service Department for further assistance.

## BATTERIES


The thermometer incorporates visual low battery indication as follows:



'Battery OK': measurements are possible



'Battery Low': battery needs to be replaced, measurements are still possible



'Battery Exhausted': measurements are not possible

⚠ When the 'Low Battery' icon indicates the battery is low, the battery should be replaced immediately with AAA, 1.5V batteries. Please note: It is important to turn the instrument off before replacing the battery otherwise the thermometer may malfunction. Dispose of used battery promptly and keep away from children.

## SPECIFICATION

Measurement Range	-50 to +550 °C (-58 to +1022 °F)
Operating Range	0-50°C (32-122°F)
Accuracy, (Tobj=15-35°C, Tamb=25°C)	+/-1.0°C (1.8°F)
Accuracy (Tobj=-33-400°C, Tamb=23 +/- 3°C)	+/-2% of reading or 2°C (4°F) whichever is greater
Emissivity	0.95 fixed
Resolution (-9.9-199.9°C)	0.1°C/0.1°F
Response Time (90%)	1sec
Distance:Spot	9:1
Battery Life	Typ.18, min 14 hours continuous use
Dimensions	175.2 x 39.0 x 71.9mm
Weight	179 grams including batteries (AAA*2pcs)
** The thermometer will automatically shut off if left idle for more than 15sec.	

## MAVERICK LIMITED 90 DAY WARRANTY

Maverick Industries Inc. warrants this product to be free of defects in parts, materials and workmanship for a period of 90 days, from date of purchase. Should any repairs or servicing under this warranty be required, contact Maverick Customer Service by mail or phone for instructions on how to pack and ship the product to Maverick's National Service Center located as follows:

Maverick Customer Service  
94 Mayfield Ave.  
Edison NJ 08837

Telephone: (732) 417-9666

Hours: Weekdays 8:30 AM- 4:30 PM

Do not send any parts or product to Maverick without calling and obtaining a Return Authorization Number and instructions.

This warranty is VOID if instructions for use are not followed; for accidental damage; for commercial use; for damage incurred while in transit; or if the product has been tampered with.

This warranty gives you specific legal rights and you may also have other rights which vary from state to state.

www.maverickhousewares.com

