

# **SERVICE MANUAL**

# Capacitive level meters CLM-36









Conte	nt	2
l.	Description	3
II.	Technical specification	4-7
III.	Types and performance of electrode	8
IV.	Linearity	9
V.	Mounting and dismounting	10-12
VI.	Instalation of level meter and placing in operation	13
VII.	Preparing of level meter for measuring	14
VIII.	Setting of level meter with unknown value of permittivity of measured med	dium15
IX.	Setting of level meter with known value of permittivity of measured mediu	m 16-18
Χ.	Maintainance and service of level meter	19
XI.	Protection, safety, compatibility and explosion proof	20
XII.	Marking of level meters	21
XIII.	Marking of labels	22-23
XIV.	Accessories	24
XV.	Table of relative permittivity (dielectric constants) of selected materials	25-26
XIV.	Notes	27
Conta	cts	28

I. Description **Dinel** 

Capacitive level meters CLM-36 are designed for continuous level measurement of liquids, powders and bulk-solid materials in vessels, tanks, sumps, containers, silos, etc.

Variants according working areas:

- for non-explosive area: CLM-36N\_-\_-- for explosive area: CLM-36Xi\_-\_-

Available is high temperature performance for both working areas:

high temperature performance for non-explosive area:
 high temperature performance for explosive area:
 CLM-36NT-\_\_ CLM-36XiT-\_-

#### Classification of areas:

Performance of level meter		Part of the level meter with electrode	Part of the level meter with housing	
CLM-36N		non-explosive		
CLM-36NT		non-explosive		
CML-36Xi		II1GDT83°CEEXialIBT5 with ISIR <sup>1)</sup>		
		zone 0, zone 20		
CLM-36XiT	<b>⟨€</b> χ⟩	II1/2GDT83°CEEXiaIIBT5 with ISIR <sup>1)</sup>		
CLIVI-30XII	(CX)	zone 0, zone 20	zone 1, zone 21	

The electrode and its surroundings (the wall of vasel, the reference tube, etc.) make capacitor. The electrode is designed according measured material:

variant with rod electrode:
 variant with rod electrode and reference tube:
 CLM-36\_\_-10, 12
 CLM-36\_\_-20, 22
 variant with rope electrode:
 CLM-36\_\_-30, 31, 32

Available is mechanical connection:

Inside of the level meter's housing is placed removable electronic module with adjustment elements (see chapter VII).

Type of level meter	CLM-36	
Supply voltage: - var. N, NT - var. Xi,XiT	9 ÷ 36 V DC 9 ÷ 30 V DC	
Current output: - non-activated electrode - full-activated electrode	4 mA 20 mA	
Max. internal values of Xi version	Ui=30VDC, Ii=132mA, Pi=0,99W, Ci=370nF, Li=0,9mH	
Sensitivity ranges	20, 30, 50, 100, 150, 300, 500, 1000 pF	
Maximum capacity of flooded electrode (range)	70, 250, 600, 1200, 3000, 7000, 18000, 36000 pF	
Initial capacity regulation ratio	min. 1:2	
Nonlinearity	max. 1 %	
Temperature error	max. 0,05% / K	
Voltage error	max. 0,3 μA / V	
Internal resistance / electric strength (electrode - housing)	1 MΩ / 250 V AC	
Coupling capacity / electric strength (housing - supply leads)	var. N 51 nF / 250 V AC var. Xi 26 nF / 500 V AC	
Allowed temperature range in zone 0 (EN 50284)	-20 to +60°C	
Allowed pressure range in zone 0 (EN 50284)	0,8 to 1,1 bar (0,08 to 0,11 MPa)	
Protection class: - housing - connector type GDM 2009 - connecor type GDM-K 2000	IP 67 IP 65 IP 67	
Connector socket type Hirschmann DIN 43 650	GDM 2009 (standard) GDM-K 2000 (optional)	
Recommended cable	2 x 0,75 mm <sup>2</sup>	
Max. load (serial) resistance (U = 24 V)	R <sub>max</sub> =750 Ω	
Weight of the housing (without electrode)	var. N, Xi aprox. 0,5 kg var. NT, XiT aprox. 1 kg	

# Temperature resistance of CLM-36:

Variant of performance	Temperature of medium	Ambient temperature range t <sub>a</sub> (at housing)		
periormance	(at electrode)	variant N	variant Xi	
CLM-3610, 20	-40 to +200°C	-40 to +85°C	-40 to +75°C	
CLM-3612, 22	-40 to +120°C	-40 to +85°C	-40 to +75°C	
CLM-3630, 31, 32	-40 to +105°C	-40 to +85°C	-40 to +75°C	

# Pressure resistance of performance CLM-36N(Xi):

Variant of	Maximum operating overpressure		
performance	for $t_a$ = -40 to +20°C	for t <sub>a</sub> = -40 to +85°C	
CLM-3610, 20	3 MPa	1 MPa	
CLM-3612, 22	3 MPa	1 MPa	
CLM-3630, 31, 32	1 MPa	0,5 MPa	

# Pressure resistance of high temperature performance CLM-36NT(XiT):

Temperature in connection point	+ 100°C	+120°C	+150°C	+180°C
Maximum overpressure	3,0 MPa	2,0 MPa	1,5 MPa	0,5 MPa

#### **Used materials:**

Part of the level motor (type)	Material		
Part of the level meter (type)	standard	optional	
housing (all)	st. steel W. Nr. 1.4301	st. steel W. Nr. 1.4571, Incoloy 825 (W. Nr. 2.4858)	
insulation bushing (all)	PTFE	-	
electrode (10, 12, 20, 22)	st. steel W. Nr. 1.4301	st. steel W. Nr. 1.4571	
electrode (30, 31, 32)	zinc coated steel rope	-	
electrode coating (12, 22, 32)	FEP	-	
electrode coating (30, 31)	polyolefin (modified PE)	PTFE	
weight insulation (32)	PTFE	-	
weight / anchor mechanism (30, 31, 32)	st. steel W. Nr. 1.4301	-	
reference tube (20, 22)	st. steel W. Nr. 1.4306	st. steel W. Nr. 1.4571	


#### **Dimensions of each variants:**


with rod electrode:

with rod electrode and reference tube:


with rope electrode:

CLM-36\_ \_-10-\_ CLM-36\_ \_-12-\_ CLM-36\_ \_-20-\_ CLM-36\_ \_-22-\_ CLM-36\_ \_-30-\_

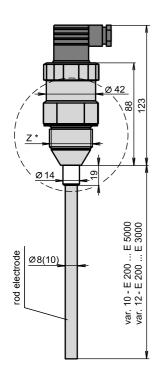

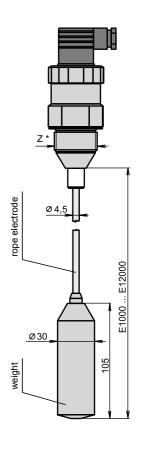


var. M, G - housing with thread



var. CI - housing with

Triclamp coupling

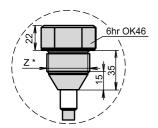

Z\* - var. M - thread M-36x2 - var. G - thread G1"

#### **Dimensions of each variants:**


with rope electrode: with rope electrode

with anchor:

CLM-36\_\_-31-\_

high temperature performance:

CLM-36\_T-\_ \_-\_

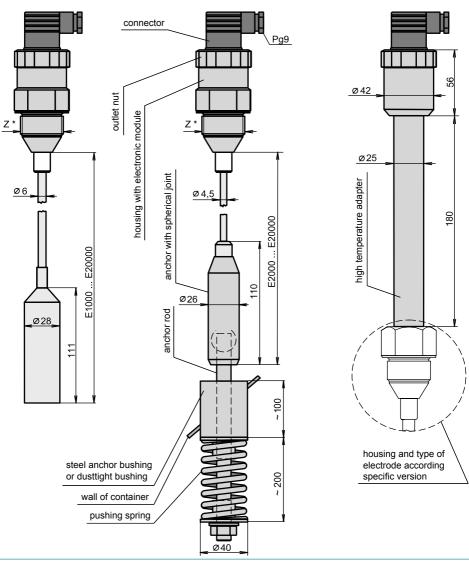

#### Characteristic of variants:

#### CLM-36\_ \_-10-\_

With uncoated rod electrode - for level measurement of non-conductive liquids (oils, diesel, benzine) and bulk-solid materials (flour, sand, cement, plastic granulates, etc.). Max. electrode length 5 m.

#### CLM-36\_ \_-12-\_

With coated rod electrode (FEP isolating) - for level measurement of water and other conductive liquids including waste liquids in metal vessels, concrete sumps, reservoirs, etc. Resistant against aggressive medium, lower adhesion to some mediums. Max. electrode length 3 m.

#### CLM-36\_ \_-20-\_

With uncoated rod electrode and reference tube - for level measurement of clean non-conductive liquids (oils, diesel, benzine). By means of reference tube the output signal does not depend on the dimension and shape of the vessel. Impossible to use for waste and high viscosity liquids and bulk-solid materials. Max. electrode length 3 m.

#### CLM-36 -22-

With coated rod electrode (FEP isolating) and reference tube - for level measurement of clean conductive liquids. Main use is for measurement in plastic and glass vessels and for fine measuring. Not suitable for waste water and high viscosity liquids and bulk-solid materials. Max. electrode length 3 m.

#### CLM-36\_ \_-30-\_

With coated rope electrode (polyolefine isolating) and uncoated weight - for level measurement of bulk-solid materials (grains, sand, flour, cement, etc.). Max. electrode length 12 m.

#### CLM-36 -31-

With coated rope electrode with anchor (polyolefine isolation) and uncoated weight - as the type 30. For use for higher silos. Max. electrode length 20 m.


#### CLM-36 -32-

With coated rope electrode (FEP isolation) and coated weight (isolation PTFE) - for level measurement of conductive and non-conductive liquids. Max. electrode length 20 m.


IV. Linearity **Dine1**®

Influence of the tank shape on a linearity of measured capacity of non-conductive liquids:

1. In the tank with straight wall (for example vertical cylinder) and with the sensor placed parallely with the wall capacity change is linear.



2. In a curved tanks (most frequently horizontal cylinder) capacity change during measuring of electrically non-conductive material is non-linear. Linearity is done by reference tube (CLM-36\_ \_-20, 22-\_).

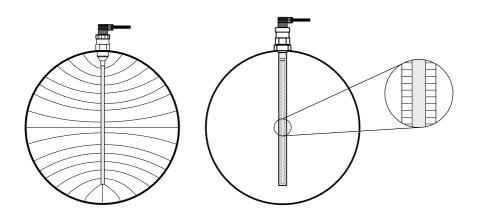

Level meters with coated electrode have protection cover at the end of electrode, which is necessary take down befere mounting.

Level meters mount in vertical position to upper lid of tank or reservoir by steel welding flange ON-36x2 (steel 11375), stainless steel welding flange NN-36x2 (stainless steel 1.4301) or Clamp flange.


For mounting level meter to the metal tank or reservoir is not necessary to ground housing again.

In case of installation in concrete sumps or silos it is properly to install level meter at metalic auxiliary construction (console, lid, etc.) and then connect with metal all the time submerged object, eventually with steel armouring.

For measuring of material in plastic and glass vessels by level meter without reference tube is necessary to connect grounding screw at housing with auxiliary electrode which is fixed by the appropriate method to the outer casing of vessels (or at inner wall). Material of auxiliary electrode is necessary to choose with consideration to the working environment and properities of measured material.

Orientation of proportion for mounting of level meter (including eventually auxiliary electrode) shows following pictures.


installation into the metal and non-metal vessels

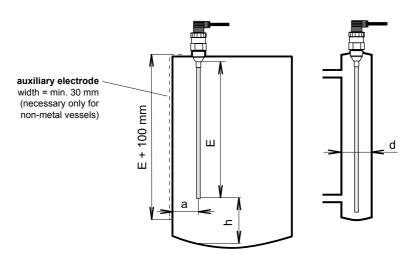

- E the length of electrode [mm] the end of the electrode has to be dipped min. 20 mm below the lowest measured level
- h the distance from the bottom min. 50 mm
- a the distance from the wall min. approx. E/20
- d the diameter of auxiliary tube vessel min. 40 + E/20 (smaller dimension has to be discussed with producer)

CLM-36 -20, 22-


installation with reference tube

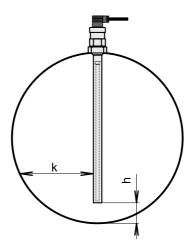


- the distance from the bottom min. 50 mm with respect on possibility of presence of heavy fraction (water) in oil products
- k the distance from the wall optional

CLM-36\_ \_-30, 32-\_

installation into the metal tank and concrete containers

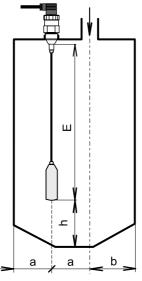


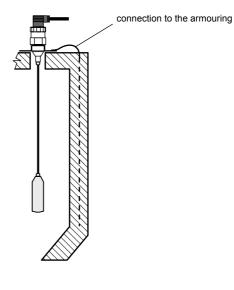

- the length of electrode [mm] the end of the electrode has to be dipped min. 20 mm below the lowest measured level
- h the distance from the bottom min. 100 mm
- a the distance from the wall approx. the same as the distance from the inlet

CLM-36\_ \_-31-\_

installation of rope electrode with anchor

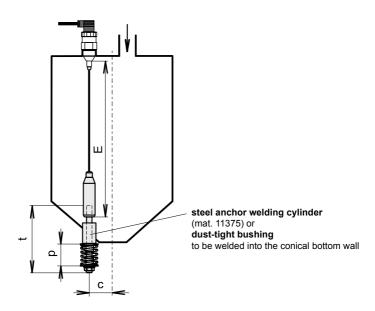

- **E** the length of electrode [mm]
- c the distance from the centre line of the silo has to be as minimal as possible
- t the length of the conduction rod approx. 500 mm
- p the length of the press spring approx. 200 mm


# VI. Instalation of level meter and placing in operation

Mounting, installation, placing in operation, maintainance, using and service of level meter CLM-36 must be done in conformity with this service manual and has to be performed according the norms for installation of electrical devices.


Electric connection of feeder cable is realized in state without voltage through the use of thread terminal in dismountable connector GDM at level meter's housing.

Positive pole of supply (+U) will be connected at terminal (1), negative pole of supply (0V) will be connected at terminal (2) - see following pictures.

#### Connection scheme of level meter



#### The inside scheme of the GDM connector socket

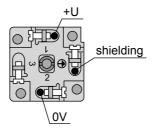

Cable from level meter to the further unit is by two-wire cable with outside diameter of  $6 \div 8$  mm (recommended cross section of cores  $0.5 \div 0.75$  mm<sup>2</sup>).

A shielded cable must be only used if the lead is longer than 30 m or in the event that a power line must be used simultaneously with the lead. Connect shielding to the socket  $\bigoplus$ , shielding do not connect to the power panel.

Power supply for variants CLM-36N and CLM-36NT can be by stabilized safety voltages power supply  $9 \div 36 \text{ V DC}$  (SELV), example PSU-2400 or DSU-2400.


Or following evaluation device, for example programmable display unit PDU-4xx. For variants CLM-36Xi and CLM-36XiT must be connected with intrinsically safe isolating repeater  $9 \div 30 \text{ V DC}$ , for example IRU-420.

Activation is by turning on of the power supply (for example PSU-2400 či DSU-2400 for variants CLM-36N and CLM-36NT) or intrinsically safe isolating repeater (for example IRU-420 for variants CLM-36Xi and CLM-36XiT).

#### Preparing of level meter

- 1. For access to the adjustment elements disconnect a connector and unscrew a nut (attention for inside connecting wires). Connector connect again.
- 2. Level meter connect to the supply unit through miliampermeter (controler, etc.).
- 3. Trimmer<sup>2)</sup> 20 mA bring into the basic position (this position is set by producer):
  - a) Turn out trimmer totally rightwards (in clockwise).
  - b) Return back for 3 turns leftwards.

#### Adjustment elements of level meter

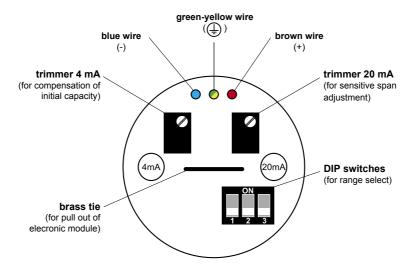

(the top view on the internal electronic module)

<sup>2)</sup> The trimmers are without backstops - approx. 15 turns.

<sup>3)</sup> Sensitivity - minimal capacity change of electrode to reach a current range 4 ÷ 20 mA.

<sup>4)</sup> Range - maximum capacity of housing and activated electrode to reach current range 4 ÷ 20 mA.

<sup>5)</sup> In case of short of electrode on housing or setting of a very sensitive range can caused to current restriction of level meter on value max. 30 mA.

# Setting of level meter with unknown value of permittivity of measured medium

- 1. Empty tank to the minimum level.
- 2. By DIP switches on level meter set range<sup>4)</sup> No. 2 (250 pF).
- 3. Turn by screwdriver in trimmer 4 mA and set quiescent current of the level meter to 4 mA. Turning rightwards (in clockwise) increase the current, turning leftwards decrease the current. When is impossible to set required current to 4 mA, then switch DIP switches to the nearest higher range and set up of current 4 mA perform at this range.
- 4. Fill the tank to the maximum level. When it is impossible fill the tank to the maximum state then we use some known (measurable) level and current for next setting calculate according to formula:

$$I_{OUt} = 4 + (0.16 \text{ x level in }\%)$$
 [mA]

- 5. By DIP switches stepwise switch to higher ranges till the current is greather then 20 mA (or calculated value I<sub>out</sub>), thru level meter then flows current e.g. 21 mA<sup>5)</sup>. **Trimmer 20 mA** is still in basic position.
- Then set by trimmer 20 mA current of level meter to 20 mA (or to calculated value I out
   see bellow).
- 7. To reach a maximum accuracy is useful to check over the setting of 4 mA (compensation of initial capacity quiescent current).

#### Table of ranges:

No.	Sensitivity <sup>3)</sup> (S)	Range <sup>4)</sup> (R)	Position of DIP switch
1 <sup>6)</sup>	20 pF	70 pF	
2	30 pF	250 pF	
3	50 pF	600 pF	
4	100 pF	1 200 pF	
5	150 pF	3 000 pF	
6	300 pF	7 000 pF	
7	500 pF	18 000 pF	1 2 3
8	1 000 pF	36 000 pF	

6) Range No. 1 (70 pF) is very sensitive and we recommend to use it only at level meters with short electrode (approx. to 500 mm) and measured media with low permittivity.

# Setting of level meter with known value of permittivity of measured medium

- 1. Calculation of measuring range:
  - a) Count sum of capacity of housing (CH) and capacity of non-activated electrode (CNE).

$$C1 = CH + CNE$$

Capacity of housing (typical values)	СН
Capacity of housing - normal performance	21 pF
Capacity of housing - high temperature performance	28 pF

Capacity of non-activated electrodes (electrode length 1000 mm)	CNE (air)
all types without reference tube in distance 250 mm from conducting wall	12 ÷ 15 pF
uncoated rod electrode with reference tube (type 20)	approx. 50 pF
coated rod electrode with reference tube (type 22)	approx. 55 pF

b) Count sum of capacity of housing (CH) and capacity of activated electrode (CAE) - selected mediums see the table.

$$C2 = CH + CAE$$

Capacity of activated electrodes (electrode length 1000 mm)	CAE (benzine)	<b>CAE</b> (water)
all types without reference tube in distance 250 mm from conducting wall	25 ÷ 30 pF	500 pF (coated electorde)
uncoated rod electrode with reference tube (type 20)	approx. 100 pF	-
coated rod electrode with reference tube (type 22)	approx. 110 pF	500 pF

c) Set the possible ranges - capacity of housing and activated electrode (C2) will not be greather than range value (R).

d) Sensitivity check - difference of capacity activated (CAE) and non-activated (CNE) electrode must be greather than sensitivity of calculated range.

$$C2 - C1 > S$$
 (CAE - CNE > S)

- e) Choose the range both previous conditions must be used together c) and d).
- 2. Empty the tank to the minimum level.
- 3. By DIP switches on level meter set up pre-counted range.
- 4. Turn by screwdriver in trimmer 4 mA and set quiscent current of the level meter to 4 mA. Turning rightwards (in clockwise) increase the current, turning leftwards decrease the current. When is impossible to set required current to 4 mA, then switch DIP switches to the nearest higher range and set up of current 4 mA perform at this range.
- 5. Fill the tank to the maximum level. When it is impossible fill the tank to the maximum state then we use some known (measurable) level and current for next setting calculate according to formula:

$$I_{OUT} = 4 + (0.16 \text{ x level in }\%)$$
 [mA]

- On preliminary range of level meter set by trimmer 20 mA current of level meter to 20 mA (or to calculated value I <sub>Out</sub> - see bellow). Turning rightwards (in clockwise) increase the current, turning leftwards decrease the current.
- 7. To reach a maximum accuracy is useful to check over the setting of 4 mA (compensation of initial capacity quiscent current).

# **Example of calculation:**

Level meter CLM-36N-20-M E1000, measured medium is benzine ( $\epsilon_r$  = 2,2), distance from wall to level meter with uncoated rod electrode with reference tube is optional.

1.a) Sum of capacity of housing and non-activated electrode:

$$C1 = CH + CNE = 21 + 51 = 72 pF$$

1.b) Sum of capacity of housing and activated electrode:

$$C2 = CH + CAE = 21 + 100 = 121 pF$$

# IX. Setting with known value of permittivity

1.c) Possible ranges:

1.d) Check the sensitivity:

$$C2 - C1 > S$$

$$C2 - C1 = 121 - 72 = 49 pF$$

1.e) Recommended accurate range:

Level meter CLM-36N-20 with electrode E = 1000 mm by flowage of benzine has capacity 120 ÷ 135 pF - typical measuring range is range (2) 250 pF.

Typical measuring ranges of CLM-36 with electrode 1 m, 2 m and 5 m length for selected medias:

Medium	Sand, grains		edium Sand, grains Cement		Flour	
Type	1 m	5 m	1 m	5 m	1 m	5 m
10	2	3	2	4	1	3
12	2	3	2	4	1	3
30	2	3	2	4	1	3
31	2	3	2	4	1	3

Medium	Water		Benzine, petroleum, diesel, oils	
Type	1 m	2 m	1 m	2 m
10	-	-	1	2
12	3	4	1	2
20	-	-	2	3
22	3	4	2	3
32	3	4	1	2

Types 10, 12, 30, 31, 32 in distance 250 mm from conducting wall.

Showned ranges are orientation. Exact range for existing configuration electrode / tank must be set directly in application on mearured medium.

Note:

#### Maintainance of level meter

Maintainance of device is to control the housing of level meter and lead-in calbe. In case of any visible damages please contact producer or supplying company.

At level meter is prohibited to perform any changes or repair without producer confirmation.


#### Service of level meter

Eventual reparation of mechanical damage of level meter must be done by producer or by producer authorized service organization.

#### Replacement of defective electronic

In case of detected electronic failure it is possible to replace the electronic module directly in process place of level meter by following procedure:

- Disconnect connector and unscrew a nut (attention for inside connecting wires).
- 2. Defective electronic module pick up by pliers onto brass tie and remove by tensile from housing of level meter.
- 3. Check placing of white seal O-ring in housing and on pressure ring.
- 4. Repaired or new electronic module return back into housing of level meter and press down by clamping ring (attention that contact pin will be a little open before insertion and contact springs were not pressed under level of electronic casing).
- 5. Check placing of black seal O-ring on connector.
- 6. Screw a nut back (attention for inside connecting wires) and connect the connector.

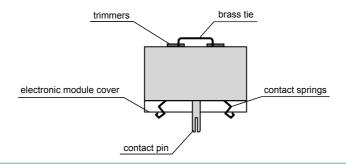

# XI. Protection, safety, compatibility and explosion proof **Dinel**

#### **Protection**

Level meter is equipped with protection against reverse polarity of supply voltage and against overvoltage.

#### Safety

Safety against dangerous contact is ensure by safe power supply according norm EN 33 2000-4-41 (SELV).


#### Compatibility

Electromagnetic compatibility is provided by conformity with norms EN 55022/B, EN 61326-1, EN 61000-4-2, EN 61000-4-3, EN 61000-4-4, EN 61000-4-5, EN 61000-4-6.

# **Explosion proof**

Explosion proof of CLM-36Xi and CLM-36XiT is examined by FTZU-AO 210 Ostrava - Radvanice, certificate No. 02 ATEX 0235X.

# Method of marking of level meters CLM-36

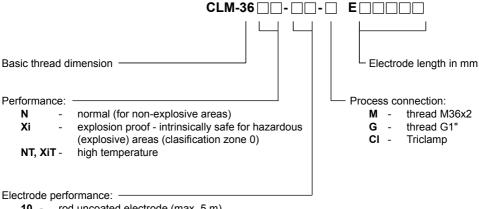

- 10 rod uncoated electrode (max. 5 m)
- 12 rod coated (FEP isolation) electrode (max. 3 m)
- 20 rod uncoated electrode with reference tube (max. 3 m)
- rod coated (FEP isolation) electrode with reference tube (max. 3 m) 22 -
- 30 rope electrode with coated (polyolefine isolation) rope and uncoated weight (max. 12 m)
- 31 rope electrode with anchor with coated rope (polyolefine isolation) and uncoated weight (max. 20 m)
- 32 rope electrode with coated rope (FEP isolation) and coated weight (isolation PTFE) (max. 20 m)

# **Examples of correct marking**

CI M-36N-10-G F1100

CLM-36XiT-20-M E900

CLM-36N-12-CLF2000

CLM-36NT-12-M E1500

CLM-36Xi-30-M F12000

CLM-36N-32-G F6000

#### On label of level meter type CLM-36N(T) are following datas:



- symbol of producer: logo Dinel<sup>®</sup>
- contact: Dinel, s.r.o., Zlin, Czech Republic, www.dinel.cz, dinel@dinel.cz
- connection scheme and labelling of wires: +U, 0V, GND
- type of level meter: CLM-36-N\_-\_\_, include length of electrode: E in mm
- serial number: Ser. No.: xxxxx production year (first two position) and sequence factory number (next three position)
- power supply voltage: U<sub>i</sub> = 9 ÷ 36 V DC
- output current range: I = 4 ÷ 20 mA
- ambient temperature range: t<sub>a</sub> = -40 ... +85 °C
- protection degree: IP 65 / IP 67
- label of shody: CE
- symbol of electro-equipment for back collection and separate collection of electrowaste

# On label of level meter type CLM-36Xi are following datas:



- symbol of producer: logo Dinel<sup>®</sup>
- contact: Dinel, s.r.o., Zlin, Czech Republic, www.dinel.cz, dinel@dinel.cz
- connection scheme and labelling of wires: +U, 0V, GND
- type of level meter: CLM-36-Xi-\_\_\_, include length of electrode: E in mm
- serial number: Ser. No.: xxxxx production year (first two position) and sequence factory number (next three position)
- label of non-explosive device: Ex in hexagon
- performance: II1GDT83°CEExialIBT5
- number of authorized person examining control of system quality: 1026
- number of certificate of intrinsically safety: FTZU 02 ATEX 0235X
- limiting operating parameters:  $U_i$  = 30 V DC,  $I_i$  = 132 mA,  $P_i$  = 0,99 W,  $C_i$  = 370 nF,  $L_i$  = 0.9 mH
- ambient temperature range:  $t_a = -40 \dots +75 \,^{\circ}\text{C}$ ,  $t_a = -20 \dots +60 \,^{\circ}\text{C}$  (zone 0)
- protection degree: IP 65 / IP 67
- label of shody: CE
- symbol of electro-equipment for back collection and separate collection of electrowaste

#### On label of level meter type CLM-36XiT are following datas:



- symbol of producer: logo Dinel<sup>®</sup>
- contact: Dinel, s.r.o., Zlin, Czech Republic, www.dinel.cz, dinel@dinel.cz
- connection scheme and labelling of wires: +U, 0V, GND
- type of level meter: CLM-36-XiT-\_\_-, include length of electrode: E in mm
- serial number: Ser. No.: xxxxx production year (first two position) and sequence factory number (next three position)
- label of non-explosive device: Ex in hexagon
- performance: II1/2GDT83°CEExiaIIBT5
- number of authorized person examining control of system quality: 1026
- number of certificate of intrinsically safety: FTZU 02 ATEX 0235X
- limiting operating parameters:  $U_i$  = 30 V DC,  $I_i$  = 132 mA,  $P_i$  = 0,99 W,  $C_i$  = 370 nF,  $L_i$  = 0,9 mH
- ambient temperature range: t<sub>a</sub> = -40 ... +75 °C, t<sub>a</sub> = -20 ... +60 °C (zone 0)
- protection degree: IP 65 / IP 67
- label of shody: CE
- symbol of electro-equipment for back collection and separate collection of electrowaste

XIV. Accessories Dine1

#### Standard accessories:

For each level meter:

- 1 pc of connector socket GDM 2009 (IP 65)
- 1 pc of seal (material AFM)

For each delivery (each 5 pcs):

- 1 pc of screwdriver for adjustment

#### Optional accessories:

For mounting of level meter:

- stainless fixing nut UM-36x2 (material stainless steel 1.4301)
- steel welding flange ON-36x2 (material steel 11375)
- steel welding flange with lock and Al seal ON-36x2-Z (material steel 11375)
- stainless welding flange NN-36x2 (material stainless steel 1.4301)

#### Other:

- connector socket GDM-K 2000 with 5 m of calbe (IP 67)
- seal (on request material PTFE, Al, etc.)

# Table of relative permittivity (dielectric constants) of selected materials

Material	ε <sub>r</sub>
Acetone	19,5 ÷ 21,4
Acetylentetrachloride	8,1
Aminoplasts	5 ÷ 8
Ammonia	15 ÷ 24
Aniline	6,9
Ash	1,5 ÷ 1,7
Benzaldehyde	18,3
Benzene	2,28 ÷ 2,3
Benzol	2,3
Celluloide	3,5 ÷ 6,2
Cement	4,0
Dioxane	2,235
Ebonit	2,5 ÷ 5
Ethanol	24
Ethylacetate	6,0
Ethyleneglycol	38,7
Ethylenechloride	10,5
Flint crystal	4,5
Flour	2,5 ÷ 3,0
Food salt (NaCl)	6,0
Freon R22	6,1
Fused quartz	3,7
Gasoline (benzin)	2,0 ÷ 2,2
Glass	3,7 ÷ 10
Glass organic	3 ÷ 3,6
Glass silicate	16
Glazed carton	3,5
Glycerine	47
Grains	3,0 ÷ 5,0
Hardened textile	2 ÷ 6
Hexane	1,9

Material	$\epsilon_{r}$
Chloroforme	4,81
Ice	3,1
Liquefied air	1,5
Liquefied CO2	1,6
Liquefied chlore	2,0
Liquefied propan	1,6 ÷ 1,9
Marble	9,3 ÷ 11,6
Methanol	32,7 ÷ 33,8
Mica	5 ÷ 8
Mikanite	4,5 ÷ 6
Milk powder	3,5 ÷ 4
Monochlorbenzene	4,0
Nitrobenzene	35,7
Ortonitrotoluene	27,4
Paper	1,6 ÷ 2,6
Paraffin	1,9 ÷ 2,5
Paraffin oil	1,9 ÷ 2,5
Paraffinic oil	2,2
Petroleum	2,0 ÷ 2,2
Polyacetal	3,6 ÷ 3,7
Polyamide - PA	4,0 ÷ 5,0
Polydichlorstyrole	2,7
Polyetheretherketone -	3,2
Polyetherimide - PEI	3,0
Polyethylene - PE	2,16
Polyfenylenesulfide - PPS	3,3
Polymethylmetakrylate	2,56
Polypropylene - PP	2,0 ÷ 2,2
Polystyrole	2,39
Polysulphone - PSU	3,0
Polytetrafluorethylene	2,0 ÷ 2,1

# Table of relative permittivity (dielectric constants) of selected materials

Material	$\mathcal{E}_{r}$
Polyvinylacetate	2,7
Polyvinylchloride - PVC	2,51 ÷ 3,1
Polyvinylidenefluoride	6,0 ÷ 7,4
Porcelain	4,5 ÷ 7
Pyridine	13,6
Rape-seed (colza) oil	2,8
Resin - acrylic	2,4 ÷ 4,5
Resin - epoxy	2,5 ÷ 8,0
Resin - melamine	4,7 ÷ 10,2
Resin - phenolic	4,0 ÷ 12,0
Resin - polyester	2,8 ÷ 8,1
Resin - styrene	2,3 ÷ 3,4
Resin - ureal	5,0 ÷ 8,0
Rubber	2,0 ÷ 6,0
Sand	3,0 ÷ 5,0
Silicon caoutchouc	2,8 ÷ 3,3
Succinite	2,9
Sugar	3,0
Sulphur	3,4 ÷ 3,6
Toluene	2,3 ÷ 2,38
Trichlorethylene	3,43
Trolitule	2 ÷ 2,6
Vaseline	2,2 ÷ 2,9
Water	81
Water solution	50 ÷ 80
White beeswax	2,0 ÷ 2,9
Wood - damp	10 ÷ 30
Wood - dry	2 ÷ 6

XVI. Notes **Dine1**°



Dinel, s.r.o. U Tescomy 249 760 01 Zlin Czech Republic

phone: (+420) 577 002 003 fax: (+420) 577 002 007

e-mail: sale@dinel.cz

www.dinel.cz www.levelmeasurement.eu