

MANUAL PART NUMBER: 400-0199-003

DA1931CT

CAT-5 TO VGA + AUDIO RECEIVER USER'S GUIDE

EALTIMEX

SIGNAL
MANAGEMENT
SOLUTIONS

TABLE OF CONTENTS

	Page
PRECAUTIONS / SAFETY WARNINGS	2
GENERAL.....	2
INSTALLATION	2
CLEANING.....	2
FCC / CE NOTICE.....	2
ABOUT YOUR DA1931CT	3
TECHNICAL SPECIFICATIONS.....	3
PRODUCT DESCRIPTION	4
APPLICATION DIAGRAM	5
DIAGRAM 1: TYPICAL CONFIGURATION	5
DIAGRAM 2: RJ-45 PINOUT	6
DIAGRAM 3: INTERNAL VIEW	7
DIAGRAM 4: DIP SWITCH SETTINGS.....	8
INSTALLING YOUR DA1931CT.....	9
OPERATION	9
VIDEO EQUALIZATION.....	9
TROUBLESHOOTING GUIDE	10
LED IS NOT RED	10
LED IS NOT GREEN	10
NO SOUND.....	10
NO REMOTE IMAGE	10
RECEIVING DISPLAY QUALITY IS POOR	11
ALTINEX POLICY	11
LIMITED WARRANTY/RETURN POLICY	11
CONTACT INFORMATION	11

PRECAUTIONS / SAFETY WARNINGS 1

Please read this manual carefully before using your **DA1931CT**. Keep this manual handy for future reference. These safety instructions are to ensure the long life of your **DA1931CT** and to prevent fire and shock hazard. Please read them carefully and heed all warnings.

1.1 GENERAL

- Qualified ALTINEX service personnel, or their authorized representatives must perform all service.

1.2 INSTALLATION

- To prevent fire or shock, do not expose this unit to rain or moisture. Do not place the **DA1931CT** in direct sunlight, near heaters or heat radiating appliances, or near any liquid. Exposure to direct sunlight, smoke, or steam can harm internal components.
- Handle the **DA1931CT** carefully. Dropping or jarring can damage the unit.
- Do not pull the cables that are attached to the **DA1931CT**.

1.3 CLEANING

- Clean only with a dry cloth. Never use strong detergents or solvents, such as alcohol or thinner. Do not use a wet cloth or water to clean the unit. Do not open the unit to clean.

1.4 FCC / CE NOTICE

- This device complies with part 15 of the FCC Rules. Operation is subject to the following two conditions: (1) This device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

- This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.
- Any changes or modifications to the unit not expressly approved by ALTINEX, Inc. could void the user's authority to operate the equipment.

ABOUT YOUR DA1931CT 2

DA1931CT CAT-5 TO VGA + AUDIO RECEIVER

The **DA1931CT** provides a means of receiving computer video and audio signals over twisted pair (CAT-5) type cable when used together with an ALTINEX Twisted Pair Video Transmitter, such as the **DA1930CT**.

The **DA1931CT** is compact and easy to use. The **DA1931CT** is able to receive one of the video sources, such as VGA, Component Video, S-Video or C-Video along with Stereo Audio transmitted over the CAT-5/6 cable from the **DA1930CT** or equivalent Transmitter.

The **DA1931CT** provides both Audio and Video outputs. The **DA1931CT** offers a female 15-pin HD output for RGBHV/YPbPr signals, a 4 pin Mini-Din connector for S-Video and an RCA connector for Composite Video Output. A 5 pin terminal block is available for balanced stereo output and a 3.5mm jack is used for unbalanced stereo output.

The unit also offers hardware Video Equalization for transmission lengths up to 400 feet. The Video Equalization work in conjunction with the Video Equalization on the transmitter. There is also a Signal Detect feature which shows when an input signal is present.

TECHNICAL SPECIFICATIONS 3

FEATURES/ DESCRIPTION	DA1931CT
GENERAL	
Inputs Video/Audio	
Altinex CAT-5/6 Twisted Pair Standard	RJ-45
Outputs	
RGBHV/YPbPr	15 Pin HD
S-Video	4 Pin Mini DIN
Composite Video	RCA female
Stereo Audio – unbal.	3.5mm female
Stereo Audio – balanced	5 Pin Terminal Block
Compatibility	VGA through UXGA, Stereo Audio, C-Video, S-Video

Table 1. **DA1931CT** General

400-0199-003



3

MECHANICAL	DA1931CT
Material	0.1" Al
Finish	ALTINEX Grey
Top Panel	Lexan Overlay
Height (inches)	5.28in (134mm)
Width (inches)	4.29in (109mm)
Depth (inches)	0.98in (25mm)
Weight (pounds)	1.0lb (0.45kg)
Ship Weight (pounds)	1.6lbs (0.73kg)
T° Operating	10°C-40°C
T° Maximum	50°C
Humidity	90% non-condensing
MTBF (calculations)	40,000 hrs

Table 2. **DA1931CT** Mechanical

ELECTRICAL	DA1931CT
Input	
CAT-5/6 Twisted Pair Input	Video/Sync/Audio Signals Altinex Standard
Output Video Signals	
RGBHV/YPbPr - Video	75 Ohms
RGBHV - Sync	10 kOhms/TTL
S-Video	75 Ohms
Composite Video	75 Ohms
Output Audio Signals	
Gain at 1 KHz- Balanced	+6dB +/- 10%
Gain at 1 KHz- Unbal.	0dB +/- 0.5dB
Amplitude Matching (difference Left to Right)	10% maximum
Frequency Response	20Hz-18KHz (+/-0.5dB)
Power	
External Adapter (included)	9V DC, 1A

Table 3. **DA1931CT** Electrical

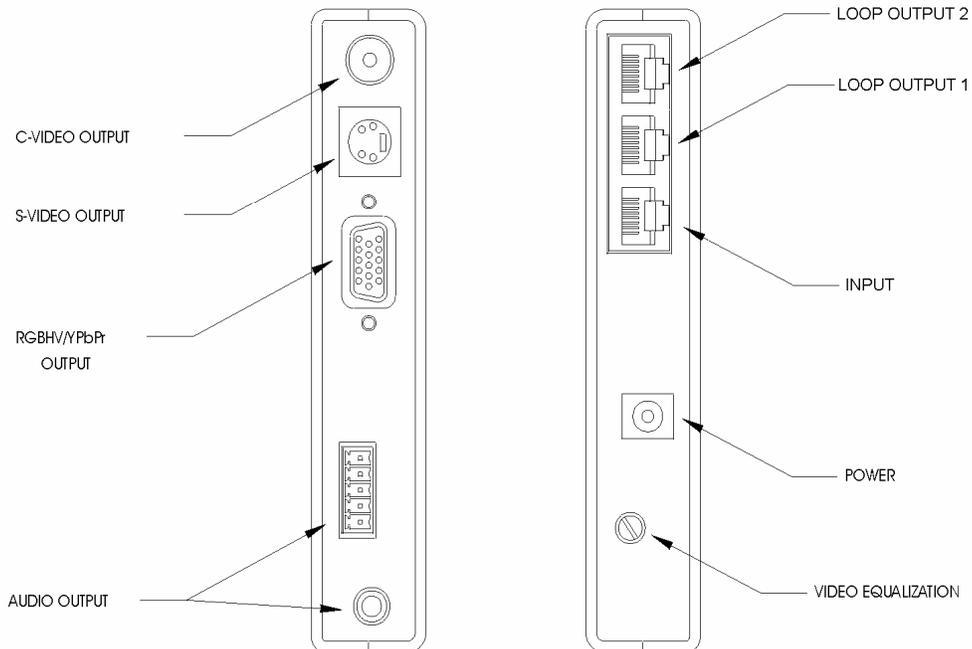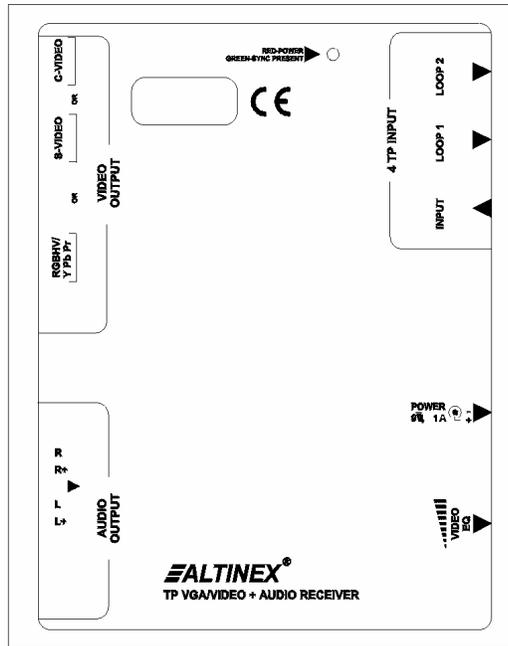

APPLICATION DIAGRAM

5

DIAGRAM 1: TYPICAL CONFIGURATION


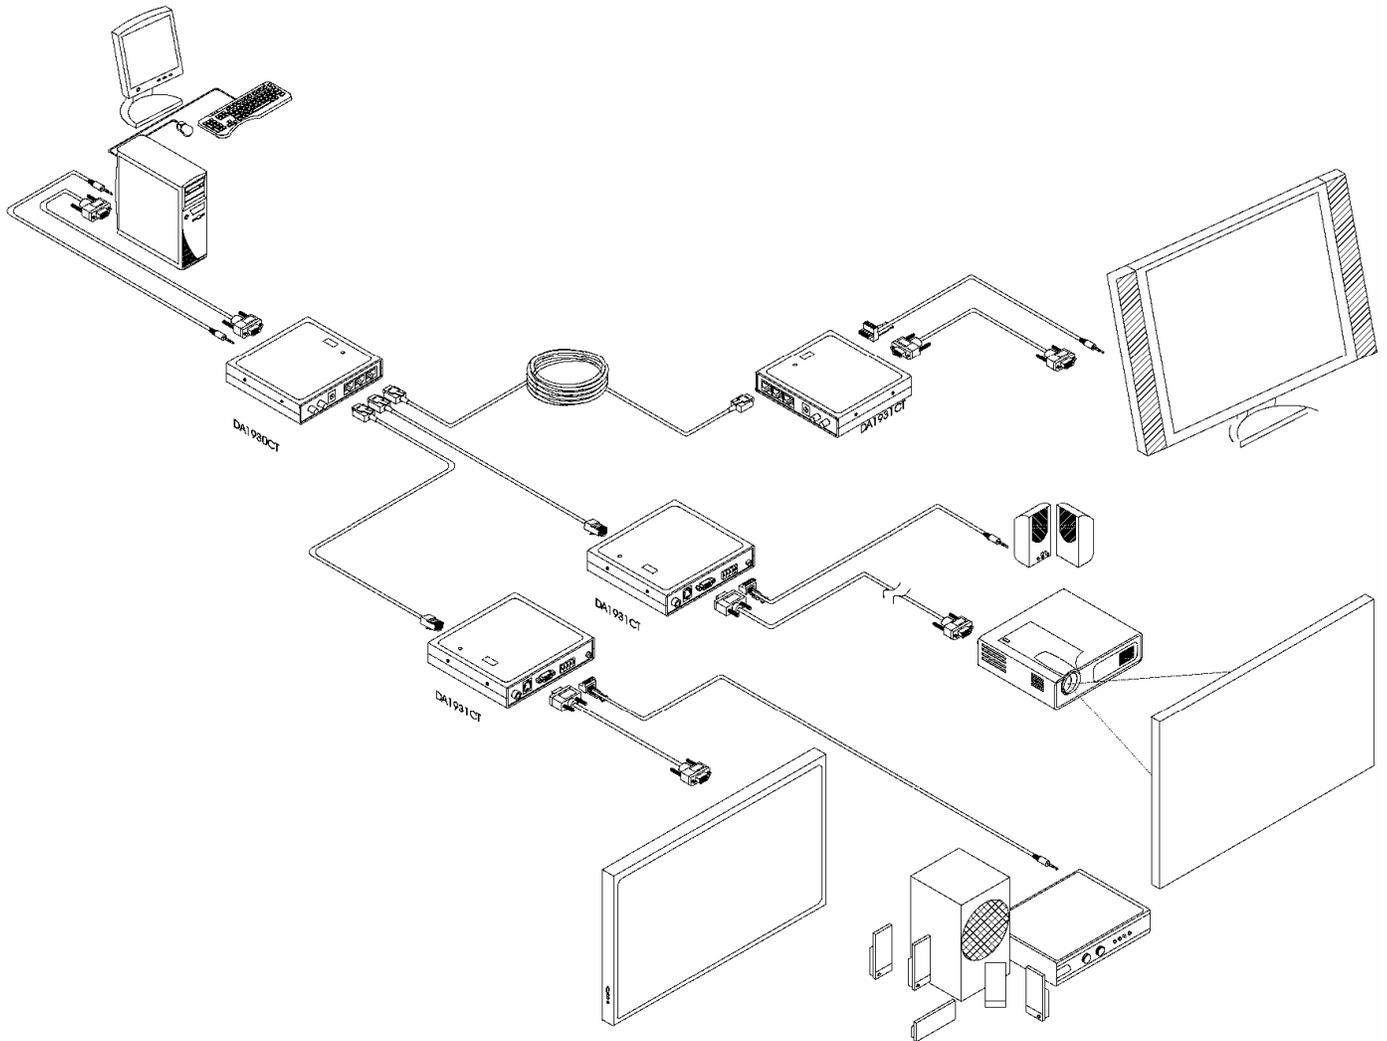


DIAGRAM 2: RJ-45 PINOUT

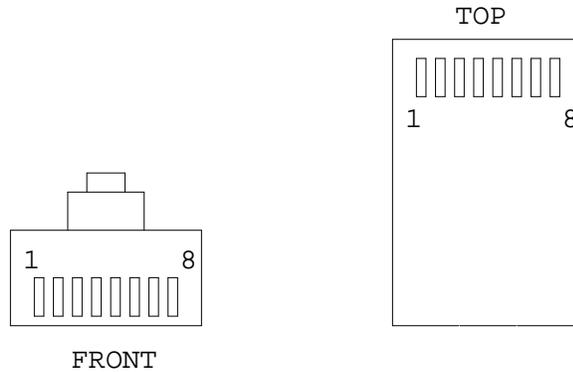


Pin Number	RJ-45 Output Signals
1	Orange/White
2	Orange
3	Green/White
4	Blue
5	Blue/White
6	Green
7	Brown/White
8	Brown

Table 1
Standard 568B Wiring Color Code

SPECIAL APPLICATION

DIAGRAM 3: INTERNAL VIEW


VGA + AUDIO TO CAT-5 RECEIVER

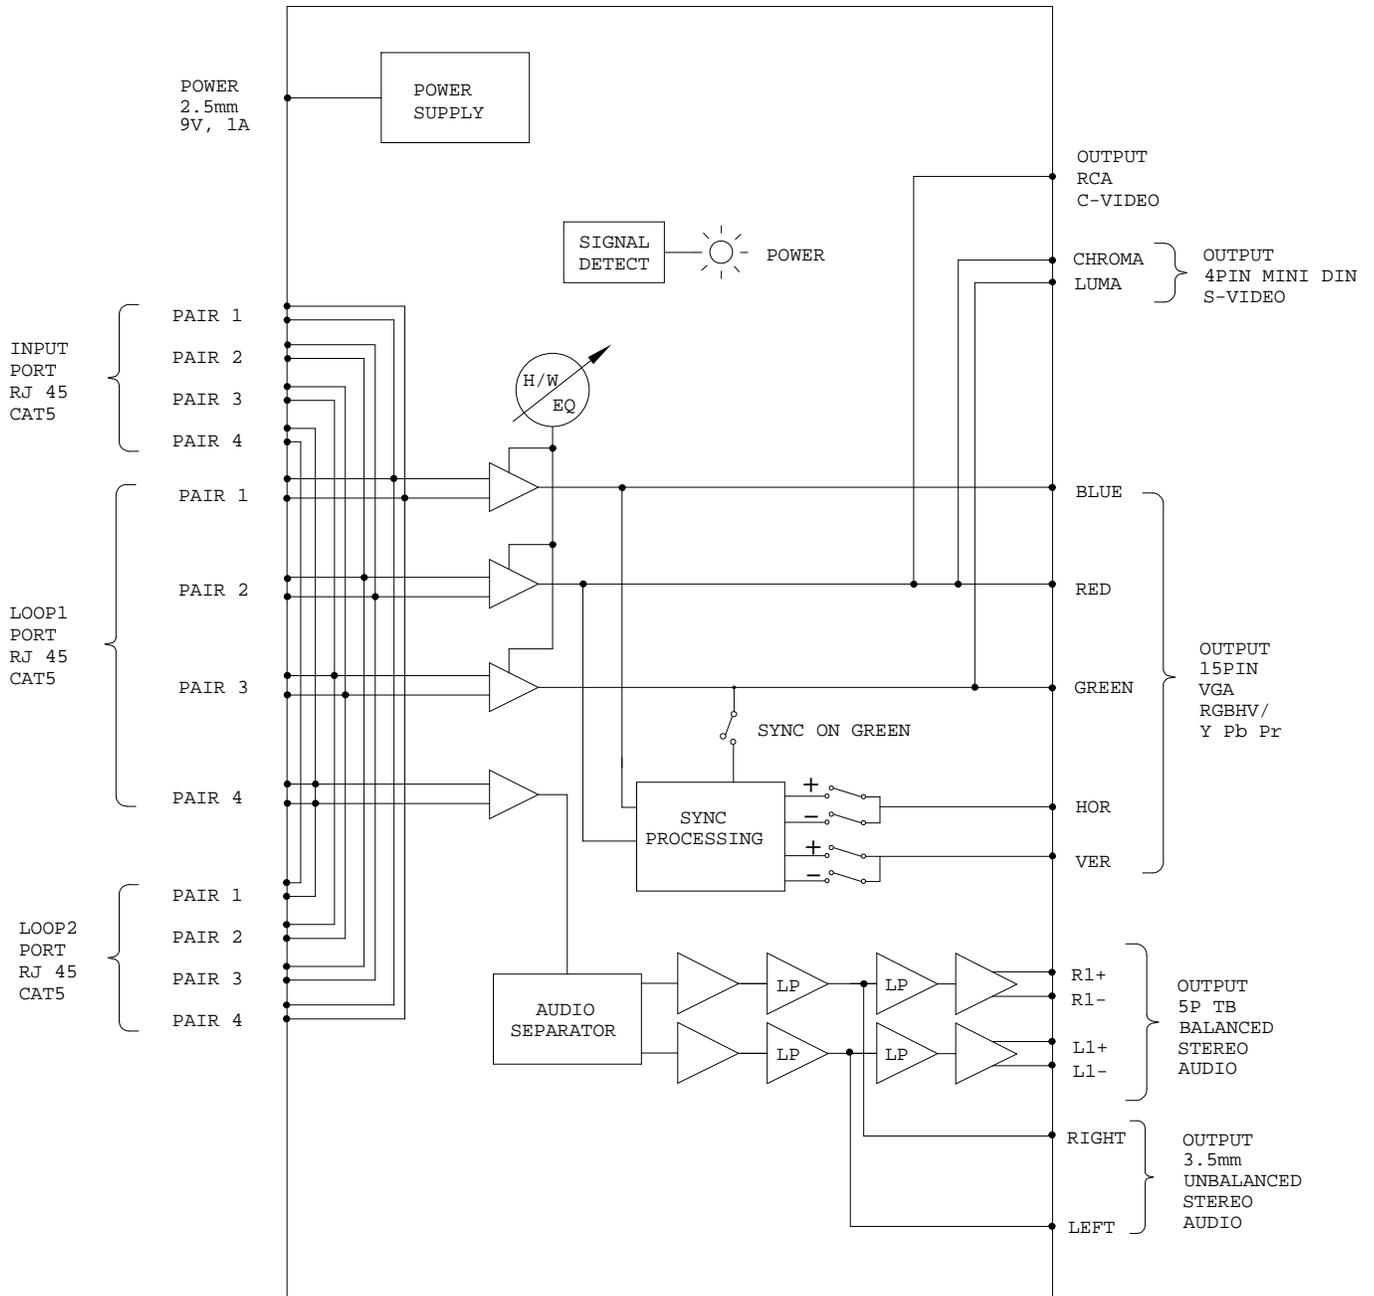

SPECIAL APPLICATION


DIAGRAM 4: DIP SWITCH SETTINGS

The DA1931 has an internal Dip-Switch with 6 positions to achieve following features:

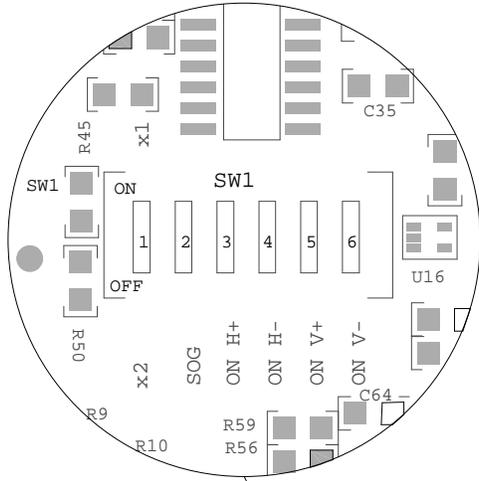

Position **Description**

- 1 Video Gain (G=1/G=2)
Factory Default = G1.
- 2 Sync on Green (ON/OFF)
Factory Default = OFF
- 3, 4 HSync Polarity (Positive/Negative)
3 ON, 4 OFF = **Positive (Factory Default)**
3 OFF, 4 ON = Negative
- 5, 6 VSync Polarity (Positive/Negative)
5 OFF, 6 ON = **Positive (Factory Default)**
5 ON, 6 OFF = Negative

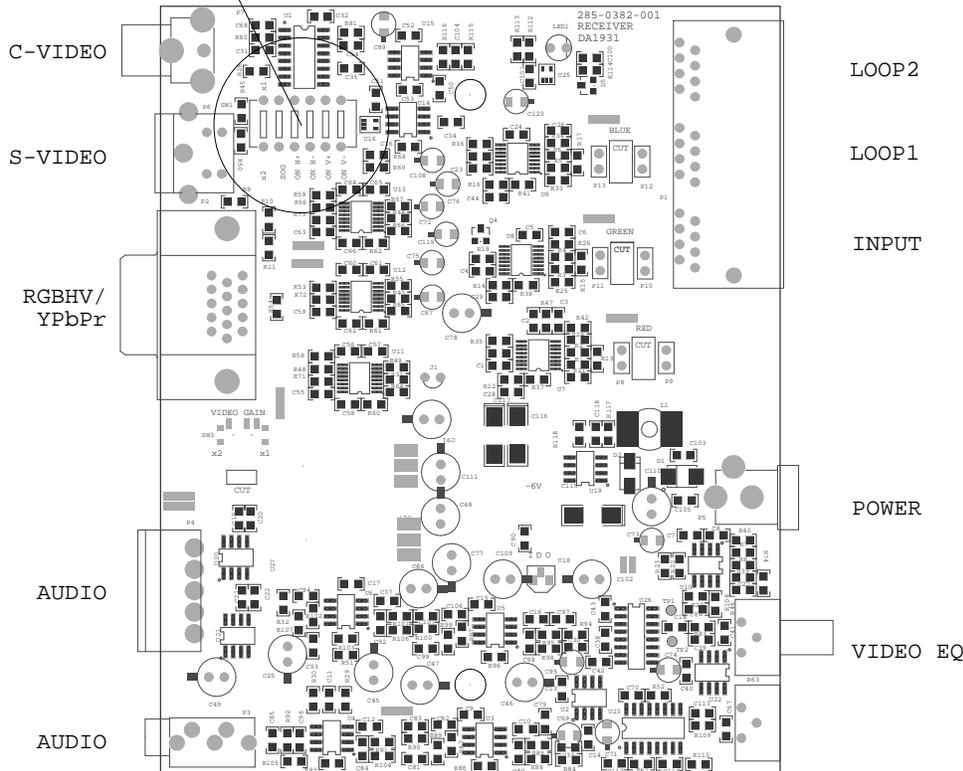

INSTALLING YOUR DA1931CT 6

- Step 1.** Determine the settings required for Gain, Sync On Green, Horizontal Sync Polarity and Vertical Sync Polarity. If necessary to change the factory defaults, open the unit and set the switches per DIAGRAM 4 on page 8.
- Step 2.** Plug the 9V power adapter into an AC outlet and then connect the other end to the POWER input jack on the **DA1931CT**.
- Step 3.** Verify the LED near the top of the unit is illuminated RED indicating power is applied.
- Step 4.** Connect the CAT-5/6 cable from the video output of the CAT-5 Transmitter to the CAT-5 Input port on the **DA1931CT**.
- Step 5.** Verify the power LED at the top of the unit changes to GREEN, indicating a SYNC signal has been detected.
- Step 6.** Connect the stereo audio output from the **DA1931CT** to the audio receiving device.
- Step 7.** Connect the receiving monitor to the applicable **DA1931CT** Video Output connector, either RGBHV/YPbPr, S-Video or C-Video depending on the input type to the transmitter.
- Step 8.** Verify the picture quality on the receiving monitor is equivalent to the quality as displayed on the local monitor at the transmitter. If the quality of the image is poor or non-existent, it may be necessary to adjust the Video Equalization on the **DA1931CT** and/or **DA1930CT**. See the OPERATION section that follows for details.

OPERATION 7

The **DA1931CT** requires only one adjustment to be made for optimal performance. Video Equalization is required for long cable lengths and may be adjusted to fine tune the video display.

7.1 VIDEO EQUALIZATION

Video Equalization is provided to fine tune the displayed image on the remote display. Typically, for short cable runs the equalization will be set to near minimum. Cable lengths up to 400 feet will require near maximum equalization.

The equalization adjustments on the **DA1931CT** Receiver and **DA1930CT** Transmitter work together to provide equalization for maximum cable lengths. For example, for cable runs less than 50 feet, both equalization settings may be set to approximately minimum, since on the short distances no equalization is required. Where as cable runs of 400 feet will see equalization settings at about the three-quarter position.

We have carefully tested and have found no problems in the supplied **DA1931CT**. However, we would like to offer suggestions for the following:

8.1 LED IS NOT RED

The LED should be ON and RED when power is applied and there is no video signal present. If the LED is ON and GREEN, the unit is receiving power and a SYNC signal.

Cause 1: No AC power.

Solution: Verify the adapter is plugged into a working AC outlet and that the outlet has power.

Cause 2: Adapter is not plugged into DA1931CT.

Solution: Verify the DC power plug coming from the AC adapter is plugged all the way into the **DA1931CT**.

Cause 3: The DA1931 has a problem.

Solution: If there is AC power to the adapter and the LED still does not turn on, the **DA1931CT** or the power adapter may require service. Call ALTINEX at (714) 990-2300.

8.2 LED IS NOT GREEN

Cause 1: There is no power.

Solution: Disconnect the video input from the **DA1931CT** and verify the LED is ON and RED indicating power is present. Reconnect the computer's video output. If the LED is still not GREEN see Cause 2.

Cause 2: There is no Sync signal.

Solution: Verify the computer output is operating correctly by connecting it directly to a monitor. If the display is good, call ALTINEX at (714) 990-2300.

8.3 NO SOUND

Cause 1: The source has a problem.

Solution: Check the source and make sure that there is a signal present and all source connections are correct. If the source is working and there is still no sound, see Cause 2.

Cause 2: The volume is too low.

Solution: Increase the AUDIO GAIN toward maximum. If there is still no sound present, see Cause 3.

Cause 3: Cable connections are incorrect.

Solution: Make sure that cables are properly connected. Also, make sure that the continuity and wiring are good. If there is still no sound, see Cause 4.

Cause 4: The receiving device has a problem.

Solution: Make sure the receiving device has power and is turned ON. If there is still no sound, please call Altinex at (714) 990-2300.

8.4 NO REMOTE IMAGE

Cause 1: The source has a problem.

Solution: Check the image on the local monitor and verify the quality is good. If the local image is good, see Cause 2.

Cause 2: Video equalization required.

Solution: Adjust the VIDEO EQUALIZATION on the **DA1931CT**. Long cable runs may require adjustment on both the **DA1930CT** and the **DA1931CT**.

In general, cable runs less than 50 feet require little or no video equalization and should be set to minimum. Cable runs up to 400 feet will require maximum equalization on both the transmitter and receiver.

8.5 RECEIVING DISPLAY QUALITY IS POOR

Cause 1: The source has a problem.

Solution: Check the image on the local monitor and verify the quality is good. If the local image is good, see Cause 2.

Cause 2: Video equalization required.

Solution: Adjust the VIDEO EQUALIZATION on the **DA1931CT**. Long cable runs may require adjustment on both the **DA1930CT** and the **DA1931CT**. If the image is still not correct, call ALTINEX at (714) 990-2300.

ALTINEX POLICY

9

9.1 LIMITED WARRANTY/RETURN POLICY

Please see the Altinex website at www.altinex.com for details on warranty and return policy.

9.2 CONTACT INFORMATION

ALTINEX, INC

592 Apollo street

Brea, CA 92821 USA

TEL: 714 990-2300

TOLL FREE: 1-800-ALTINEX

WEB: www.altinex.com

E-MAIL: solutions@altinex.com